High Grove Solar

Preliminary Environmental Information Report Appendix 10.4 Draft Arboricultural Impact Assessment

April 2025

Treework Environmental Practice

Draft Arboricultural Impact Assessment

High Grove Solar

Report Reference Number: 250328-1.0-HGS-AIA-HB

On behalf of

Ove Arup and Partners Limited (Arup)

28 March 2025

Table of Contents

Executive Summary **1**

1 Introduction **2**

1.1 Brief and Context 2

1.2 Purpose of this Report 2

1.3 The Proposed Development 2

2 Existing Tree Population and Constraints **3**

2.1 Desk Study 3

2.2 Baseline Tree Survey 3

3 Arboricultural Removal and Pruning **5**

3.1 Tree Removal and Retention 5

3.2 Facilitative Tree Works 6

4 Irreplaceable habitats – veteran trees and ancient woodland **6**

4.1 Background 6

4.2 Ancient woodland 7

4.3 Veteran trees 7

5 Mitigation **8**

5.1 Design Development 8

5.2 Tree Protection 9

5.3 Special Technical Measures 10

Appendix A: Tree Protection Plan

Appendix B: Tree Constraints Plan

Appendix C: Tree Protection Specifications

Appendix D: Tree Schedule

Appendix E: Tree Survey Method and Limitations

Executive Summary

- This report relates to the Proposed Development of High Grove Solar. This report provides a preliminary assessment of the impact of the Proposed Development upon trees following the principles of BS 5837, and makes recommendations for mitigating negative impacts. This report will be updated and a final assessment will be provided as part of the Environmental Statement to be submitted with the application for Development Consent Order.

- Breckland Council records show there are no tree preservation orders nor conservation areas present within the draft Order Limits. There are four ancient woodlands adjoining the Proposed Development and sufficiently far the proposed design so they would not be directly impacted.

- A BS 5837:2012 survey recorded 2036 tree features. The data for each tree, group of trees, hedge and woodland is presented within the Tree Schedule at Appendix D.

- To enable the Proposed Development nine arboricultural features would be removed along with parts of 60 groups and hedges. Arboricultural features to be removed or part removed comprise one category A, 33 category B and 35 category C.

- All other arboricultural features would be retained and integrated into the Proposed Development. Sufficient space and adequate protection measures have been set out to ensure that retained trees are not damaged during the pre-construction and construction phase and to enable their successful development post-construction. Protection measures for retained trees are discussed throughout this report and illustrated on the Tree Protection Plan at Appendix A.

- To enable the Proposed Development, 13 veteran trees would have some form of activity within their buffer. Section 4 addresses the impacts upon the trees which should be negligible except for T1347 which could be under pressure to be removed.

- Access track construction is proposed within the root protection area of 41 arboricultural features and a further 24 arboricultural features would require temporary ground protection to protect them during construction. Special measures are recommended to ensure that these trees are not damaged. These measures are provided in Section 5 of this report and are illustrated on the Tree Protection Plan at Appendix A.

1 Introduction

1.1 Brief and Context

1.1.1 Treework Environmental Practice was instructed by Arup on behalf of RWE Renewables UK Solar and Storage Limited ('the Applicant') to provide an Arboricultural Impact Assessment (AIA) and Tree Protection Plan, in accordance with British Standard BS 5837:2012 Trees in *Relation to Design, Demolition and Construction – Recommendations*, of the effect of High Grove Solar (the Proposed Development) on trees.

1.1.2 Trees are a material consideration when determining planning applications, whether or not they are afforded the statutory protection of a tree preservation order or conservation area. British Standard BS 5837:2012 *Trees in Relation to Design, Demolition and Construction* sets out the principles and procedures to be applied to achieve a harmonious and sustainable relationship between trees and new developments.

1.1.3 This Draft AIA reports on the direct and indirect impacts of the Proposed Development on trees in terms of both the buildability and the long-term impact of the finished Proposed Development, and where necessary presents mitigation for these impacts.

1.2 Purpose of this Report

1.2.1 This Draft AIA, and accompanying Tree Schedule and Tree Protection Plan, is provided to support the Preliminary Environmental Information Report (PEIR) at statutory consultation for the Proposed Development. It sets out the arboricultural impacts of the Proposed Development using the following considerations as a framework:

- Trees to be removed and trees to be retained.
- Remedial tree work to trees to facilitate the Proposed Development and ensure they form a harmoniously integrated component of the development.
- Suitable measures to protect retained trees.
- Special construction or engineering measures required to enable trees to be harmoniously integrated into the Proposed Development.

1.2.2 This report will be updated and a final assessment will be provided as part of the Environmental Statement (ES) to be submitted with the application for a Development Consent Order (DCO)

1.3 The Proposed Development

1.3.1 The Proposed Development is a renewable energy scheme, comprising five distinct Panel Areas covering an area of approximately 1,700 hectares (ha), including solar photovoltaic (PV) panels, on-site Battery Energy Storage Systems (BESS), underground cabling and associated infrastructure including substations and environmental mitigation and enhancement areas. The Proposed Development will also include underground Cable Corridors, which are still being refined, connecting the Panel Areas to one another and to the point of connection. The Proposed Development will have the capacity to generate over 50 Megawatts (MW) of alternating current (AC) electricity. The Proposed Development is located between

Narborough and Dereham in the county of Norfolk in the East of England. A full description of the Proposed Development and a detailed description of the design and environmental mitigation is provided in PEIR Chapter 2 The Proposed Development.

1.3.2 The following documents have been provided to and reviewed by Treework Environmental Practice:

Document Title	Document/Drawing number	Originator
LiDAR Topographical Survey	23032	Tir3D
Proposed Layout	J212_1000_04	RWE

2 Existing Tree Population and Constraints

2.1 Desk Study

2.1.1 Online information at Breckland Council[1] (last accessed on 6 January 2025) showed that none of the trees surveyed are protected by either a tree preservation order or a conservation area designation.

2.1.2 The Ancient Tree Inventory has no record of veteran trees within the draft Order Limits[2]. The Ancient Tree Inventory however has two records of veteran trees adjacent to the draft Order Limits and these appear to be duplicate records for an oak tree at Island Cottages, Acre Lane, Swaffham and is T1350 in this Draft AIA.

2.1.3 The MAGIC Maps database shows there are no ancient woodlands within the draft Order Limits however the following woodlands adjacent to the draft Order Limits are recorded as ancient woodland, the reference used in this report is added:

- Necton Wood (W784)
- Great Wood (west of H820, not surveyed as beyond 15m from site)
- High Grove (W956)
- Sporle Wood (W1859).

2.1.4 The MAGIC Maps database held no records of orchards nor wood pasture on or adjacent to the draft Order Limits.

2.2 Baseline Tree Survey

2.2.1 A tree survey to comply with BS 5837:2012 was undertaken from 26 November 2024 to 30 January 2025. Findings of the tree survey on which this report is based are given in the Tree Schedule at Appendix D, and the above- and below-ground constraints are illustrated on the Tree Constraints Plan at Appendix B. Each tree (T), group of trees (G), woodland, (W) and

[1] My Maps at https://www.breckland.gov.uk/mymaps shows the locations of tree preservation orders and conservation areas

[2] The maximum area of land that would be required for the construction, operation and decommissioning of High Grove Solar

hedge (H) has been allocated an individual number to which it is referred in this report. The survey method and limitations are set out in Appendix E.

2.2.2 The tree survey was undertaken prior to the confirmed draft Order Limits and design of the Proposed Development available for PEIR. Therefore, the survey area extent as shown in Appendices A-D is different to the draft Order Limits presented at statutory consultation. However it is considered that a representative area has been surveyed to enable a robust preliminary assessment.

2.2.3 Trees present constraints to development both above- and below- ground. The above-ground constraints comprise the physical extent of tree crowns. The below-ground constraints comprise the roots, and are expressed in terms of the root protection area (RPA), which is the minimum rooting area that a tree needs to maintain the tree's viability. These constraints, as established by the tree survey, inform this assessment of the effect of the Proposed Development on trees.

2.2.4 The survey was undertaken based on trees plotted using an outline base map as reference in Treework Environmental Practice's specialist tree management software – MyTrees. The basemap contained an aerial image and LiDAR survey showing areas of vegetation. Trees and hedges were plotted on the basemap using the LiDAR and aerial images as reference.

2.2.5 BS 5837:2012 recommends categorising trees into four quality categories to aid designers and decision makers. Table 1 summarises the number of arboricultural features surveyed and their quality categories.

Table 1: Trees Features in each Retention Category

BS 5837 Category	No. of Trees (T)	No. of Groups (G)	No. of Hedges (H)	No. of Woods (W)	Total
A	181	20	1	18	**220**
B	650	197	96	46	**989**
C	342	186	250	15	**793**
U	31	2	1	0	**34**
Total	**1204**	**405**	**348**	**79**	**2036**

2.2.6 Land within and surrounding the Proposed Development is generally rural and comprises undulating agricultural landscape with dispersed settlements and hedges are a common boundary feature. Panel Areas are located either side of a number of major roads and routes, including the busy A47 trunk road, which passes from west to east and the A1065 which runs north to south through the centre of Swaffham. Numerous minor roads cross the rural landscape, connecting small villages, hamlets and individual properties.

2.2.7 Pedunculate oak (*Quercus robur*) was the most abundant individually recorded tree with a total of 610 in the tree survey. Common ash (*Fraxinus excelsior*) was the second most abundant with 367 recorded followed by 69 field maple (*Acer campestre*).

2.2.8 Within the 405 groups of trees, which includes lines of trees and areas of trees not large enough to be recorded as woodland, common hawthorn (*Crataegus monogyna*) was the most abundant species comprising more than 26% with blackthorn (*Prunus* spinosa) making up almost 24% of all groups.

2.2.9 Of the 348 hedges 314 contained common hawthorn and 244 contained blackthorn, the two most abundant species, together making over 80% of the hedges in the tree survey. Although more than half of the hedges contained field maple, as the third most abundant species in hedges it made 7.9% of the population followed by hazel (*Corylus avellana*) making 5.8% of the hedge content. Hedges were 98% native species with English elm (*Ulmus procera*) the most common non-native species comprising 1.9% of the population and often suffering from Dutch elm disease.

2.2.10 The woodlands recorded in the tree survey were predominantly comprised of native species. The most common species in 64 of the woodlands was pedunculate oak comprising almost 22% of all woodland trees. The next most abundant species of tree in woodlands were common hawthorn 21% and Scots pine (*Pinus sylvestris*) 10%.

3 Arboricultural Removal and Pruning

3.1 Tree Removal and Retention

3.1.1 Trees have been identified for removal where they come into direct conflict with the current design of the Proposed Development and proposed structures, where construction cannot be achieved without their removal, or where their future relationship with the Proposed Development is considered unsustainable, having regard to their eventual potential size. Where higher value trees may be in minor conflict with the Proposed Development, pruning or special construction and protection measures have been specified, as explained in Section 5.

3.1.2 The nine arboricultural features that would be wholly removed to facilitate the current design of the Proposed Development are summarised in Table 2 by BS 5837:2012 category. Table 3 summarises the 60 arboricultural features that would require part of the hedge or group to be removed. All trees other than those in Table 2 and Table 3 would be retained and protected during development (see Section 5). The extent of removals assumes that existing culverts and ditch crossing are sufficient to use without ground works to extend, this will be reviewed for the final report to be submitted with the Environmental Statement.

Table 2 – Arboricultural features to be removed by BS 5837 Category

Category A	Category B	Category C	Category U
None	T882, T883, T984, T1123, T1164, T1168, T1406	G1407, T1642,	None

Table 3 – Arboricultural features with partial removal by BS 5837 Category

Category A	Category B	Category C	Category U
G1645	H49, G268, G274, G296, G386, H641, H662, H666, H709, H732, G1121, H1294, H1301, H1311, H1468, H1484, H1493, H1506, H1511, H1514, H1546, T1548, H1557, H1576, H1596, H1746	H114, H115, H156, H207, H330, H430, H457, H501, H866, H885, H886, H895, H924, H1043, H1051, H1130, H1131, H1142, H1166, H1170, H1199, H1204, H1232, H1243, H1251, H1643, H1644, H1705, H1706, H1749, H1771, H1887, H1952	None

3.1.3 The majority of the removal is for the installation of access tracks across the draft Order Limits, the extent of partial group and hedge removal is shown on the Tree Protection Plan in Appendix A. Two arboricultural features would be removed for the installation of panels and these are T1406 and G1407.

3.2 Facilitative Tree Works

3.2.1 No specific tree works other than removal of the trees listed in Table 2 and Table 3 are recommended to enable the Proposed Development. It is assumed that hedges will be maintained through trimming or flailing to ensure they do not unduly obstruct access or sight lines; this cyclical work is already undertaken for many of the hedges across the draft Order Limits.

4 Irreplaceable habitats – veteran trees and ancient woodland

4.1 Background

4.1.1 Natural England and Forestry Commission have published standing advice guidance titled '*Ancient woodland, ancient trees and veteran trees: advice for making planning decisions*'. The standing advice provides guidance for designers to avoid and mitigate impacts of development in relation to ancient and veteran trees and recommends use of buffers for ancient woodland at 15m from the woodland and for veteran trees a buffer that is 15 times stem diameter – both are larger than the root protection areas recommended in BS 5837:2012 to ensure maintain the trees' viability.

4.1.2 The Tree Protection Plan at Appendix A includes both the minimum root protection recommended in BS 5837:2012 and the buffer recommended by standing advice.

4.1.3 In the context of planning decision making National Policy Statement EN-1 Overarching National Policy Statement for energy (the primary decision making framework for the Proposed Development as a Nationally Significant Infrastructure Project), paragraph 5.4.53

states that "*The Secretary of State should not grant development consent for any development that would result in the loss or deterioration of any irreplaceable habitats, including ancient woodland, and ancient and veteran trees unless there are wholly exceptional reasons and a suitable compensation strategy exists*".

4.1.4 National Planning Policy Framework (2024) states in paragraph 193c that 'development resulting in the loss or deterioration of irreplaceable habitats (such as ancient woodland and ancient or veteran trees) should be refused, unless there are wholly exceptional reasons and a suitable compensation strategy exists'.

4.2 Ancient woodland

4.2.1 The ancient buffer in relation to the Proposed Development in the Tree Protection Plan shows that Necton Wood (W784), Great Wood and Sporle Wood (W1859) are further than 15m from the panels and fence of the Proposed Development. The root protection area for these woodlands could be protected by exclusion zones and there should be no direct impact.

4.2.2 High Grove (W956) is further than 15m from the panels and fences, however an access track was proposed between H1 and H2 which would pass through the 15m buffer. There is already an access track in this area so a level of ground compaction is already present, therefore the proposed track was removed from the design and use of the existing track adopted, and direct impacts upon the health or viability of the trees from a new or enhanced access track avoided. This change was adopted into the design and Outline Environmental Masterplan for statutory consultation, and will be considered in the final version of this report.

4.2.3 While the trees would not be directly impacted, measures should still be taken to minimise impacts upon the ecosystem. No-dig road construction, to retain the ground undisturbed beneath the access track, should be used to minimise impact upon the ground. Such construction should ensure that there is no loss of nor detrimental impact upon ancient woodland.

4.3 Veteran trees

4.3.1 Within the study area the following trees were recorded as veteran trees:

T51, T76, T81, T285, T338, T341, T432, T524, T554, T675, T686, T698, T700, T761, T1012, T1167, T1347, T1392, T1394, T1421, T1499, G1623 (comprising 2 trees) and T1732.

4.3.2 The Proposed Development enters the buffer zone or root protection area of 13 veteran trees which are listed in Table 4 with a summary of the source of impact. No veteran tree would be removed to enable the Proposed development.

4.3.3 The micro siting of some parts of the Proposed Development could lead to adjustments in layout to avoid the buffer zone for some of the veteran trees. Where this is not achievable mitigation measures to reduce the potential for impact on veteran trees is addressed in Section 5.

4.3.4 For T1499 and T1732 a BESS is proposed within the buffer in addition to new access tracks. The BESS is beyond the BS 5837 RPA and is assessed not to be of detriment to the trees' vitality. It is however in the buffer for irreplaceable habitat and impact upon the habitat is foreseeable.

4.3.5 Solar panels are shown to be within the buffer of T700 and T1732. The extent of the incursion is relatively minor and during detailed design it is foreseeable that a technical solution can be used to either eliminate the spatial conflict or construct with negligible impact upon the buffer zone. With regard to the T675 the extent of incursion is greater as the RPA is also affected but it is assumed that a technical solution can be found to ensure negligible impact.

4.3.6 T1347 has solar panels proposed across all the RPA and beneath the crown. It is foreseeable that if the tree can be retained through construction there could be pressure during site operation to remove the tree.

Table 4 – Veteran trees and Proposed Development within their buffer zone

Tree	Access Track	Panels	BESS	Fence	CCTV
T51	-	-	-	Yes	Yes
T432	-	-	-	Yes	Yes
T524	Yes	-	-	-	-
T675	-	Yes	-	Yes	Yes
T700	-	Yes	-	Yes	Yes
T761	Yes	-	-	-	-
T1012	Yes	-	-	-	-
T1167	-	-	-	Yes	Yes
T1347	-	Yes	-	Yes	Yes
T1392	Yes	-	-	Yes	Yes
T1394	Yes	-	-	Yes	Yes
T1499	Yes	-	Yes	Yes	Yes
T1732	Yes	Yes	Yes	Yes	Yes

5 Mitigation

5.1 Design Development

5.1.1 The Proposed Development is designed around the structure of woodlands and hedges across the draft Order Limits so that no woodland is directly impacted. Access within the Proposed Development makes use of existing access points and gaps in hedges however to install all require access some relatively small sections of hedge would be removed, these have been kept to a minimum to achieve access.

5.1.2 The Applicant is committed to revise the current design and relocate any access tracks or electrical infrastructure away from veteran trees, as has been identified and described in

paragraph 4.2.2 for ancient woodland. The revised layout will be assessed and a final report provided as part of the ES to be submitted with the application for DCO.

5.2 Tree Protection

Root Protection Areas and Construction Exclusion Zones

5.2.1 Retained trees would be protected during construction by establishing a Construction Exclusion Zone (CEZ) around their RPAs. RPAs are a layout design tool, indicating the minimum area around a tree deemed to contain sufficient roots and soil to maintain the tree's viability. RPAs should be treated as a precautionary area within which activities such as ground compaction, excavation, the storing of materials, ground level changes and other construction activity are likely to cause damage to trees and should therefore be excluded. This CEZ can be achieved by the erection of barriers at the locations shown on the Tree Protection Plan at Appendix A. In addition to the specific tree protection fence shown on the Tree Protection Plan it is assumed that the fence around Panel Areas will be installed and will also act as a tree protection fence during construction.

5.2.2 Tree protection barriers must be installed before any demolition or construction works start, and, unless approved by the Local Planning Authority or by an Arboriculturist approved by them, should remain in place until all construction activity has been completed.

5.2.3 The type of barriers should match the level of activity around the retained trees. Where a high level of construction activity is expected, fencing must be braced to be robust to vehicular impact and to prevent it from being easily repositioned; a specification similar to Figure 2 and 3 in BS 5837:2012 would be suitable (reproduced at Appendix C). In areas away from the main construction activity and vehicle movement, it may be appropriate to install a lower specification fencing, examples of which are given at Appendix C.

5.2.4 All protection fencing should carry identifying signs that state its purpose and proscribe its removal until all demolition and construction work is complete. An example sign is given at Appendix C.

5.2.5 When the Proposed Development becomes operational it is assumed that traffic will use the access tracks to travel around the draft Order Limits and the temporary tree protection fence for construction can be removed with only the permanent fence retained in-situ.

Ground Protection

5.2.6 Where it is necessary to temporarily breach the CEZ to facilitate the Proposed Developments, and following the approval of the Local Planning Authority and/or an Arboriculturist, the roots and soil structure within the RPAs of 24 arboricultural features would be protected by installing ground protection. The locations of the ground protection are shown hatched light blue on the Tree Protection Plan at Appendix A. Ground protection shall comprise:

- pedestrian access – single thickness scaffold boards laid on a compressible layer such as woodchip, laid on a geotextile membrane. The scaffold boards should be fixed together to avoid movement.

- vehicular access – purpose-built steel trackway, pre-cast reinforced concrete slabs or temporary access tracks constructed with a cellular matrix (minimum 150 mm depth) with granular infill.

5.3 Special Technical Measures

5.3.1 Conflicts between retained trees and aspects of the Proposed Development that cannot be dealt with by exclusion zones, micro siting, tree protection or tree work can be mitigated by the use of special technical measures. General recommendations for these measures are presented in the sections that follow based on the information about the Proposed Development that is currently available. The specific details must be carefully planned once detailed construction information is available to avoid tree damage. Where any of the following are to be within either an RPA or buffer of retained trees then the specific measures should be followed.

Fence installation

5.3.2 The detail of fence construction is not known at the time of writing. Where the permanent fence will also act as tree protection fence during construction it should be installed prior to other construction activity. During detailed design a method statement should be developed in which specific measures for protecting the trees is addressed which is based on the specific fence design whether driven posts or concrete footings with an impermeable barrier. In proximity to trees, provided the fence posts are installed with minimal point excavation and no trenching the impact upon trees should be negligible.

Access Track Construction

5.3.3 The installation of permanent hard surfaces within RPAs is commonly achieved through installation of above ground cellular confinement systems using a do-dig form of construction, the Tree Protection Plan at Appendix A shows locations where non-standard construction would be required near trees. Appendix C provides examples and guidance about the design and installation of such new hard surfaces. The draft Order Limits is generally flat and even such that having a higher finish level of the above ground cellular confinement systems can be integrated with relative ease to adjoining ground levels. The detail for construction at each location should be developed through detailed design and provided the no-dig construction principles are followed the impact upon trees would be negligible or minor detrimental and should not lead to the premature loss of trees.

CCTV Service

5.3.4 Around the perimeter of many Panel Areas would be CCTV that runs parallel and next to the proposed fence. Traditional trench-installed utilities should be routed outside of the RPAs of retained trees to avoid root damage. Where routing utility runs within RPAs is unavoidable, all work should comply with The National Joint Utilities Volume 4 and advice should be sought from an Arboriculturist. Following this advice should ensure that the impact upon trees is negligible and not require removal.

Soft Landscaping

5.3.5 An Arboriculturist should review any landscape operations that involve any work within the RPAs of retained trees and input additional site-specific methodology where necessary.

Appendix A

Tree Protection Plan

Appendix B

Tree Constraints Plan

Appendix C

Tree Protection Specifications

Technical Measures to Prevent Tree Damage

Tree Pruning

Tree pruning will be carried out where the design and/or planned site operations encroach into the crowns of trees and where these encroachments can be accommodated through facilitation pruning without significantly reducing the landscape value and/or viability of the tree.

Tree pruning operations would:

- be specified by an Arboriculturist
- be in accordance with current best practice
- be carried out by a suitably experienced and qualified arborist

Tree Protection Fencing


Tree protection fencing would be located at the edge of the Construction Exclusion Zone (CEZ) and would be suitably robust to provide sufficient protection for trees. The performance requirement for fencing would be determined by the type of activity that would take place in the area around the CEZ.

Typical performance requirements for the Tree Protection Fencing would be:

- Tree Protection Fencing would be installed prior to commencement of activity in the draft Order Limits.
- Tree Protection Fencing would only be removed once all works associated with the Proposed Development have been completed.
- The Tree Protection Fencing would be installed and removed without causing damage to retained trees.
- Installation, removal and, where required, replacement of Tree Protection Fencing would be supervised and signed off by an Arboriculturist.
- The Tree Protection Fencing would be stable and robust (typical construction method, in accordance with BS 5837:2012, see below).
- The area between the Tree Protection Fencing and the tree would be a Construction Exclusion Zone (CEZ)
- Fence panels would be made of mesh (e.g.: Heras fencing) or, if solid, would have 30cm windows cut into enough panels to enable conditions within the CEZ to be viewed.
- The CEZ would be clearly identified (see Construction Exclusion Zone sign example below)



Figure 1: Example Tree Protection Fencing Sign

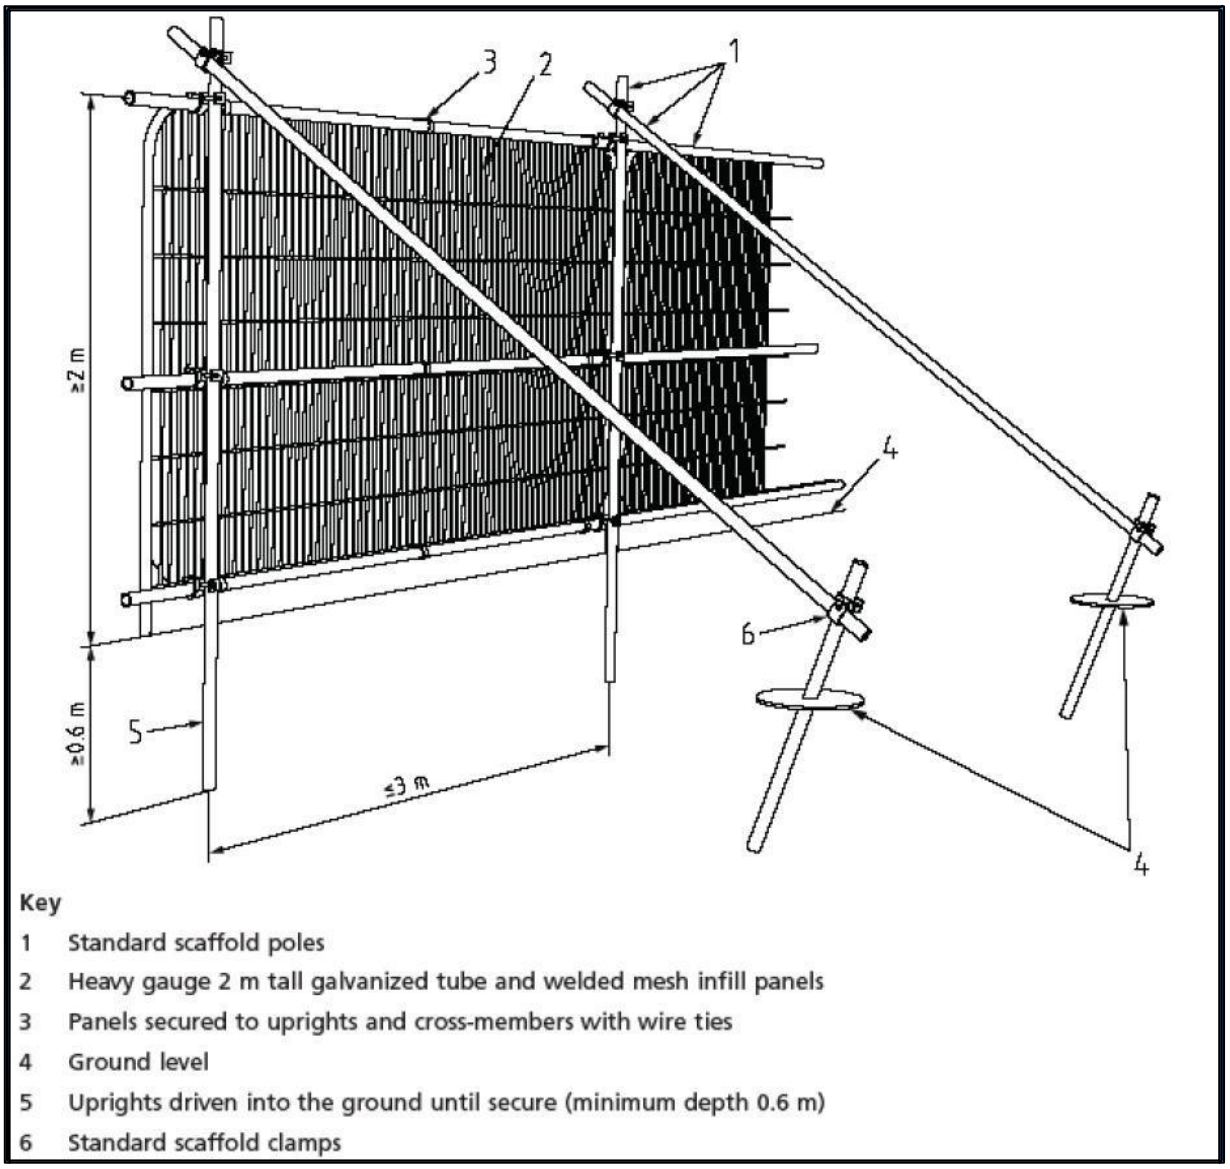

Key

1 Standard scaffold poles
2 Heavy gauge 2 m tall galvanized tube and welded mesh infill panels
3 Panels secured to uprights and cross-members with wire ties
4 Ground level
5 Uprights driven into the ground until secure (minimum depth 0.6 m)
6 Standard scaffold clamps

Figure 2: BS 5837:2012 - Tree protective barrier

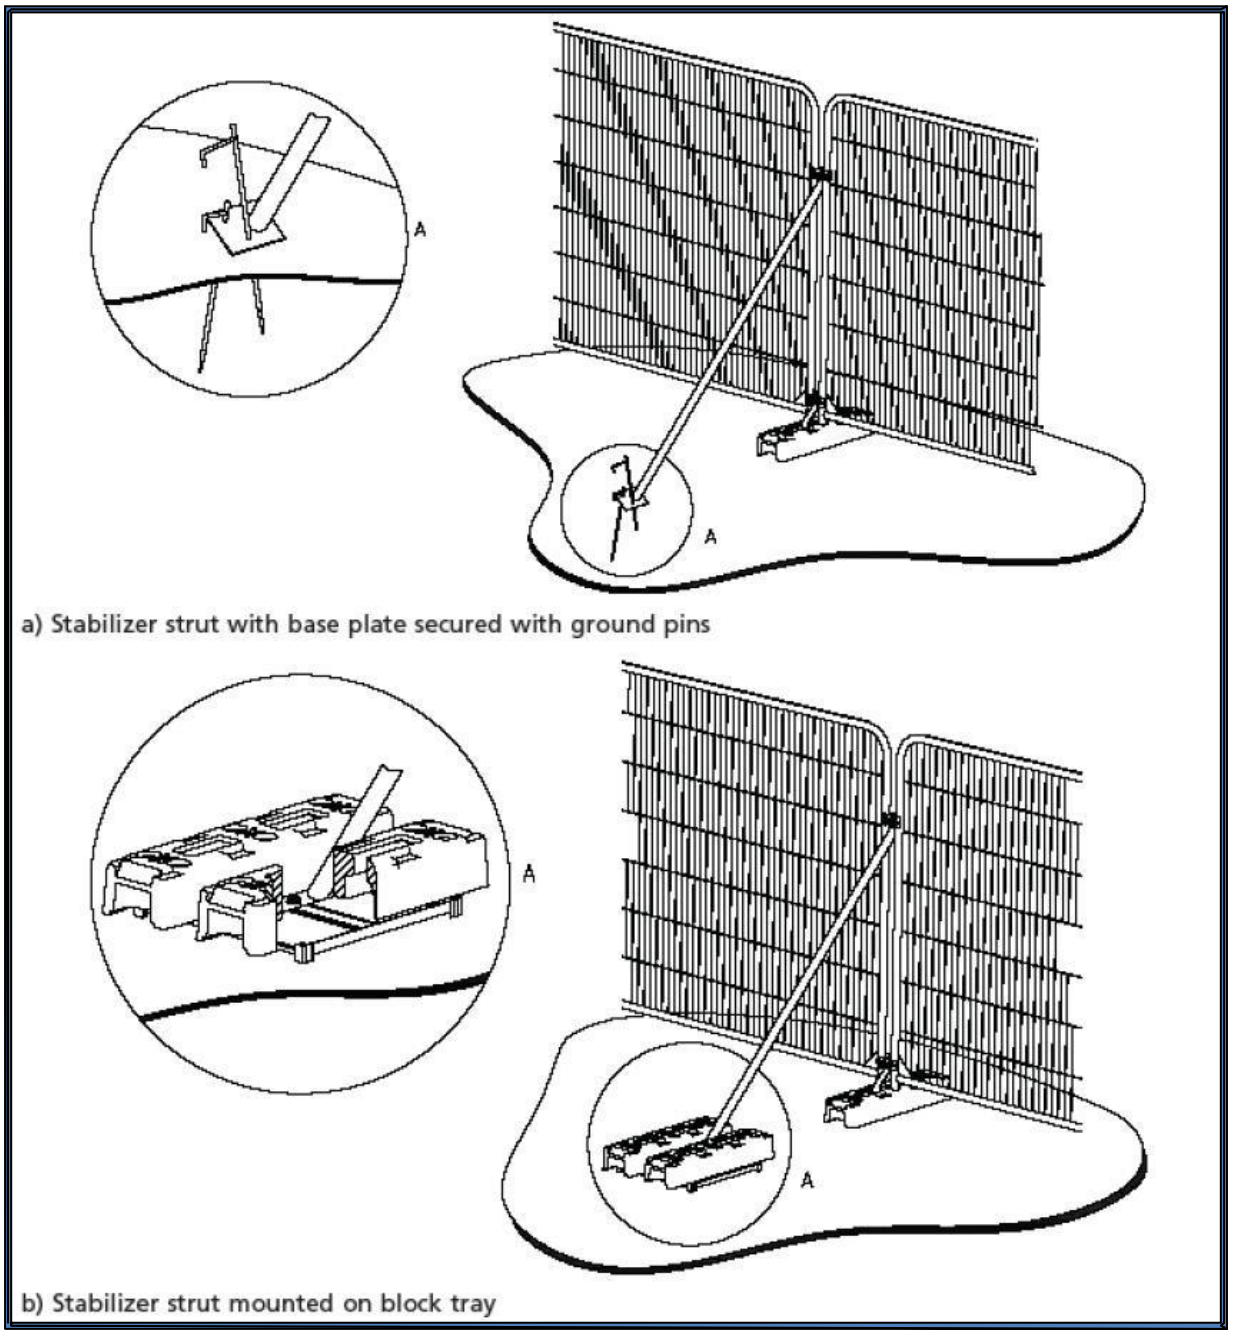


Figure 3: BS 5837:2012 - Examples of above ground stabilisation systems

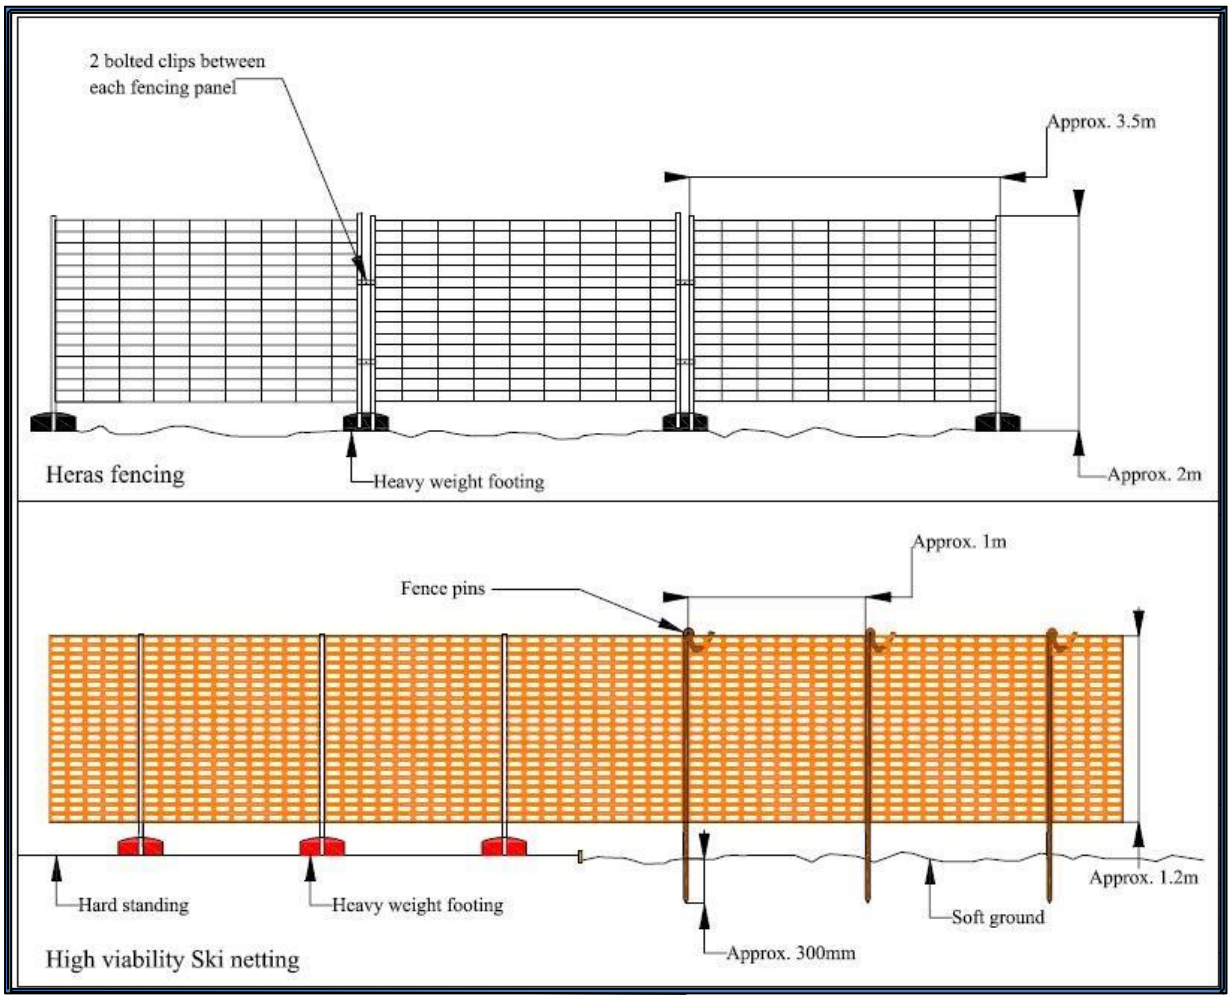


Figure 4: Examples of specification fencing that may be appropriate for areas of low-intensity activity

Ground Protection Measures

BS 5837:2012 provides the following examples of temporary ground protection measures:

a) *for pedestrian movements only, a single thickness of scaffold boards placed either on top of a driven scaffold frame, so as to form a suspended walkway, or on top of a compression resistant layer (e.g. 100 mm depth of woodchip), laid onto a geotextile membrane;*
b) *for pedestrian-operated plant up to a gross weight of 2 t, proprietary, inter-linked ground protection boards placed on top of a compression-resistant layer (e.g. 150 mm depth of woodchip), laid onto a geotextile membrane;*
c) *for wheeled or tracked construction traffic exceeding 2 t gross weight, an alternative system (e.g. proprietary systems or pre-cast reinforced concrete slabs) to an engineering specification designed in conjunction with arboricultural advice, to accommodate the likely loading to which it will be subjected.*

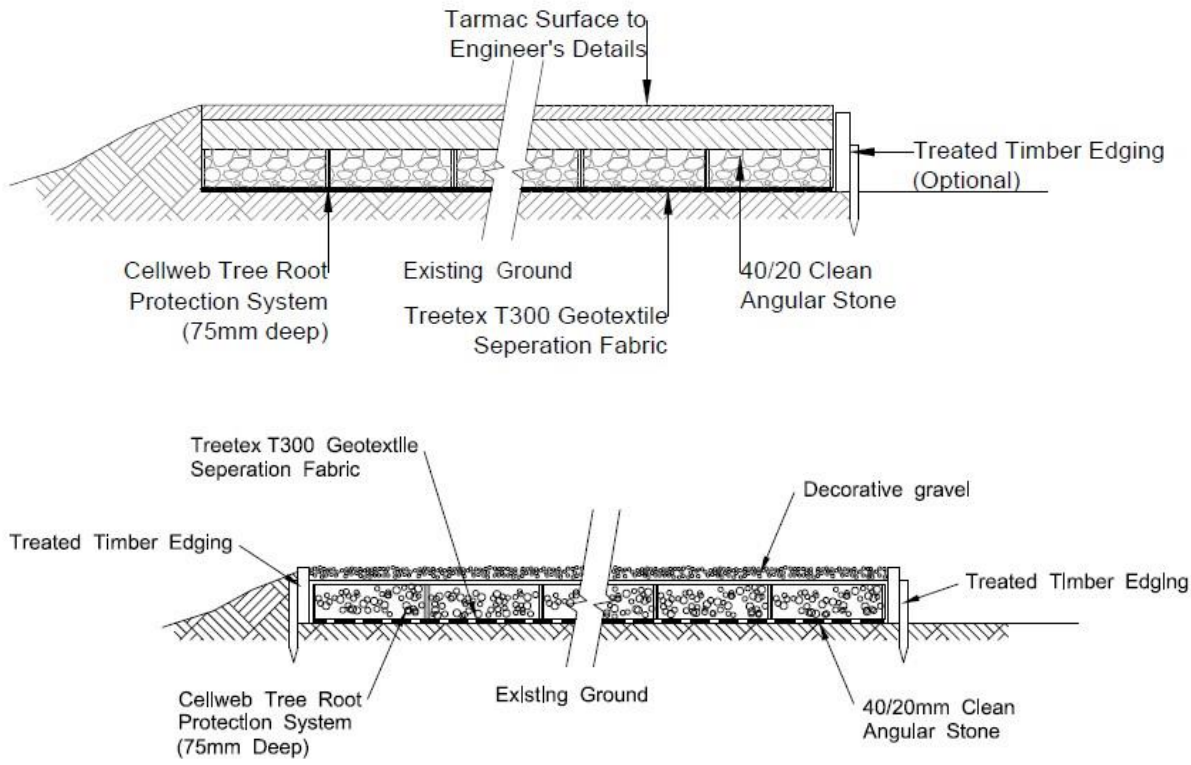


Figure 5: Examples of Cellular Confinement System Details (Cellweb)

Concrete Temporary Ground Protection

The Ground Protection would be installed using reinforced concrete slabs to an engineering specification, designed in conjunction with arboricultural advice, to accommodate the likely loading to which it would be subjected.

For the roots of the trees to remain undamaged there must be no excavation, soil stripping or site grading within the rooting areas – in other words NO DIGGING. This means that finished levels of the Temporary Ground Protection would be above existing ground level.

The Arboriculturist and Construction Manager would supervise and sign off the installation and removal of the Ground Protection and any change to the Ground Protection.

General Performance Specification

The Ground Protection would ensure that tree roots are not physically damaged

- The Ground Protection would ensure that soil within the tree root environment is not compacted
- The Ground Protection would reduce the possibility for spilled materials / substances to seep into the soil
- The Ground Protection would be designed to prevent anaerobic conditions building up under the Ground Protection allow sufficient gaseous exchange and water penetration to the covered root environment.
- The Ground Protection would only be removed once all works associated with the demolition have been completed
- The installation and removal of Ground Protection would not damage trees.

Installation of an above ground cellular confinement system (CCS)

The CCS must be installed in accordance with system supplier specifications. A typical specification is as follows:

- An above ground CCS must be installed in the area(s) shown on the tree protection plan. Excavations for connecting the cellular confinement system to the back of the footpath or drive must be carried out carefully using hand tools only.
- The CCS must be constructed of high-density polyethylene (HDPE) and able to preserve the bulk density of underlying soils.
- Any existing hard surfacing must be removed using hand tools and manual methods, without disturbing the existing sub-base if this is to be used to form the base for the new wearing surface. Surface vegetation must be removed using hand tools only.
- Any roots of diameter <25mm that are not to be retained must be pruned under the supervision of an Arboriculturist using sharp tools. Hollows must be filled using sharp sand to provide a level surface onto which the geotextile can be laid.
- The prepared ground must be covered using a non-woven geotextile fabric, overlapping all joints by 300mm. The cellular confinement panels must be expanded to their full length and pinned with staking pins to keep the cells open. Adjacent panels must be stapled together to create a continuous mattress. Each open cell must be filled with a no fines fill of crushed stone (granite, flint or basalt). Where panels of 200mm depth are used, a stone of 20-40mm diameter must be used and where panels of 100mm depth are used 4-20mm diameter stone must be used. Panels of 150mm may use either size of stone. Cells must be overcharged by approximately 50mm to protect the top edges of the panel from wear. A whacker plate must not be used to compact the stone.
- Kerb edges can be concreted in place on top of the cellular panels but a layer of heavy duty polythene sheeting must be laid on the existing ground to isolate the concrete from leaching into the underlying soil. Timber edging, where appropriate, can be installed using treated timber boards or railway sleepers held in place by wooden pegs. Soil should be placed against the timber edge and battered to provide a slope between the final surface and the existing soil level. Where there is an existing edge that can be used this would avoid or minimise excavations and tree root damage.

- During the construction phase the cellular confinement system must be finished with ground mats. At the end of construction, the ground mats shall be removed and replaced with a permeable wearing surface.

No-dig Construction and Special Engineering Measures

No-dig construction methods and special engineering measures would be employed to enable the construction of access tracks and other built features within the RPAs of trees without damaging tree roots. Installation of built features using no-dig and special engineering measures would meet the following performance criteria:

- The foundation type to be used must be determined following an assessment of the roots present in the area of concern.
- All excavations for the exploratory trench must be dug using hand tools and manual methods only. No machinery is permitted to be used. The exploratory trench must be dug down to a minimum depth of 1m below existing ground levels. If no significant roots are encountered (a low number of roots <25mm in diameter), traditional strip foundations can be used.
- Encountered roots must be cut back to provide a 50mm separation from new foundations.
- The foundation trenches must be lined with heavy-duty polythene sheeting prior to backfilling.
- An Arboriculturist must supervise the excavation work and provide an arboricultural supervision note.
- Where there are many significant roots (>25mm in diameter) encountered, they must be retained and the Proposed Development constructed using either a raft foundation or mini-pile and beam, with the ground beams sat at, or just below, ground level. The final foundation and internal floor specification must be provided by a qualified structural engineer and therefore is beyond the remit of this report.

If a raft foundation is to be used, then the following method must be followed:

- Any excavation required to create a level surface for the raft must be carried out carefully by hand. Any roots encountered must be cut back to 50mm beyond the area of disturbance. Roots must be cut cleanly, to minimise the exposed root surface. Where roots of diameter greater than 25mm must be retained wherever practicable.
- The area of ground beneath the slab must be lined with heavy-duty polythene sheeting prior to pouring of concrete.

If a piled foundation is to be used, then the following method must be followed:

- Prior to the installation of the piles an exploratory hole must be hand dug to establish the presence of roots. The exploratory hole must be repositioned if significant roots (diameter >25mm) are encountered. The final hole must be lined with heavy duty polythene sheeting to minimise soil contamination before cement is poured or the pile installed. The underside of the supporting beams for the internal floor must be suspended above existing ground levels and across the piles to avoid damage to tree roots.
- Roots of diameter greater than 25mm must be retained wherever possible. An Arboriculturist must advise on the appropriateness of root pruning before any root severance is carried out. Roots must be cut cleanly, to minimise the exposed root surface, and covered with a minimum of 50mm of soil and heavy-duty polythene sheeting prior to backfilling.

- Irrigation tubes must be used where practicable to redirect rainwater beneath the slab. This can be done by using a 60mm perforated pipe coiled beneath the suspended structure and bedded into gravel to help preserve underlying roots.


Appendix D

Tree Schedule

Appendix E

Tree Survey Method and Limitations



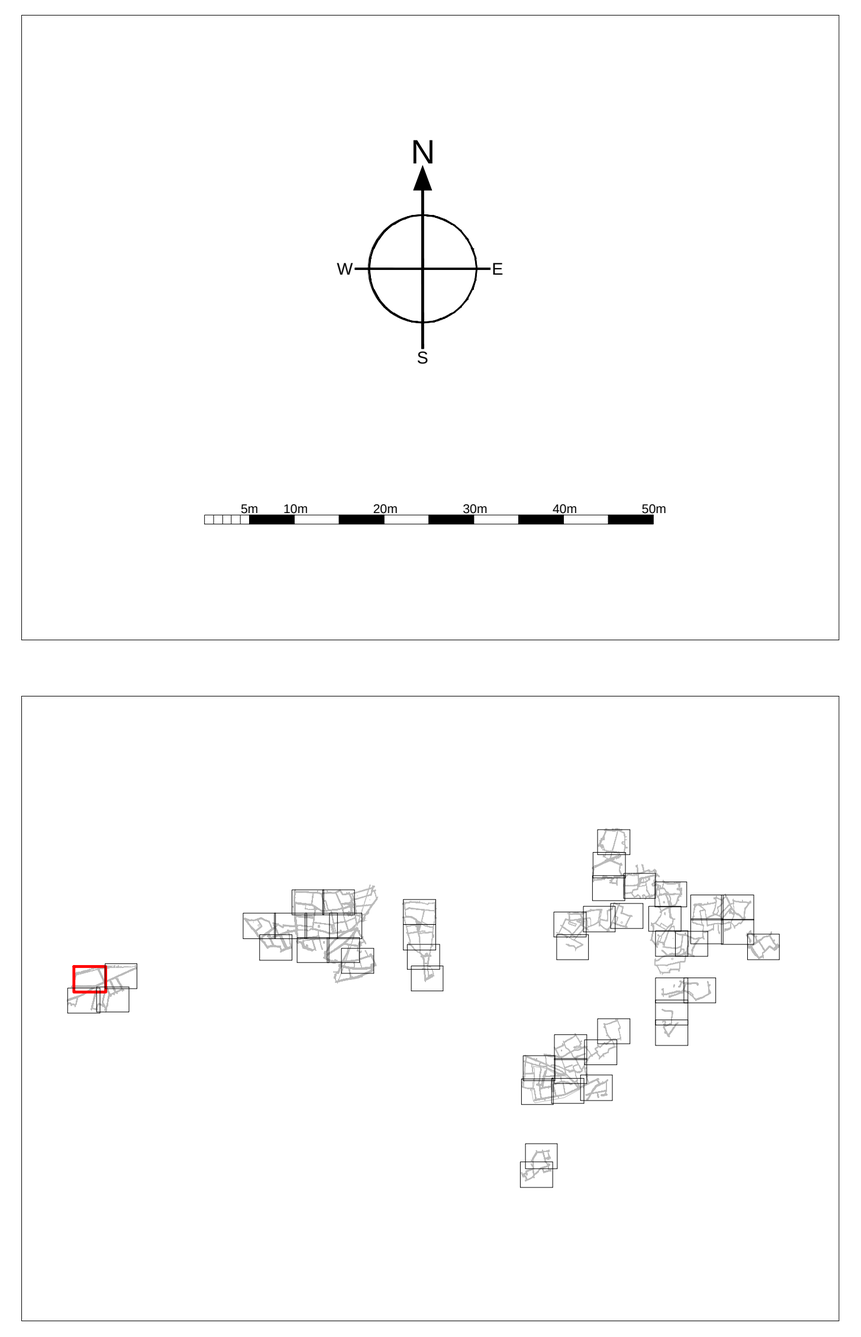

T1 Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Protection Plan


Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

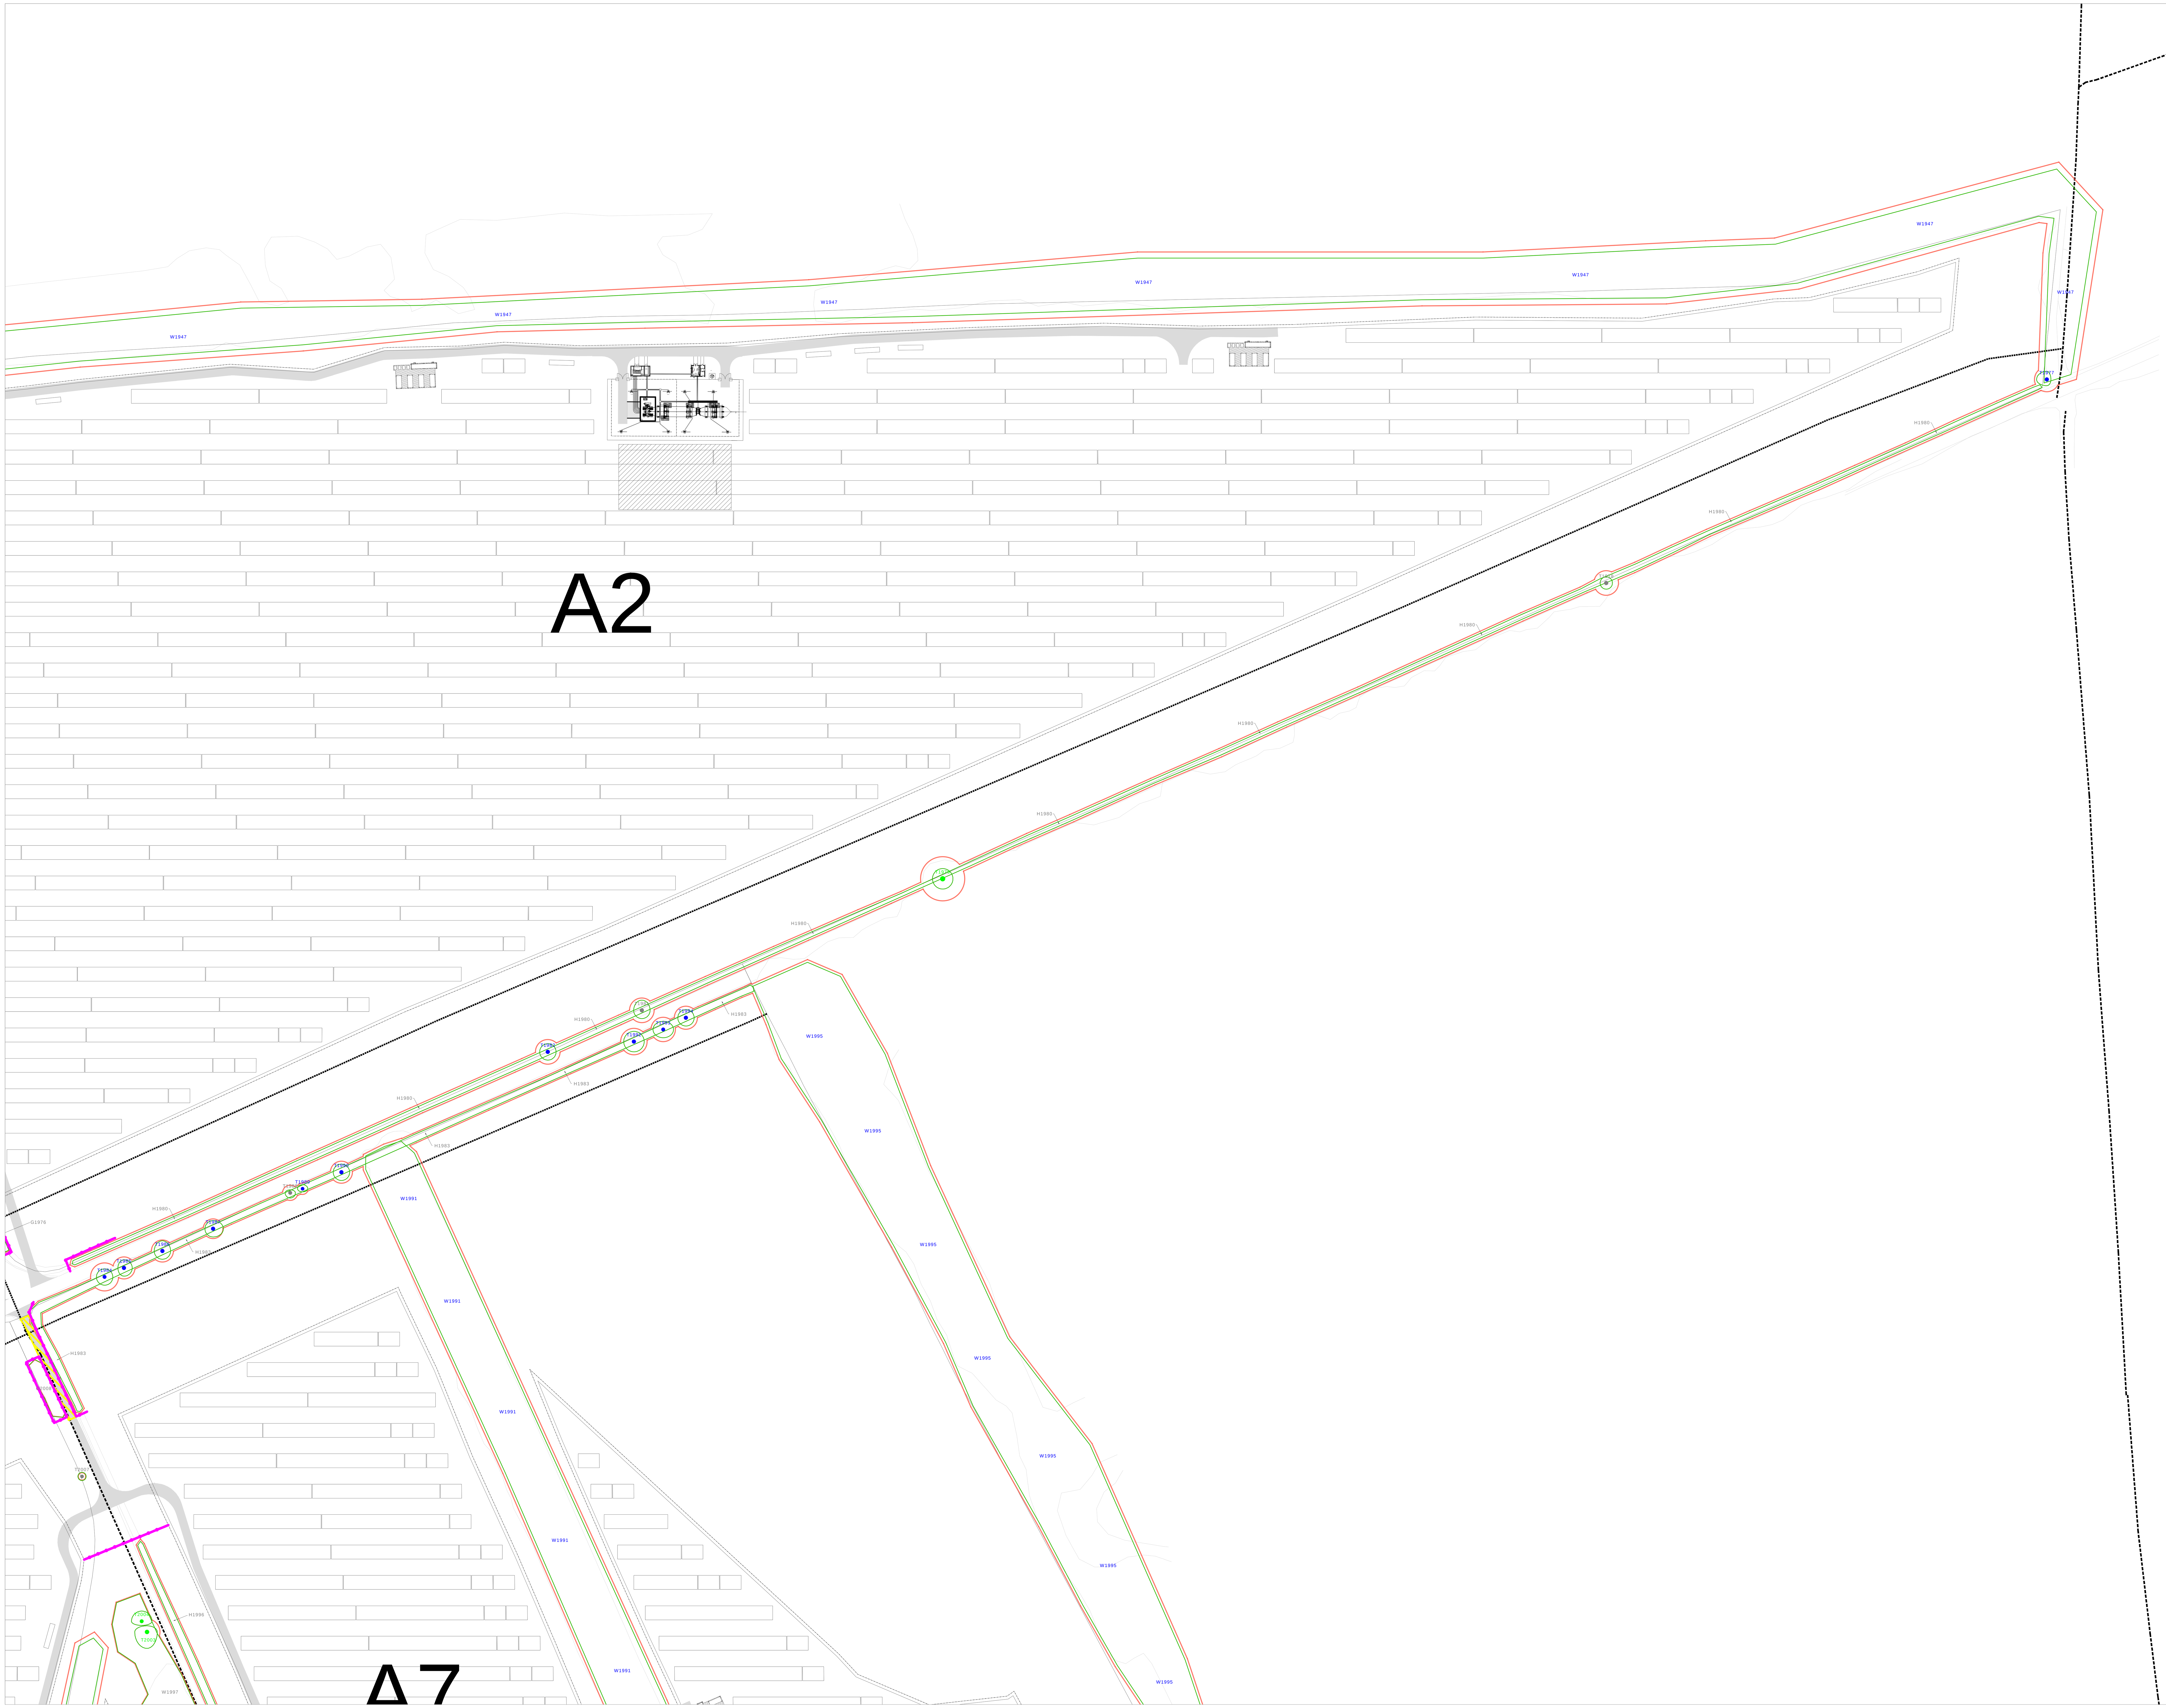

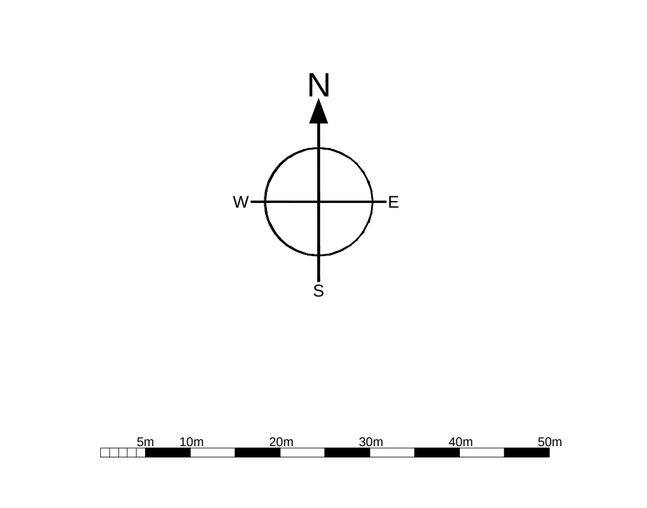

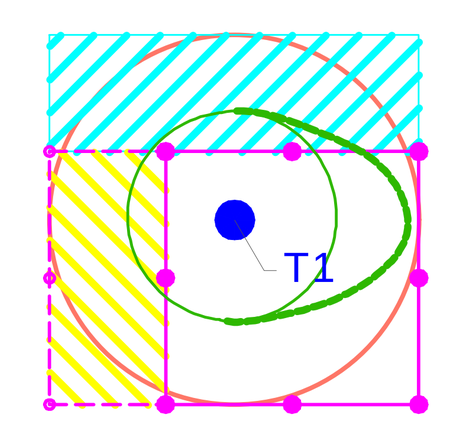

T1 Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



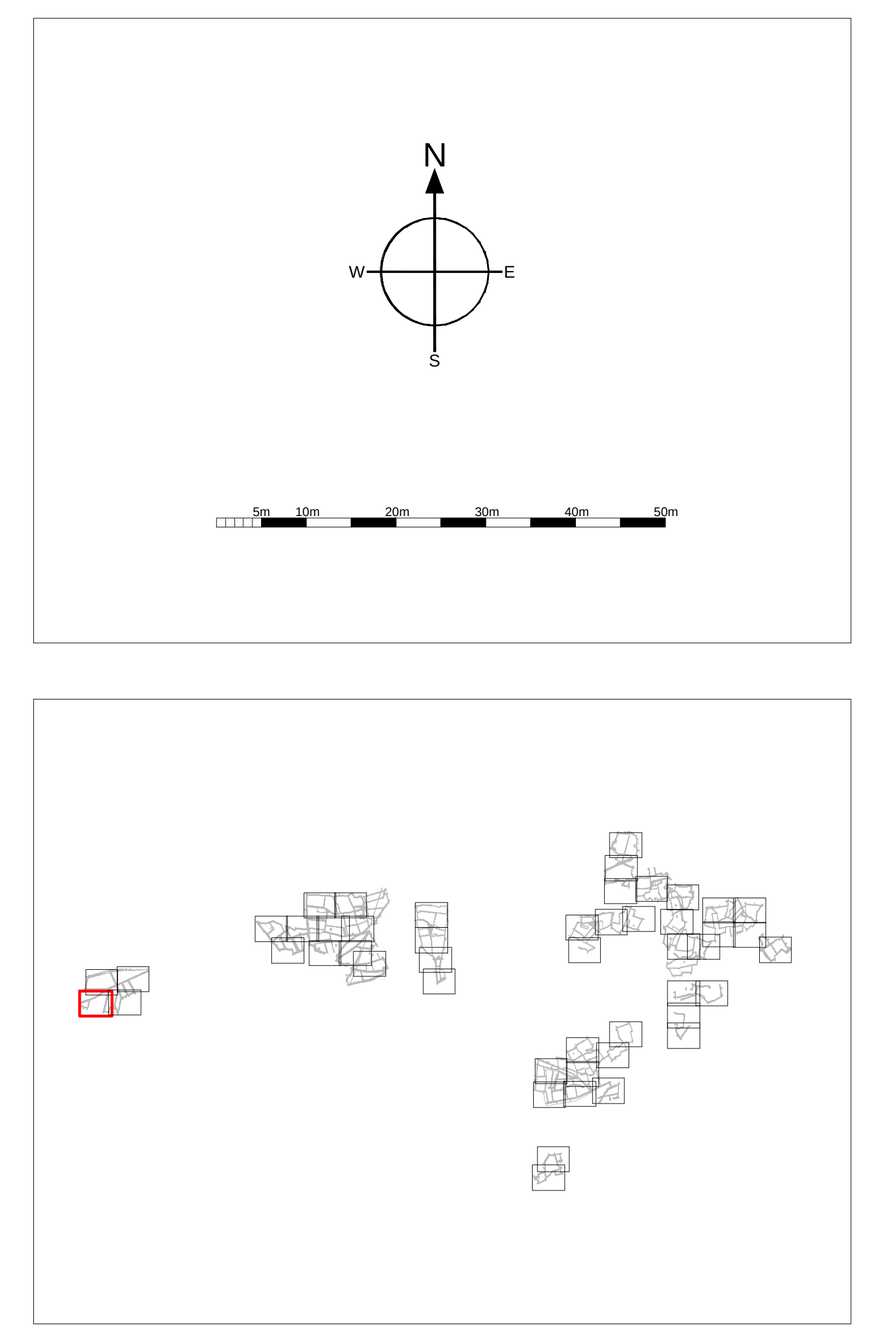

Symbol	Meaning	Symbol	Meaning
T1	Tree or Group Reference Number		Tree Protection Fencing
	Tree Stem Position A Category Tree		Initial Tree Protection Fencing
	Tree Stem Position B Category Tree		Ground Protection
	Tree Stem Position C Category Tree		Special Engineering /Supervised Excavations
	Tree Stem Position U Category Tree		Construction Exclusion Zone
	Tree Crown		Pruning/Tree Removal
	Root Protection Area		Ancient and Veteran Tree/Ancient Woodland Buffer Zone
	Topographical Survey		Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

A7

A8

A6

W1991

W1995

W1997

H1996

H1998

T1999

T2001

T2002

G2005

G2006

G2031

G2034

G2038

N

T1

Tree or Group Reference Number

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Tree Crown

Root Protection Area

Topographical Survey

Tree Protection Fencing

Initial Tree Protection Fencing

Ground Protection

Special Engineering /Supervised Excavations

Construction Exclusion Zone

Pruning/Tree Removal

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout//Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk


C1

C2

C5

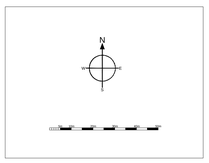





- T1 — Tree or Group Reference Number
- Tree Protection Fencing
- Tree Stem Position A Category Tree
- Initial Tree Protection Fencing
- Tree Stem Position B Category Tree
- Ground Protection
- Tree Stem Position C Category Tree
- Special Engineering /Supervised Excavations
- Tree Stem Position U Category Tree
- Construction Exclusion Zone
- Tree Crown
- Pruning/Tree Removal
- Root Protection Area
- Ancient and Veteran Tree/Ancient Woodland Buffer Zone
- Topographical Survey
- Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

C3

C4

N

T1 — Tree or Group Reference Number
Tree Stem Position A Category Tree
Tree Stem Position B Category Tree
Tree Stem Position C Category Tree
Tree Stem Position U Category Tree
Tree Crown
Root Protection Area
Topographical Survey
Tree Protection Fencing
Initial Tree Protection Fencing
Ground Protection
Special Engineering /Supervised Excavations
Construction Exclusion Zone
Pruning/Tree Removal
Ancient and Veteran Tree/ Ancient Woodland Buffer Zone
Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

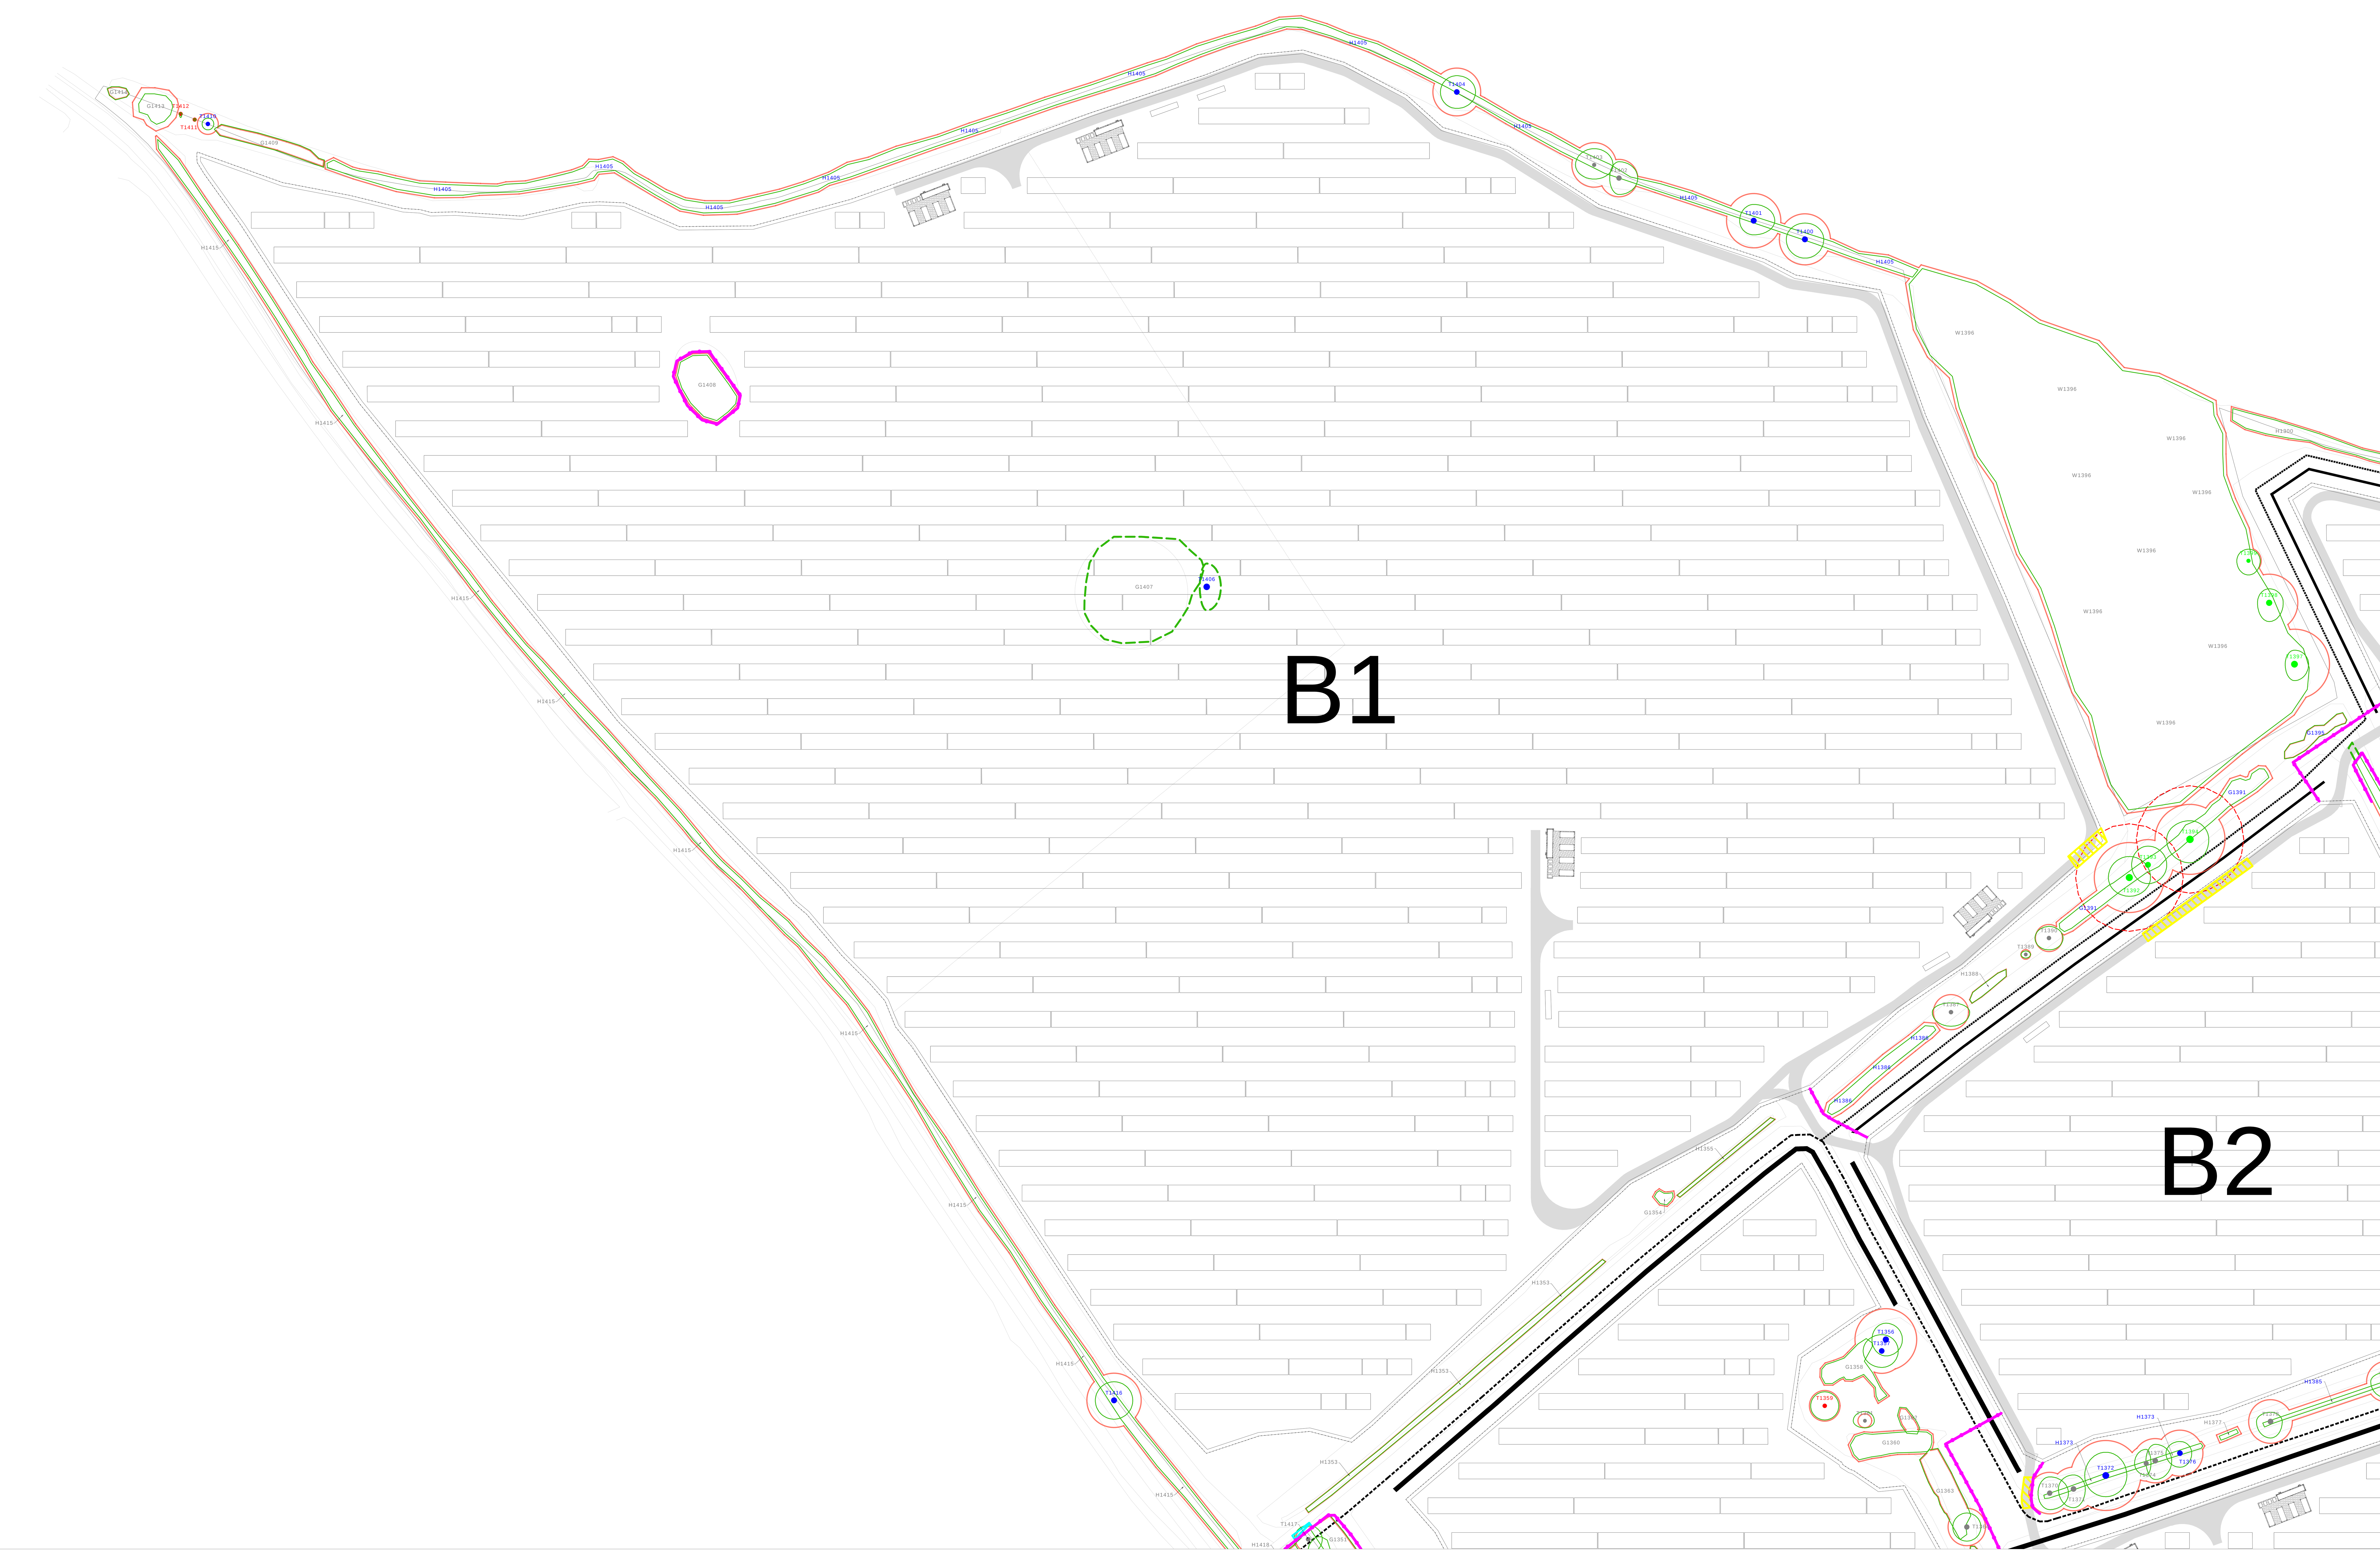

N
W
E
S

T1

T1 Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

B4

B7

C8

C

N

T1 Tree or Group Reference Number

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Tree Crown

Root Protection Area

Topographical Survey

Tree Protection Fencing

Initial Tree Protection Fencing

Ground Protection

Special Engineering /Supervised Excavations

Construction Exclusion Zone

Pruning/Tree Removal

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 2212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

C6


C7


8


C9

C10

C12

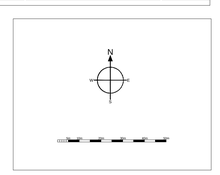

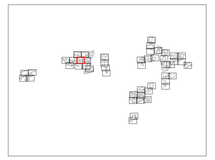



- T1 — Tree or Group Reference Number
- Tree Stem Position A Category Tree
- Tree Stem Position B Category Tree
- Tree Stem Position C Category Tree
- Tree Stem Position U Category Tree
- Tree Crown
- Root Protection Area
- Topographical Survey
- Tree Protection Fencing
- Initial Tree Protection Fencing
- Ground Protection
- Special Engineering /Supervised Excavations
- Construction Exclusion Zone
- Pruning/Tree Removal
- Ancient and Veteran Tree/Ancient Woodland Buffer Zone
- Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

C7

C15

C11

C12

N

T1 Tree or Group Reference Number

Tree Protection Fencing

Tree Stem Position A Category Tree

Initial Tree Protection Fencing

Tree Stem Position B Category Tree

Ground Protection

Tree Stem Position C Category Tree

Special Engineering /Supervised Excavations

Tree Stem Position U Category Tree

Construction Exclusion Zone

Tree Crown

Pruning/Tree Removal

Root Protection Area

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Topographical Survey

Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 2212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

C12



T1 Tree or Group Reference Number

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Tree Crown

Root Protection Area

Topographical Survey

Tree Protection Fencing

Initial Tree Protection Fencing

Ground Protection

Special Engineering /Supervised Excavations

Construction Exclusion Zone

Pruning/Tree Removal

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 2212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR


Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk


C12

C13

C14

C16

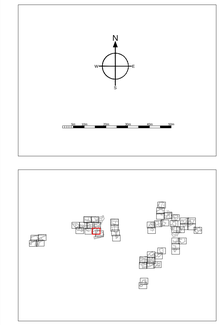

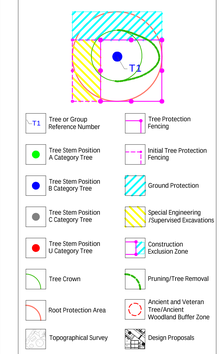

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 2212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk


L4

C16

C17

C18

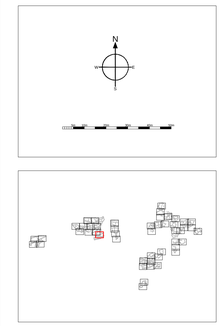

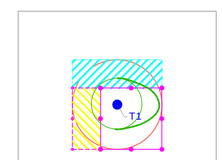

- T1 Tree or Group Reference Number
- Tree Stem Position A Category Tree
- Tree Stem Position B Category Tree
- Tree Stem Position C Category Tree
- Tree Stem Position U Category Tree
- Tree Crown
- Root Protection Area
- Topographical Survey
- Tree Protection Fencing
- Initial Tree Protection Fencing
- Ground Protection
- Special Engineering /Supervised Excavations
- Construction Exclusion Zone
- Pruning/Tree Removal
- Ancient and Veteran Tree/Ancient Woodland Buffer Zone
- Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 2212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk


Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

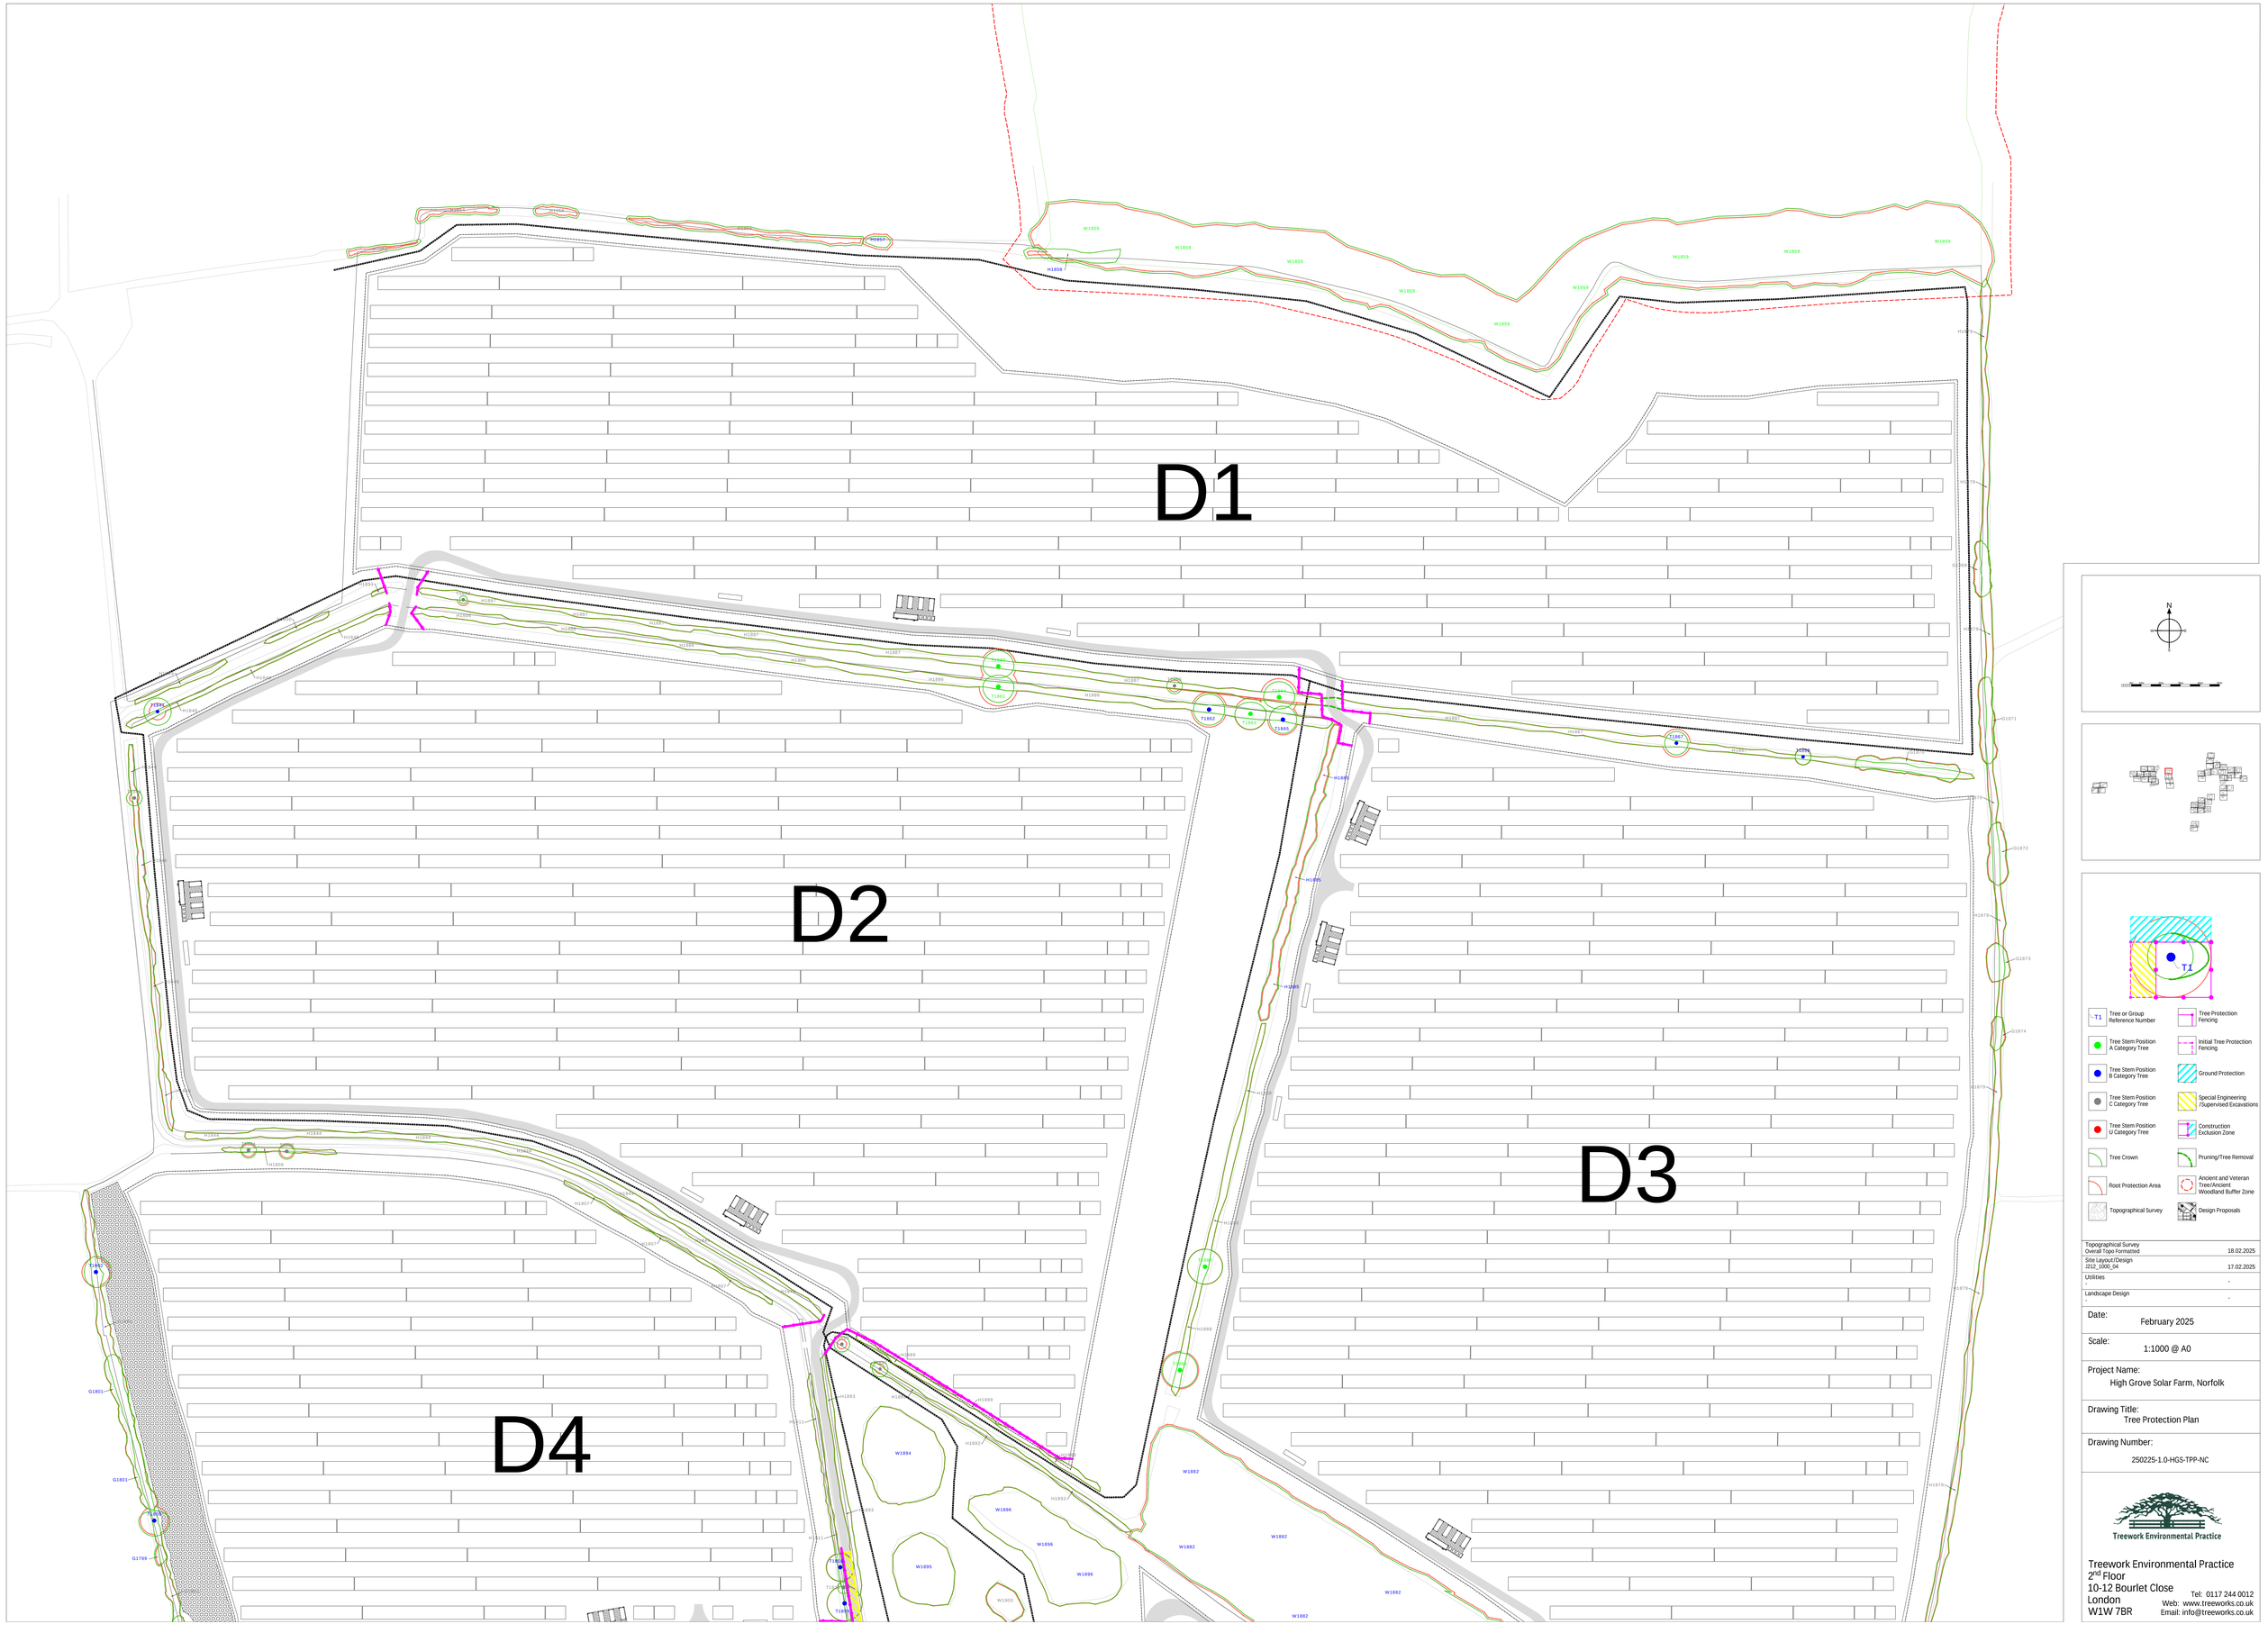

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout//Design JS3_1000_04	17.02.2025
Utilities	-
Landscape Design	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk


D4


D5

D6

D7

D8

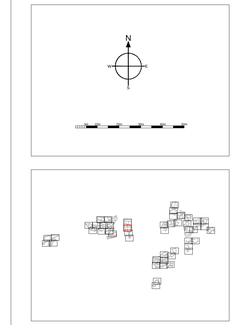



- T1 — Tree or Group Reference Number
- Tree Stem Position A Category Tree
- Tree Stem Position B Category Tree
- Tree Stem Position C Category Tree
- Tree Stem Position U Category Tree
- Tree Crown
- Root Protection Area
- Topographical Survey
- Tree Protection Fencing
- Initial Tree Protection Fencing
- Ground Protection
- Special Engineering / Supervised Excavations
- Construction Exclusion Zone
- Pruning/Tree Removal
- Ancient and Veteran Tree/Ancient Woodland Buffer Zone
- Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0


Project Name:
High Grove Solar Farm, Norfolk


Drawing Title:
Tree Protection Plan


Drawing Number:
250225-1.0-HGS-TPP-NC


Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

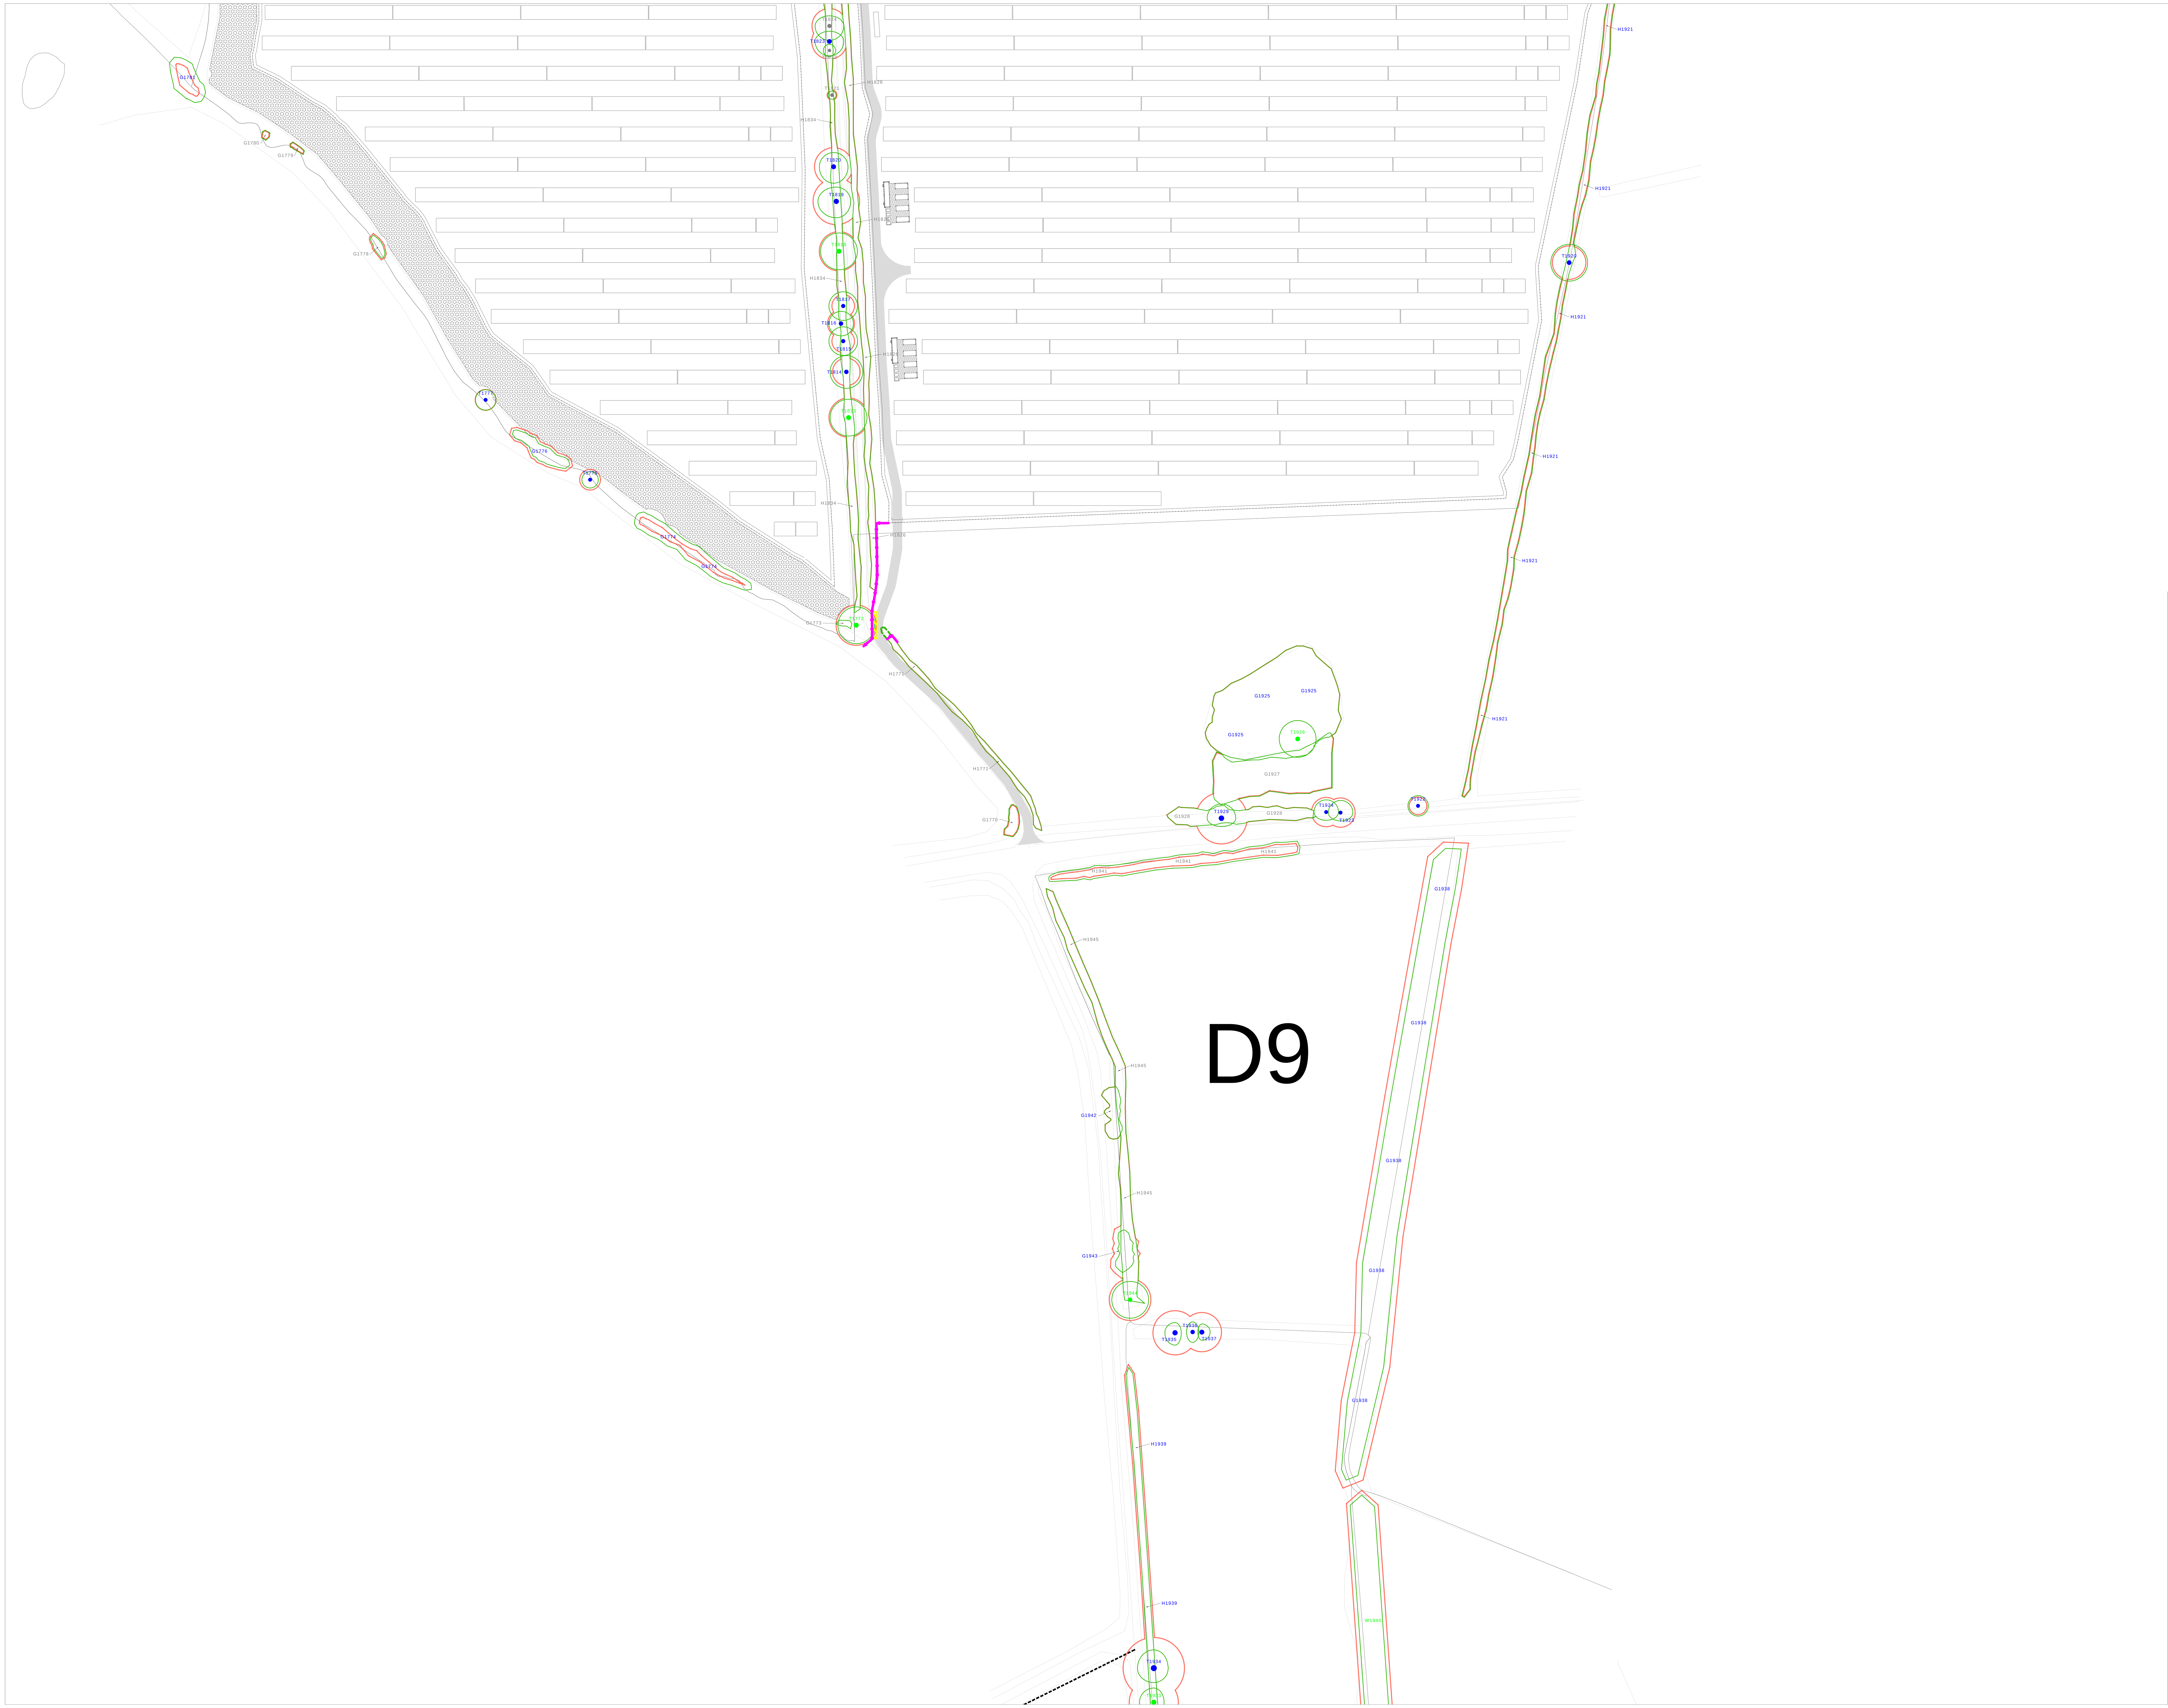

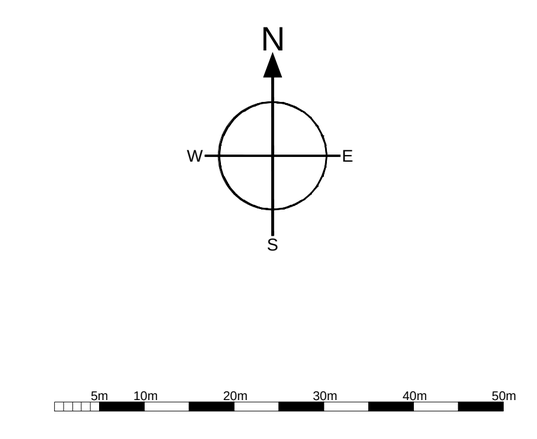

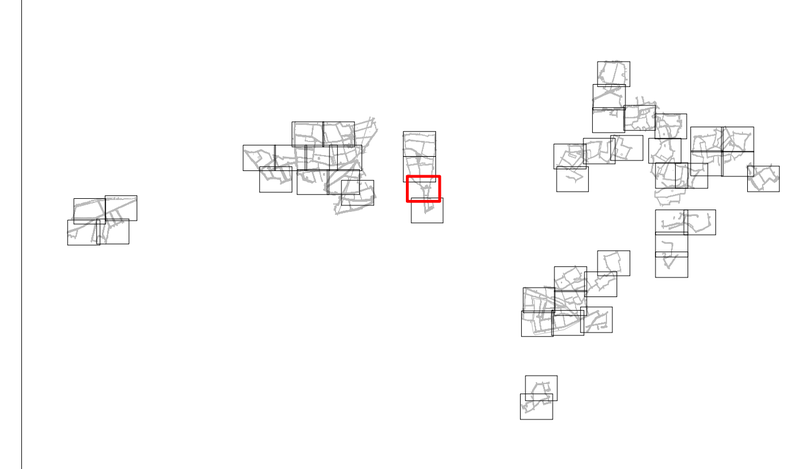

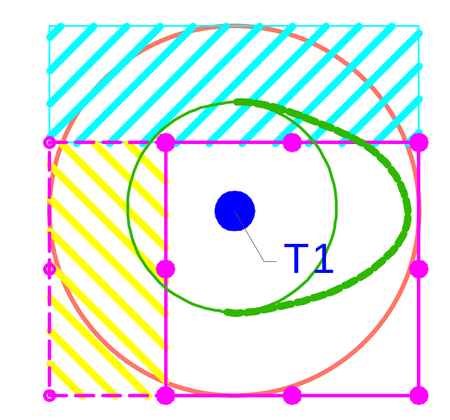

T1 Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC


Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

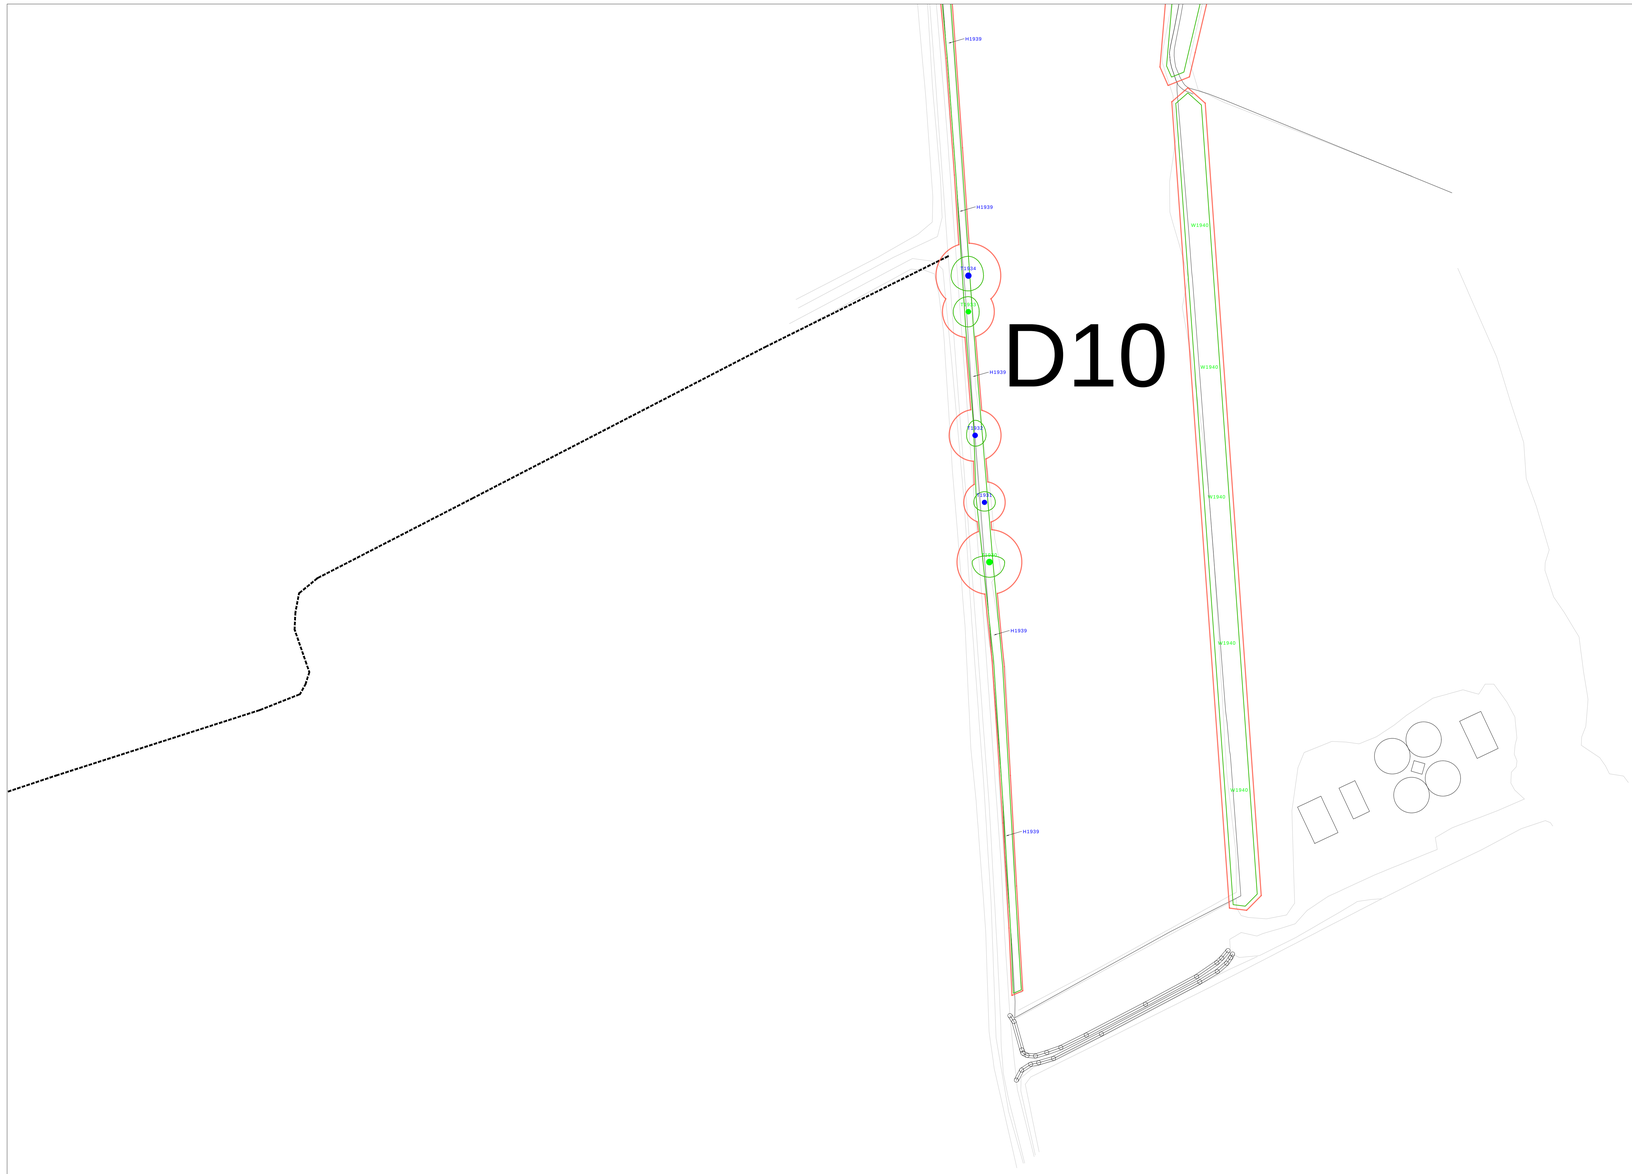

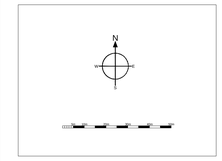





T1 Tree or Group Reference Number

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Tree Crown

Root Protection Area

Topographical Survey

Tree Protection Fencing

Initial Tree Protection Fencing

Ground Protection

Special Engineering /Supervised Excavations

Construction Exclusion Zone

Pruning/Tree Removal

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout//Design 2212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



N

Tree or Group Reference Number

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Tree Crown

Root Protection Area

Topographical Survey

Tree Protection Fencing

Initial Tree Protection Fencing

Ground Protection

Special Engineering / Supervised Excavations

Construction Exclusion Zone

Pruning/Tree Removal

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 2212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

D12

D13

N

T1

Tree or Group Reference Number
Tree Protection Fencing
Tree Stem Position A Category Tree
Initial Tree Protection Fencing
Tree Stem Position B Category Tree
Ground Protection
Tree Stem Position C Category Tree
Special Engineering / Supervised Excavations
Tree Stem Position U Category Tree
Construction Exclusion Zone
Tree Crown
Pruning/Tree Removal
Root Protection Area
Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey
Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 2212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025


Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

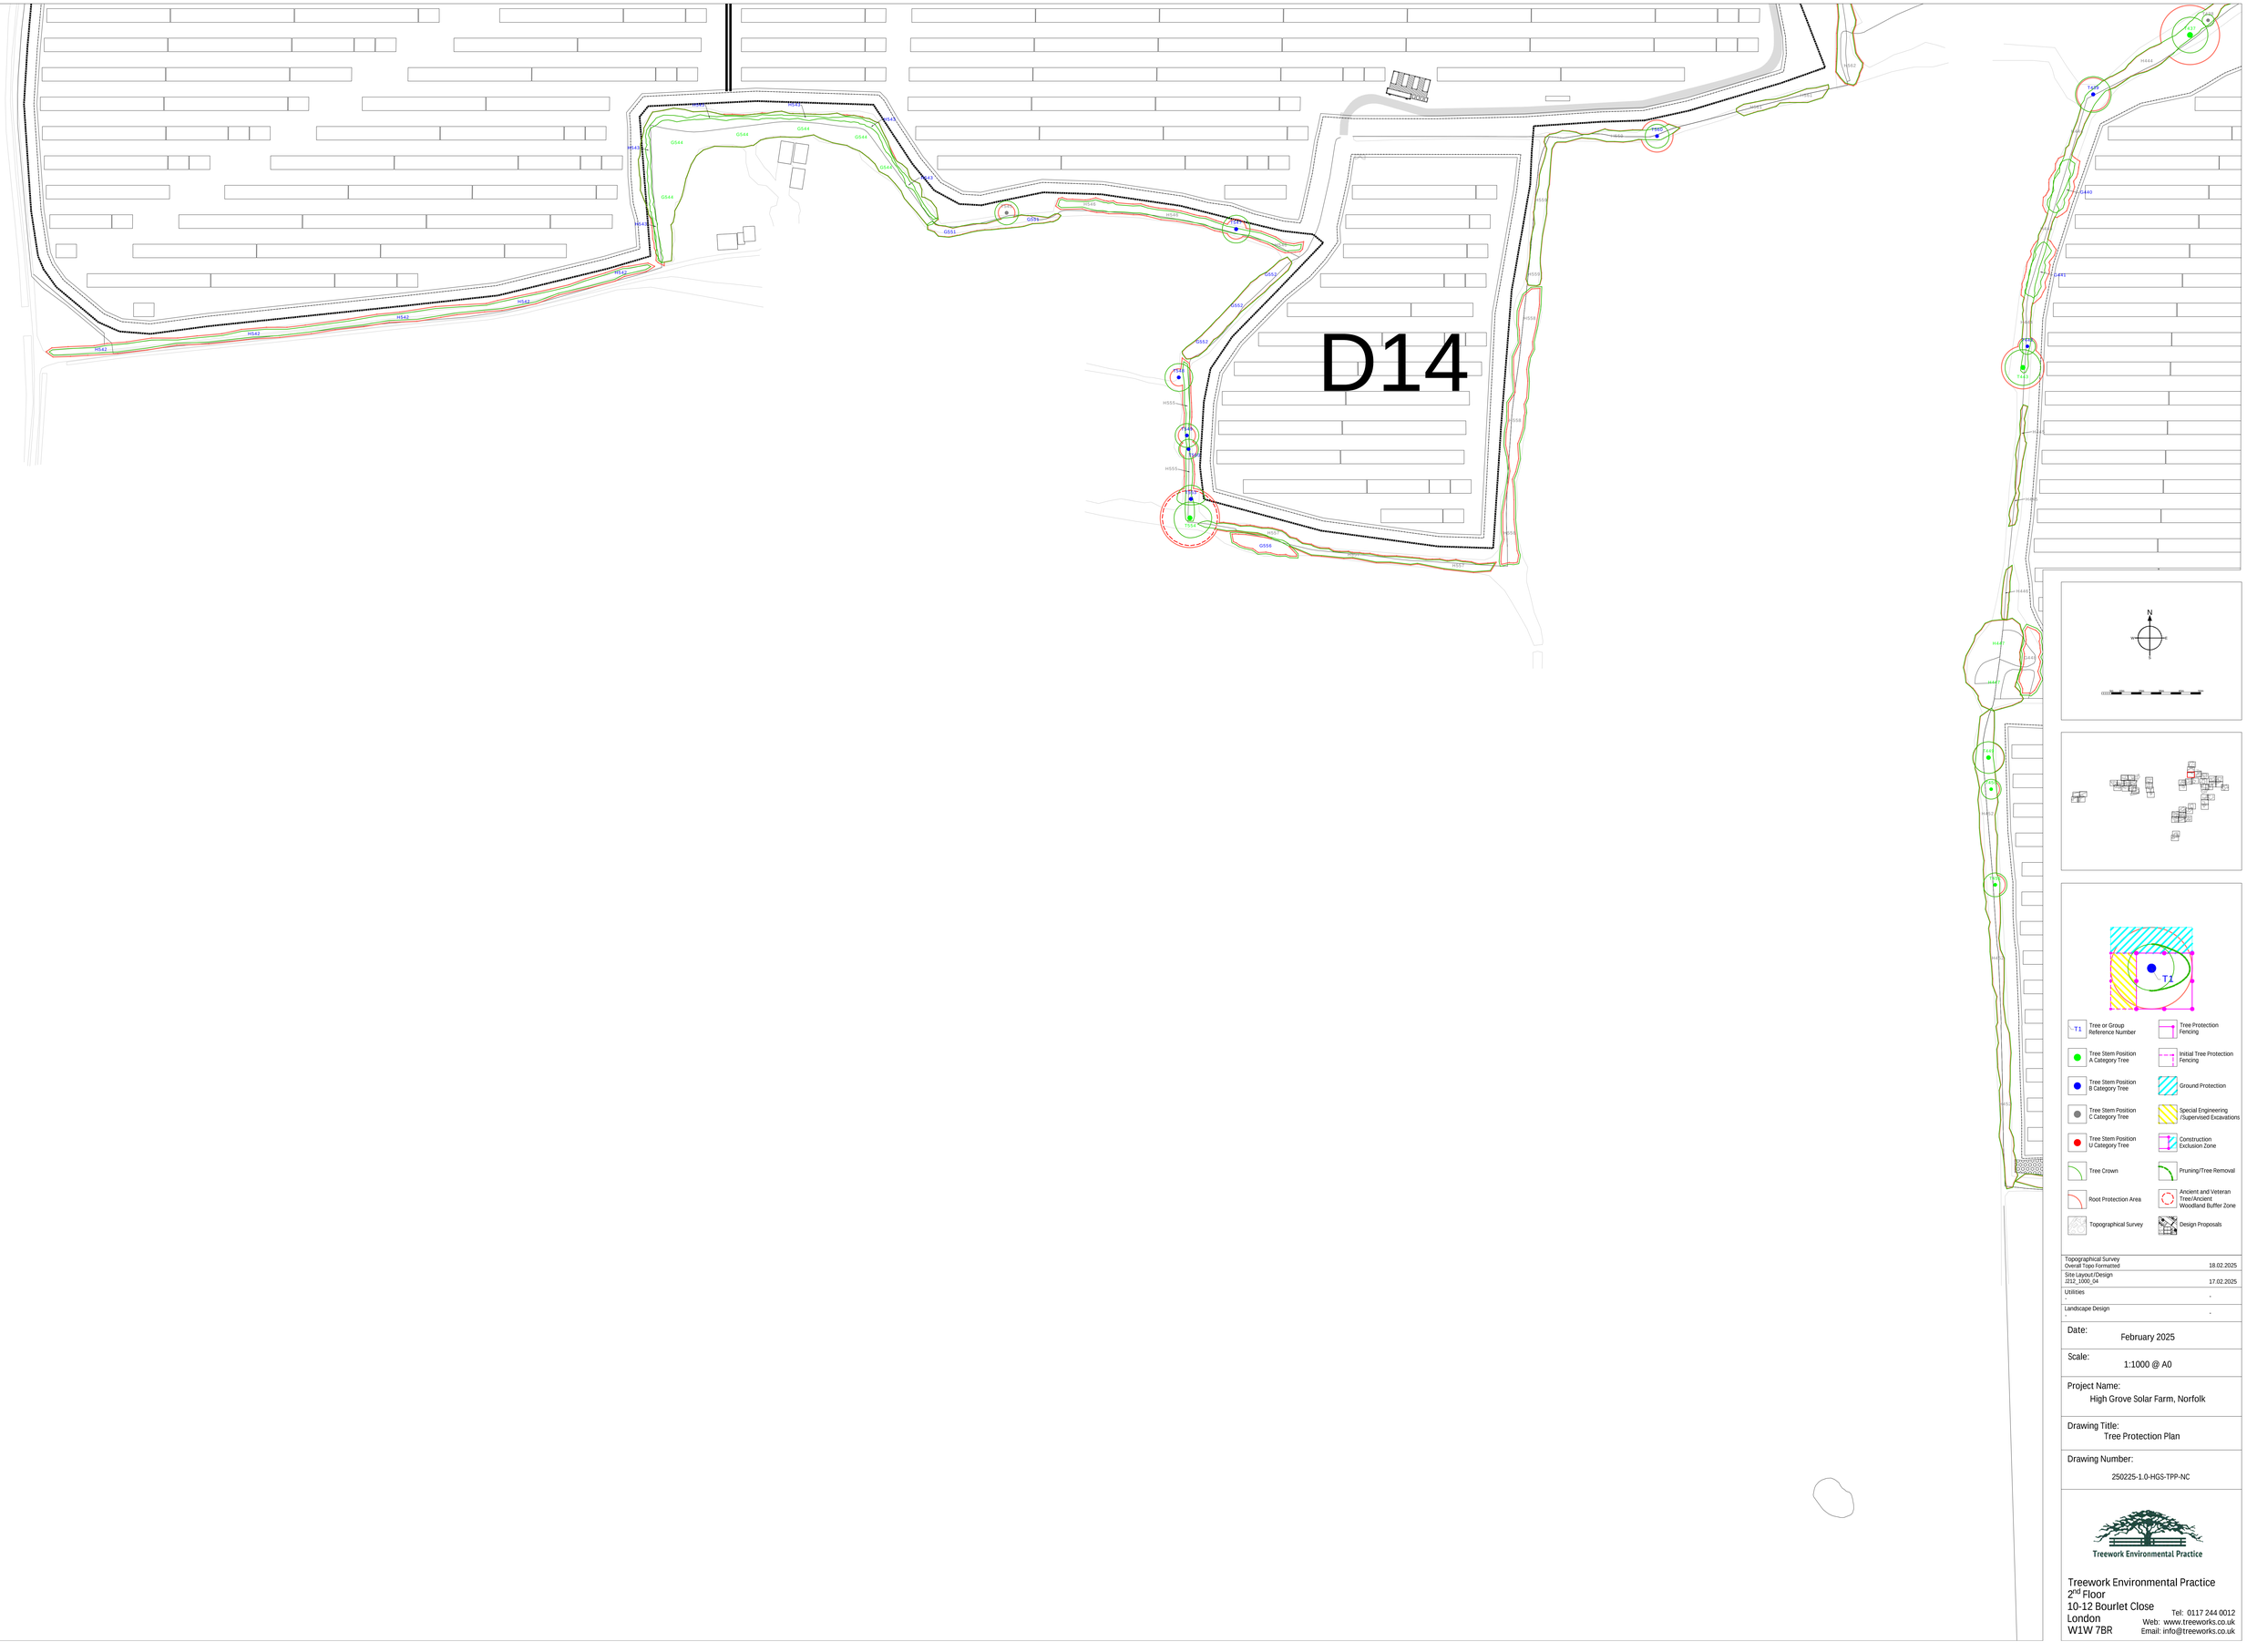

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout (Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR


Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

D15


D16

D17

D18

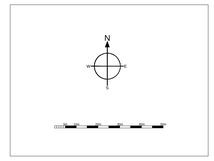





T1 Tree or Group Reference Number
Tree Stem Position A Category Tree
Tree Stem Position B Category Tree
Tree Stem Position C Category Tree
Tree Stem Position U Category Tree
Tree Crown
Root Protection Area
Topographical Survey
Tree Protection Fencing
Initial Tree Protection Fencing
Ground Protection
Special Engineering /Supervised Excavations
Construction Exclusion Zone
Pruning/Tree Removal
Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

E10

E11

E12

E13

N

T1

Tree or Group Reference Number

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Tree Crown

Root Protection Area

Topographical Survey

Tree Protection Fencing

Initial Tree Protection Fencing

Ground Protection

Special Engineering /Supervised Excavations

Construction Exclusion Zone

Pruning/Tree Removal

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk


Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

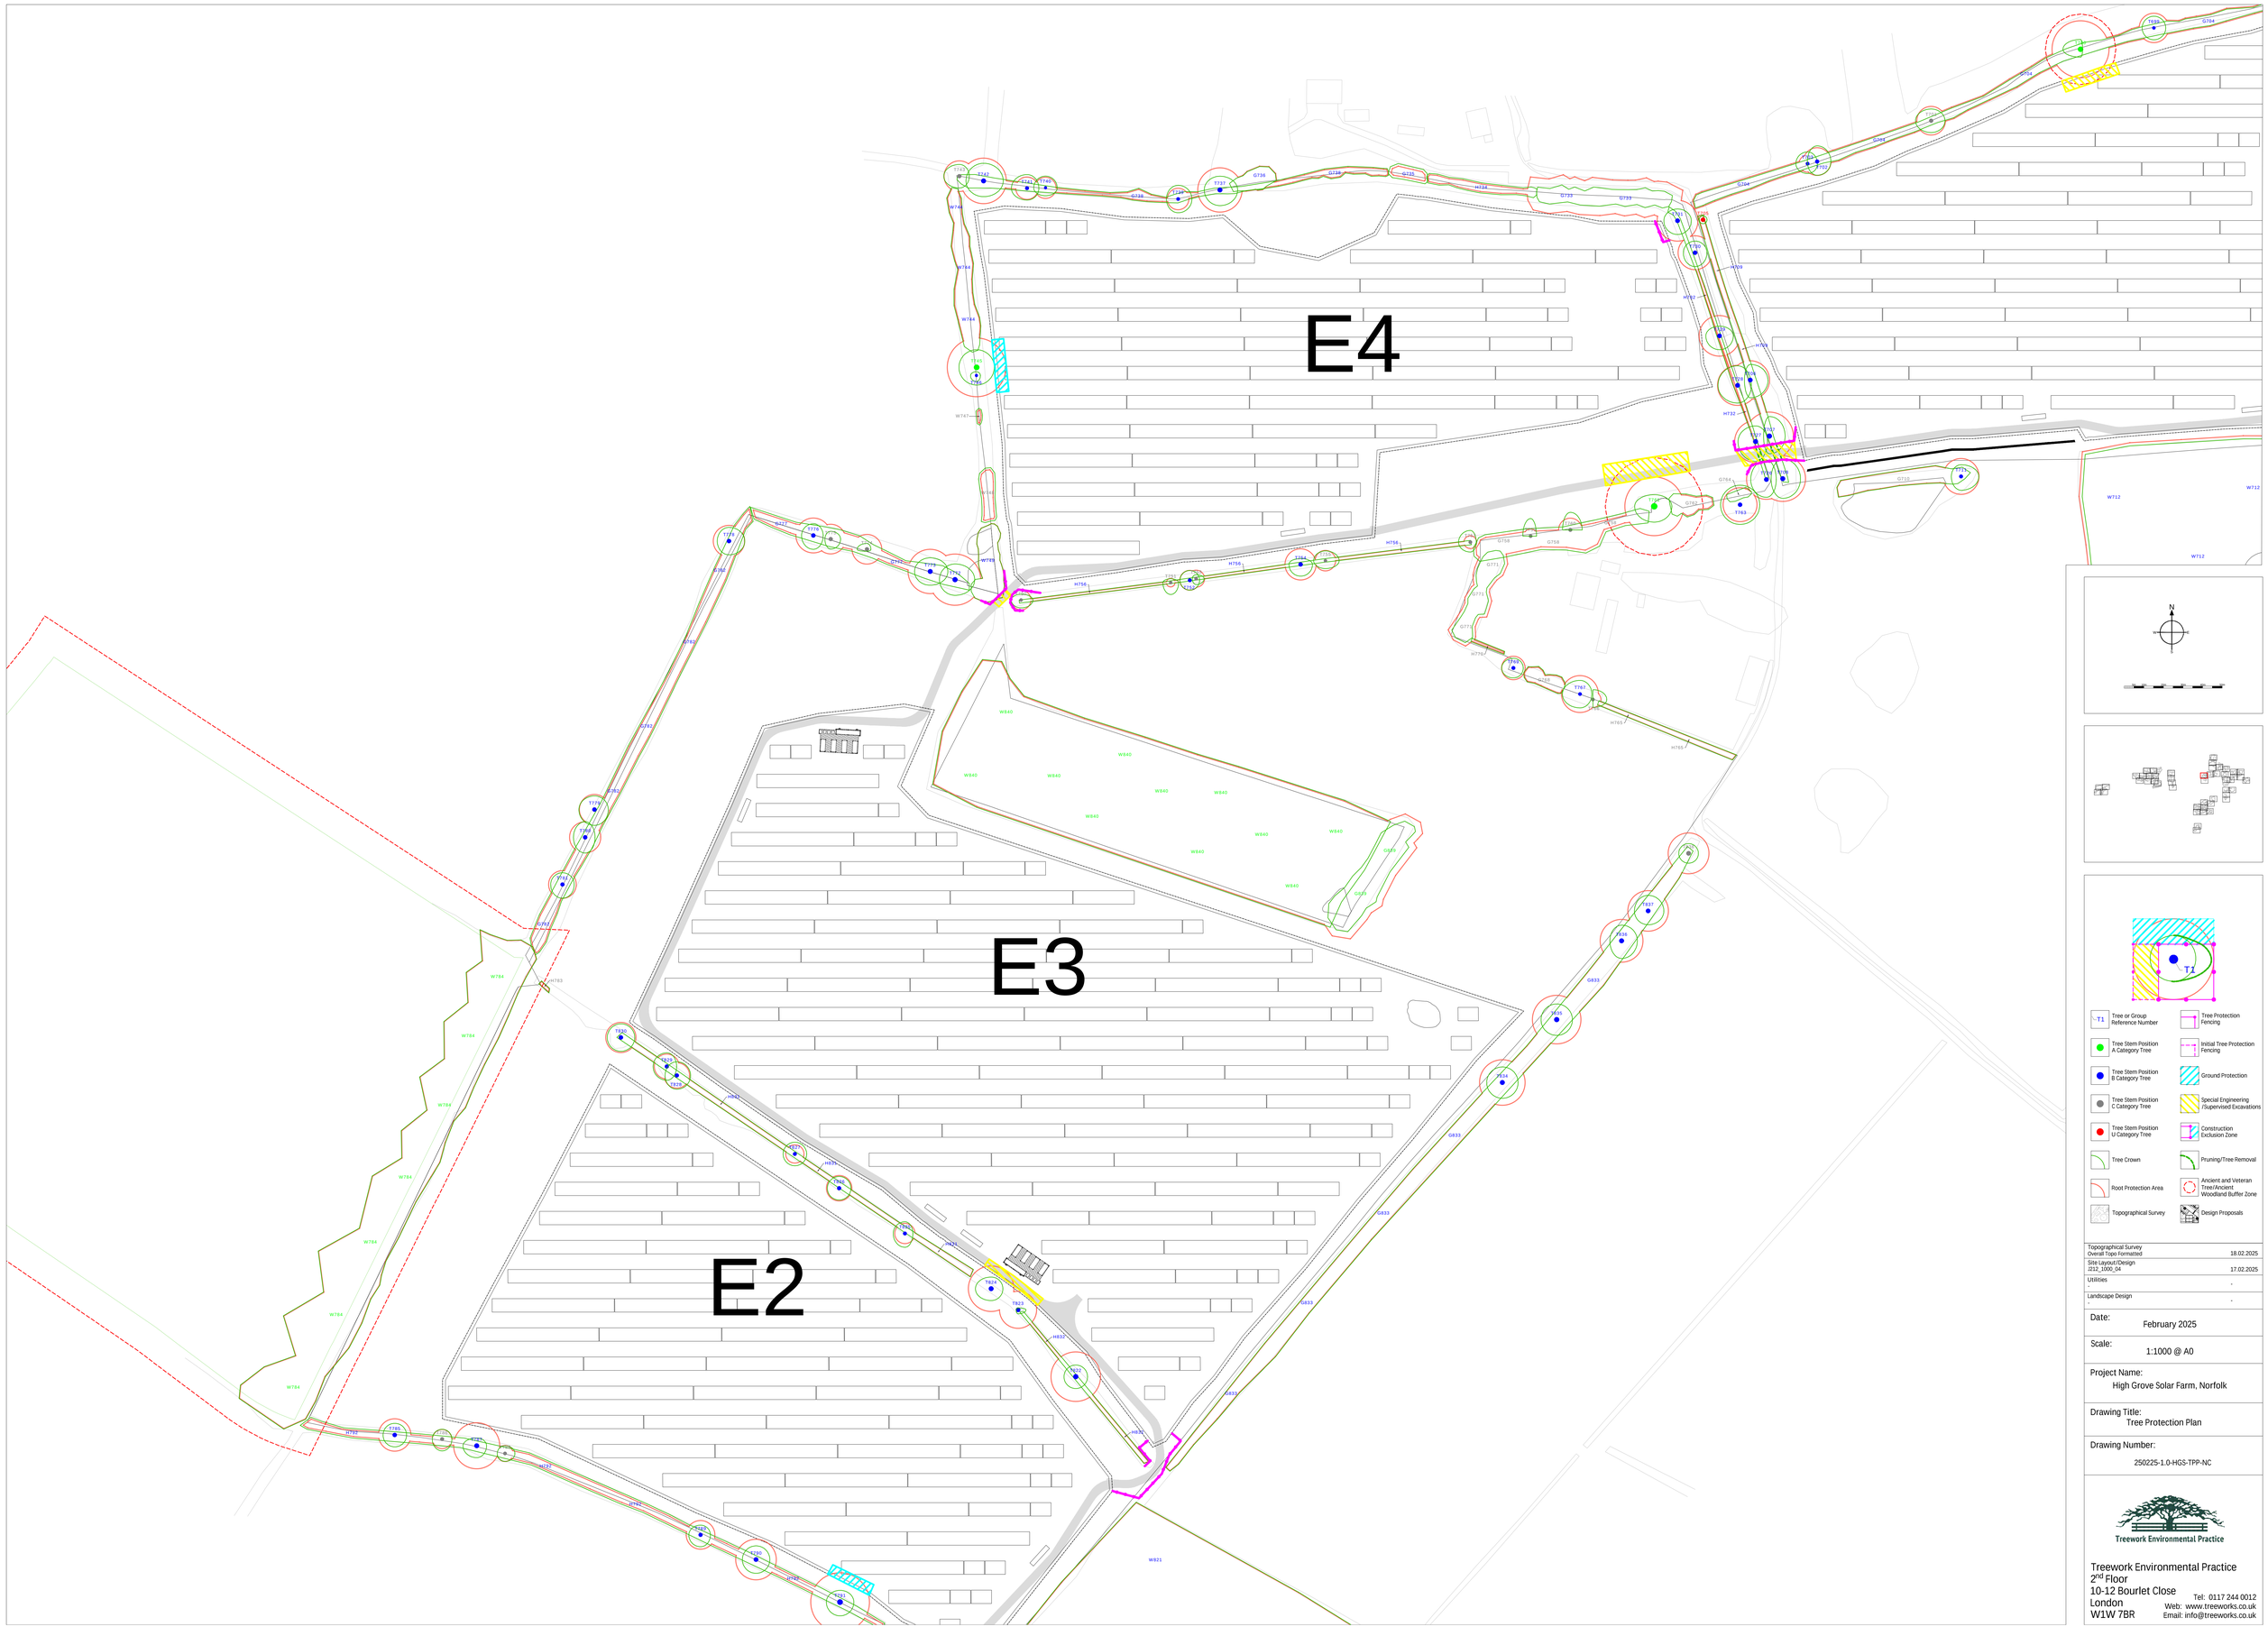

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0


Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan


Drawing Number: 250225-1.0-HGS-TPP-NC


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

E7

E8

E9

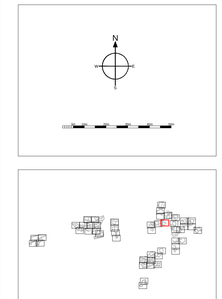

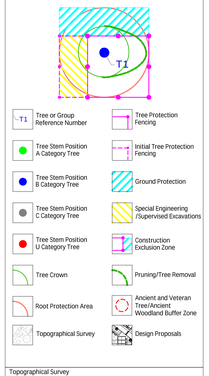

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 2212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan


Drawing Number:
250225-1.0-HGS-TPP-NC


Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

E14

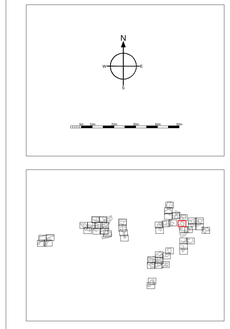



- T1 Tree or Group Reference Number
- Tree Stem Position A Category Tree
- Tree Stem Position B Category Tree
- Tree Stem Position C Category Tree
- Tree Stem Position U Category Tree
- Tree Crown
- Root Protection Area
- Topographical Survey
- Tree Protection Fencing
- Initial Tree Protection Fencing
- Ground Protection
- Special Engineering /Supervised Excavations
- Construction Exclusion Zone
- Pruning/Tree Removal
- Ancient and Veteran Tree/Ancient Woodland Buffer Zone
- Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

F1

F2

F3

F4

F5

F8

F14

F15

400kV Substation

150m

N

T1

T1 Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

F14

F13

F12

F17

F16

N

T1

Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0


Project Name:
High Grove Solar Farm, Norfolk


Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



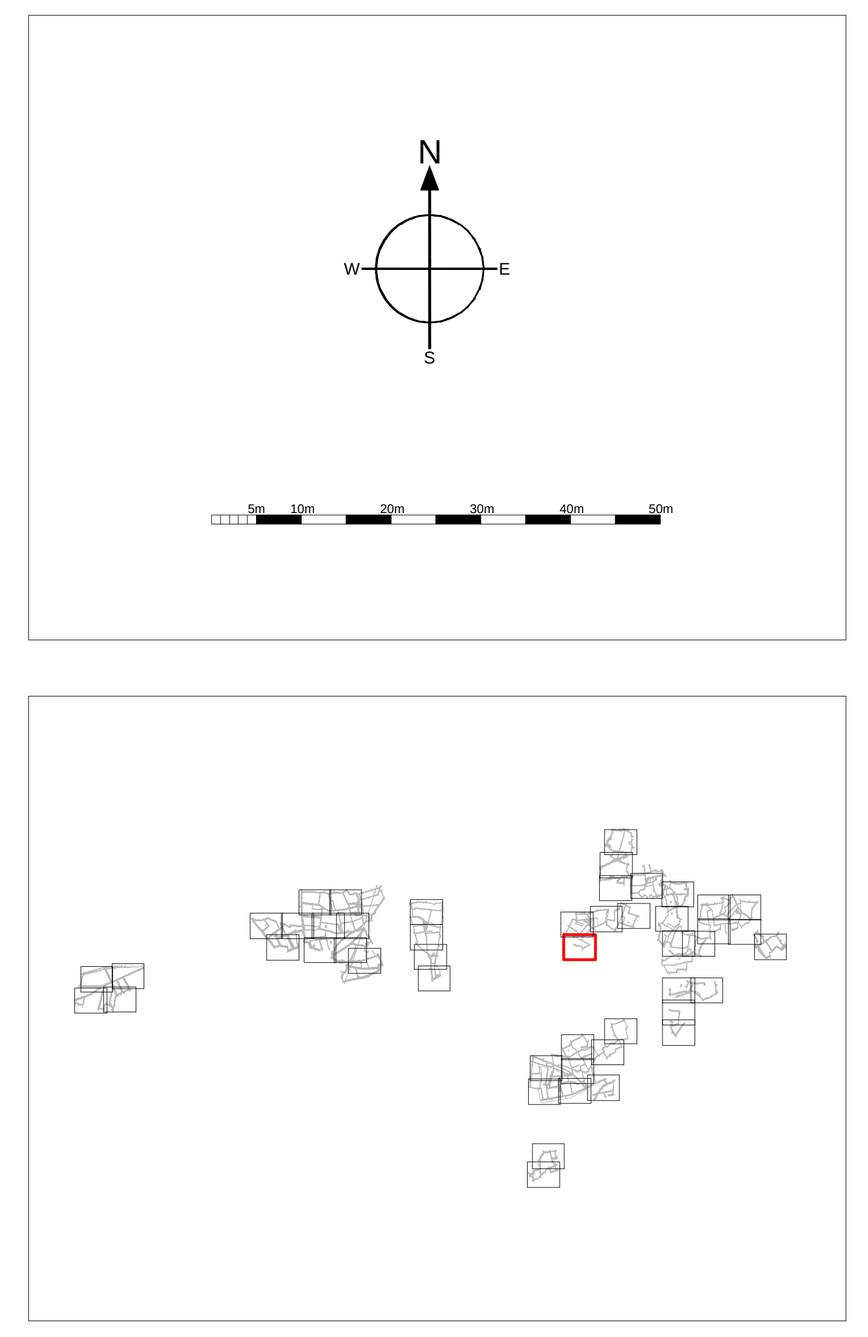

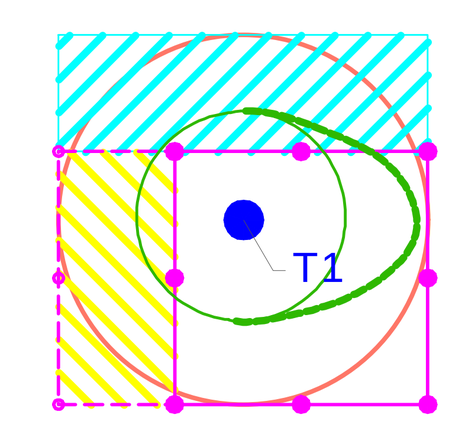

T1 Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

E15


E16


E17

E18

E19

E20

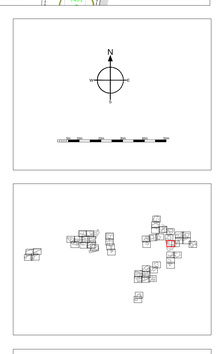



- T1 — Tree or Group Reference Number
- Tree Stem Position A Category Tree
- Tree Stem Position B Category Tree
- Tree Stem Position C Category Tree
- Tree Stem Position U Category Tree
- Tree Crown
- Root Protection Area
- Topographical Survey
- Tree Protection Fencing
- Initial Tree Protection Fencing
- Ground Protection
- Special Engineering /Supervised Excavations
- Construction Exclusion Zone
- Pruning/Tree Removal
- Ancient and Veteran Tree/Ancient Woodland Buffer Zone
- Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

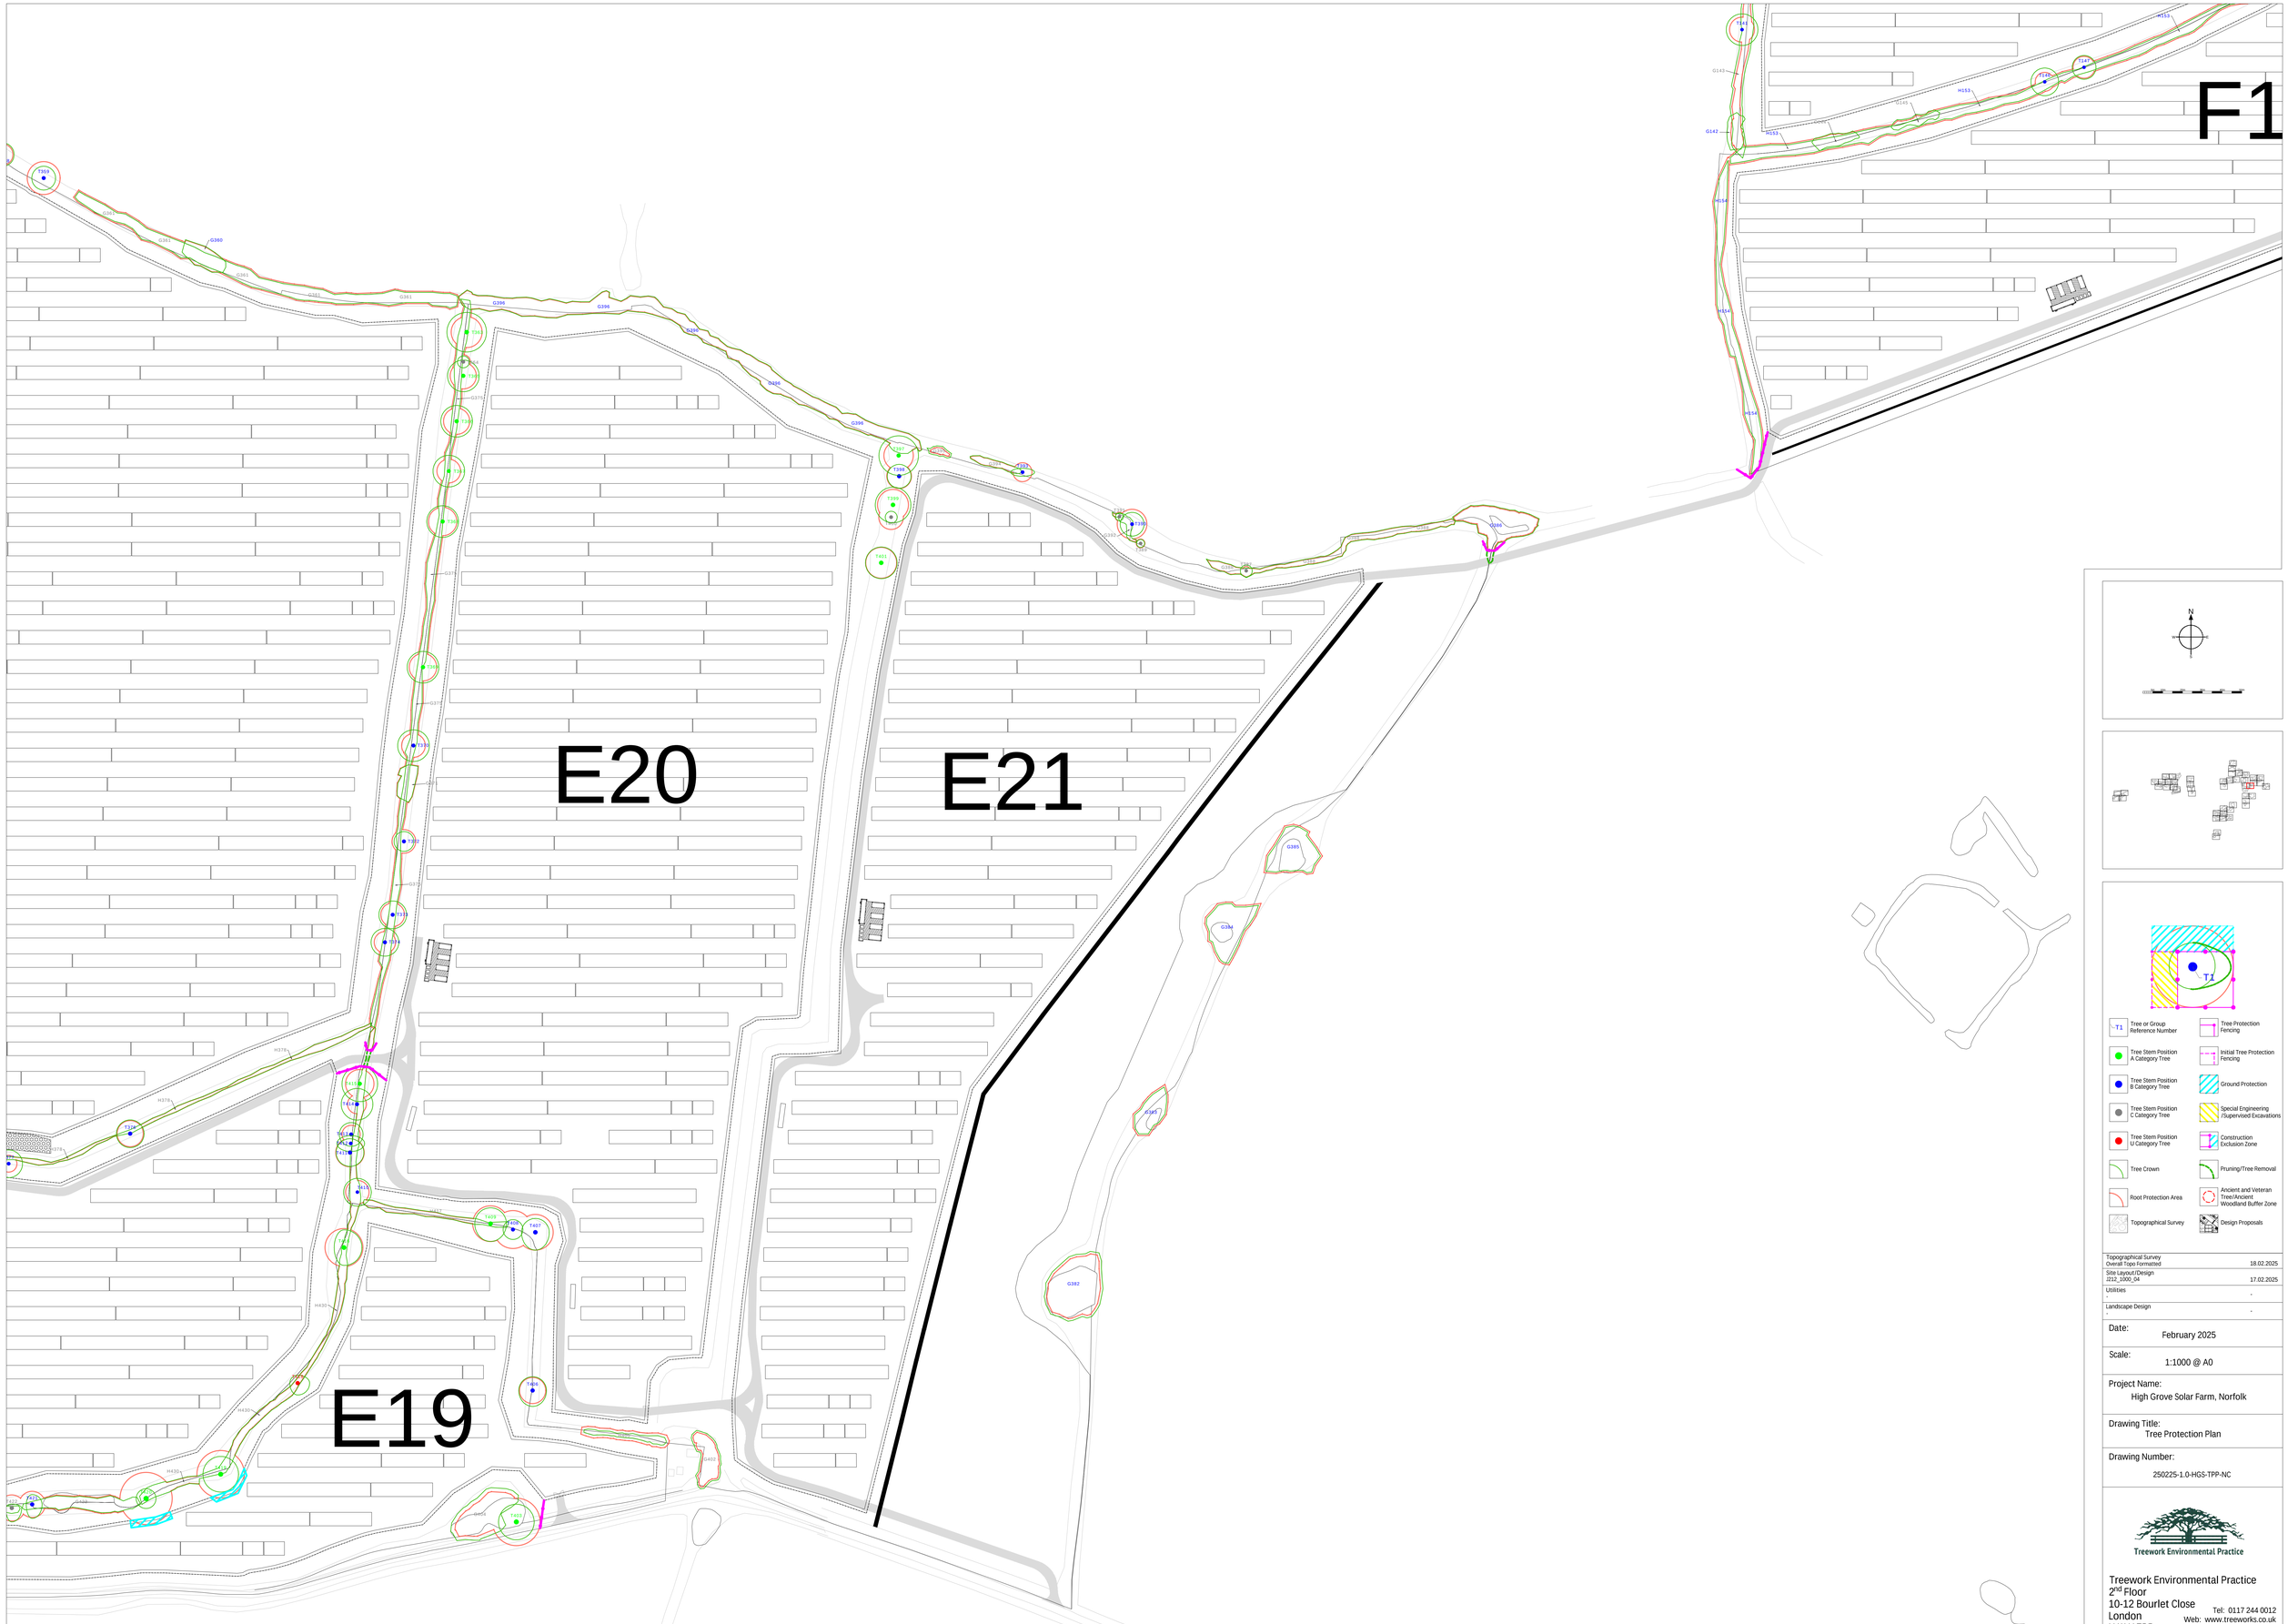

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout//Design 2D2_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

F6

F7

400kV
Substation
250mx150m

F9

F10

F11

E21

N

T1 Tree or Group Reference Number
Tree Stem Position A Category Tree
Tree Stem Position B Category Tree
Tree Stem Position C Category Tree
Tree Stem Position U Category Tree
Tree Crown
Root Protection Area
Topographical Survey
Tree Protection Fencing
Initial Tree Protection Fencing
Ground Protection
Special Engineering /Supervised Excavations
Construction Exclusion Zone
Pruning/Tree Removal
Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 2cz_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

F12

F16

F11

F18

N

T1 — Tree or Group Reference Number
Tree Stem Position A Category Tree
Tree Stem Position B Category Tree
Tree Stem Position C Category Tree
Tree Stem Position U Category Tree
Tree Crown
Root Protection Area
Topographical Survey
Tree Protection Fencing
Initial Tree Protection Fencing
Ground Protection
Special Engineering /Supervised Excavations
Construction Exclusion Zone
Pruning/Tree Removal
Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan


Drawing Number: 250225-1.0-HGS-TPP-NC


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

F18

F20

F19

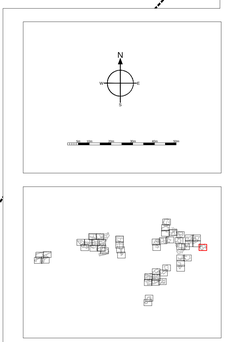

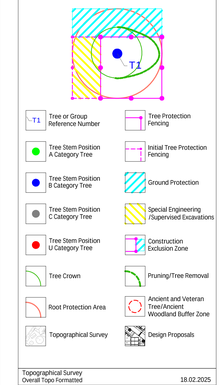

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout//Design 2212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



T1 Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025


Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan


Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

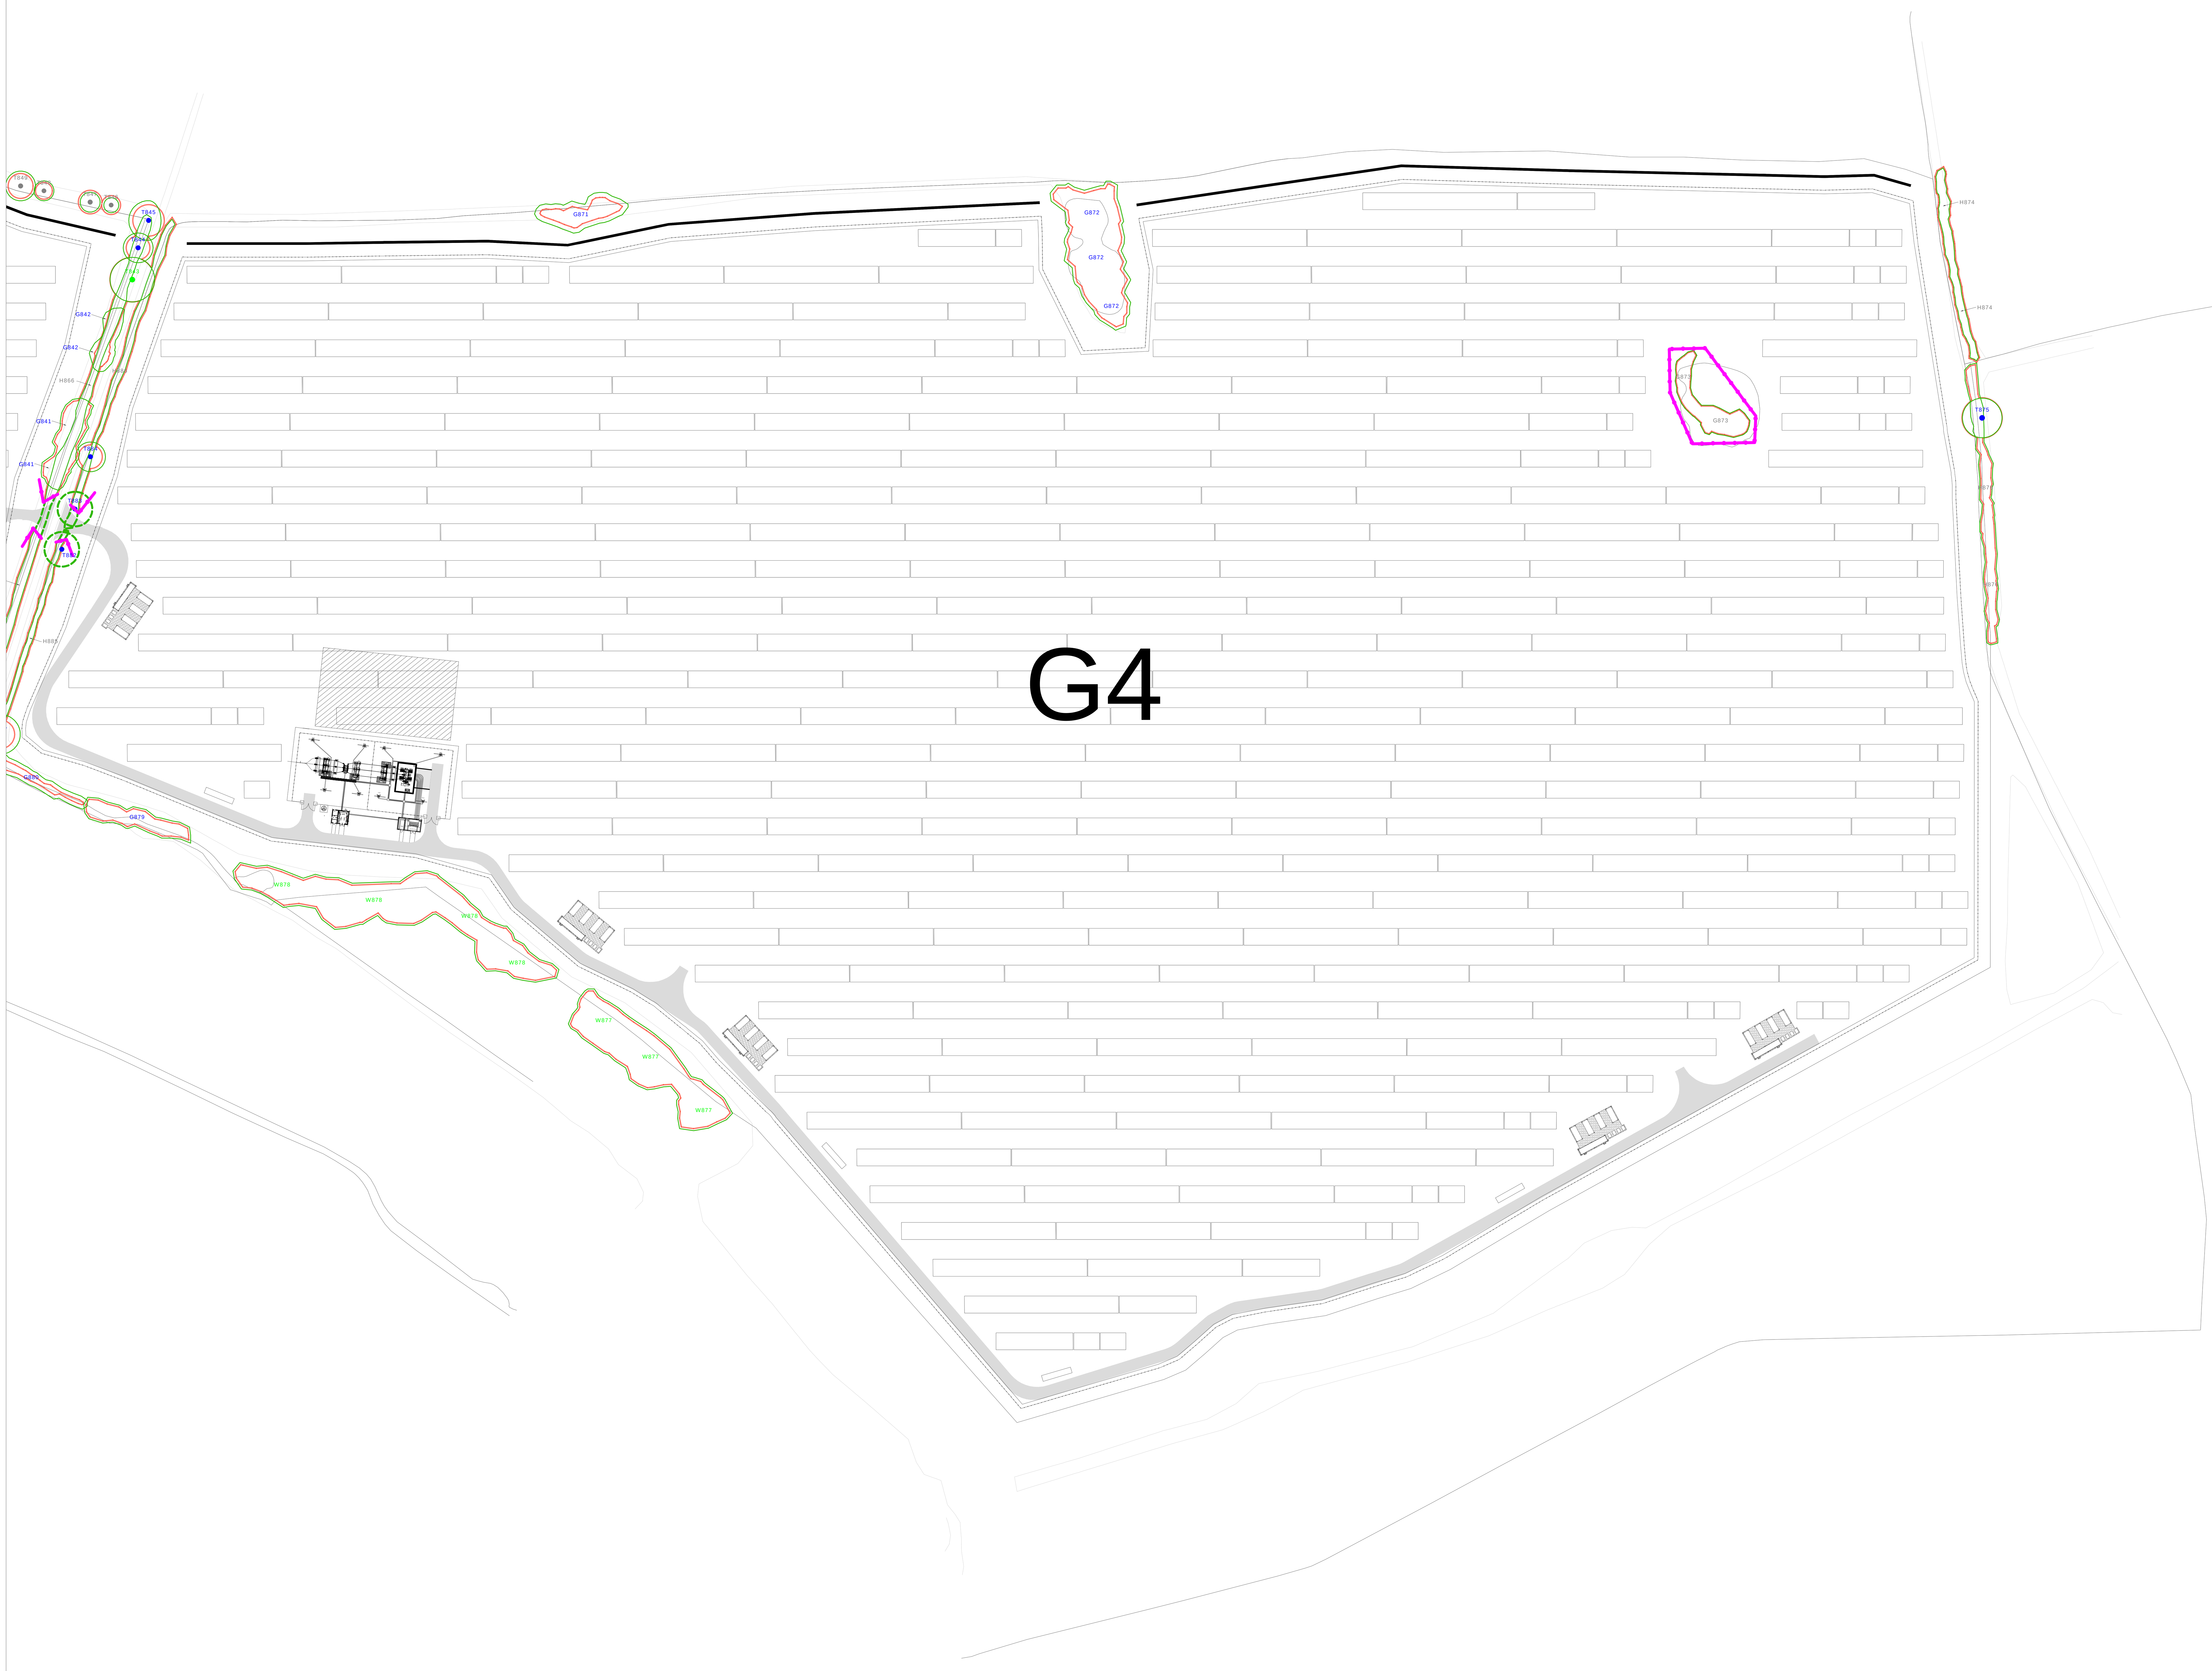

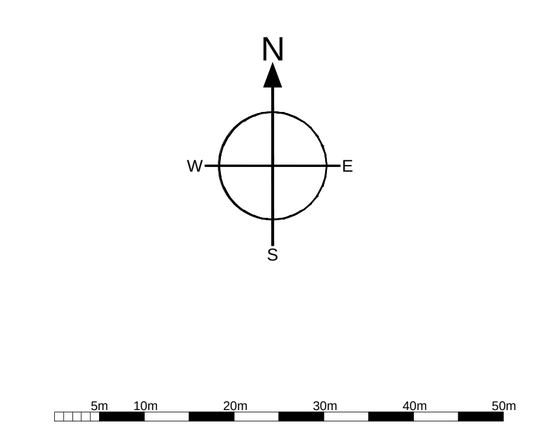



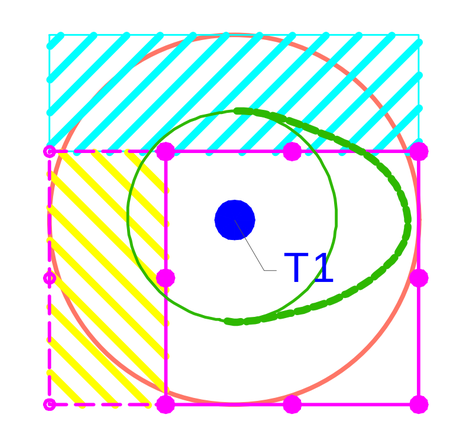

T1 Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC


Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

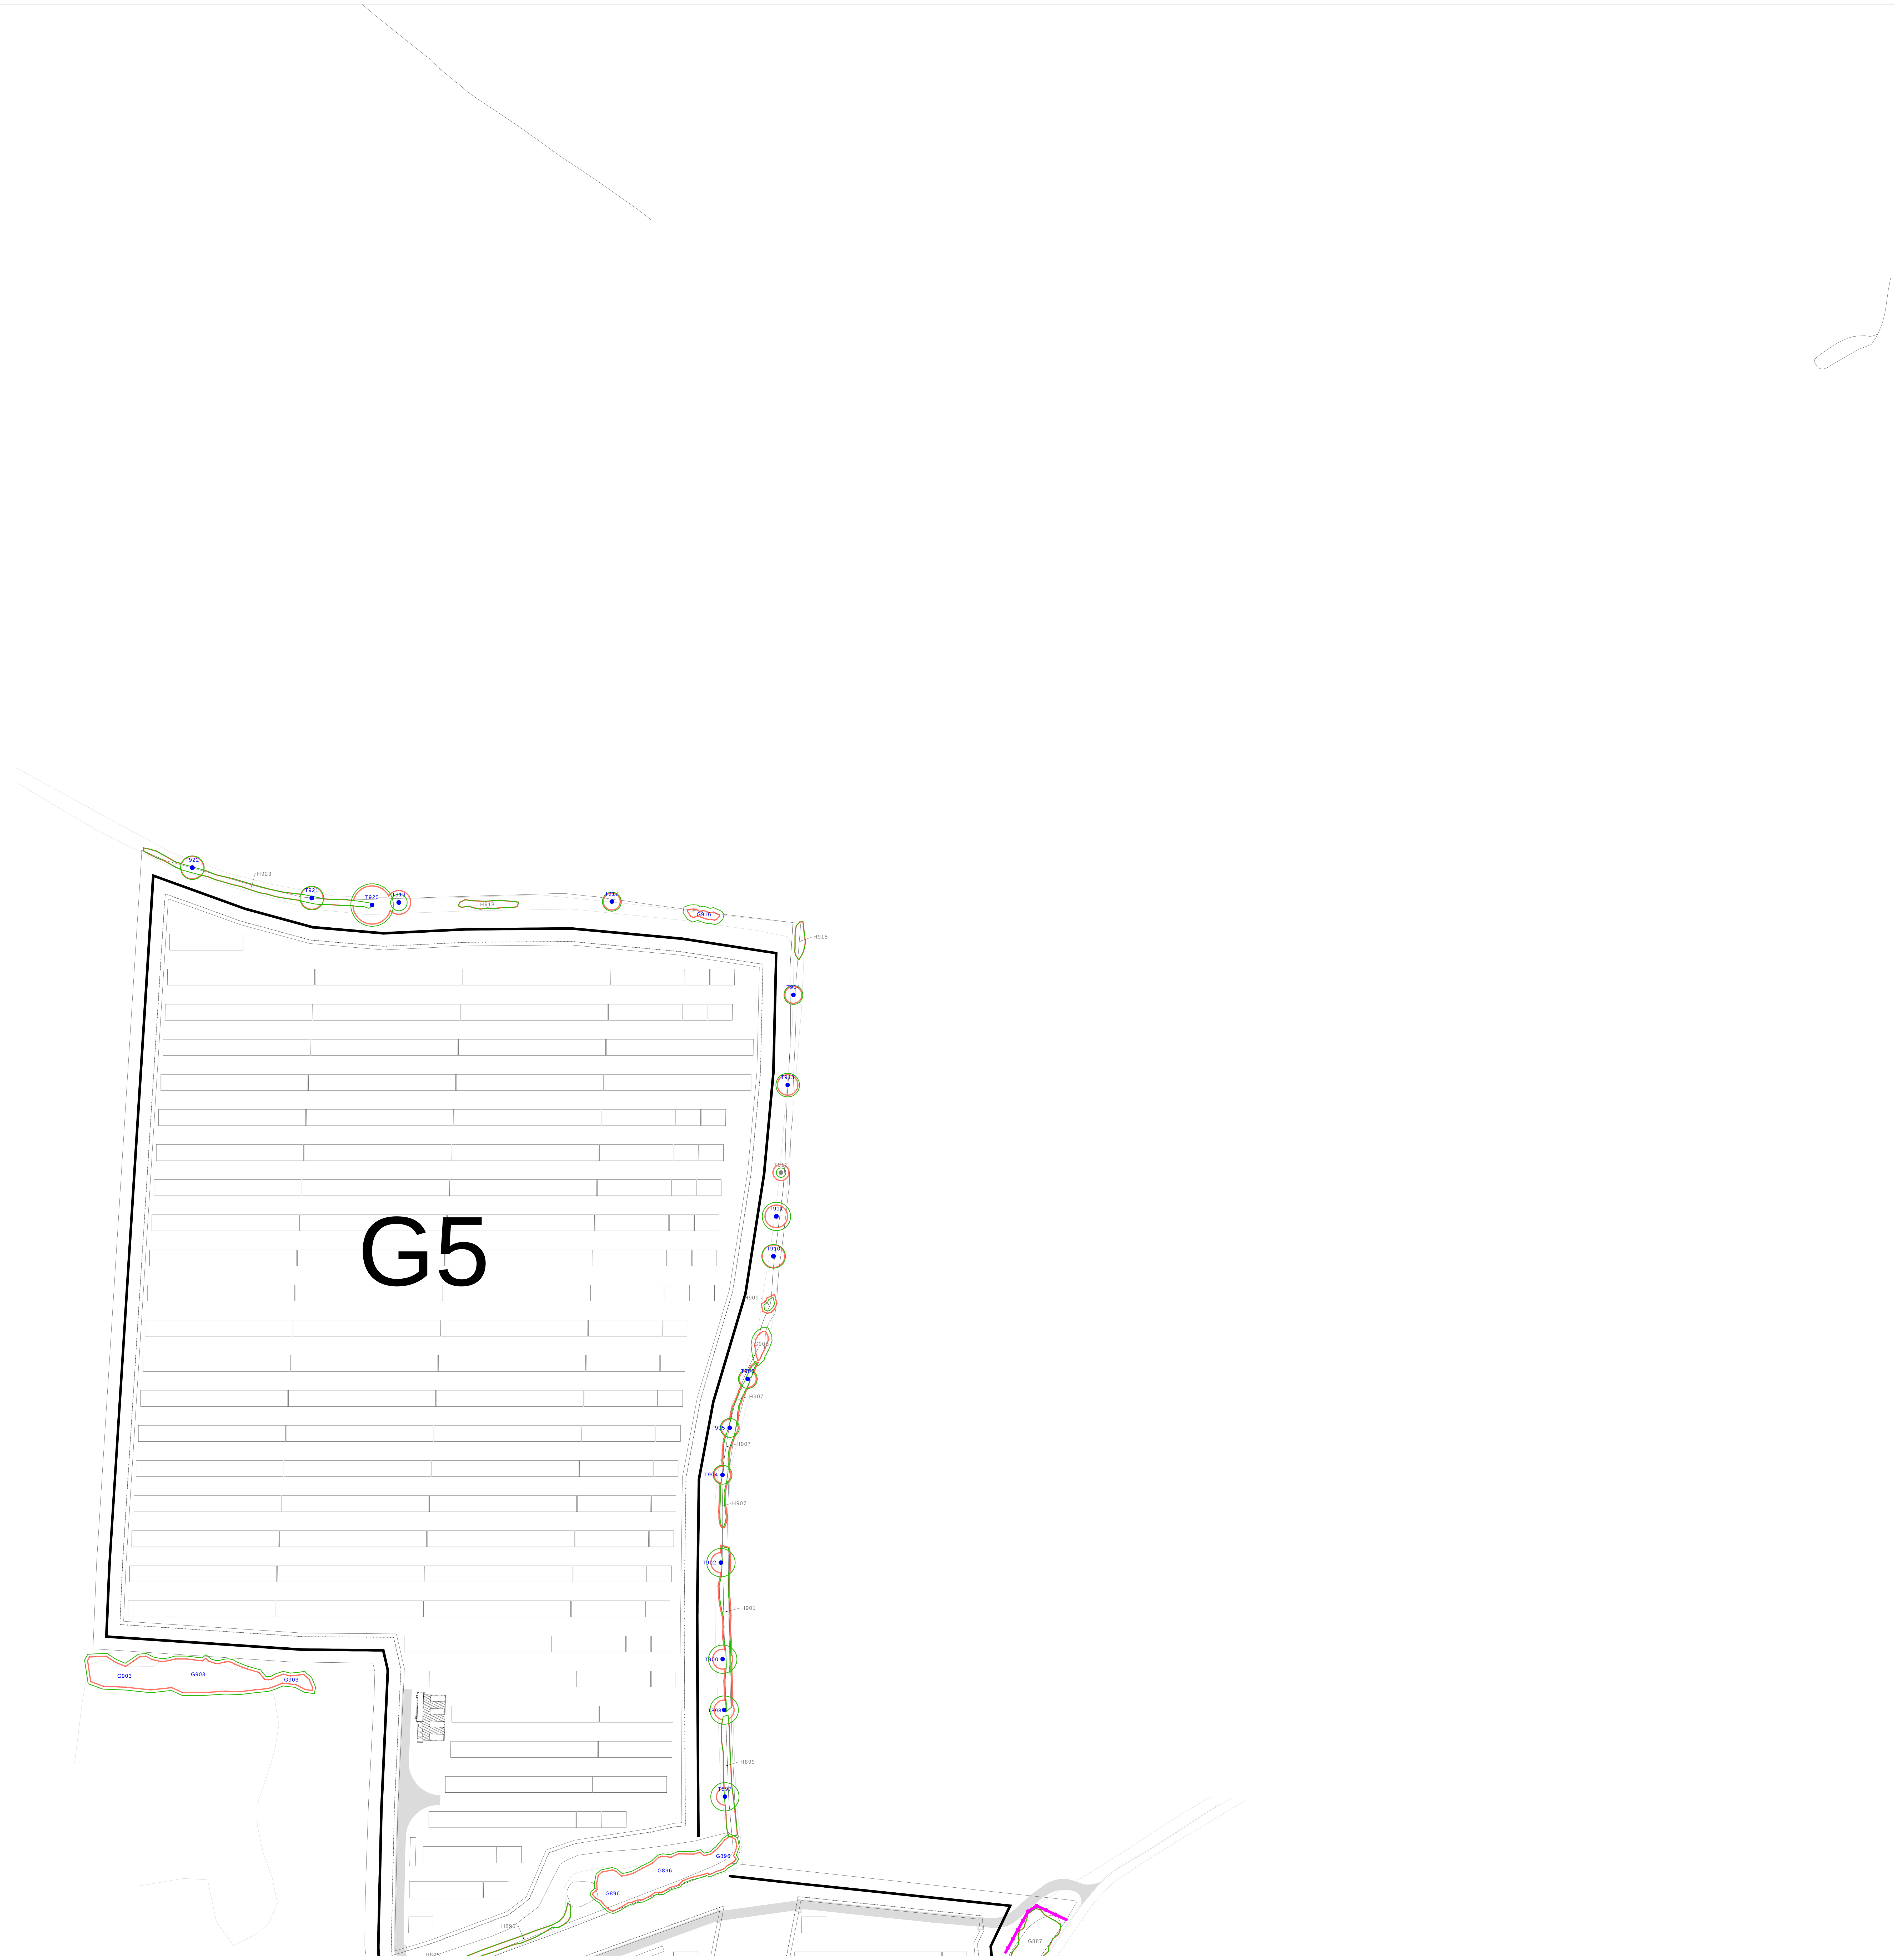

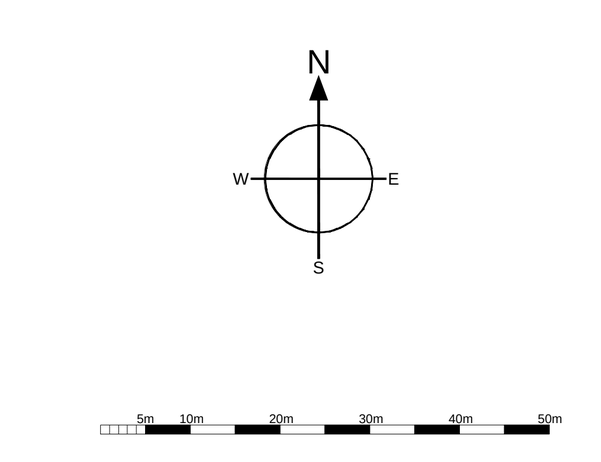



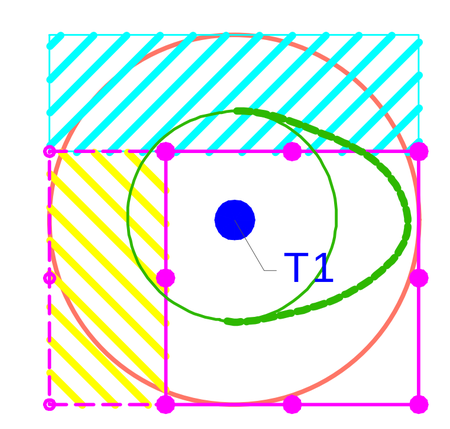

T1	Tree or Group Reference Number		Tree Protection Fencing
	Tree Stem Position A Category Tree		Initial Tree Protection Fencing
	Tree Stem Position B Category Tree		Ground Protection
	Tree Stem Position C Category Tree		Special Engineering /Supervised Excavations
	Tree Stem Position U Category Tree		Construction Exclusion Zone
	Tree Crown		Pruning/Tree Removal
	Root Protection Area		Ancient and Veteran Tree/Ancient Woodland Buffer Zone
	Topographical Survey		Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC


Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

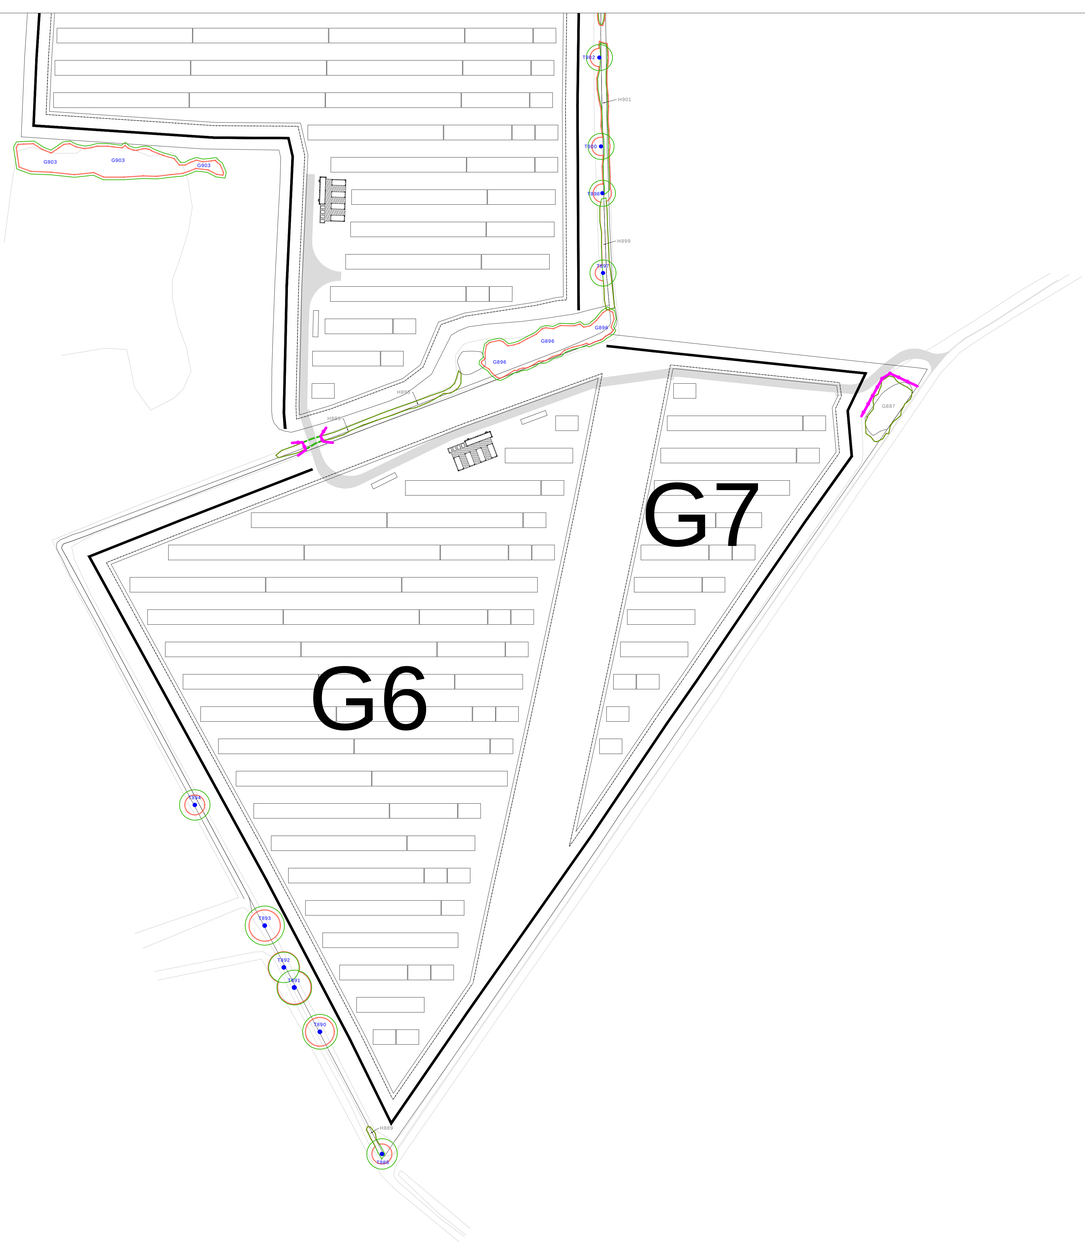

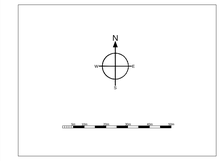





T1 Tree or Group Reference Number

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Tree Crown

Root Protection Area

Topographical Survey

Tree Protection Fencing

Initial Tree Protection Fencing

Ground Protection

Special Engineering /Supervised Excavations

Construction Exclusion Zone

Pruning/Tree Removal

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout//Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk


Drawing Title:
Tree Protection Plan


Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

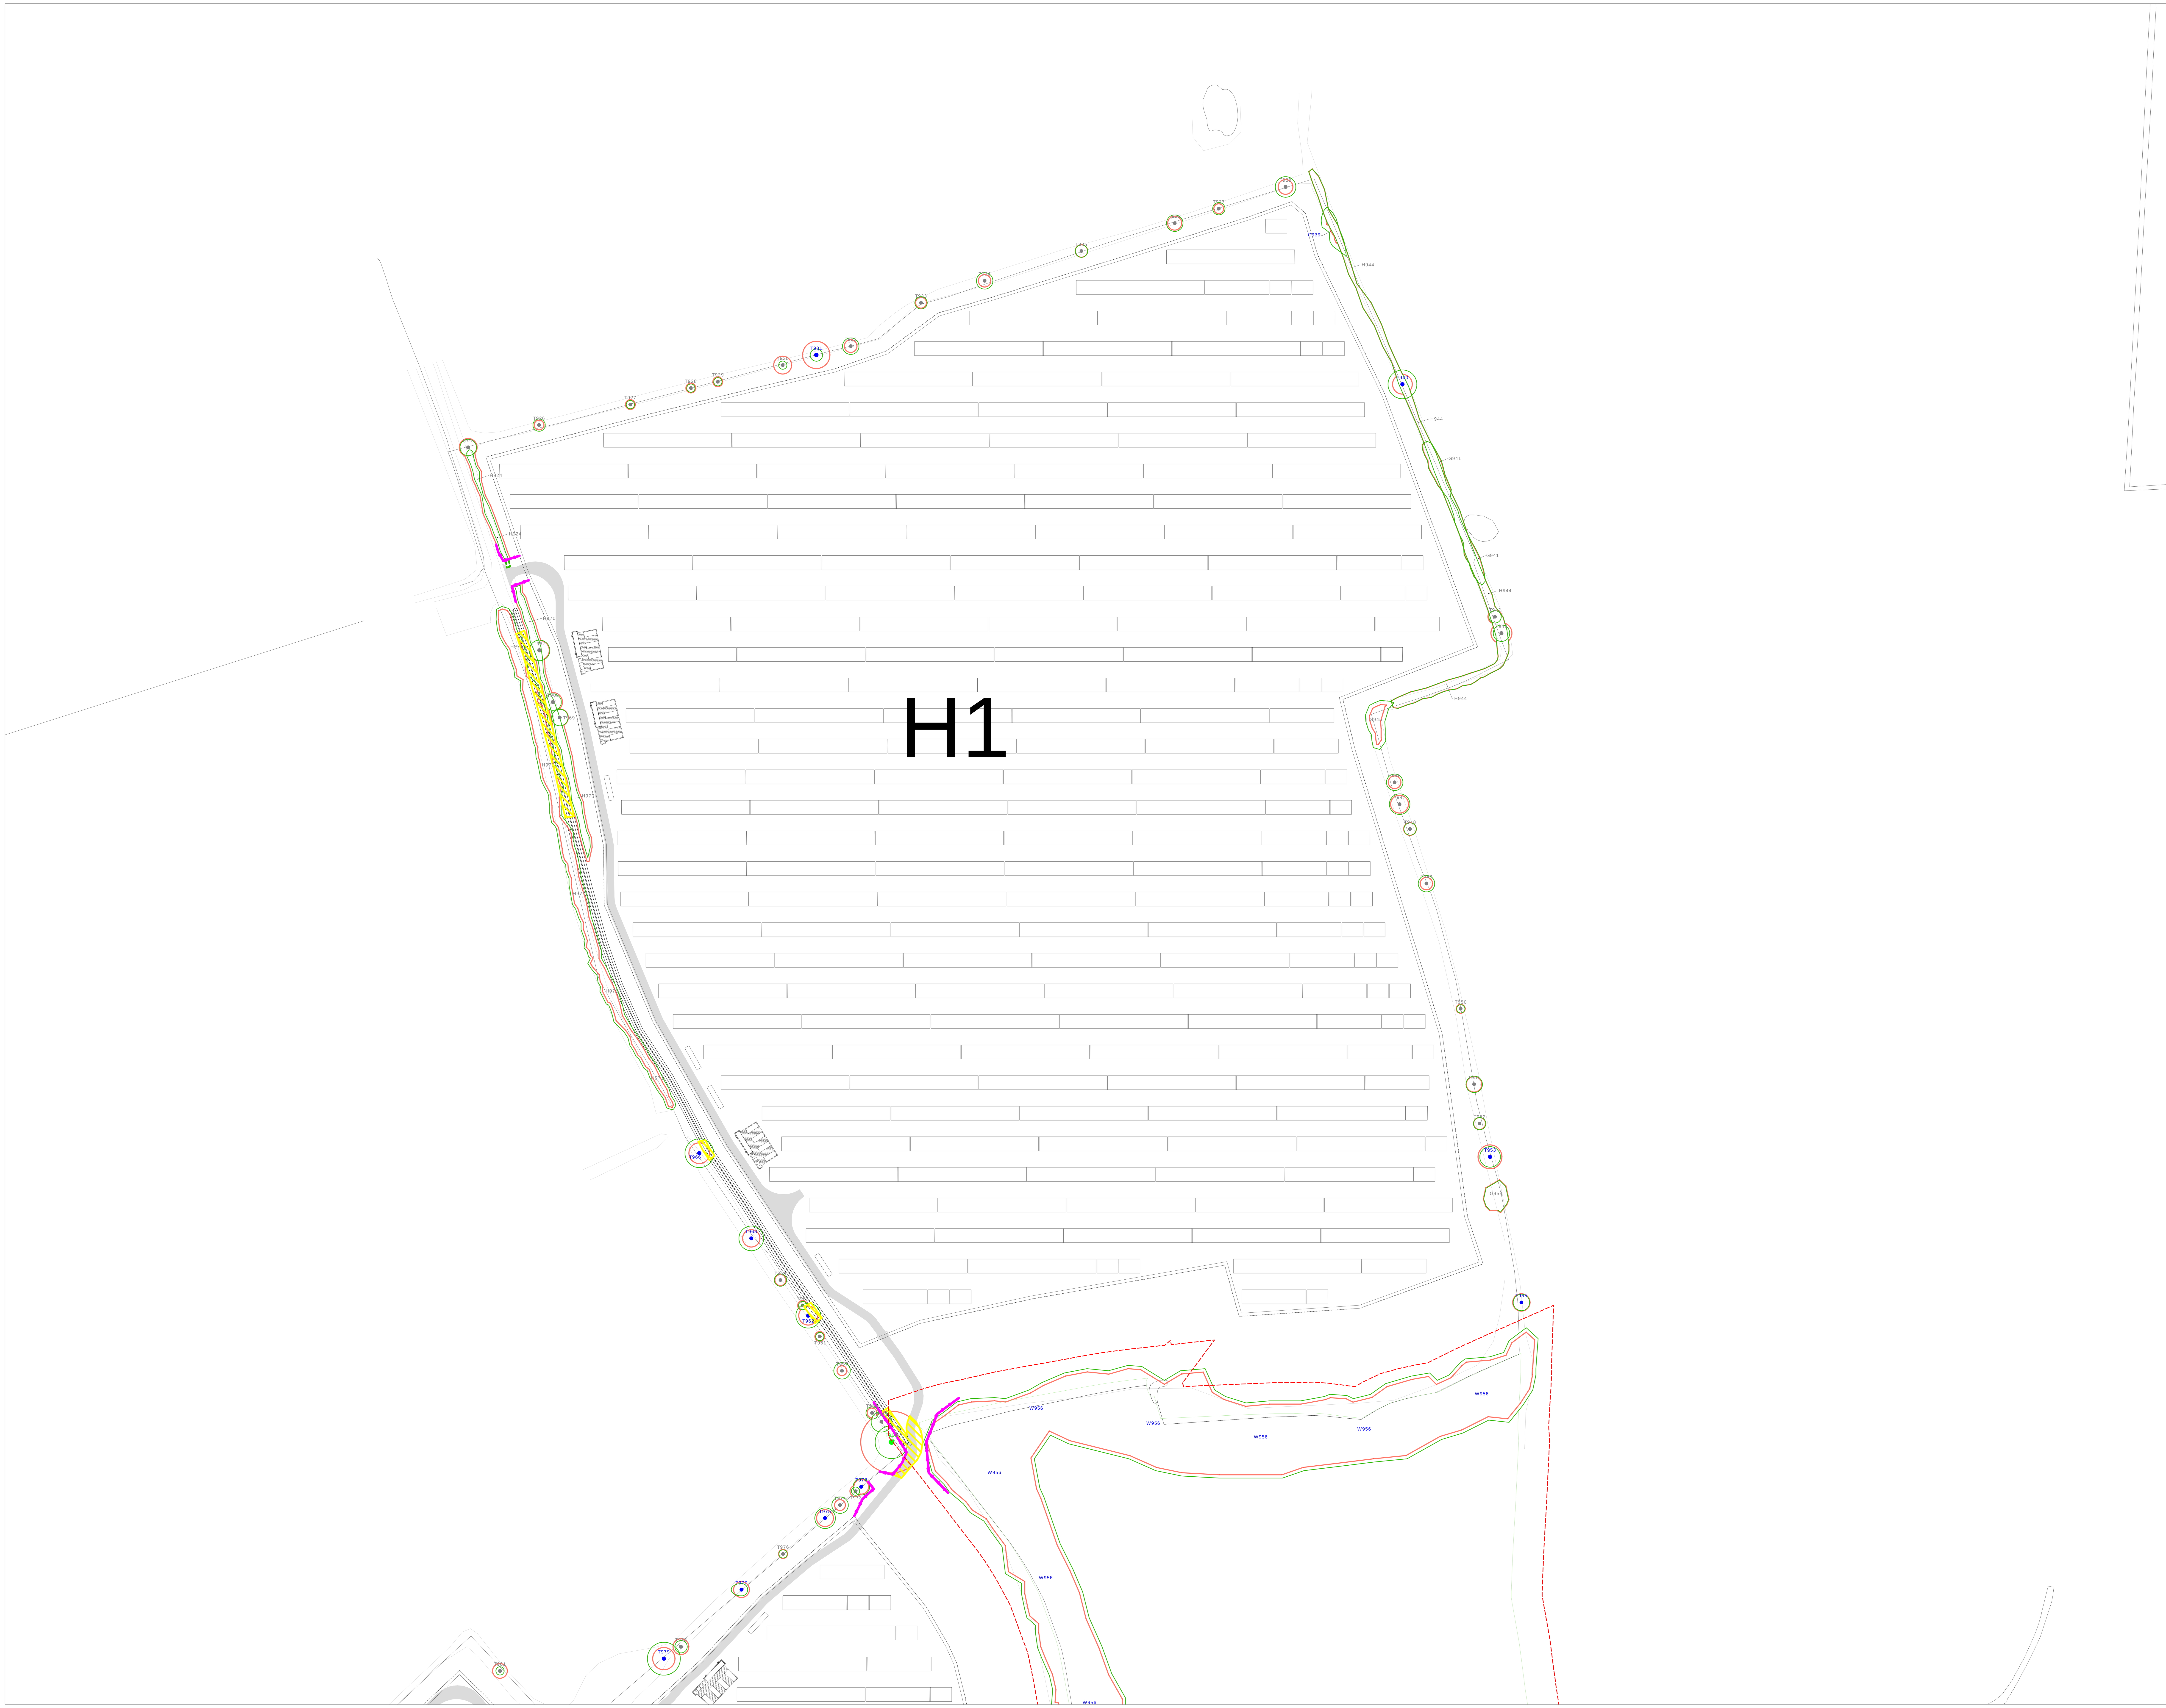

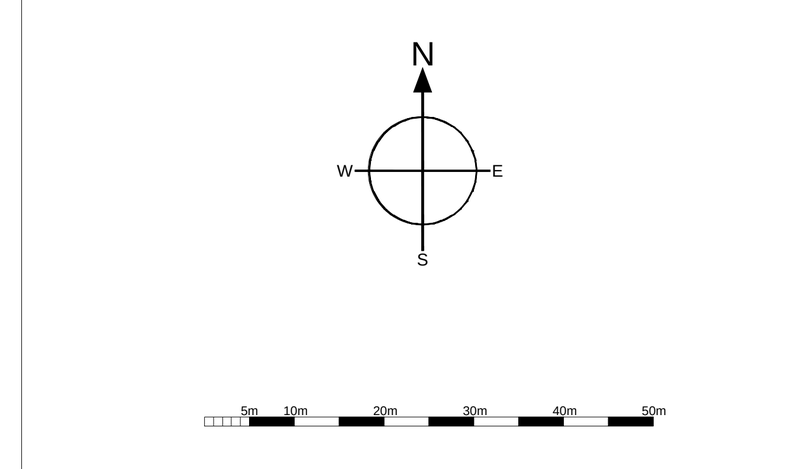



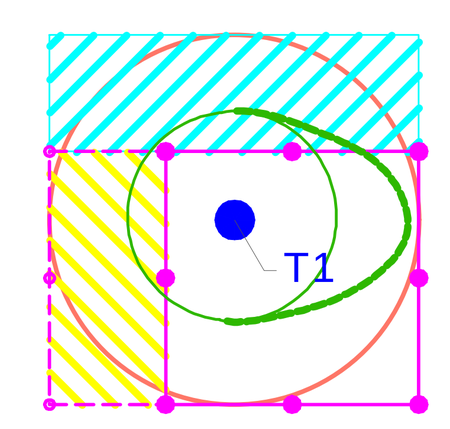

T1 Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Protection Plan


Drawing Number: 250225-1.0-HGS-TPP-NC


Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

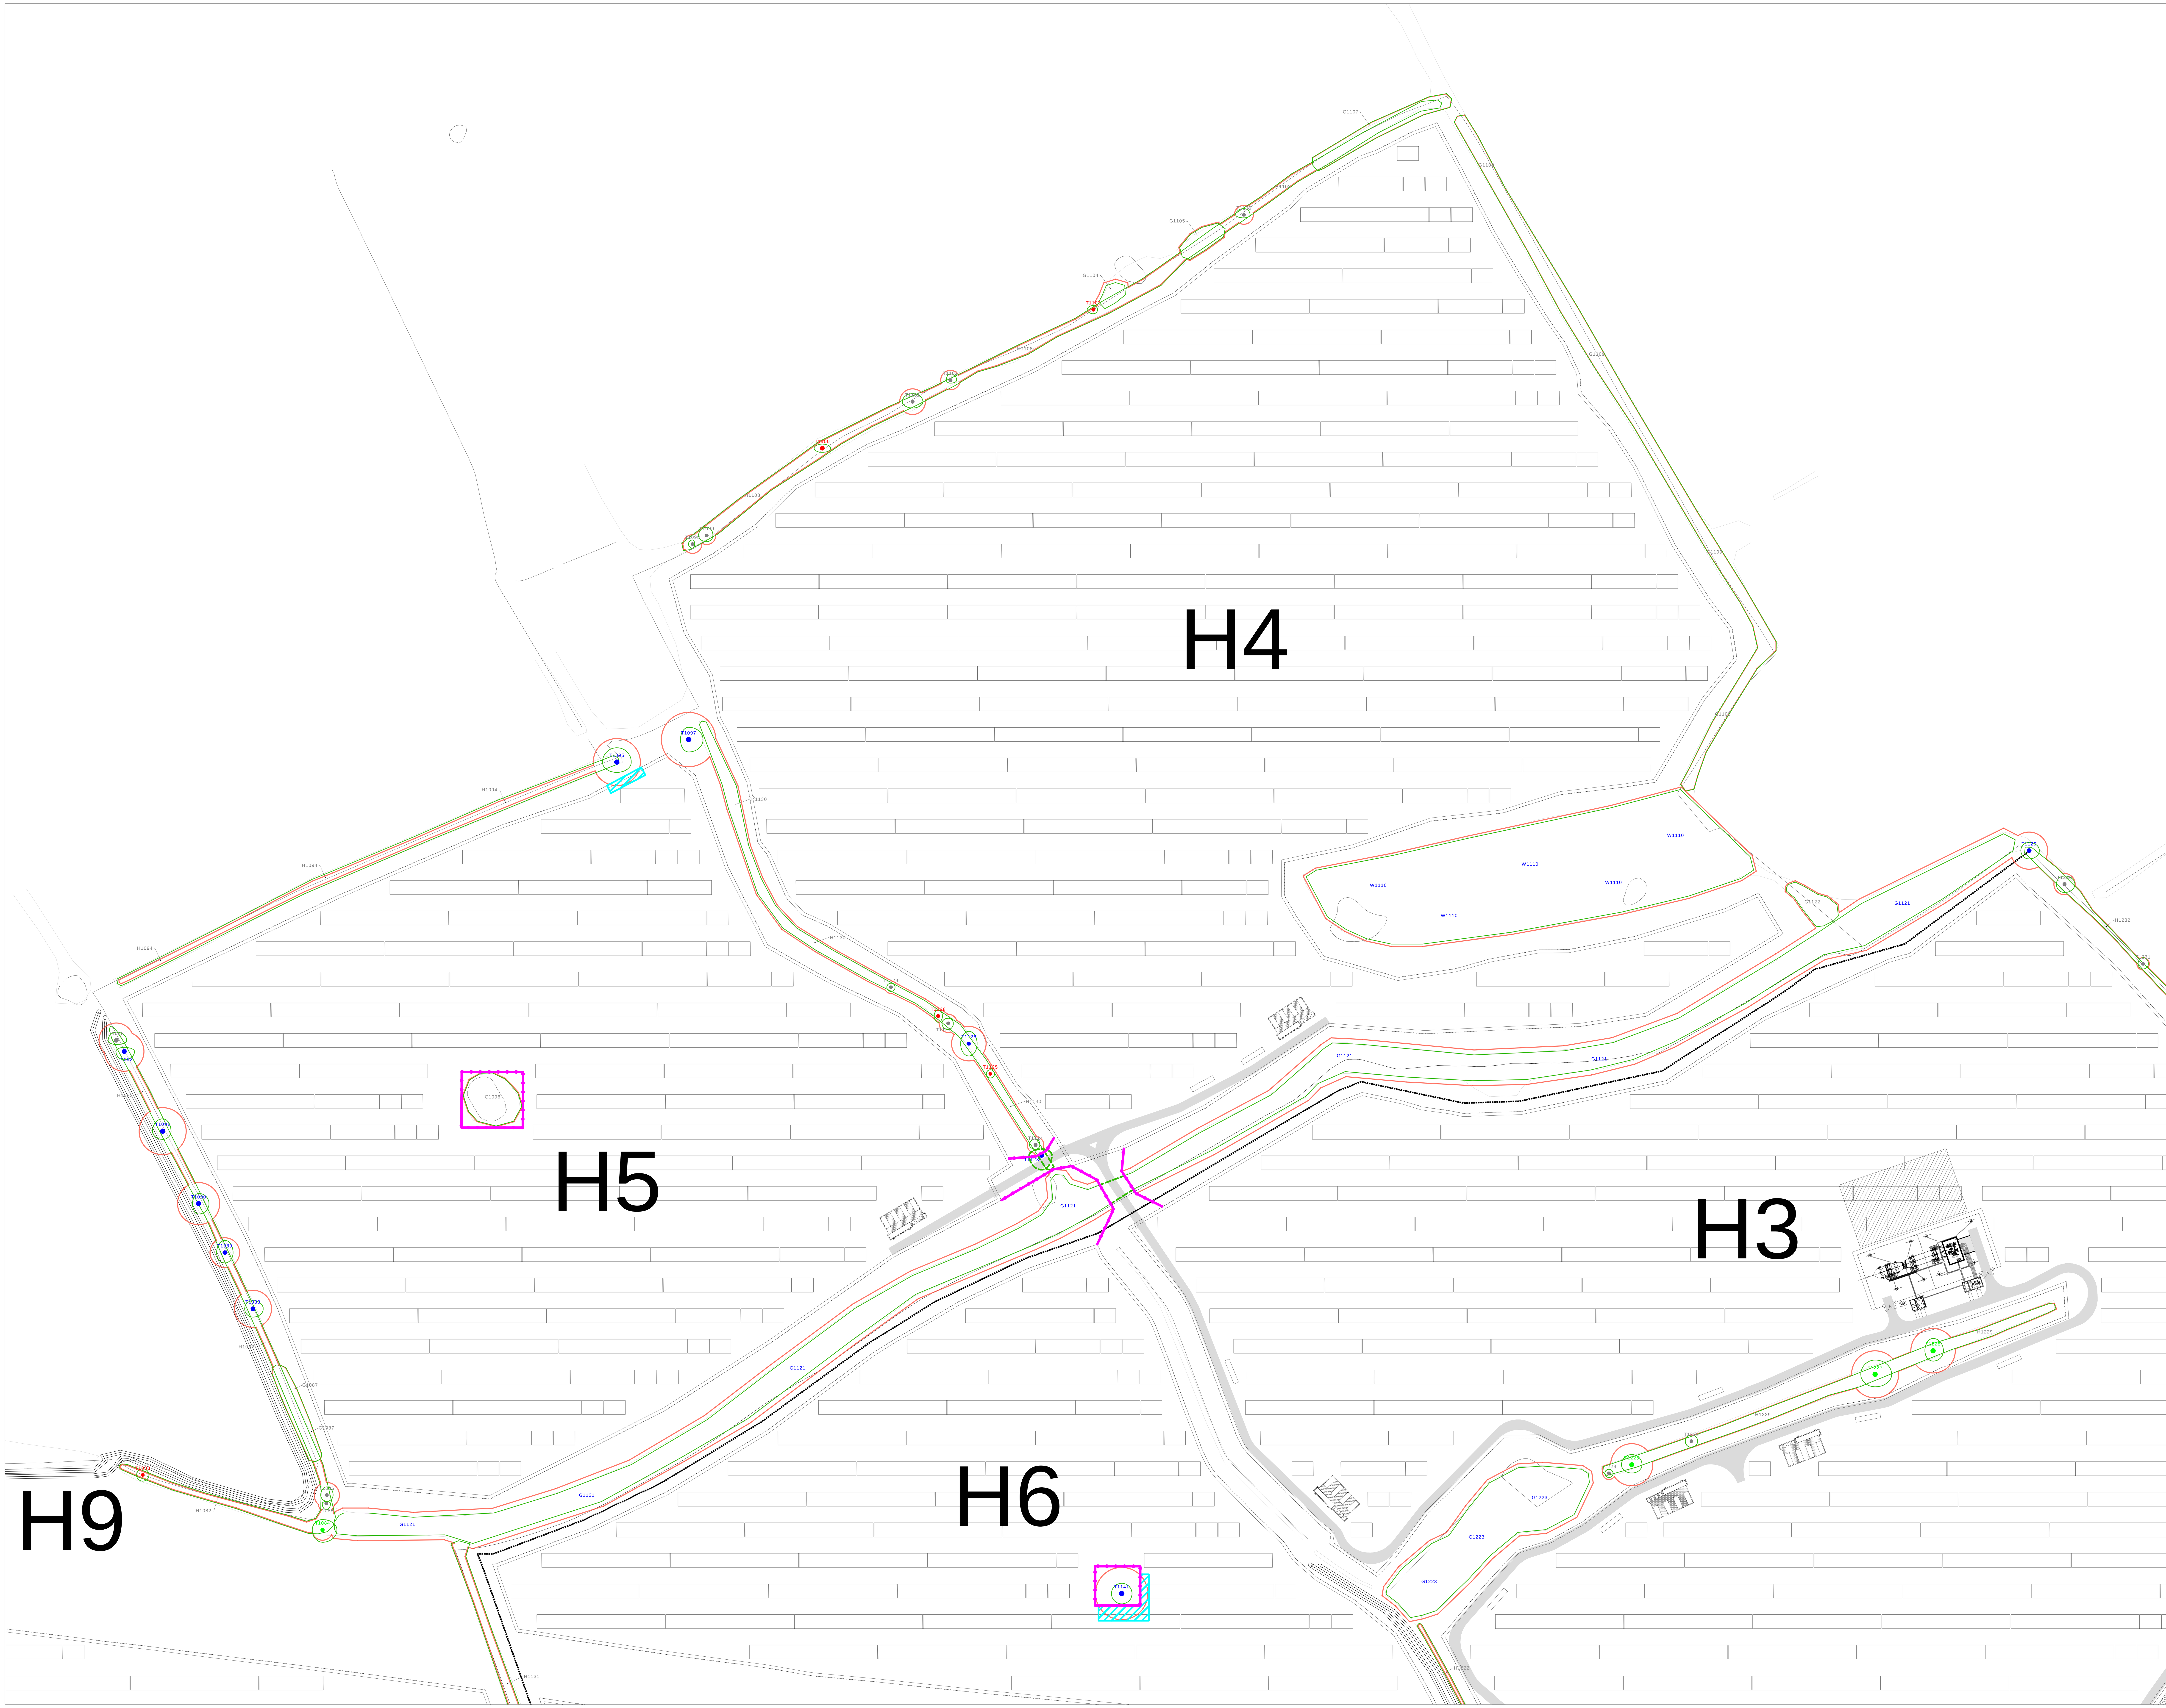

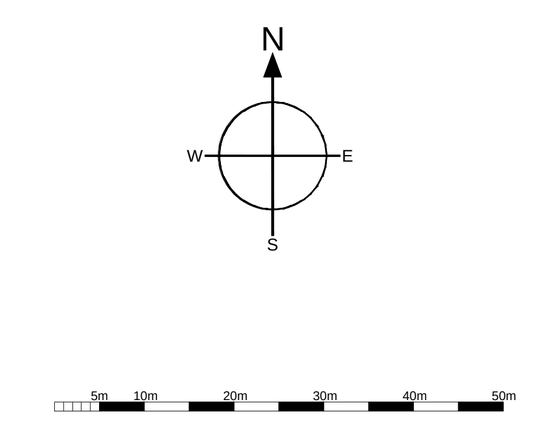

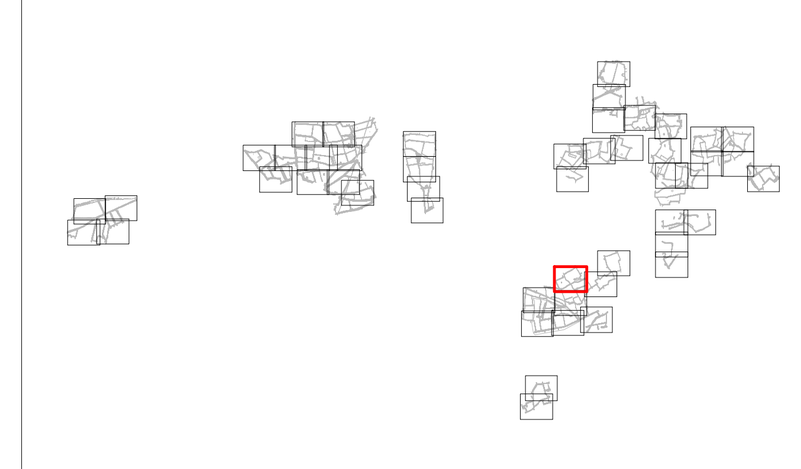

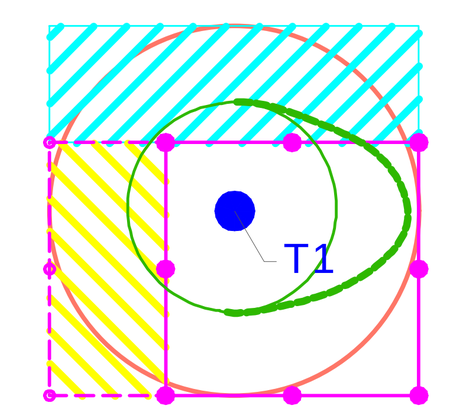

T1 Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



T1

T1 Tree or Group Reference Number	Tree Protection Fencing
Tree Stem Position A Category Tree	Initial Tree Protection Fencing
Tree Stem Position B Category Tree	Ground Protection
Tree Stem Position C Category Tree	Special Engineering /Supervised Excavations
Tree Stem Position U Category Tree	Construction Exclusion Zone
Tree Crown	Pruning/Tree Removal
Root Protection Area	Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Topographical Survey	Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

H9

H10

H29

H25


H28


H24

H26

H21

H27

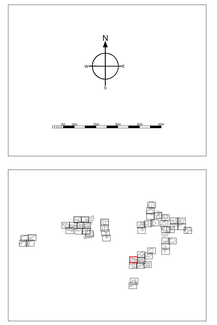

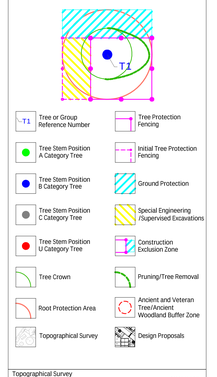

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

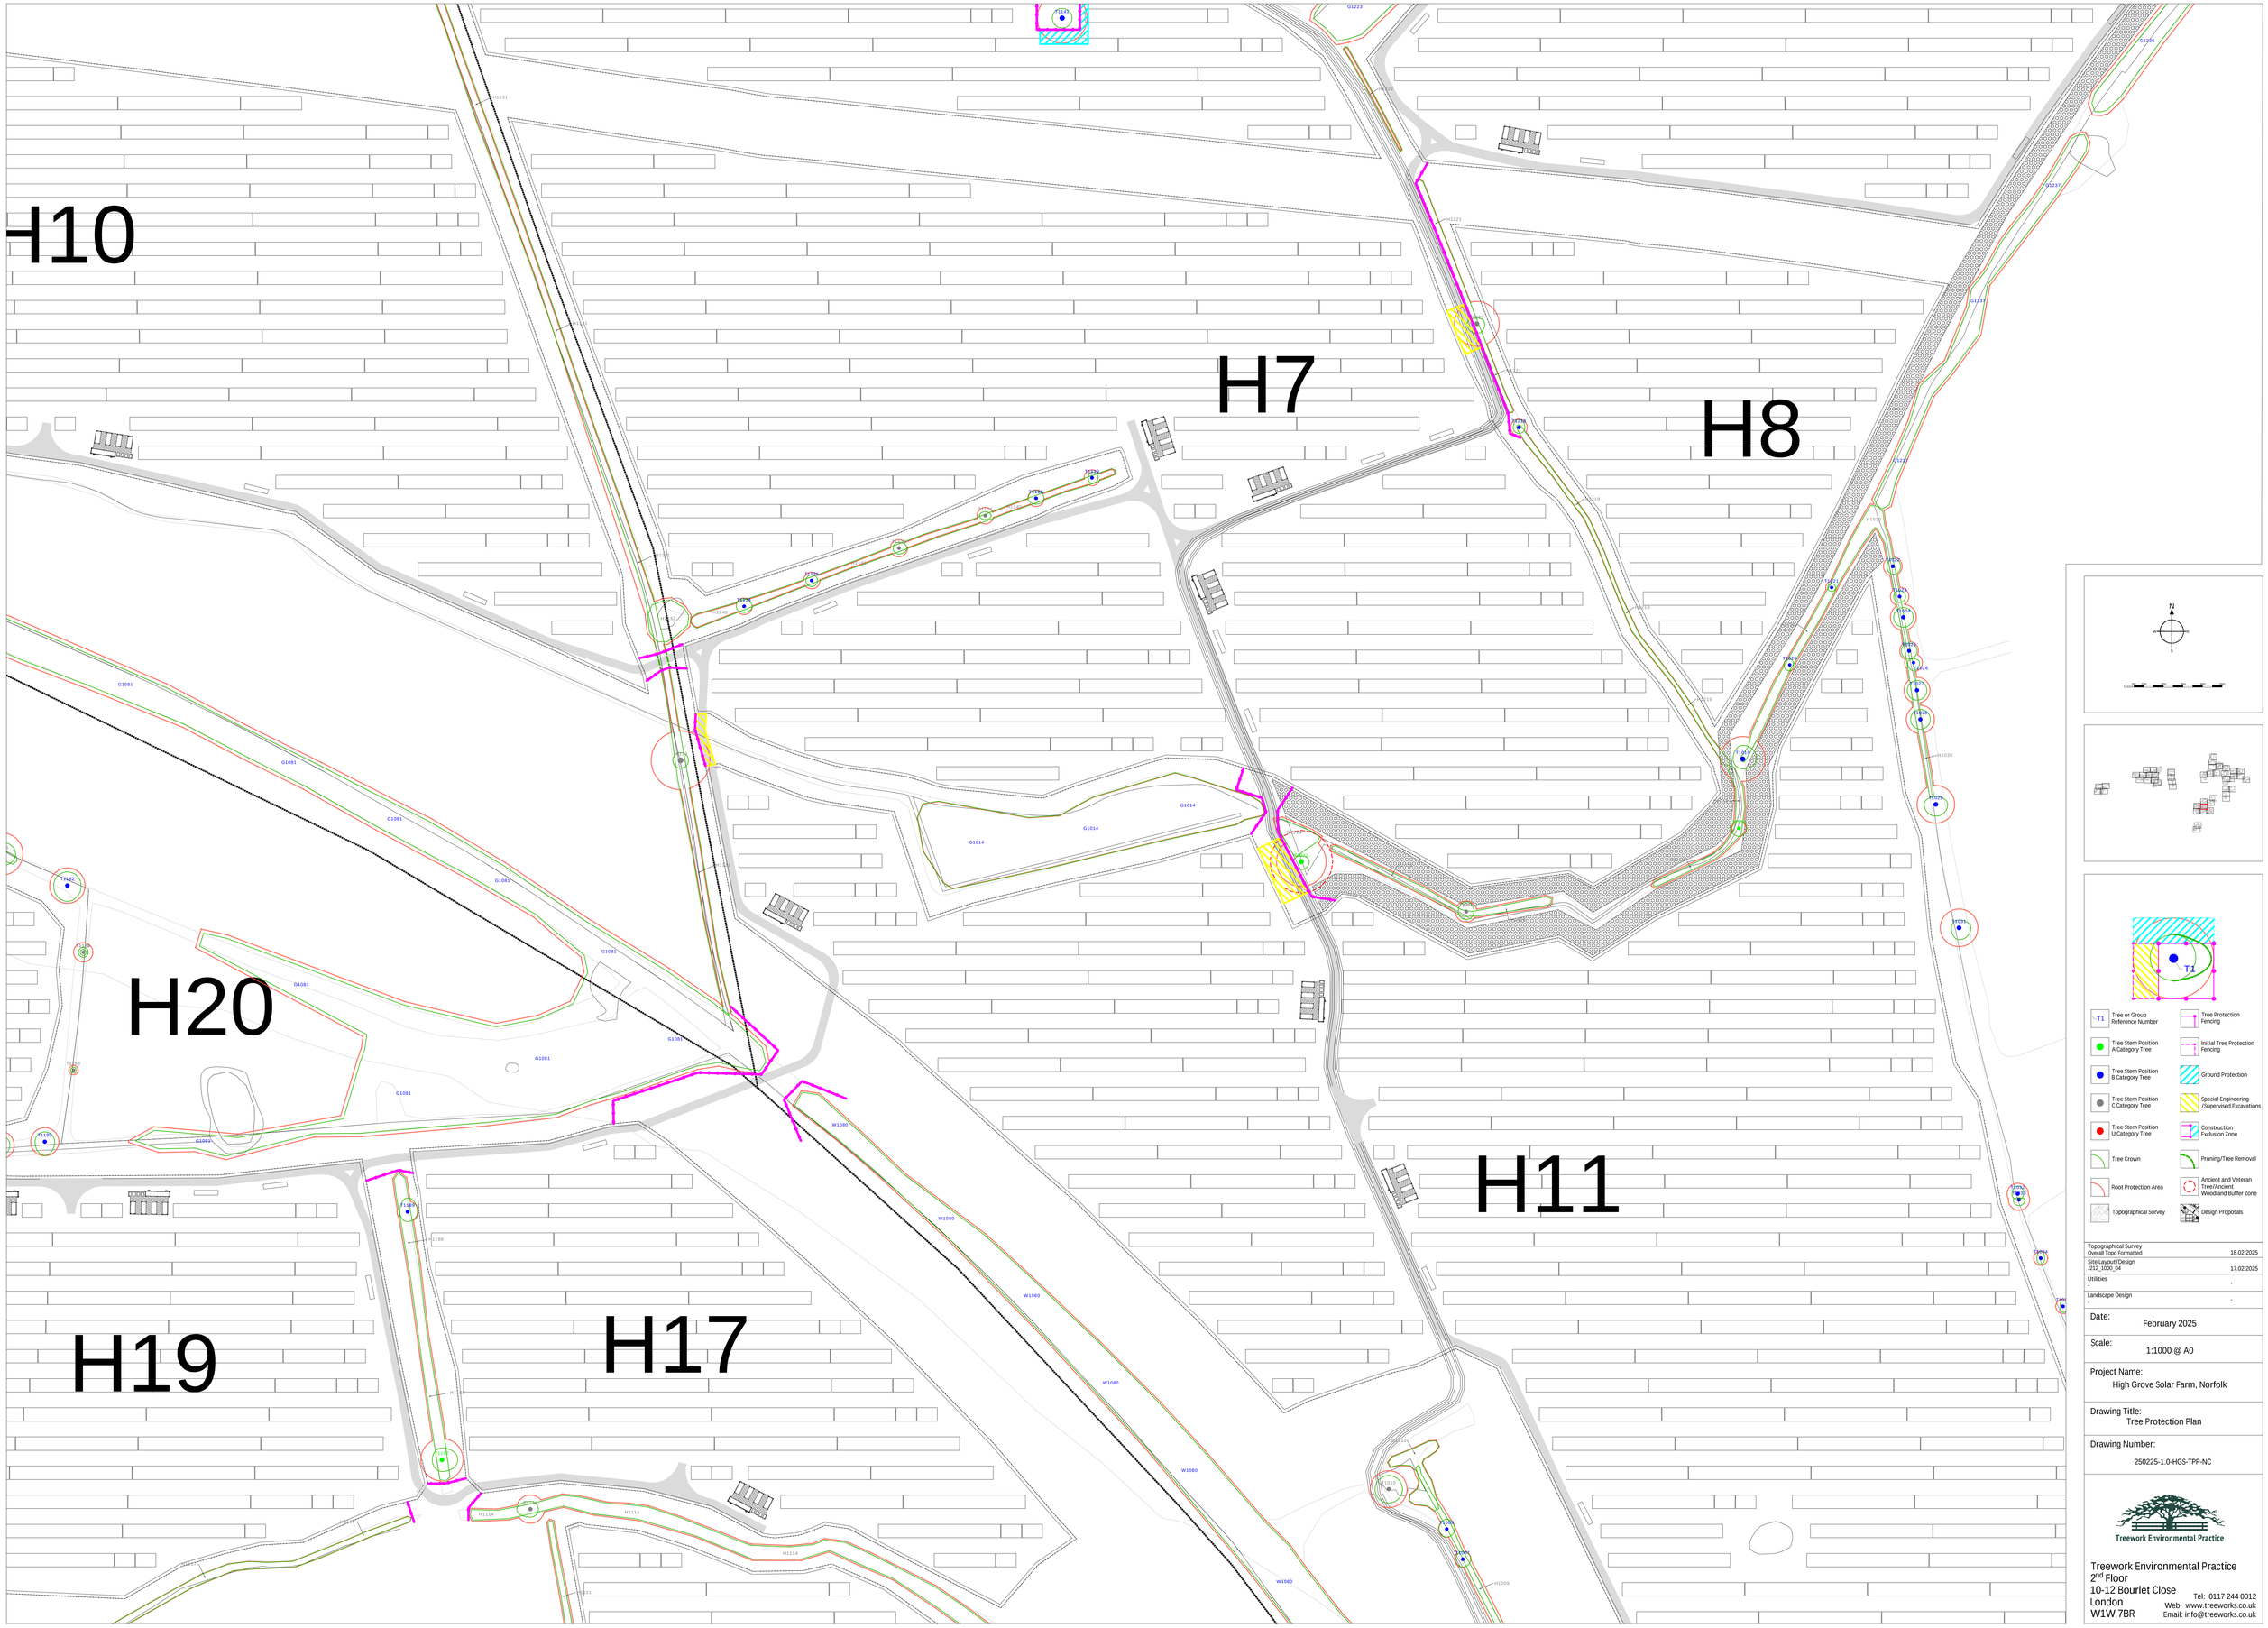

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0


Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

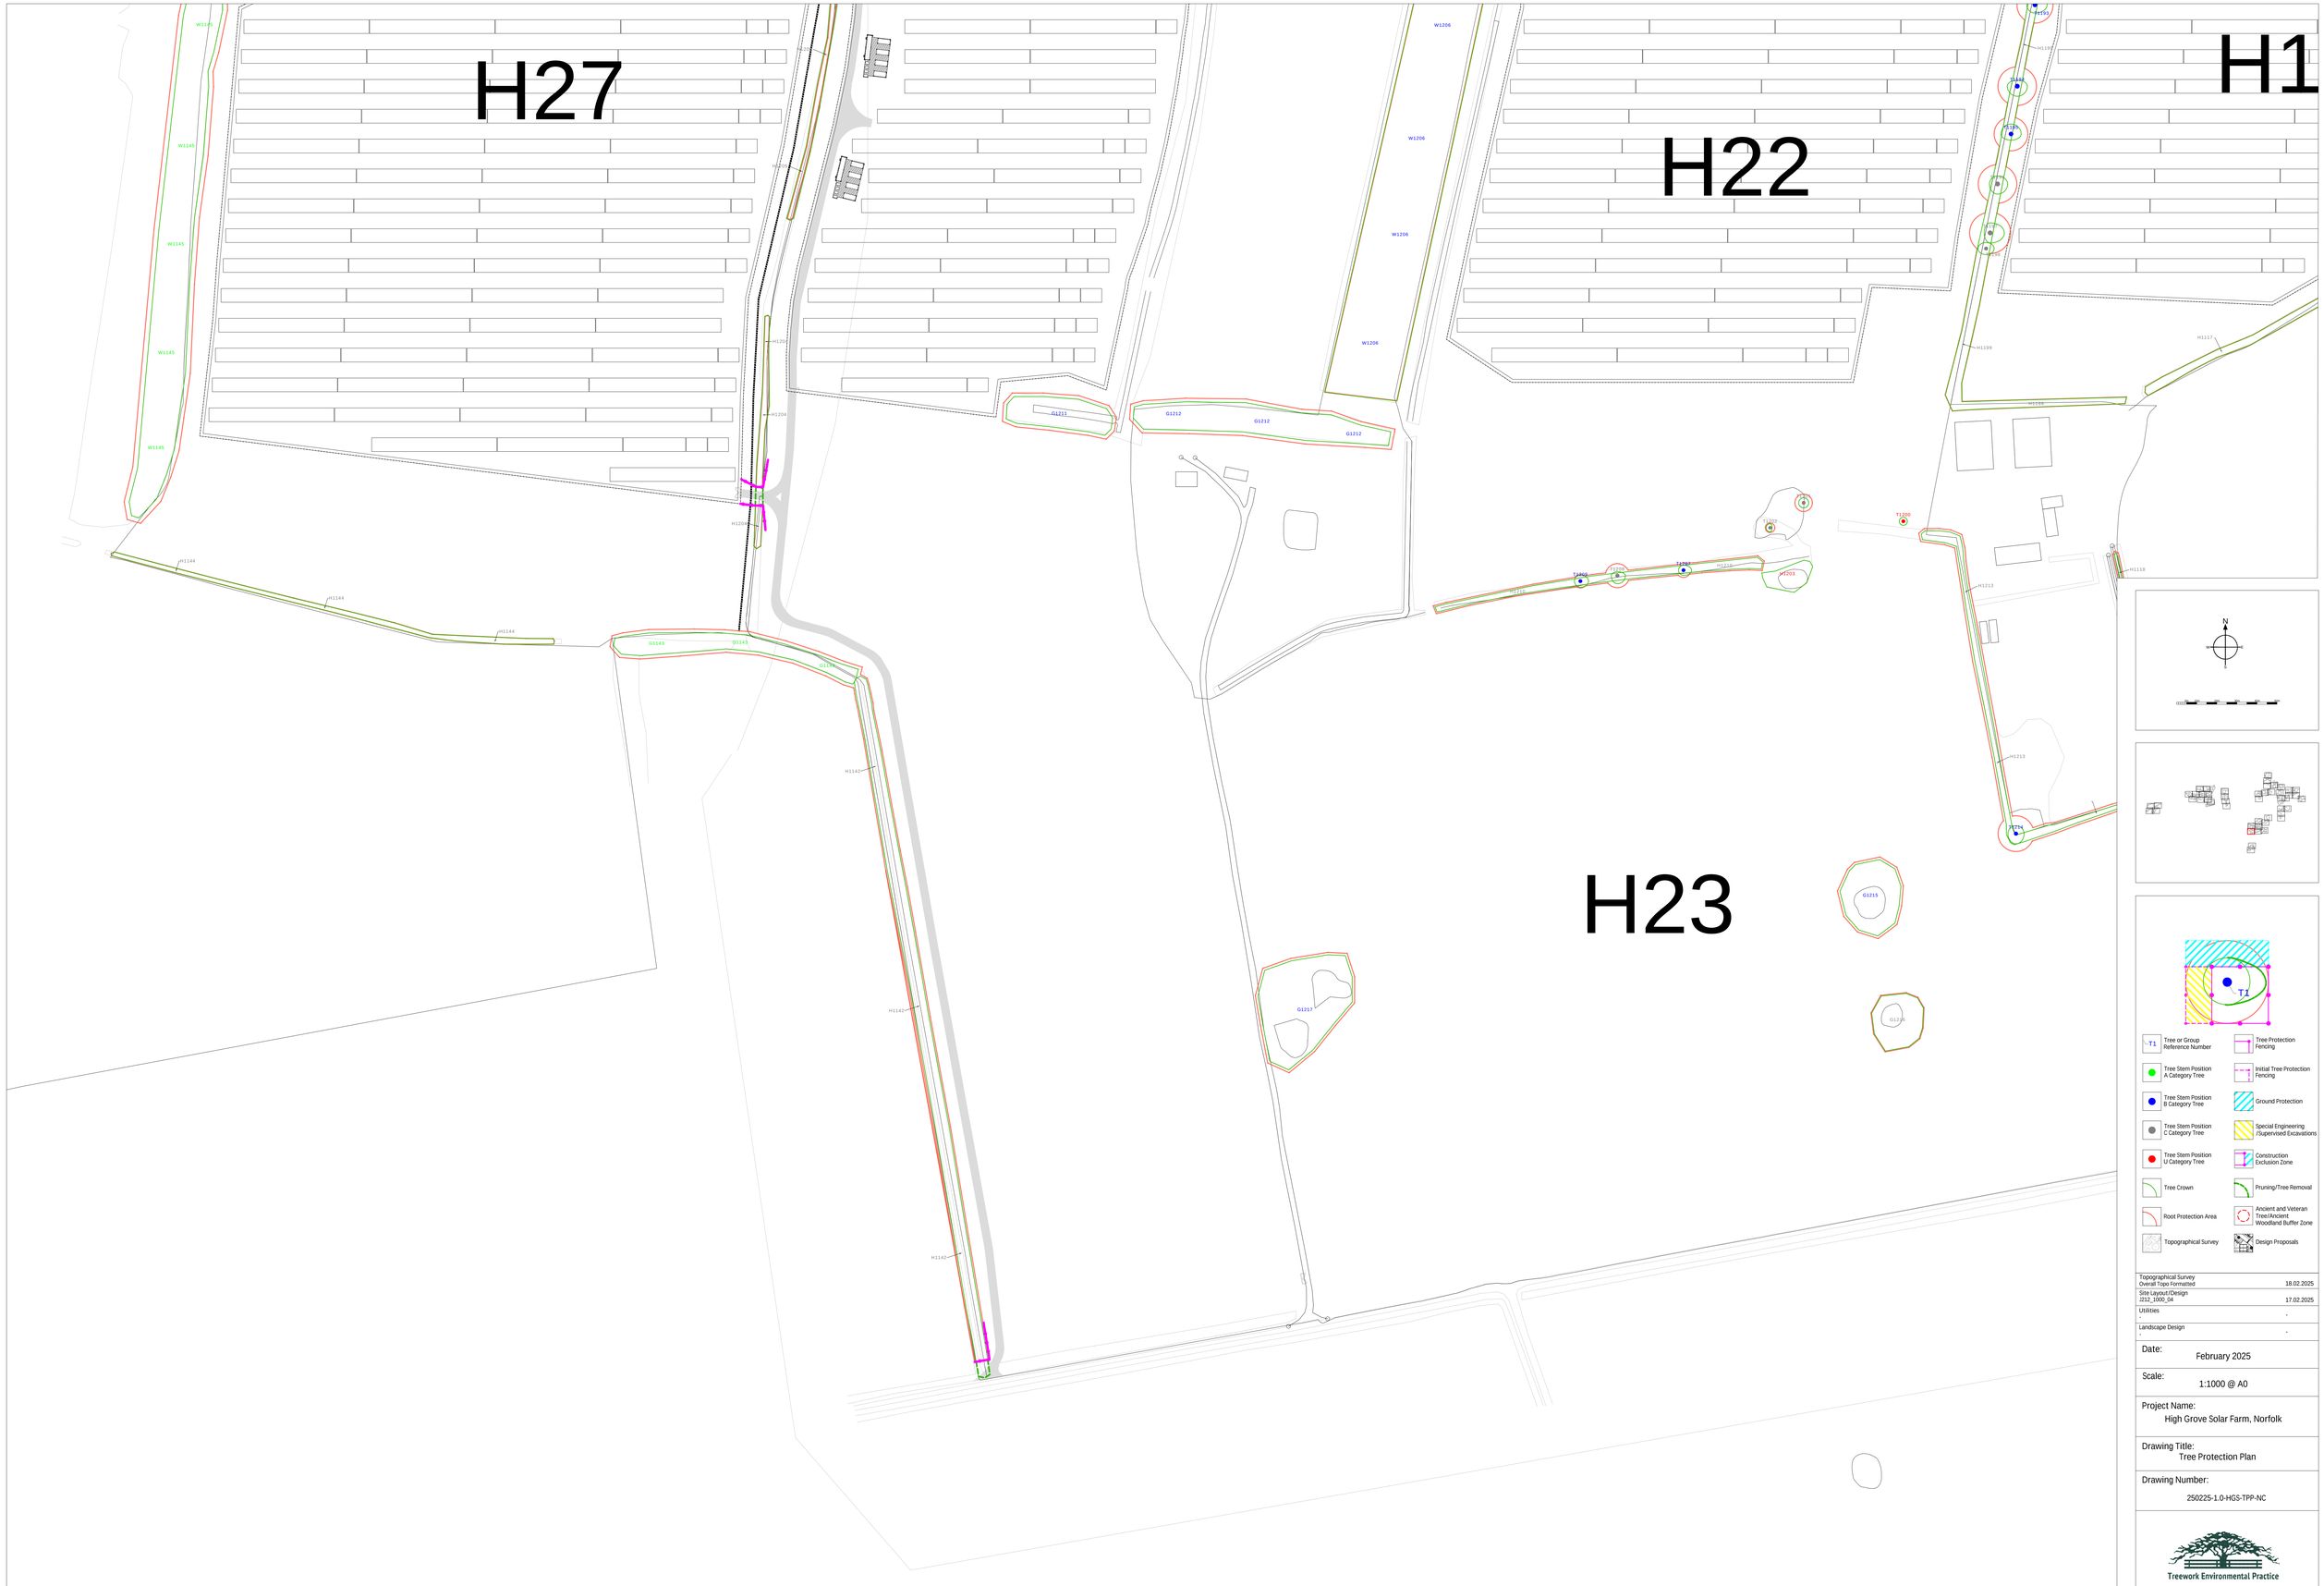

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout//Design JS3_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0


Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Protection Plan

Drawing Number:
250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan

Drawing Number: 250225-1.0-HGS-TPP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

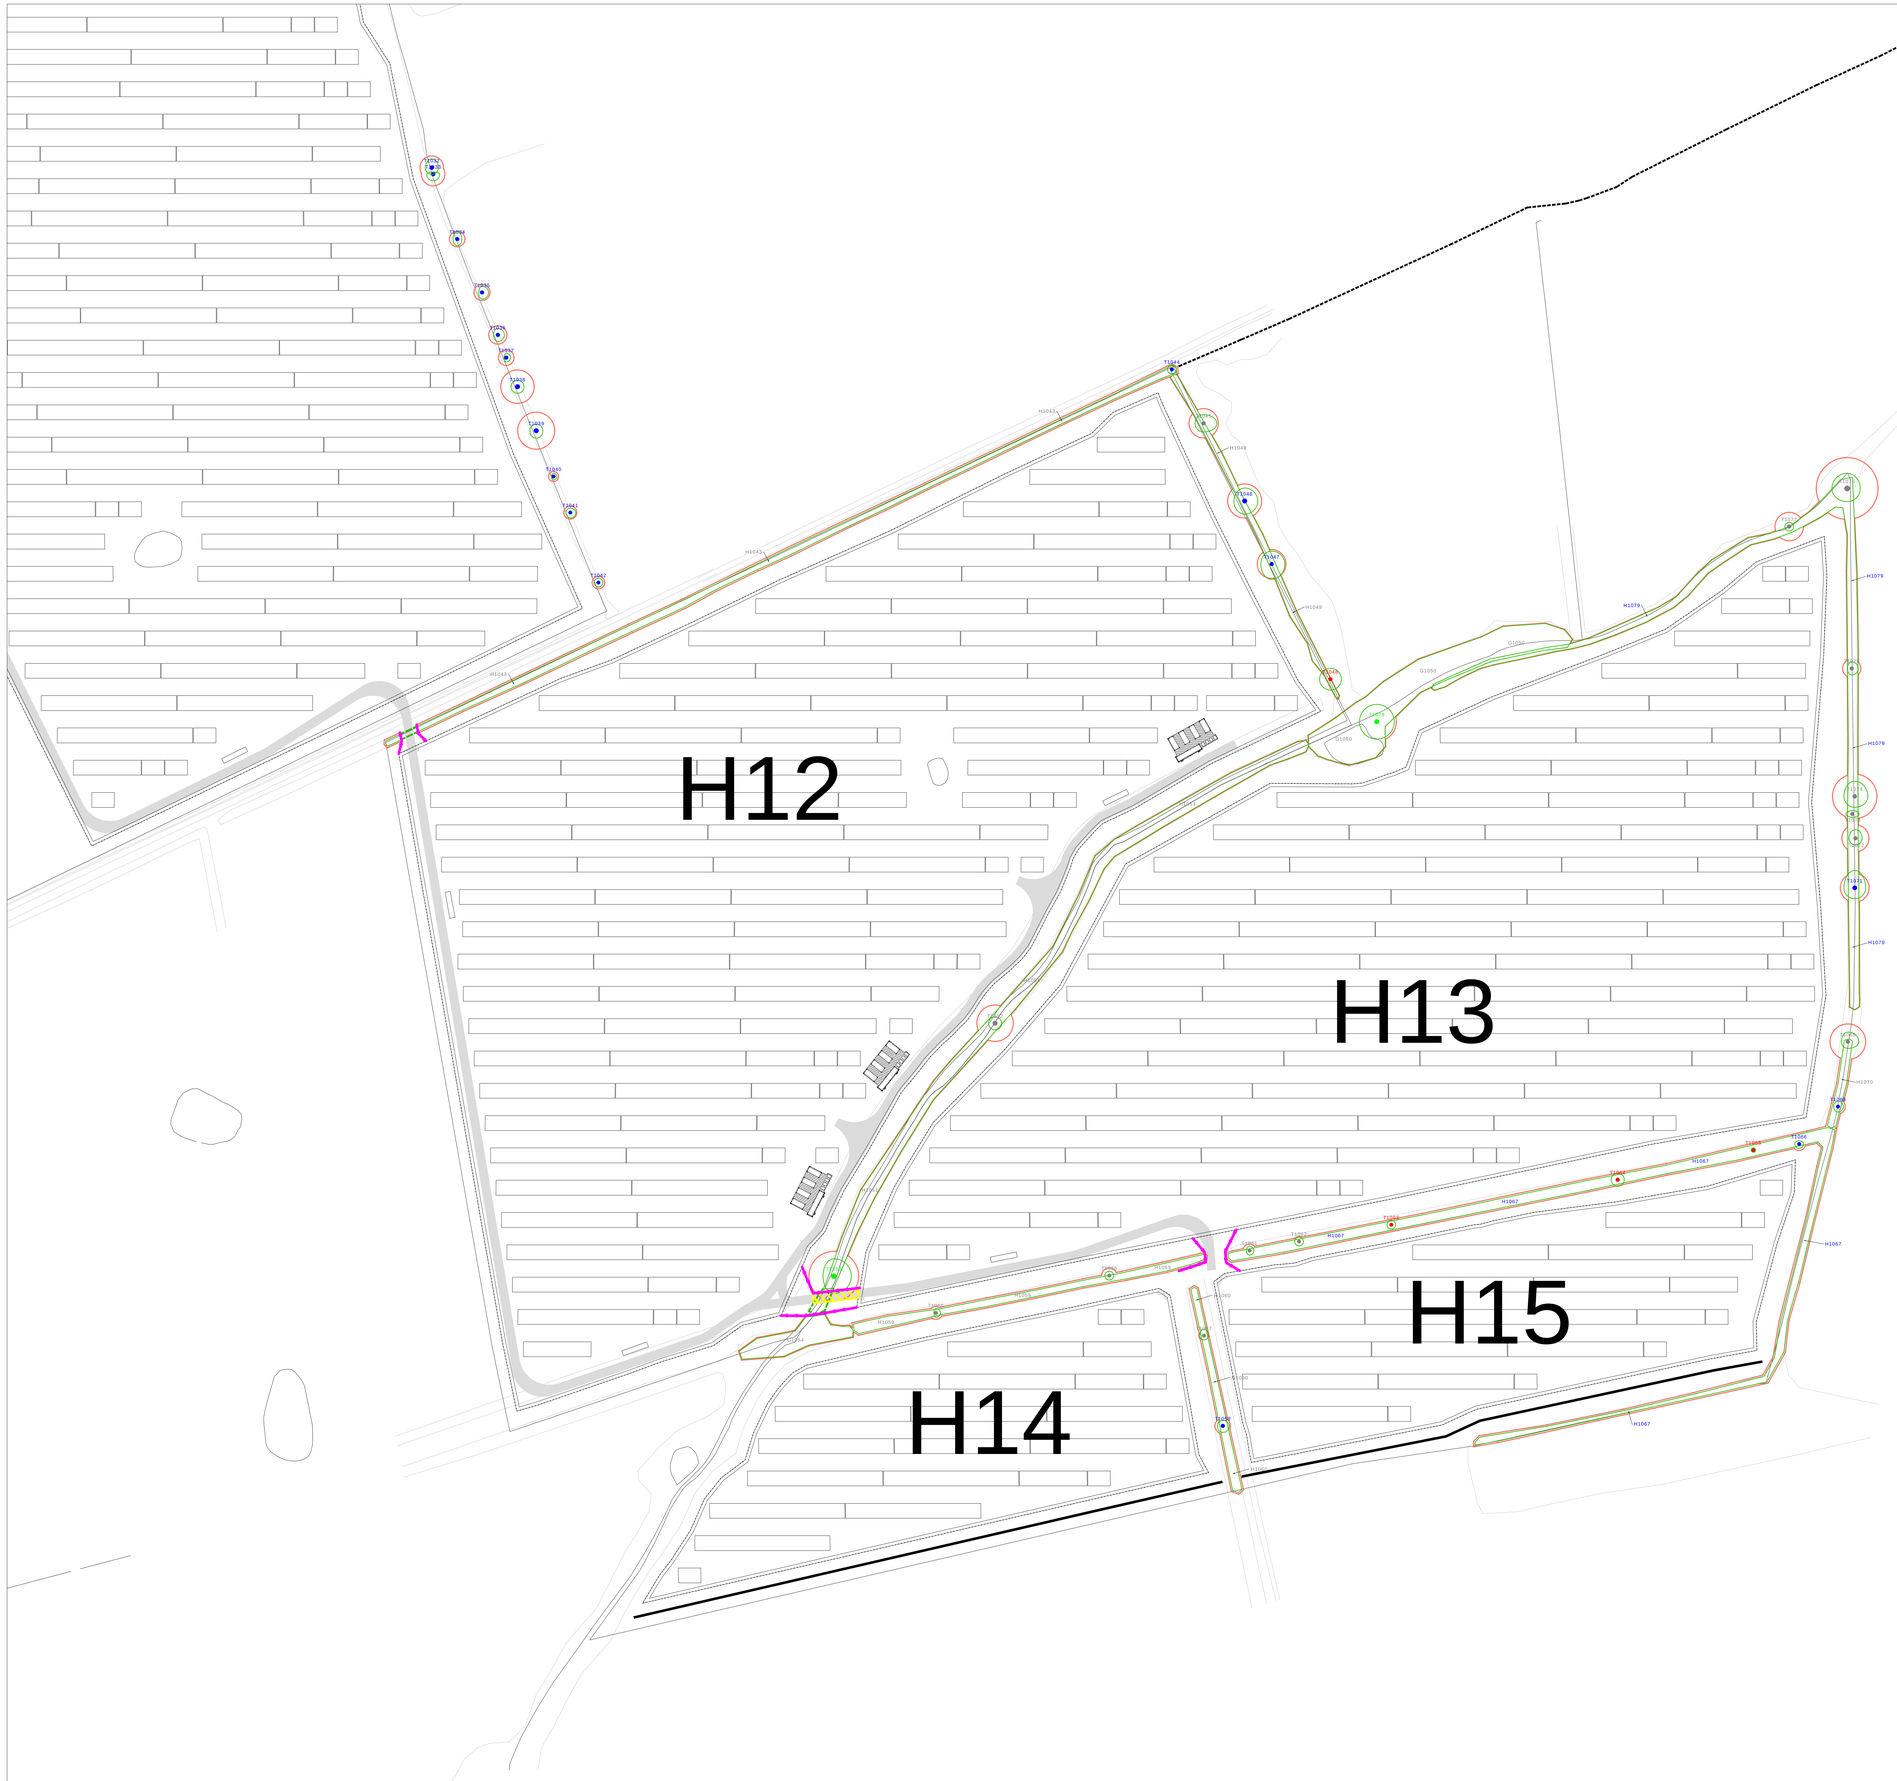

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design 212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk


Drawing Title:
Tree Protection Plan


Drawing Number:
250225-1.0-HGS-TPP-NC


Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

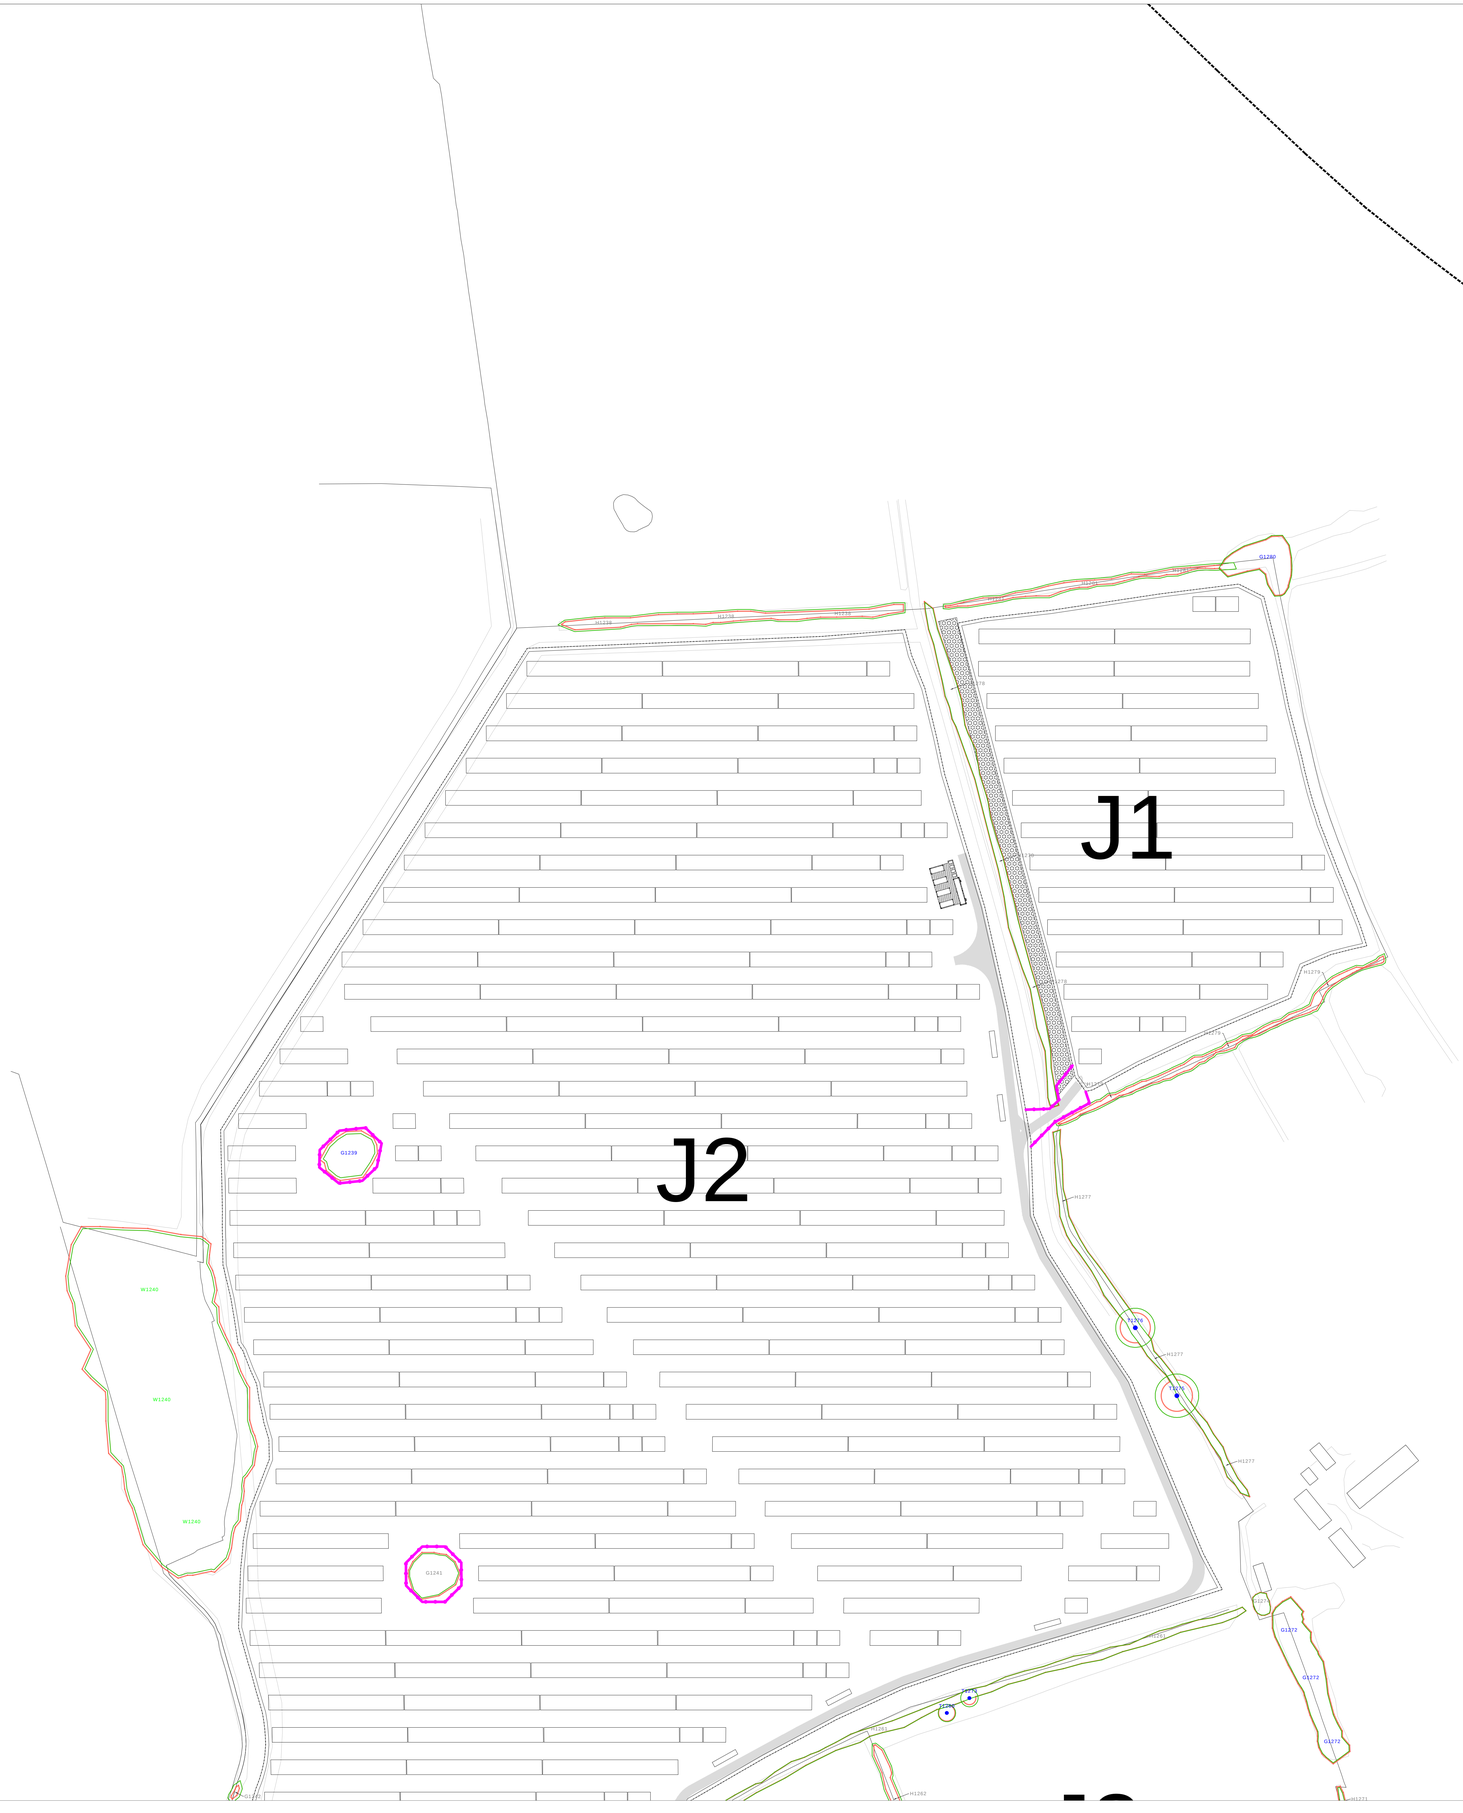

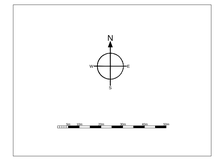

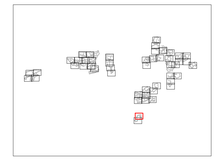



T1 Tree or Group Reference Number

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Tree Crown

Root Protection Area

Topographical Survey

Tree Protection Fencing

Initial Tree Protection Fencing

Ground Protection

Special Engineering /Supervised Excavations

Construction Exclusion Zone

Pruning/Tree Removal

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk


Drawing Title:
Tree Protection Plan


Drawing Number:
250225-1.0-HGS-TPP-NC


Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

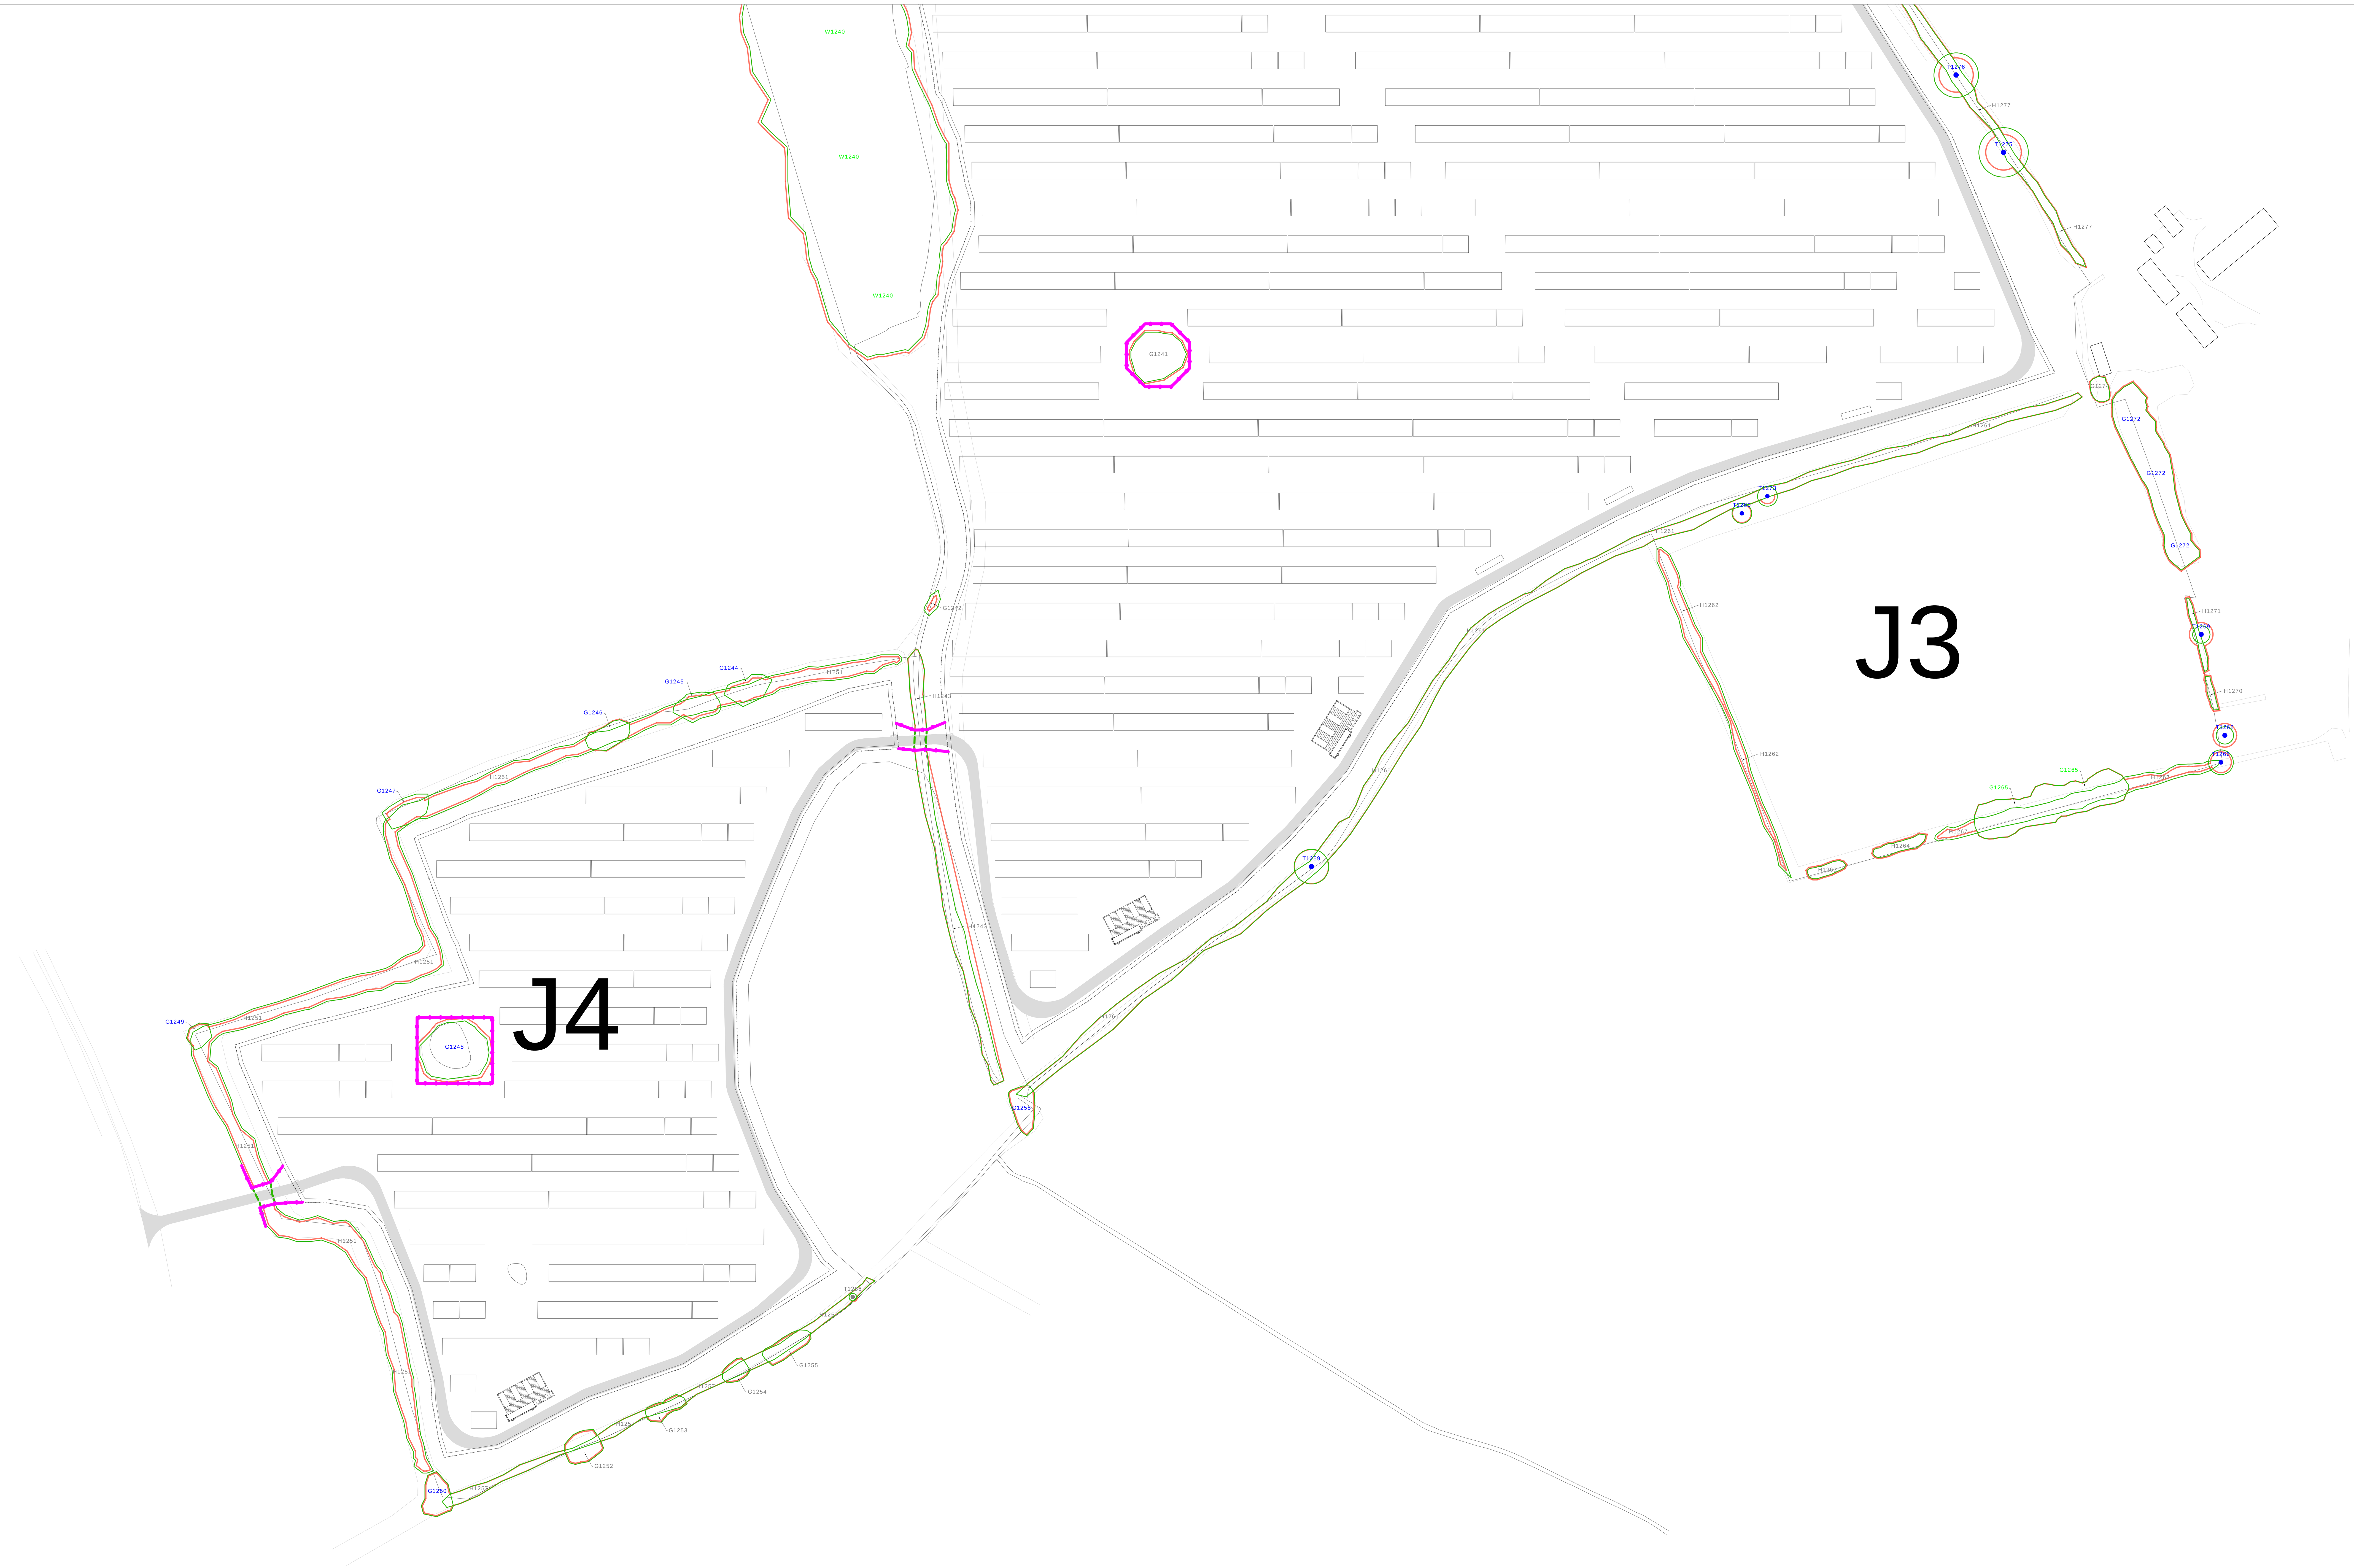

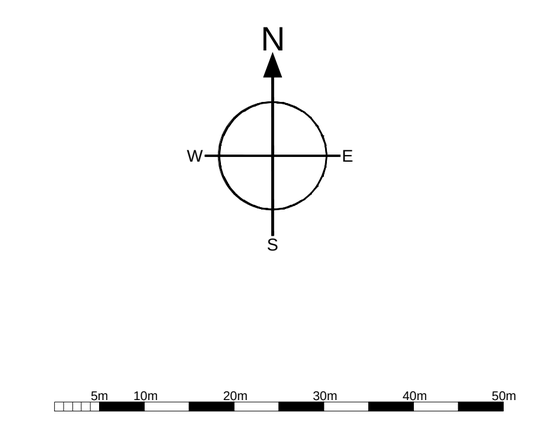

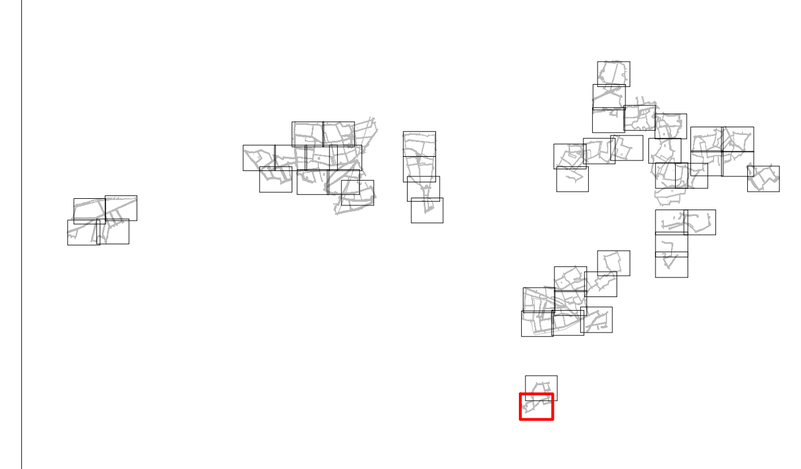

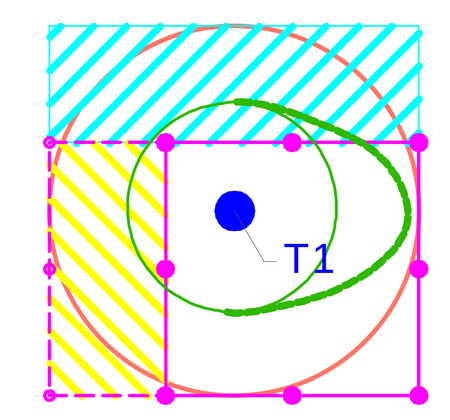

T1	Tree or Group Reference Number		Tree Protection Fencing
	Tree Stem Position A Category Tree		Initial Tree Protection Fencing
	Tree Stem Position B Category Tree		Ground Protection
	Tree Stem Position C Category Tree		Special Engineering /Supervised Excavations
	Tree Stem Position U Category Tree		Construction Exclusion Zone
	Tree Crown		Pruning/Tree Removal
	Root Protection Area		Ancient and Veteran Tree/Ancient Woodland Buffer Zone
	Topographical Survey		Design Proposals

Topographical Survey Overall Topo Formatted	18.02.2025
Site Layout/Design J212_1000_04	17.02.2025
Utilities -	-
Landscape Design -	-

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Protection Plan


Drawing Number: 250225-1.0-HGS-TPP-NC


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk


Appendix B

Tree Constraints Plan



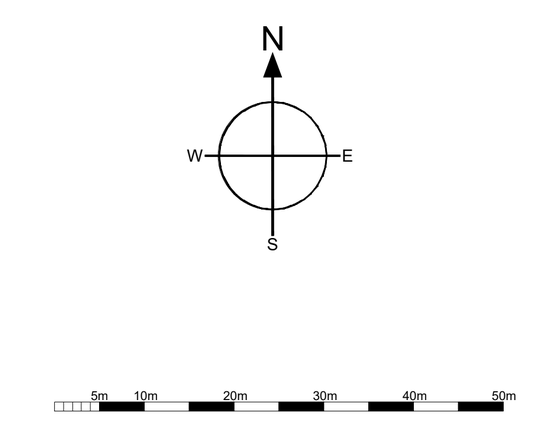

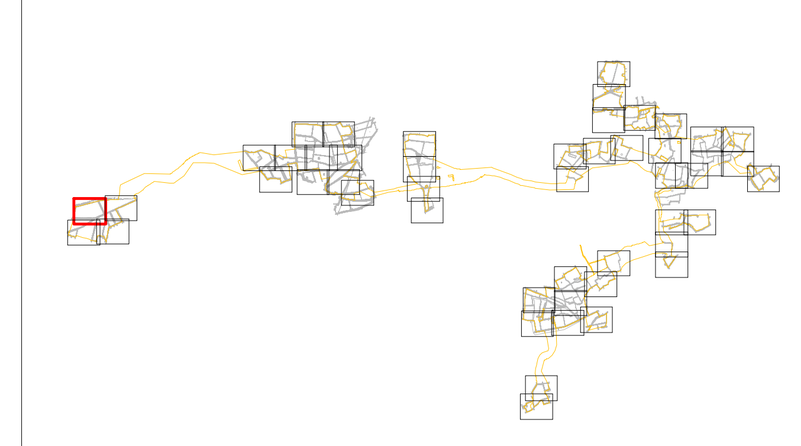

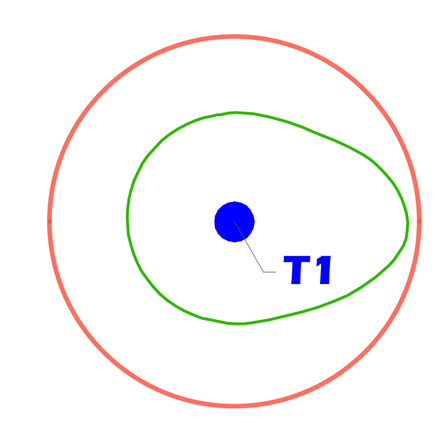

T1 Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC


Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



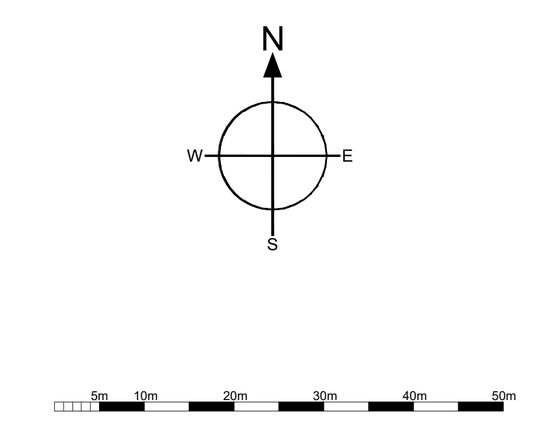

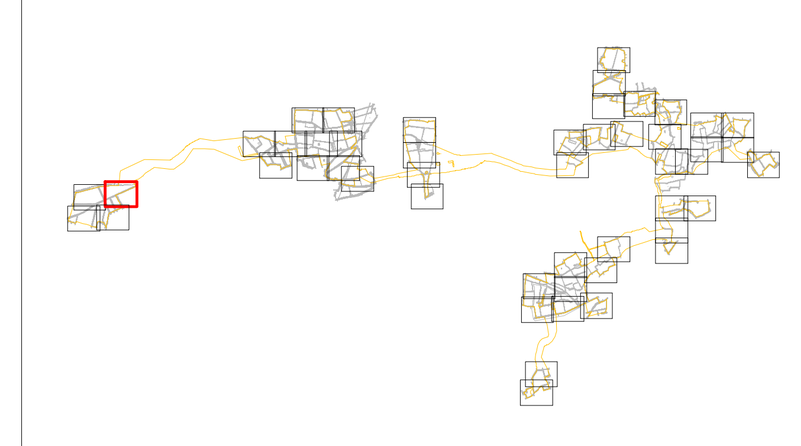

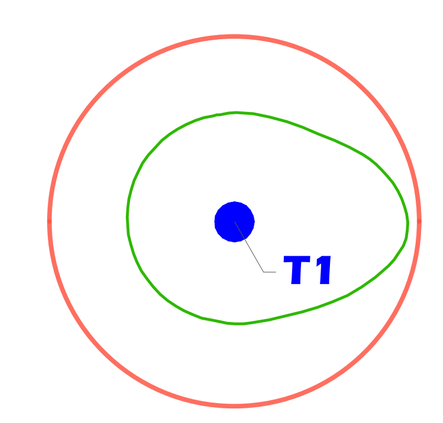

T1	Tree or Group Reference Number		Tree Stem Position A Category Tree
	Tree Crown		Tree Stem Position B Category Tree
	Root Protection Area		Tree Stem Position C Category Tree
	Tree Survey Boundary		Tree Stem Position U Category Tree
	Ancient and Veteran Tree/Ancient Woodland Buffer Zone		

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC


Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



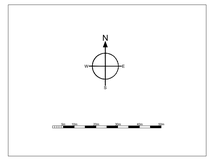

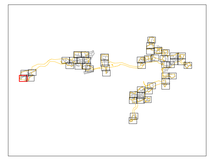



T1 Tree or Group Reference Number

Tree Crown

Root Protection Area

Tree Survey Boundary

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

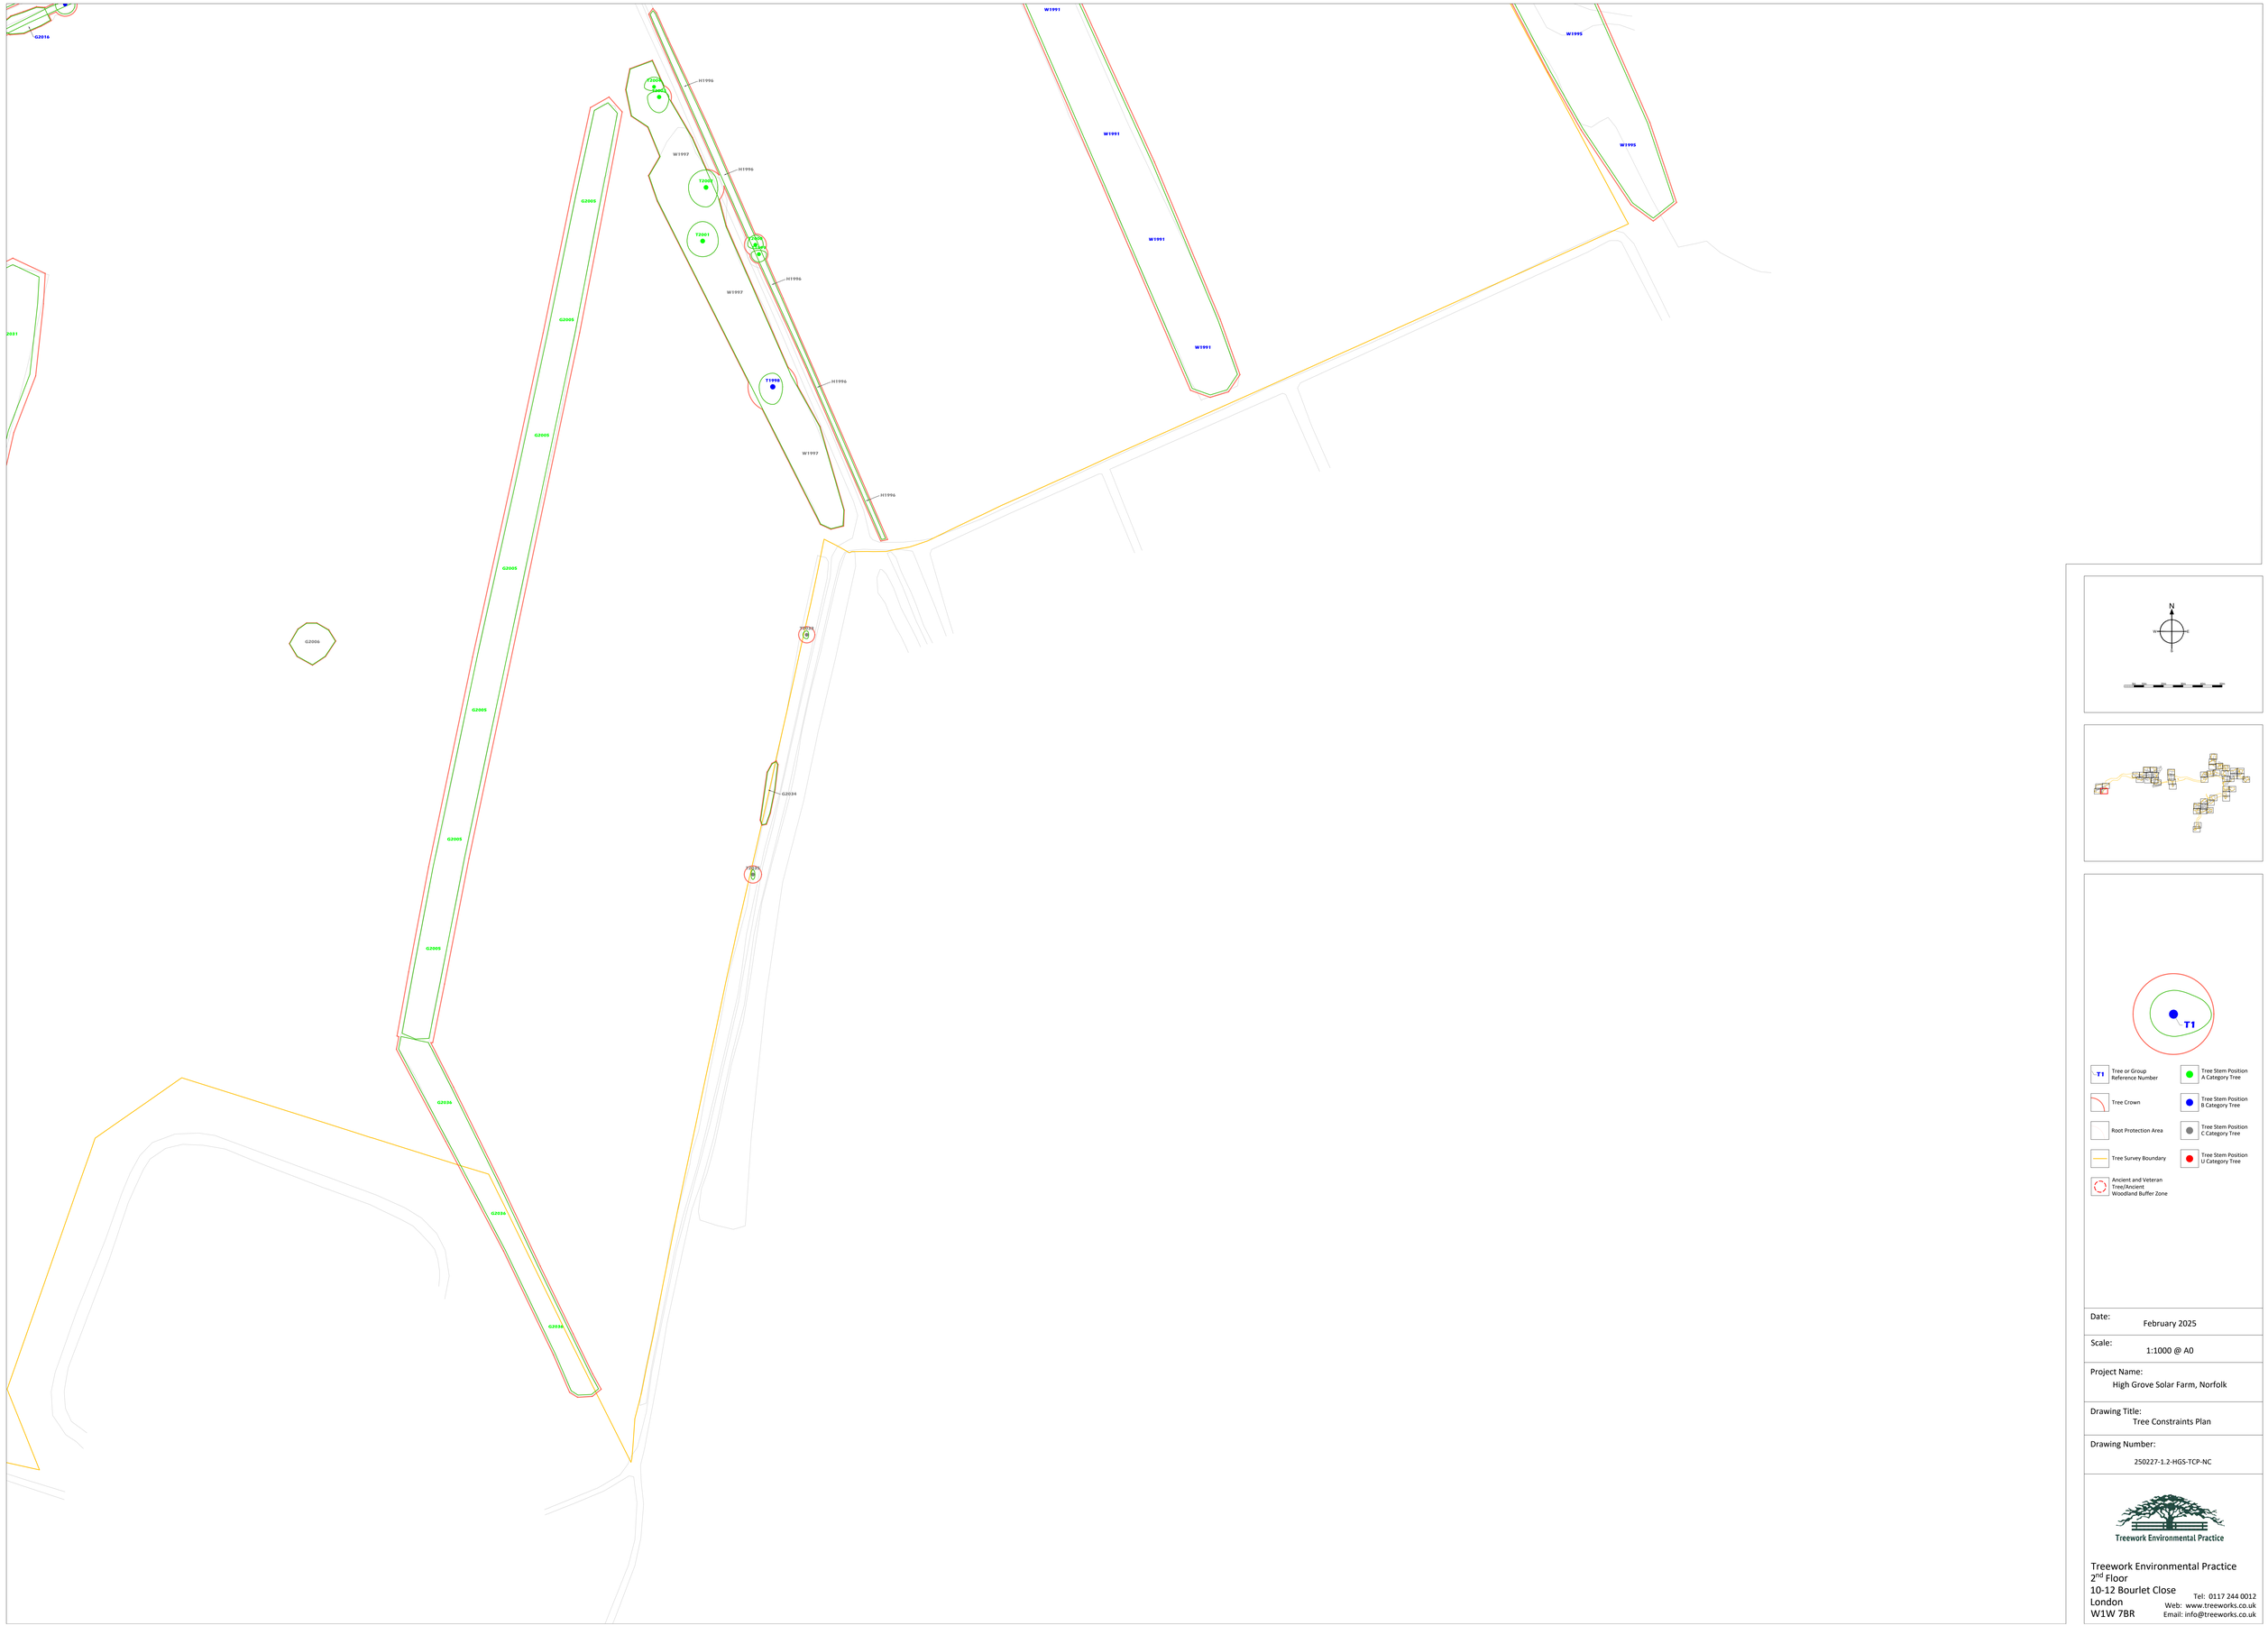

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



T1

T1 Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



T1

T1	Tree or Group Reference Number		Tree Stem Position A Category Tree
	Tree Crown		Tree Stem Position B Category Tree
	Root Protection Area		Tree Stem Position C Category Tree
	Tree Survey Boundary		Tree Stem Position U Category Tree
	Ancient and Veteran Tree/Ancient Woodland Buffer Zone		

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Date:
February 2025


Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Constraints Plan

Drawing Number:
2S0227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

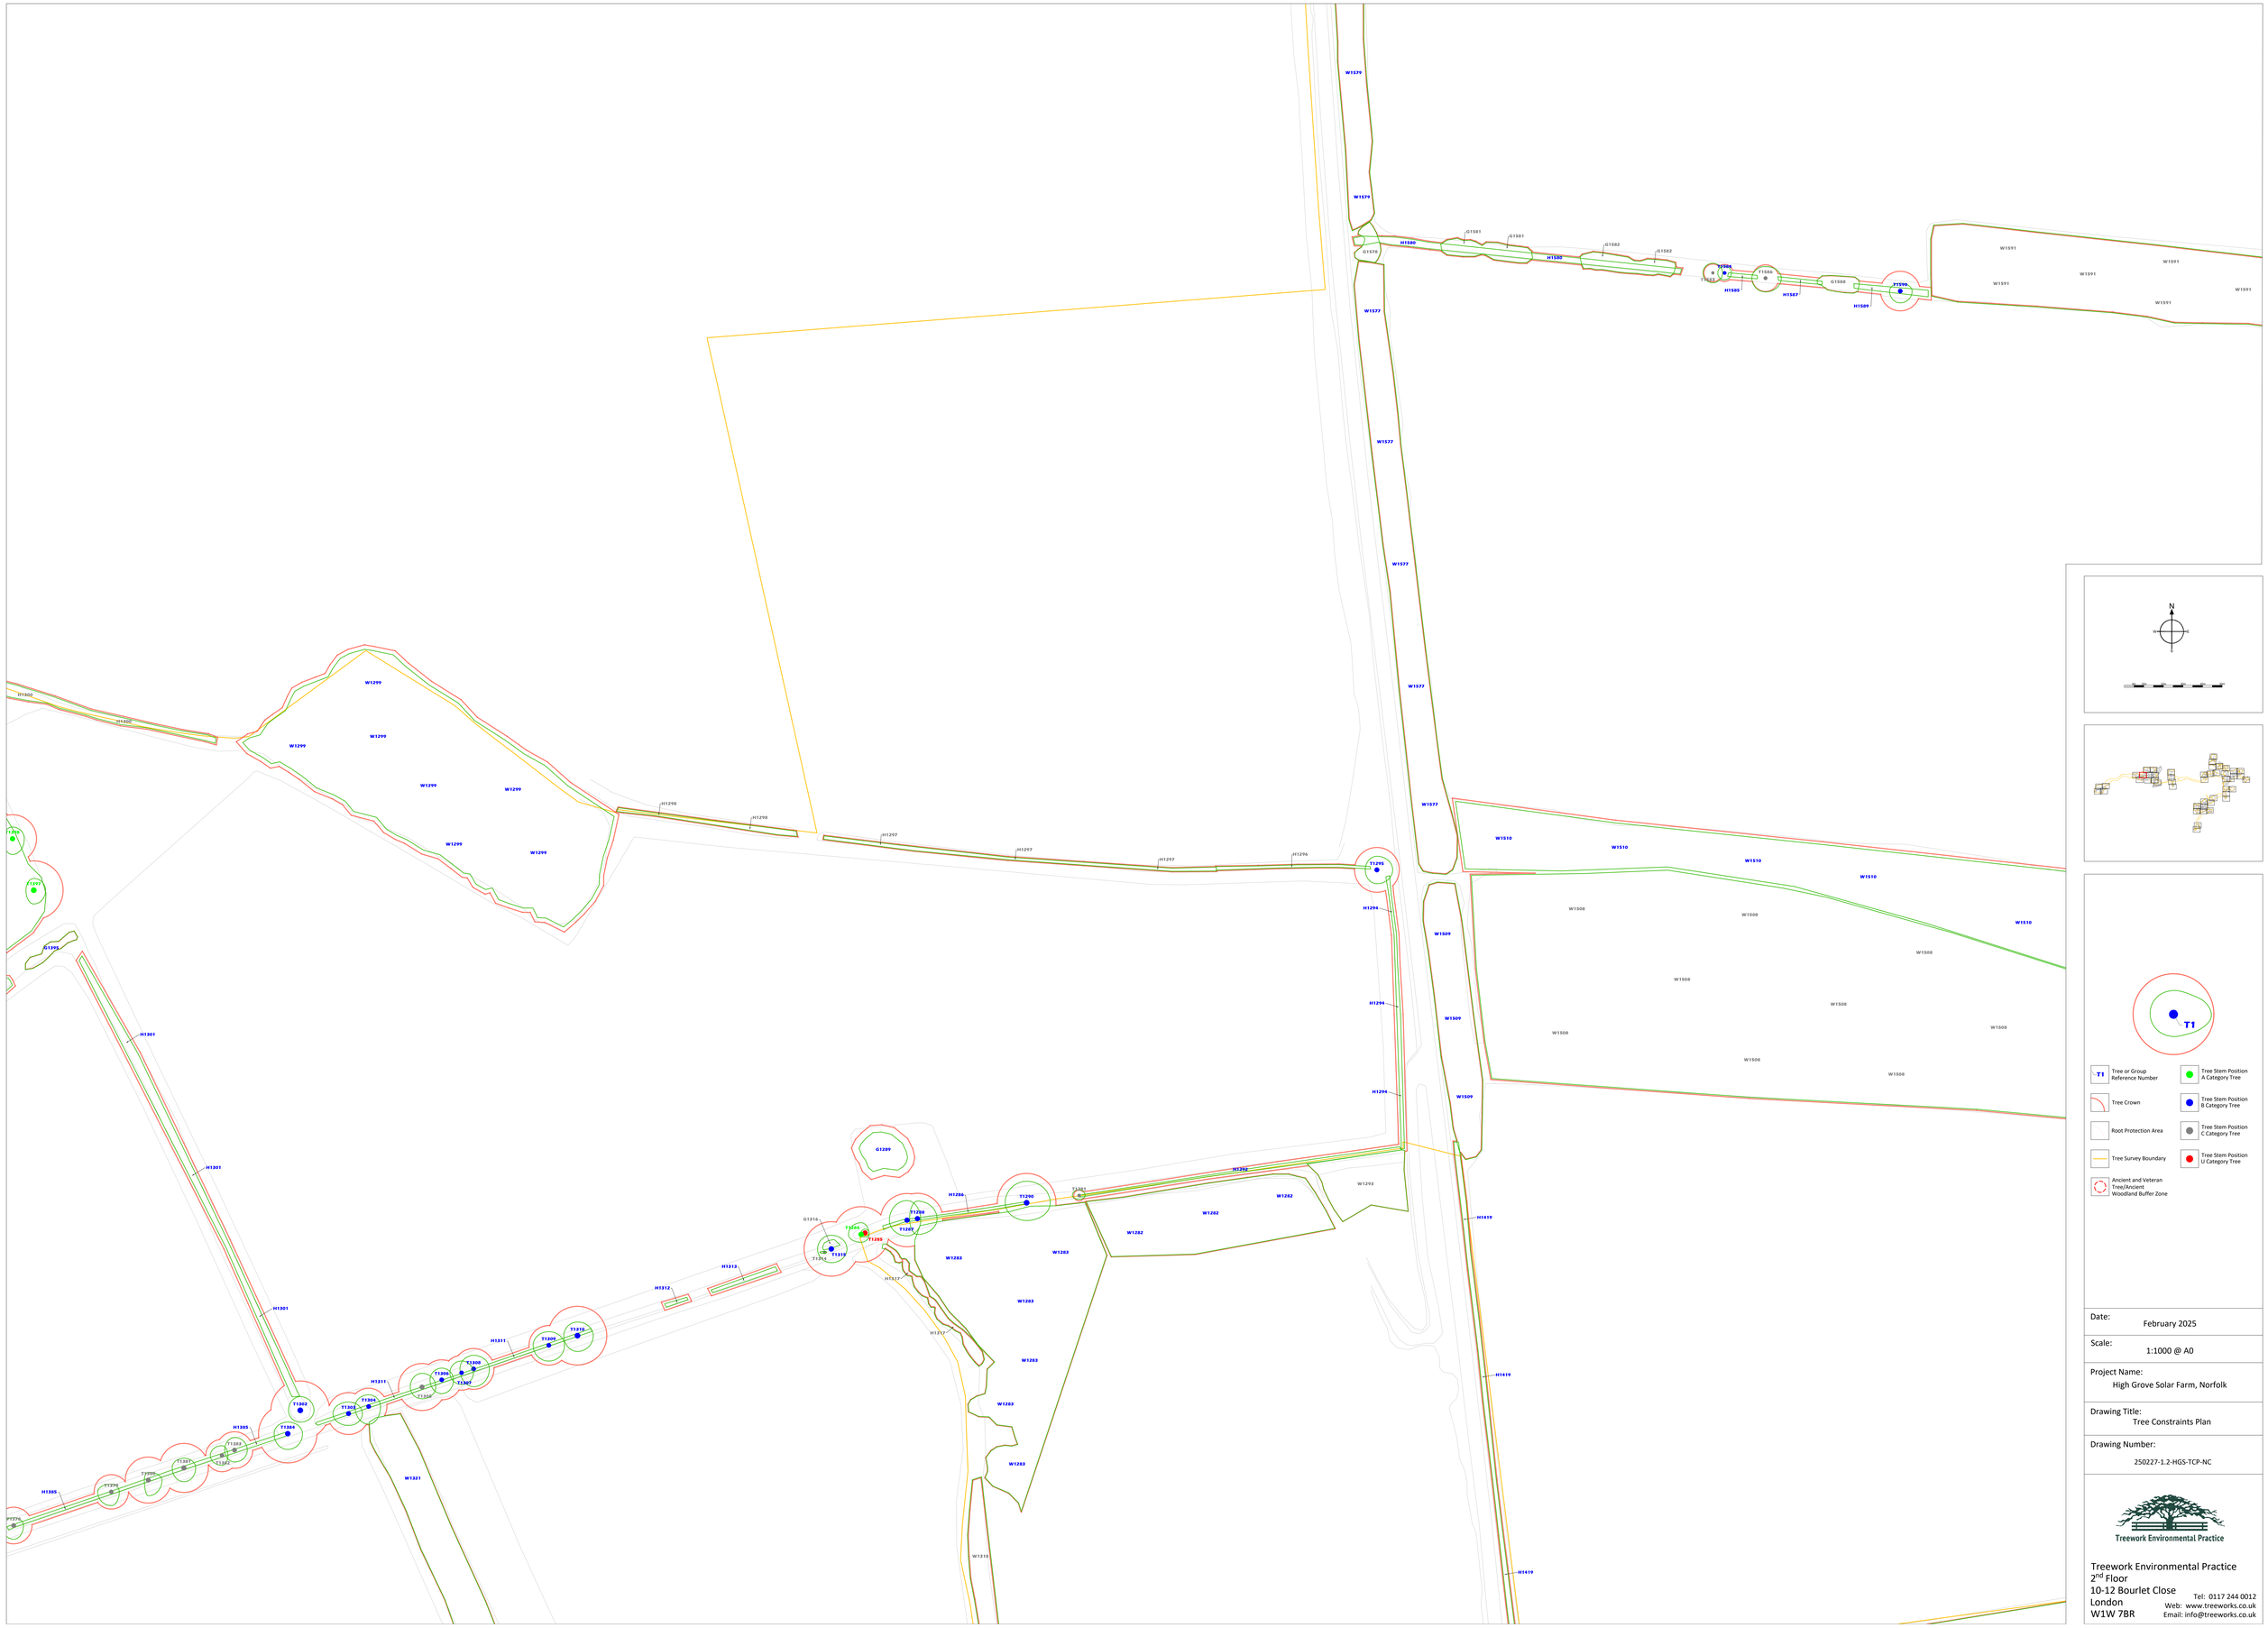

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



T1

Tree or Group Reference Number

Tree Crown

Root Protection Area

Tree Survey Boundary

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 2S0227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC


Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



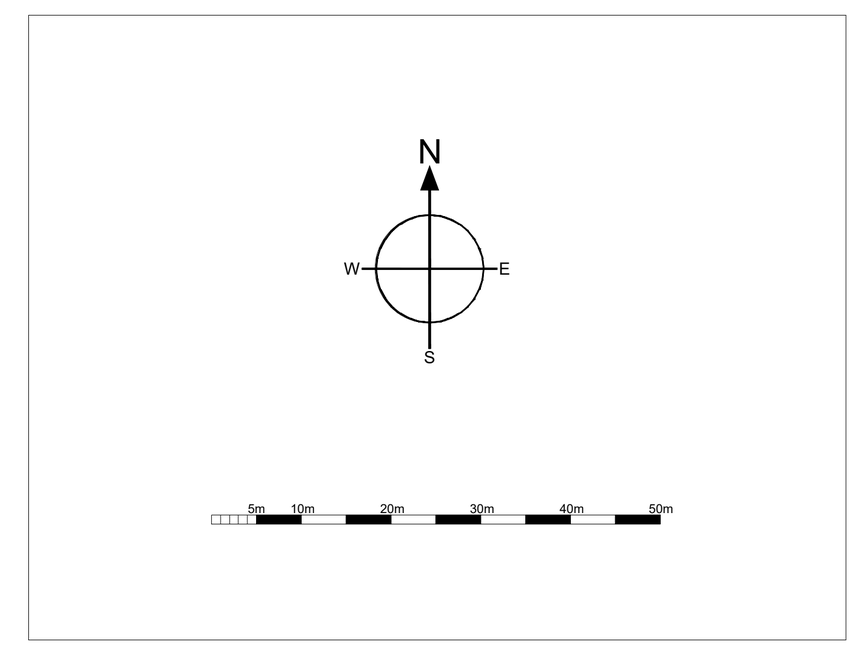

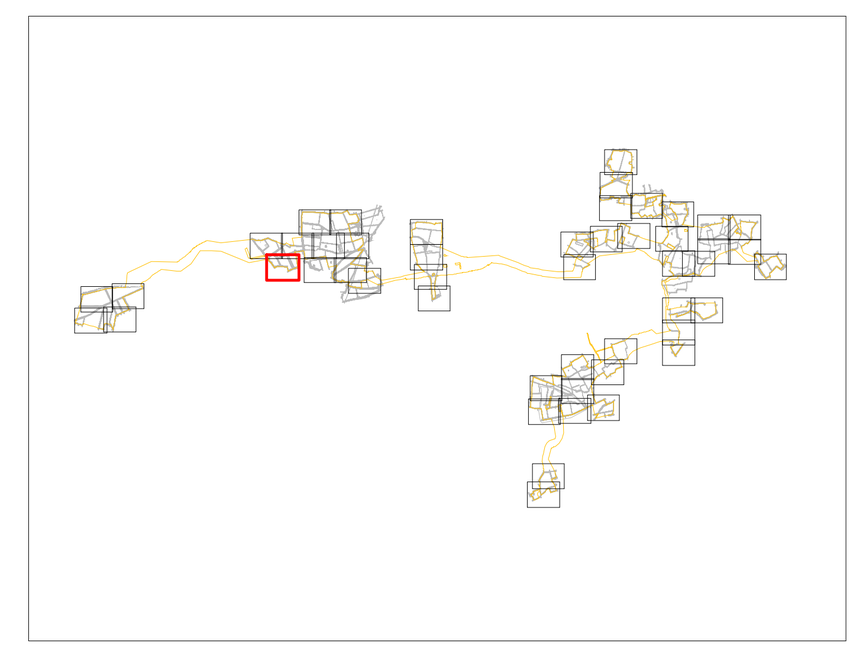

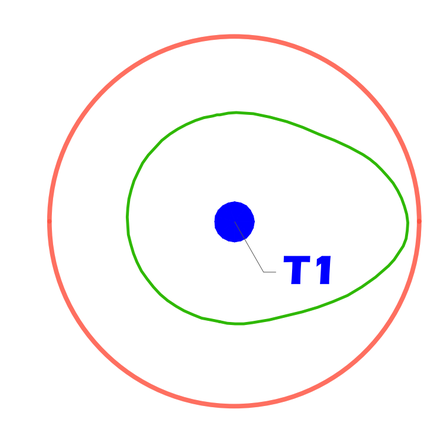

T1	Tree or Group Reference Number	●	Tree Stem Position A Category Tree
	Tree Crown	●	Tree Stem Position B Category Tree
	Root Protection Area	●	Tree Stem Position C Category Tree
	Tree Survey Boundary	●	Tree Stem Position U Category Tree
	Ancient and Veteran Tree/Ancient Woodland Buffer Zone		

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

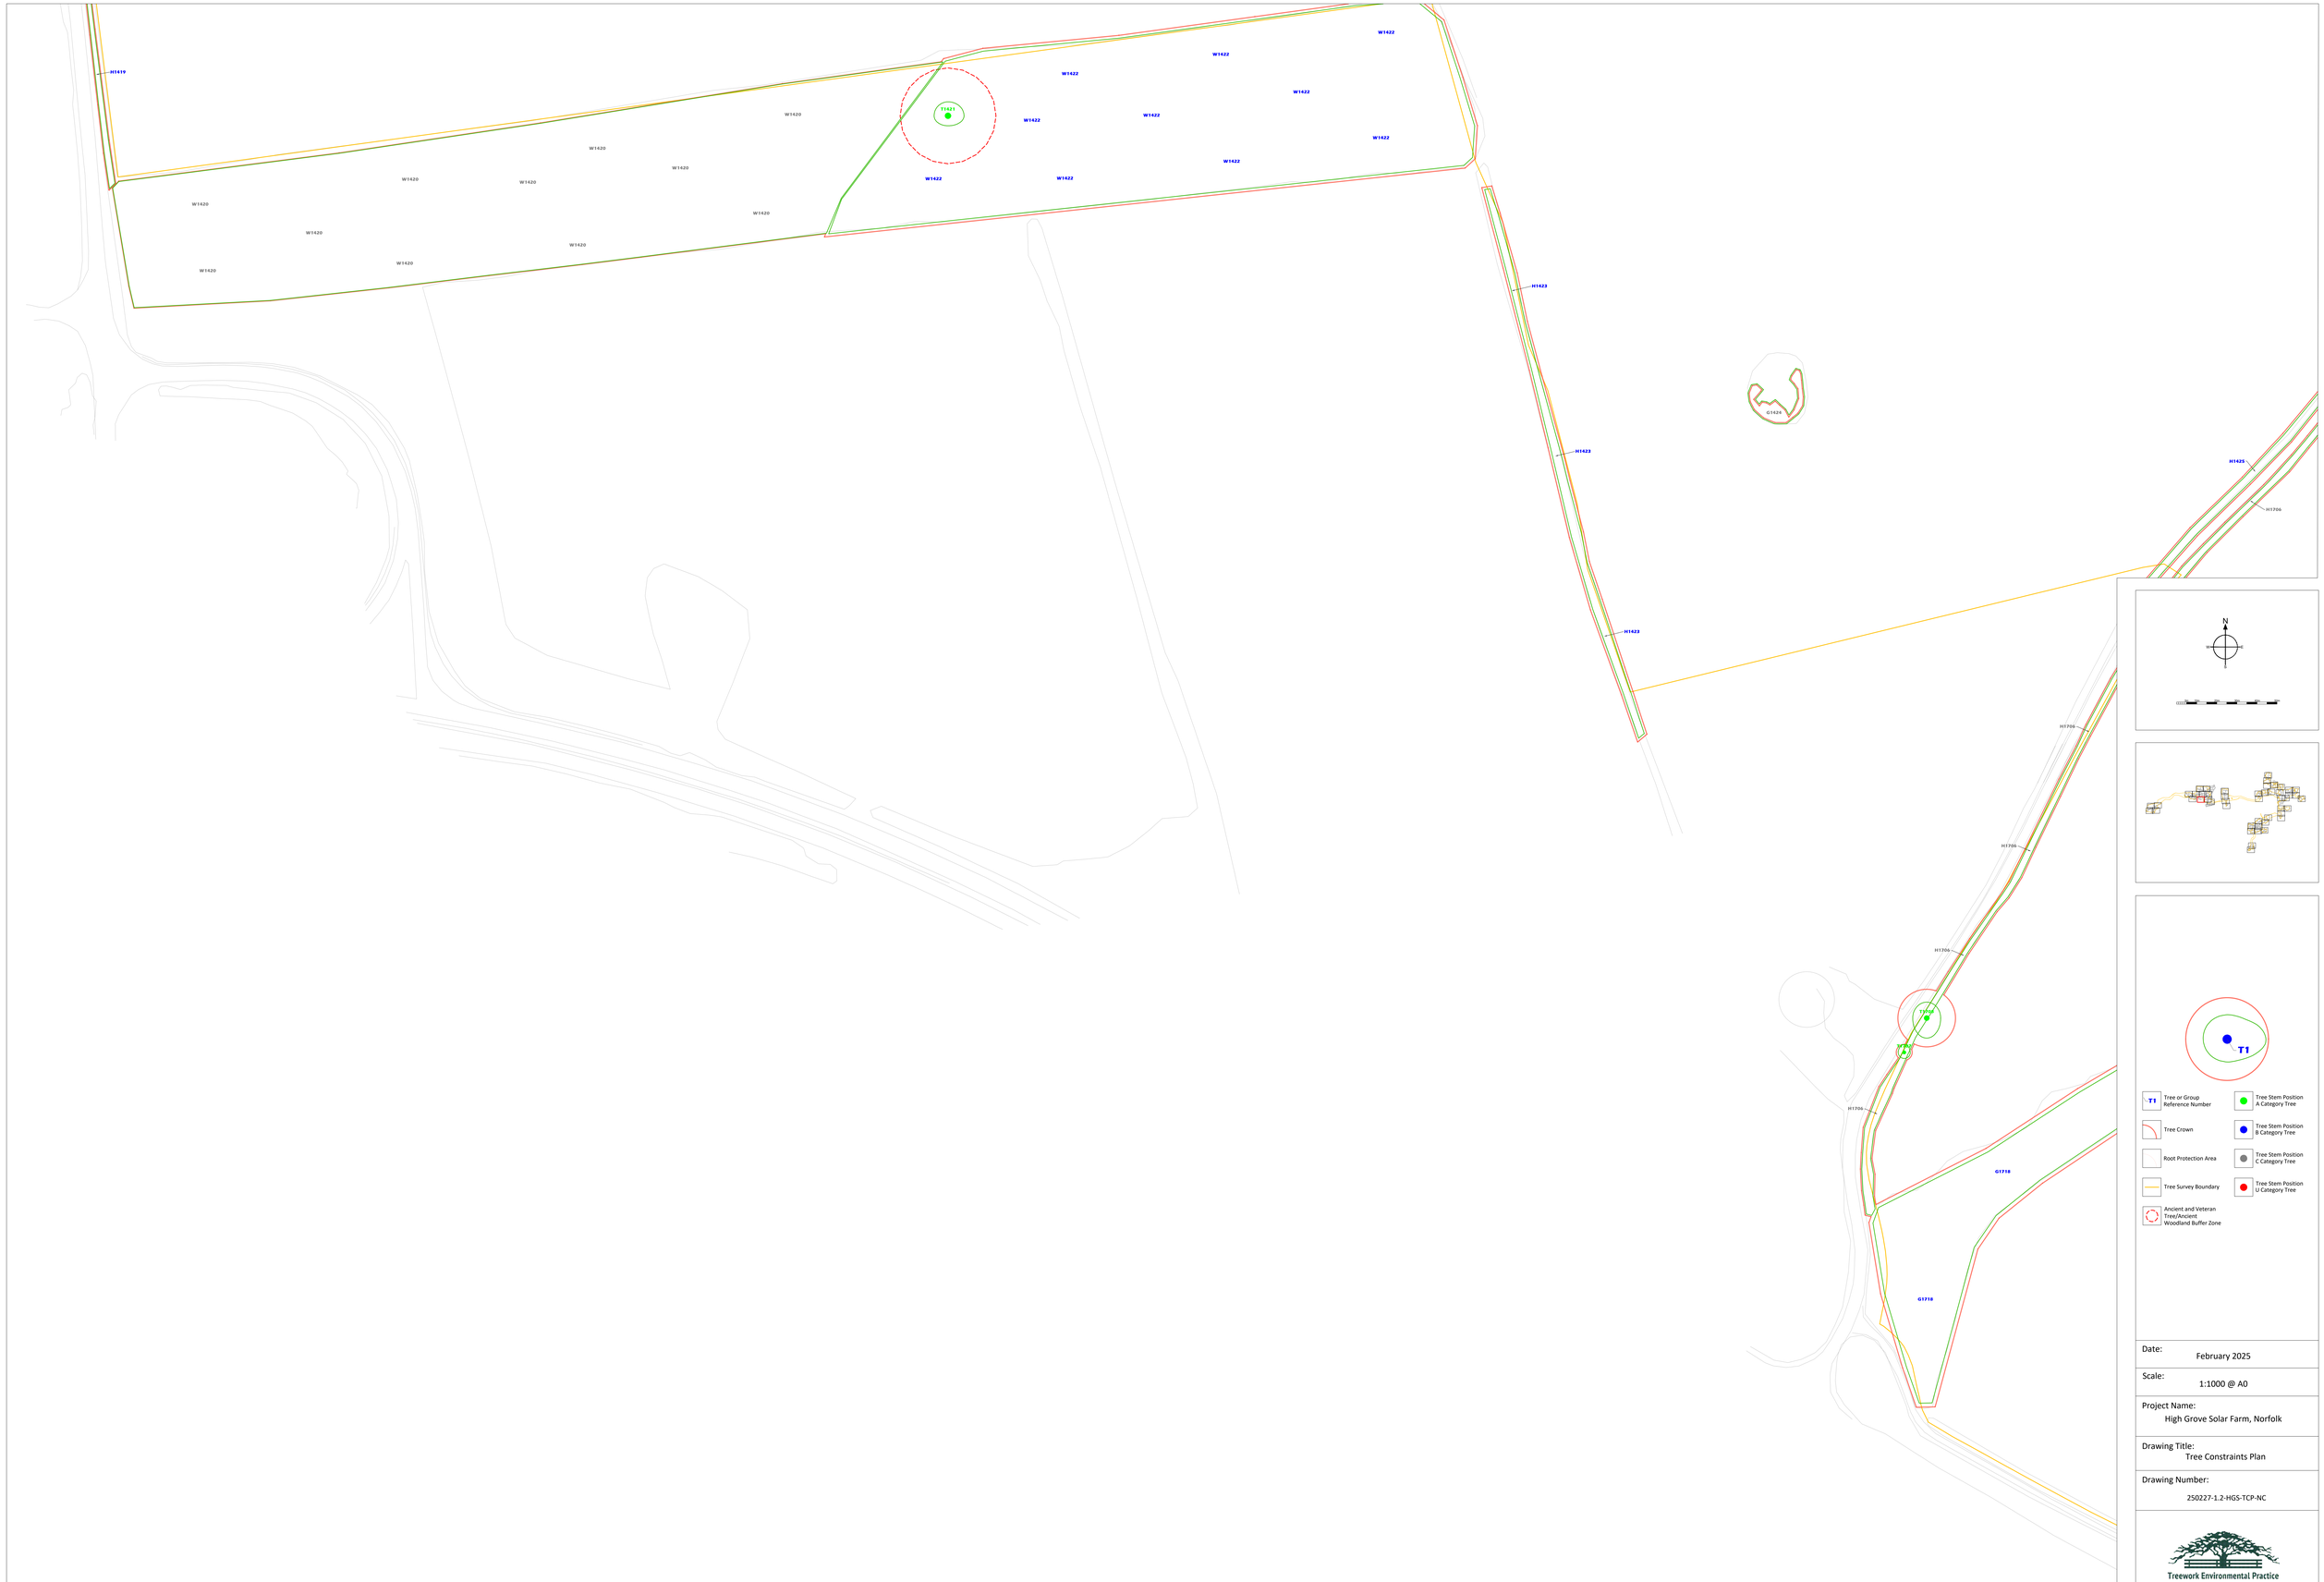

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

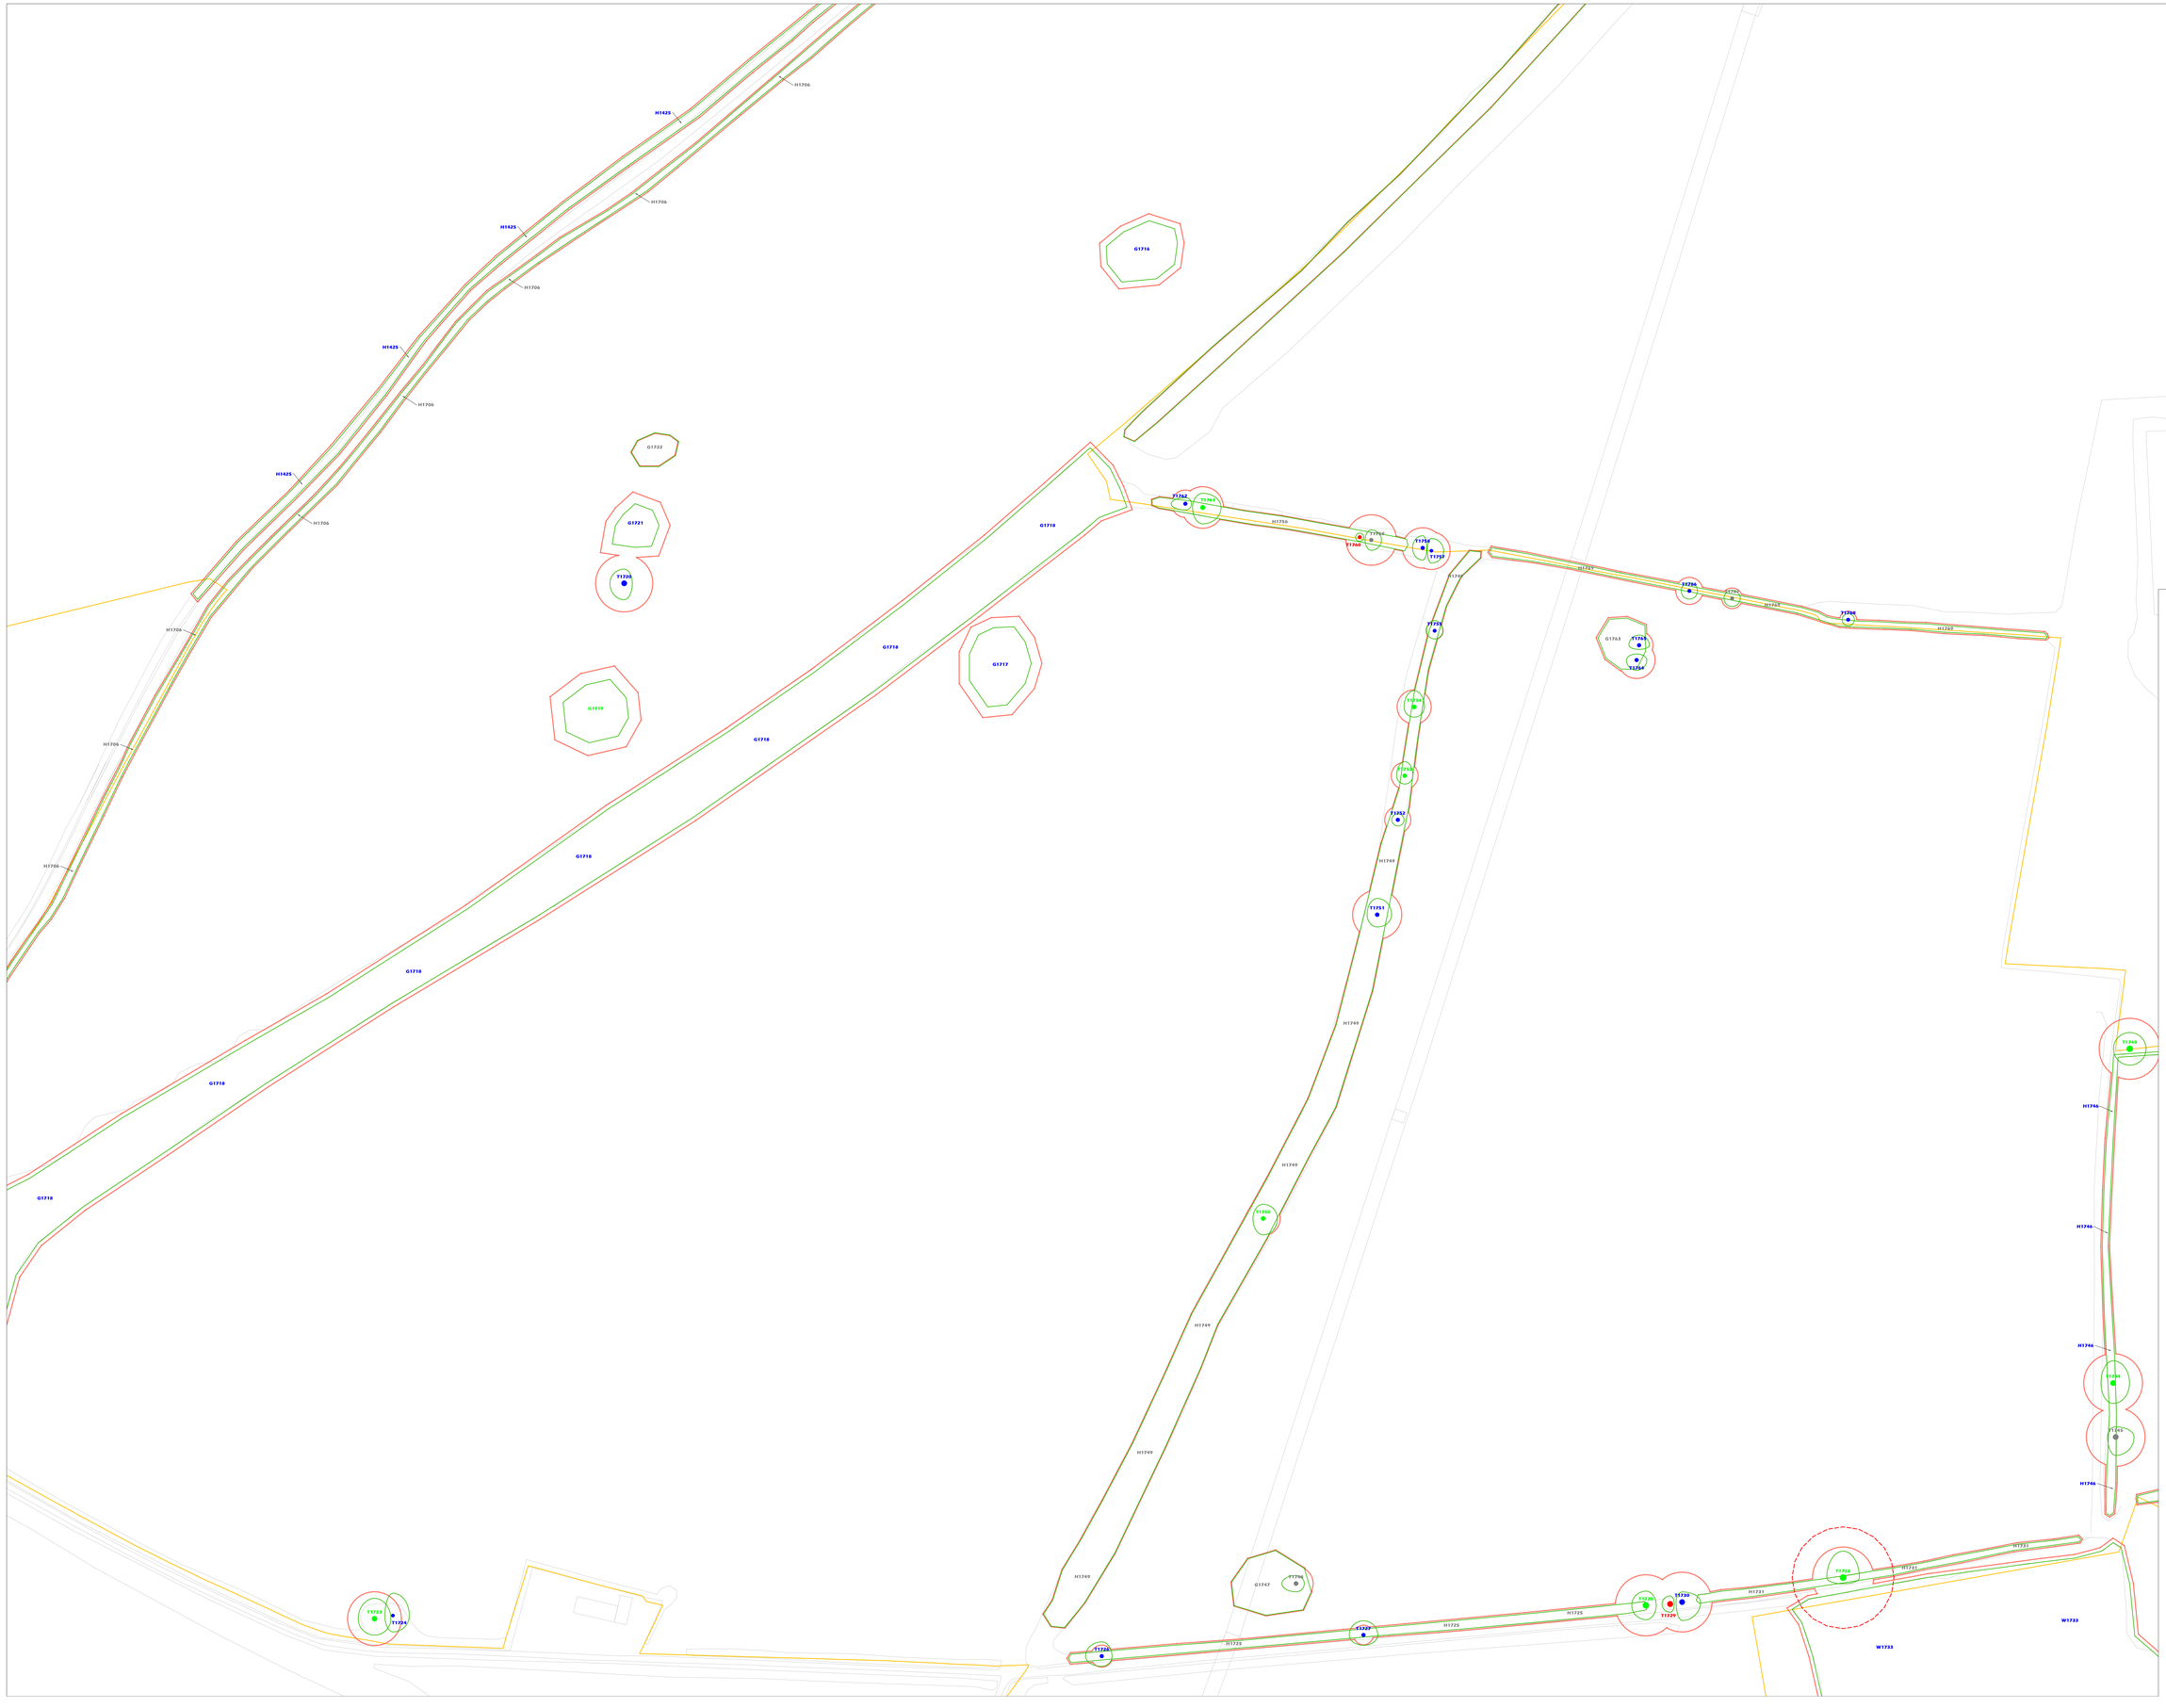

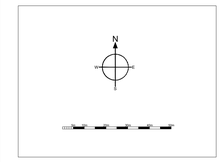





- T1 — Tree or Group Reference Number
- Tree Crown
- Root Protection Area
- Tree Survey Boundary
- Ancient and Veteran Tree/Ancient Woodland Buffer Zone
- Tree Stem Position A Category Tree
- Tree Stem Position B Category Tree
- Tree Stem Position C Category Tree
- Tree Stem Position U Category Tree

Date:	February 2025
Scale:	1:1000 @ A0
Project Name:	High Grove Solar Farm, Norfolk
Drawing Title:	Tree Constraints Plan
Drawing Number:	250227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Constraints Plan

Drawing Number:
250227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



N

T1

Tree or Group Reference Number

Tree Crown

Root Protection Area

Tree Survey Boundary

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

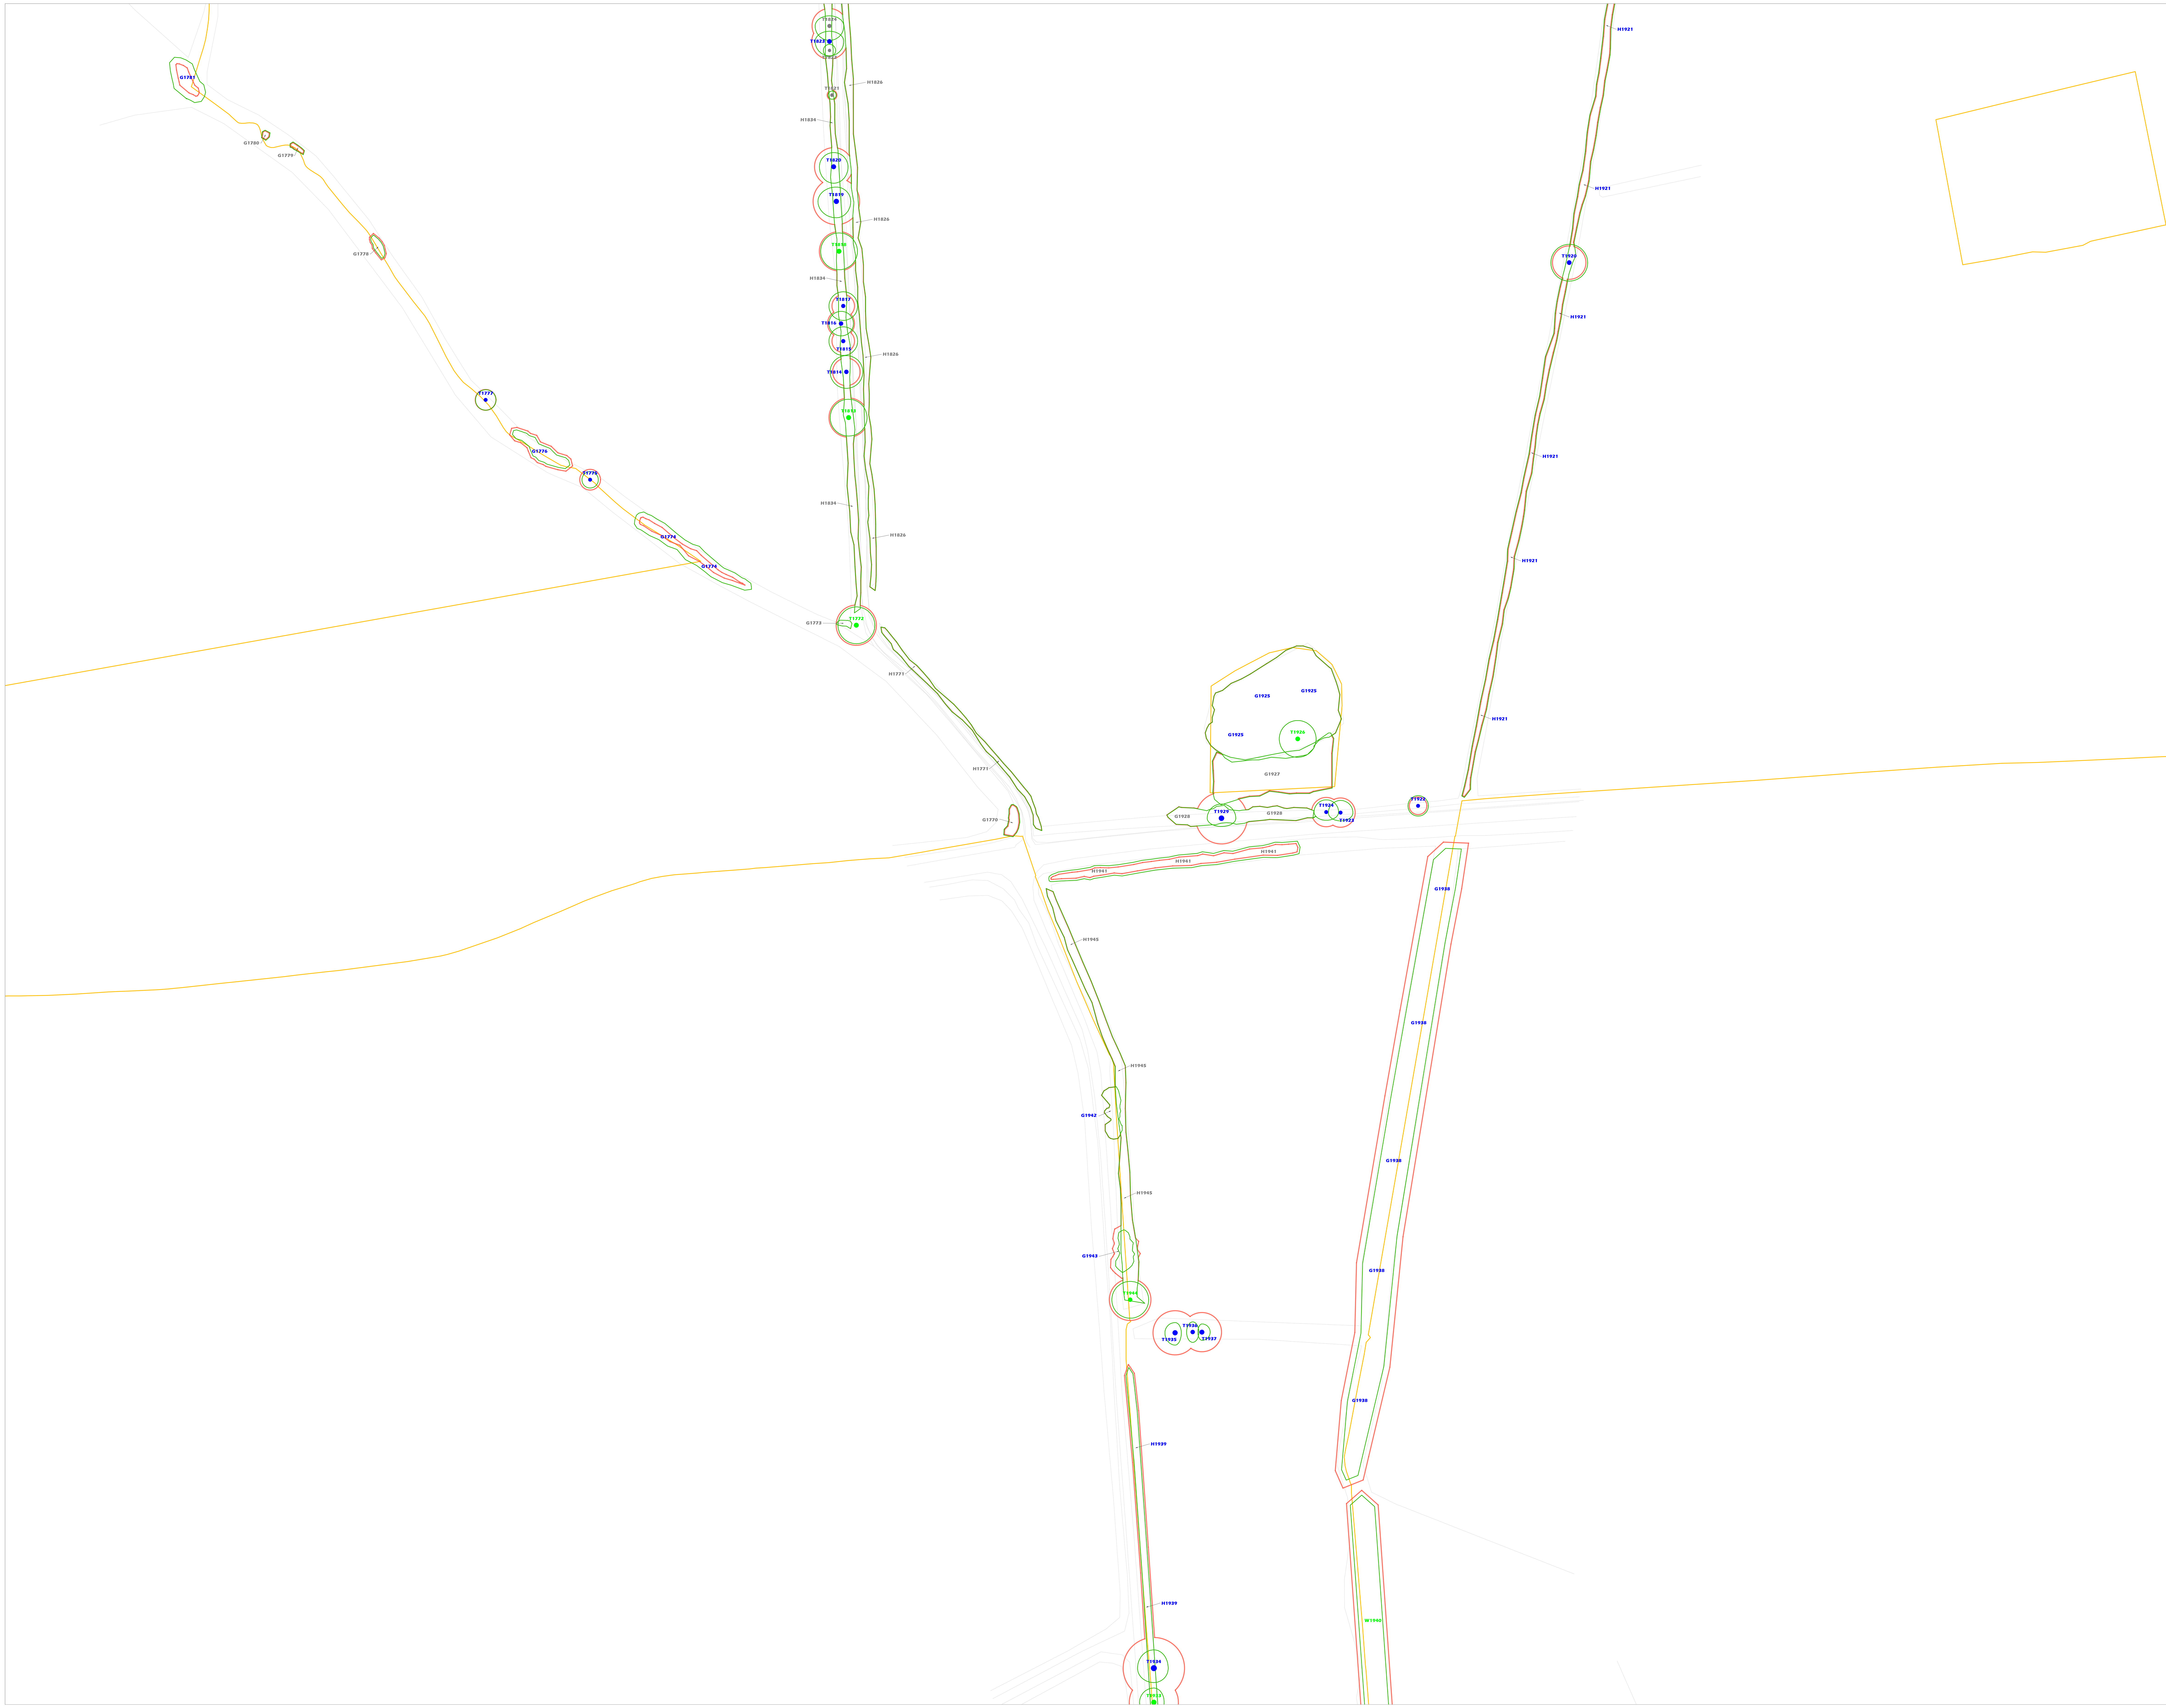

N
W
E
S

5m 10m 20m 30m 40m 50m

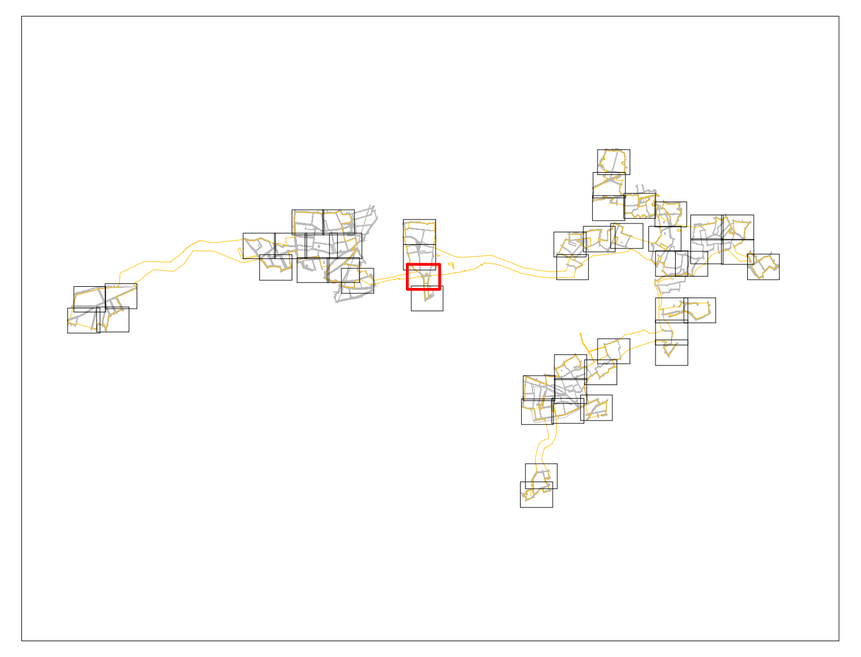

T1

Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

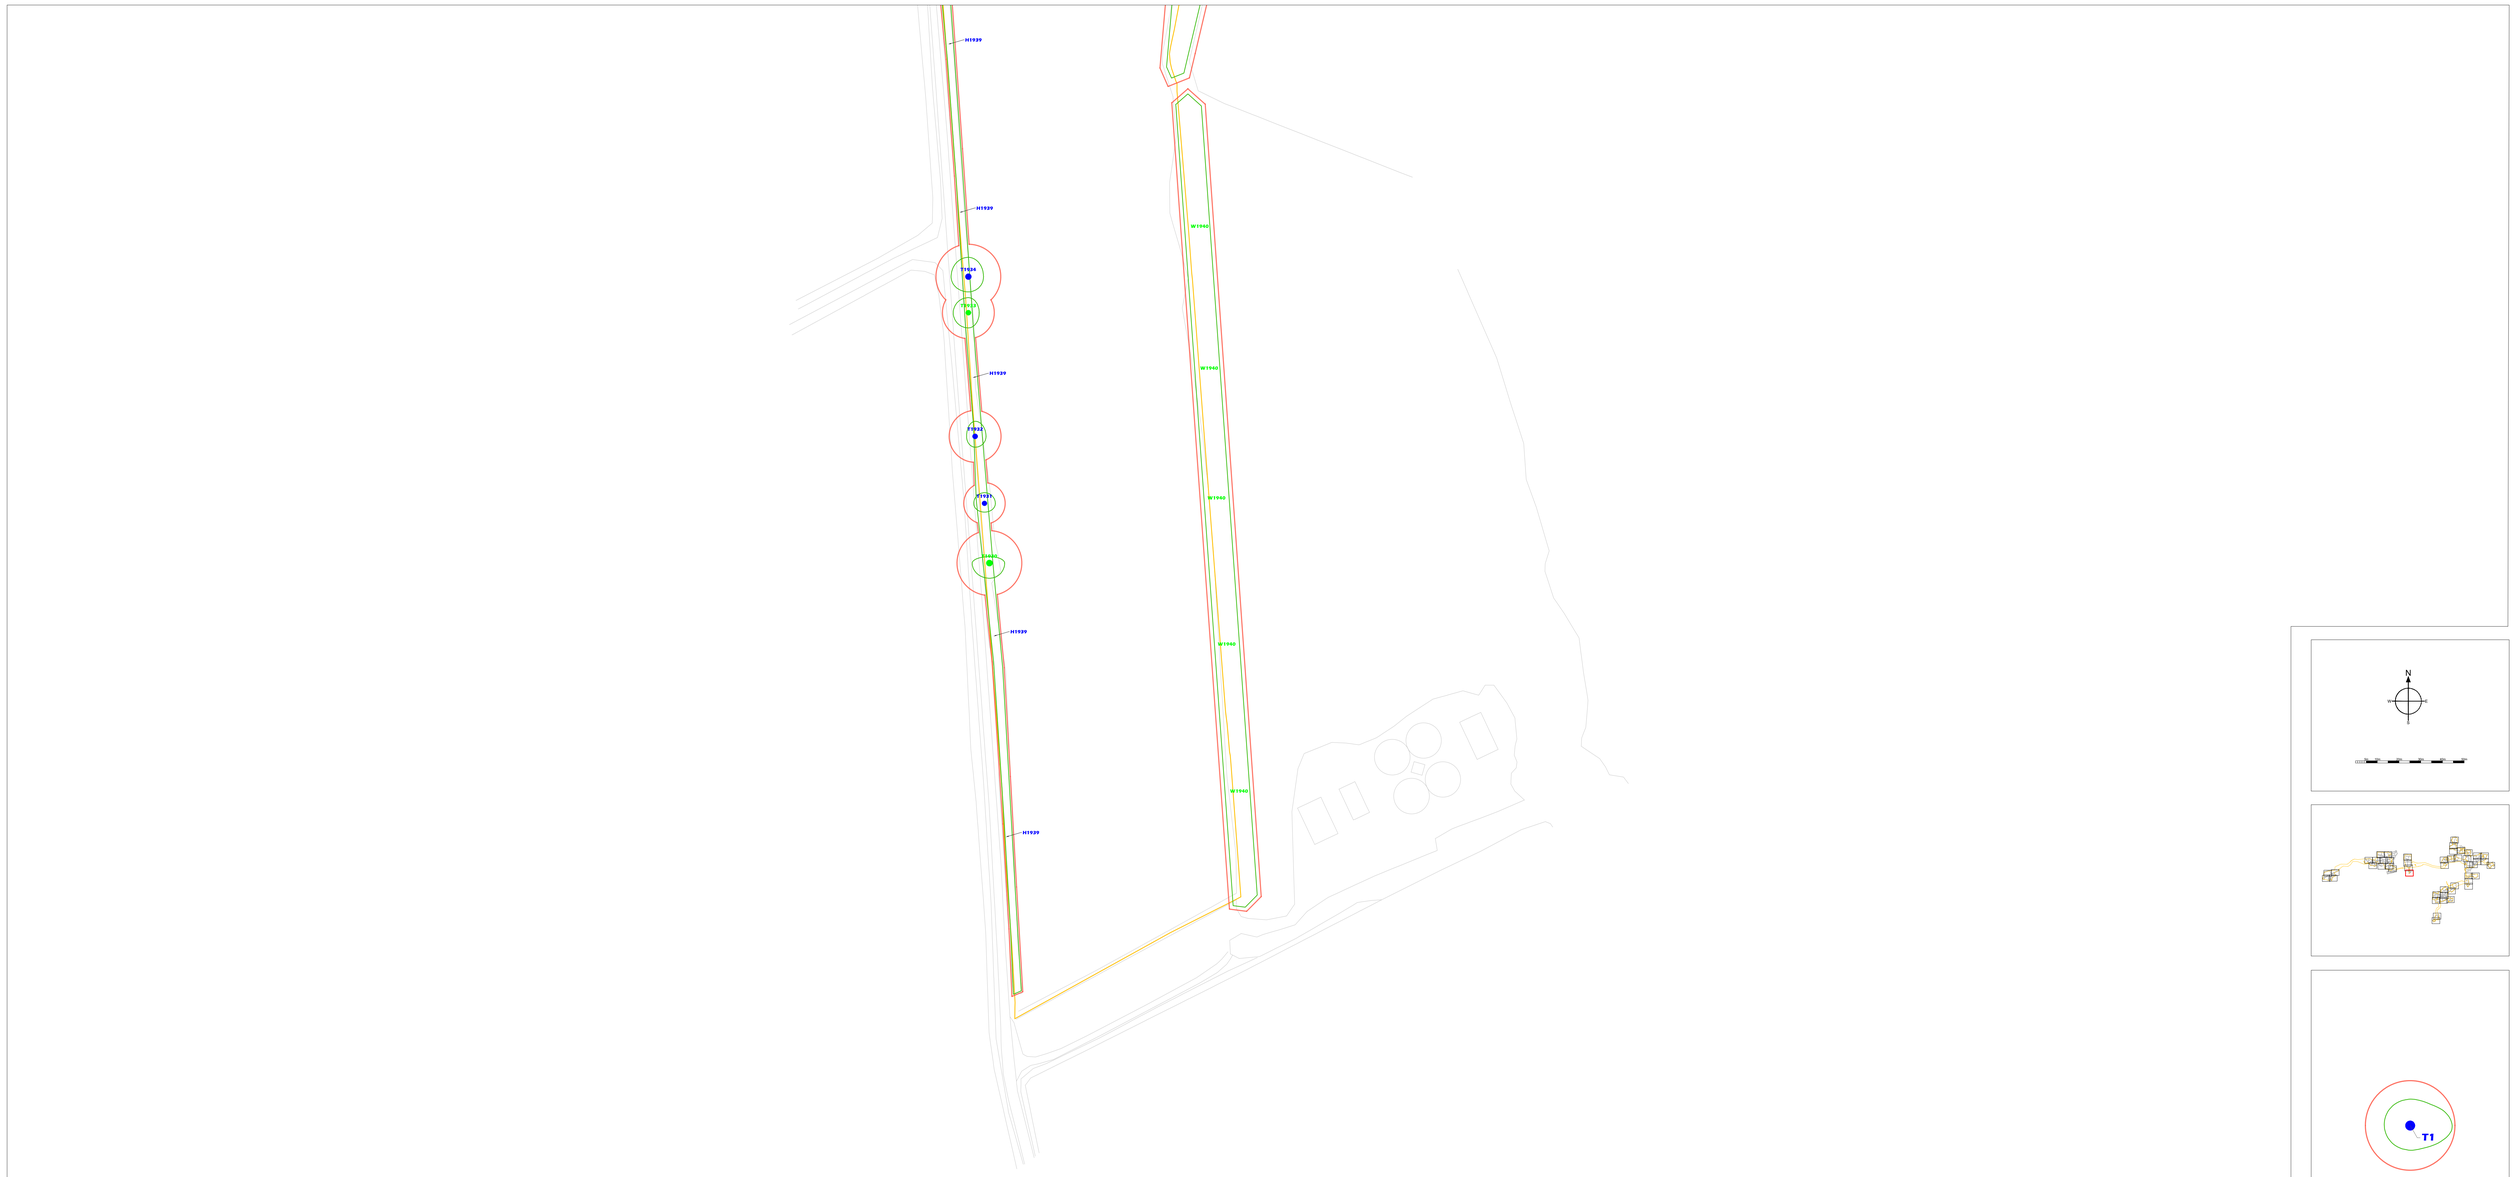

T1 Tree or Group Reference Number

Tree Crown

Root Protection Area

Tree Survey Boundary

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



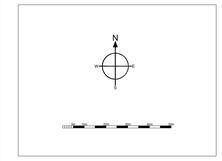



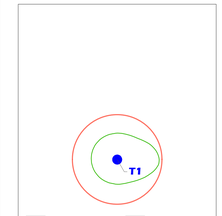

Date:	February 2025
Scale:	1:1000 @ A0
Project Name:	High Grove Solar Farm, Norfolk
Drawing Title:	Tree Constraints Plan
Drawing Number:	250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



N

W E

S

T1

Tree or Group Reference Number

Tree Crown

Root Protection Area

Tree Survey Boundary

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



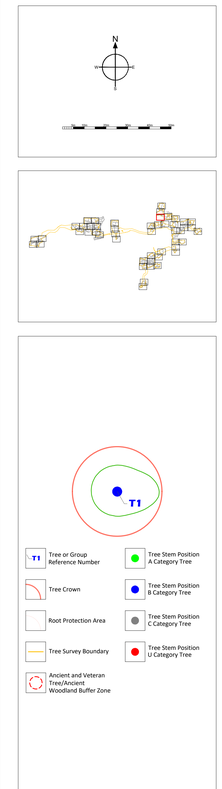

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC


Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



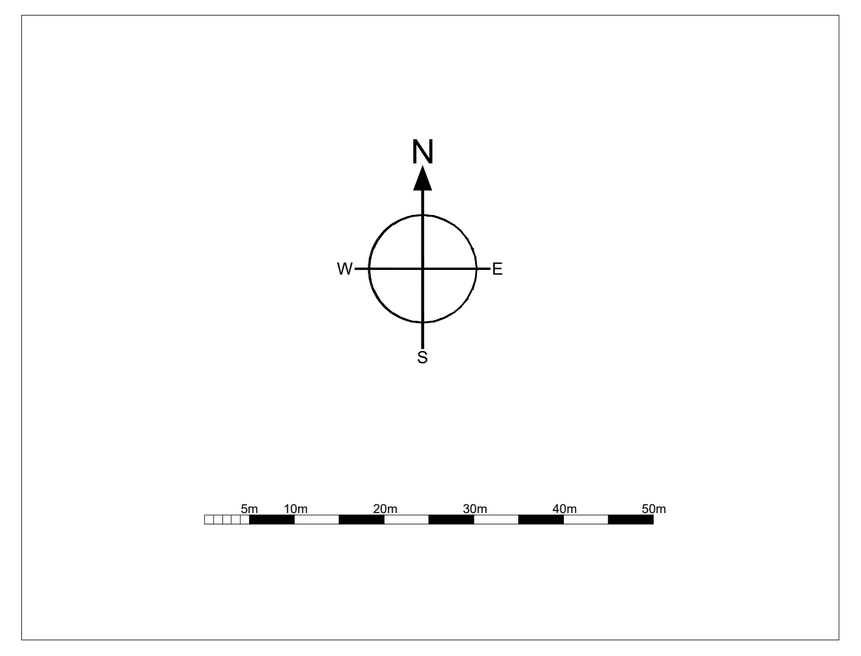

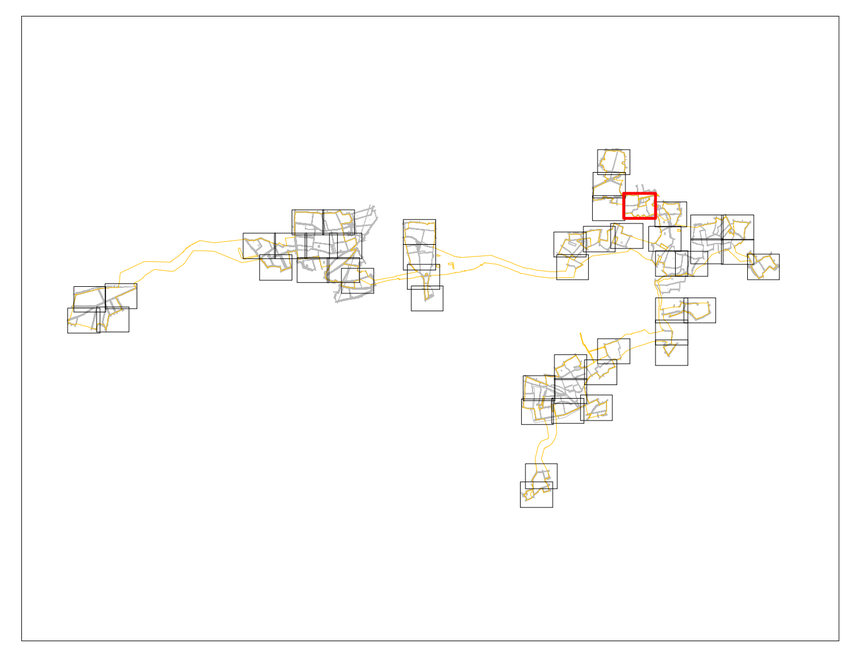

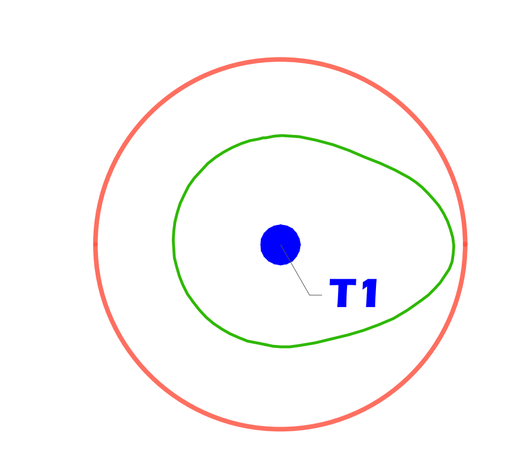

T1	Tree or Group Reference Number		Tree Stem Position A Category Tree
	Tree Crown		Tree Stem Position B Category Tree
	Root Protection Area		Tree Stem Position C Category Tree
	Tree Survey Boundary		Tree Stem Position U Category Tree
	Ancient and Veteran Tree/Ancient Woodland Buffer Zone		

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



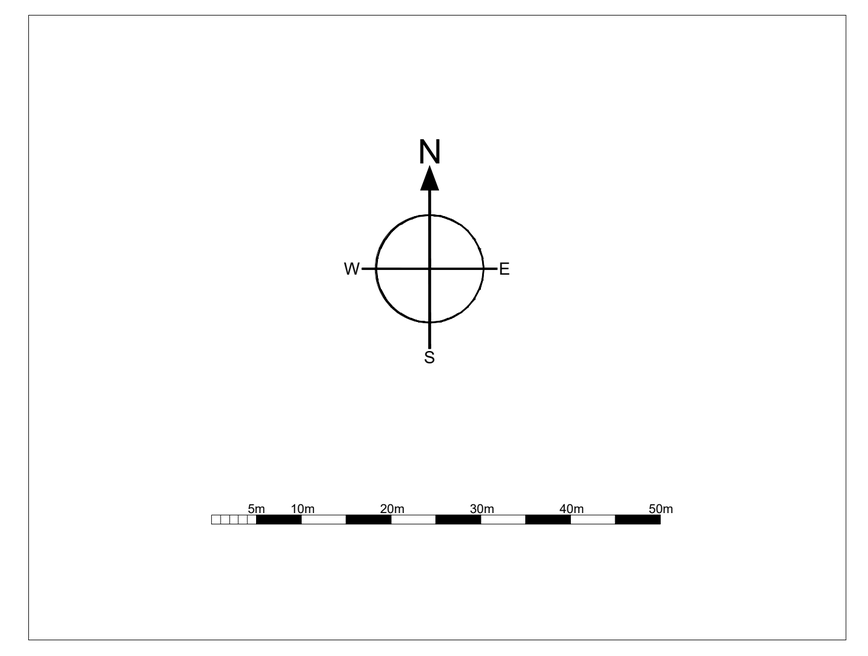

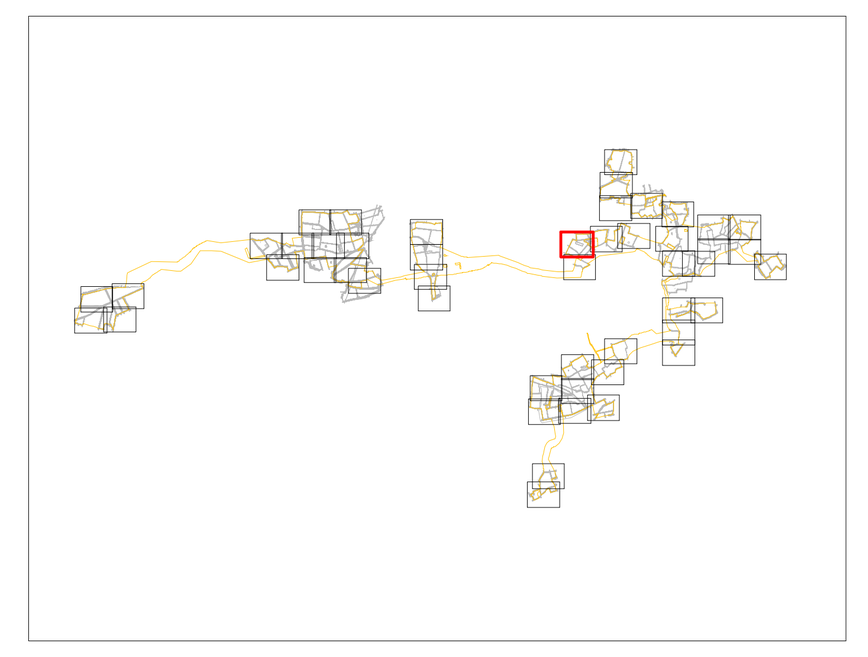

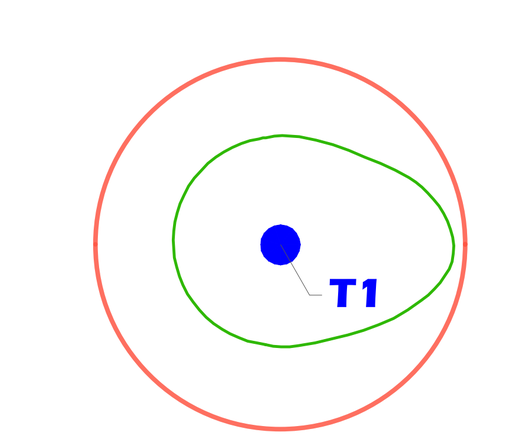

T1 Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



N

W E S

Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



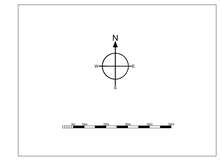





T1 Tree or Group Reference Number

Tree Crown

Root Protection Area

Tree Survey Boundary

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

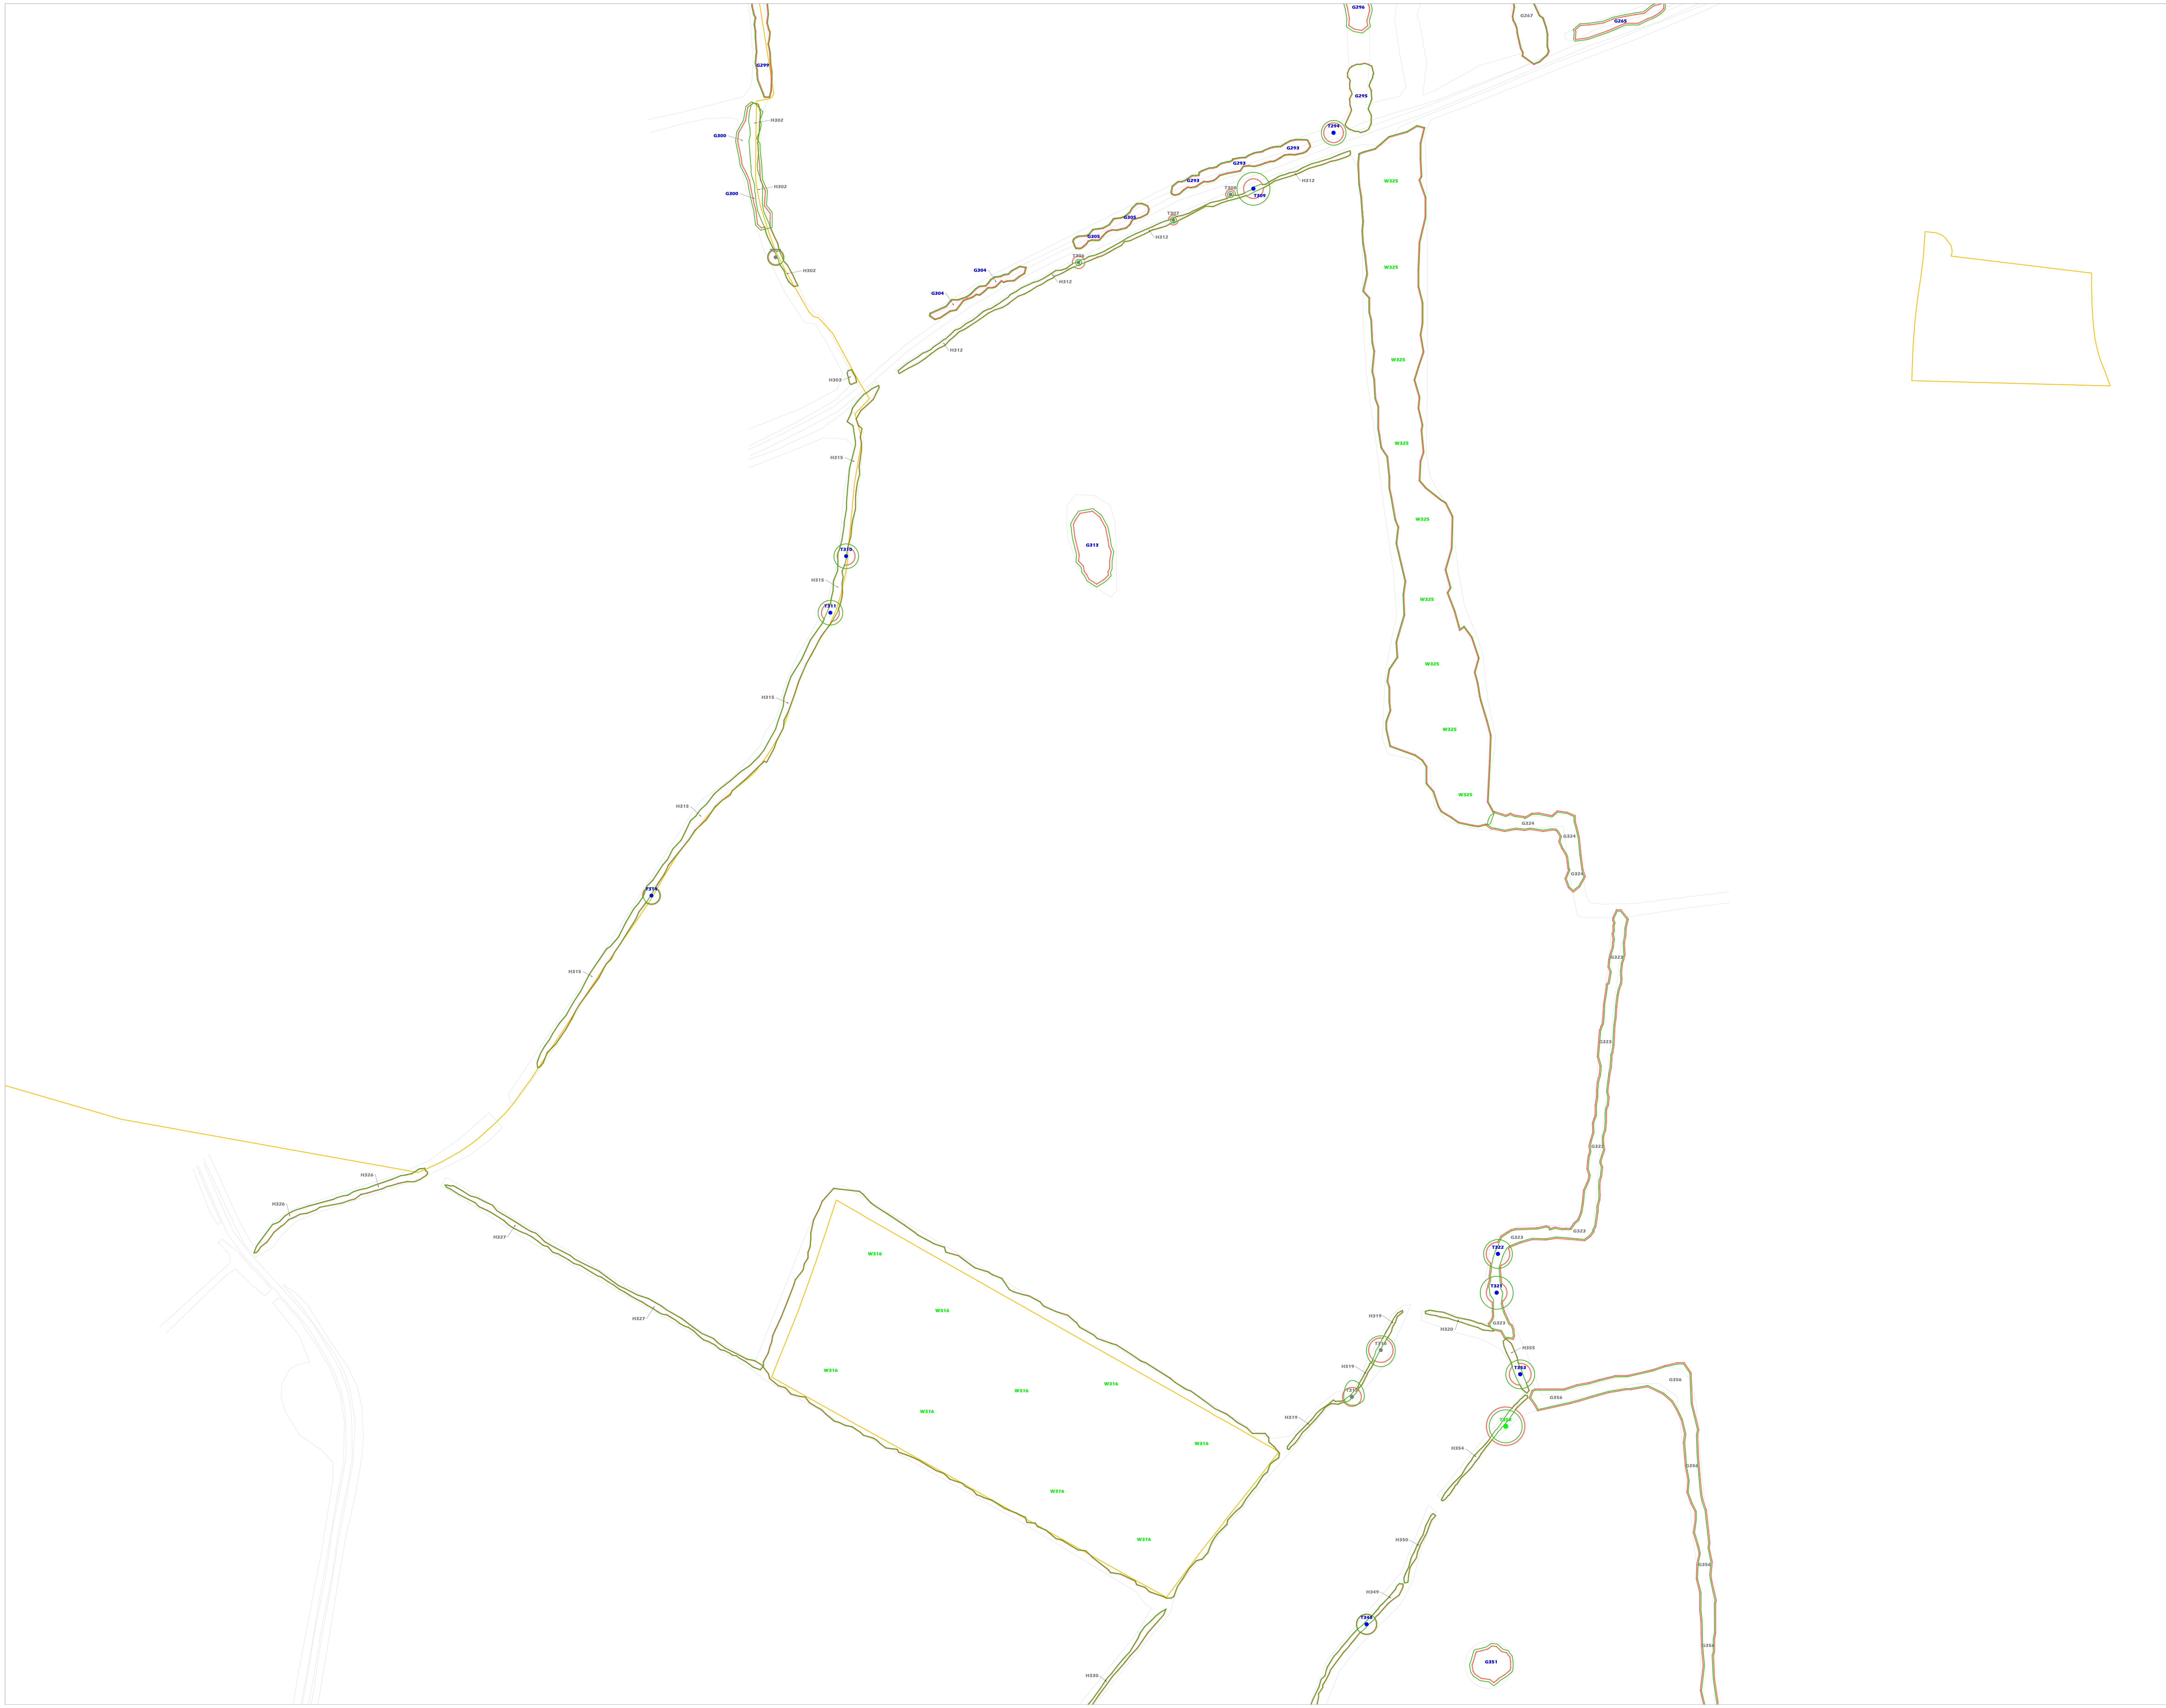

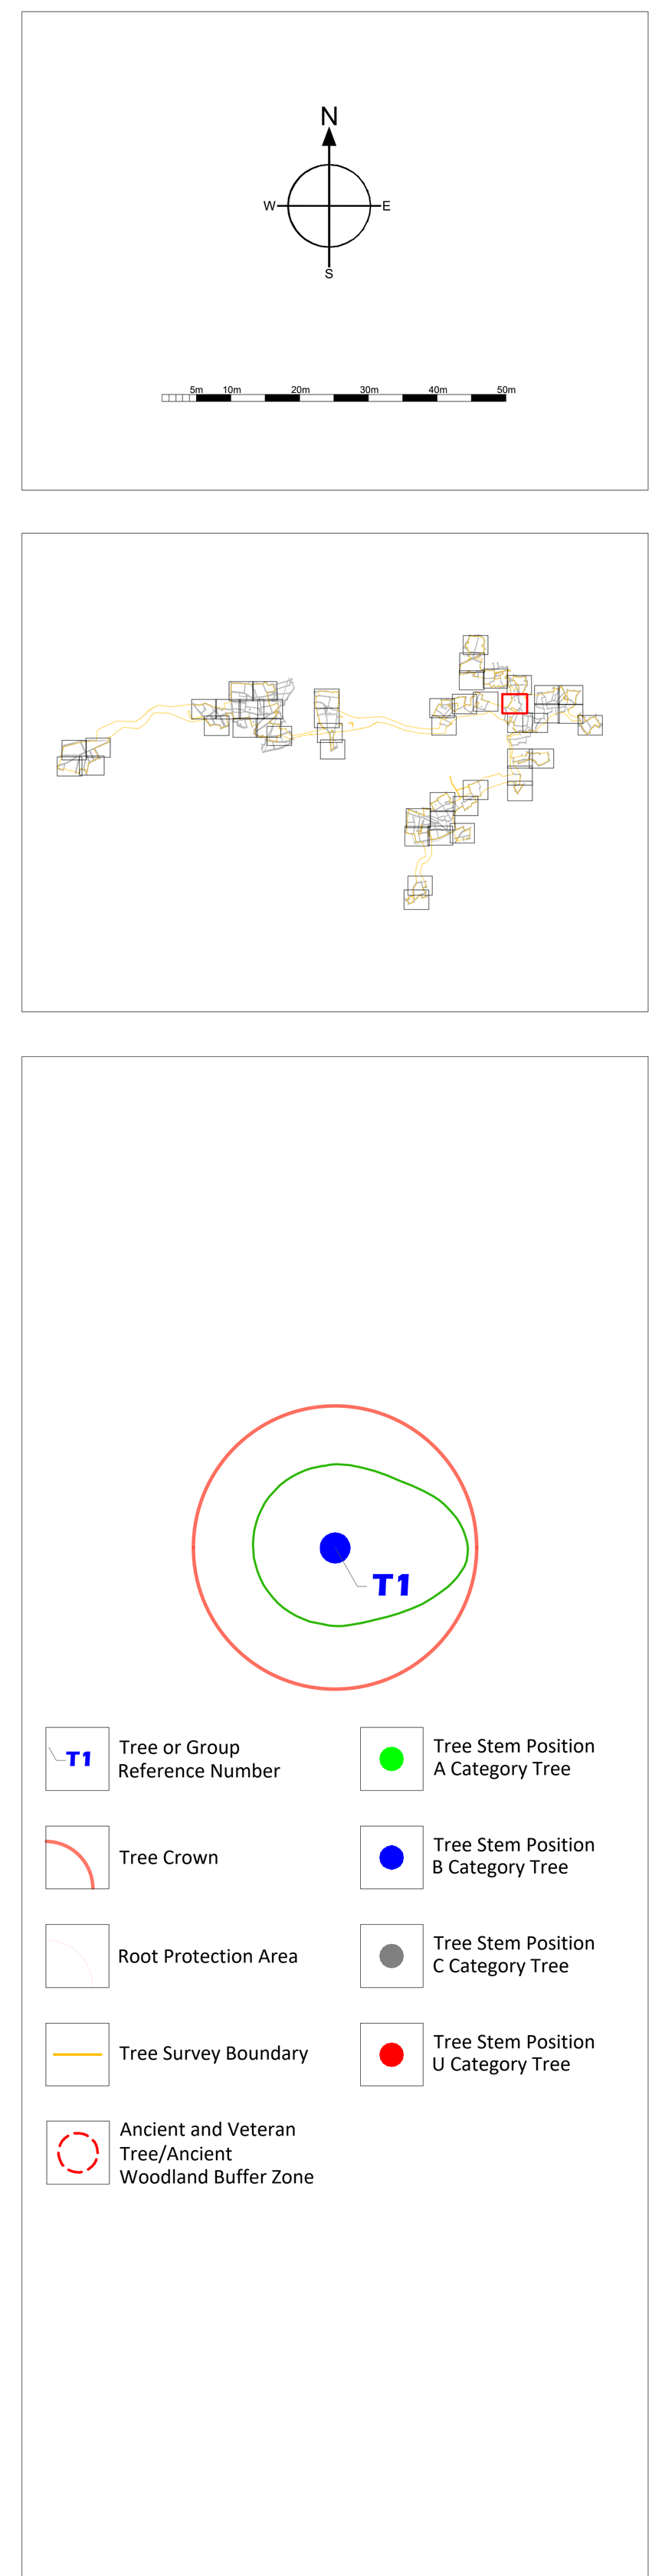

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



T1 — Tree or Group Reference Number

Tree Crown

Root Protection Area

Tree Survey Boundary

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



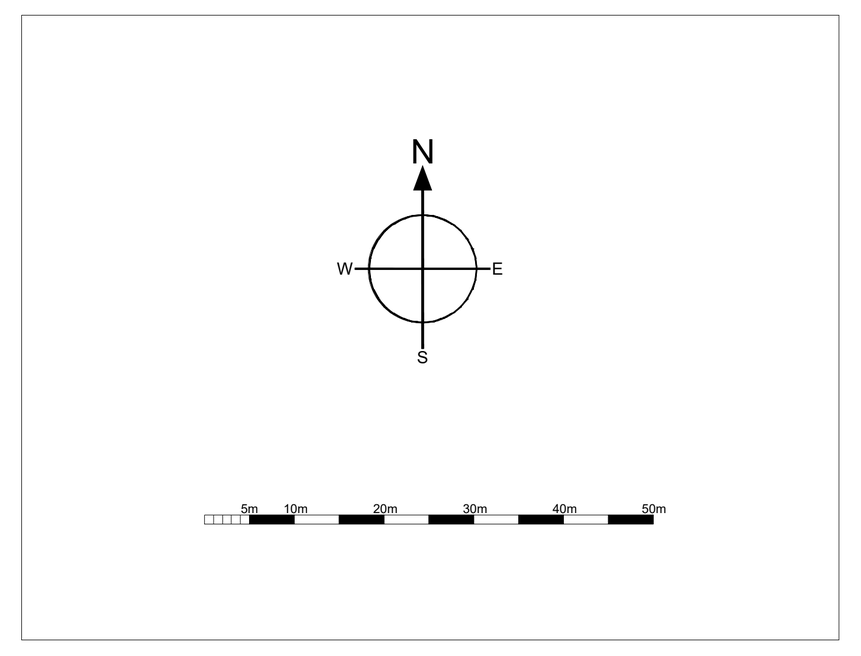

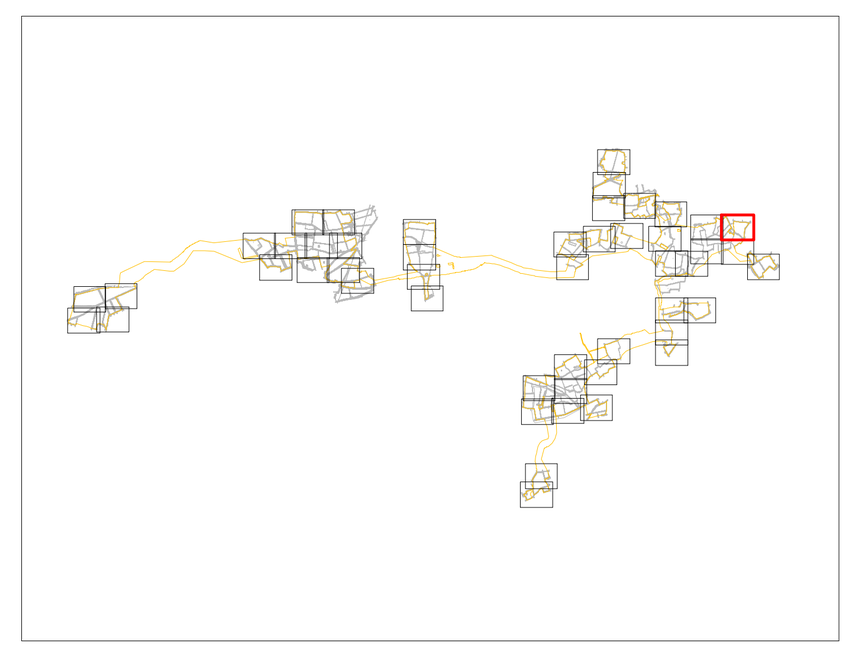

T1

Legend			
T1	Tree or Group Reference Number		Tree Stem Position A Category Tree
	Tree Crown		Tree Stem Position B Category Tree
	Root Protection Area		Tree Stem Position C Category Tree
	Tree Survey Boundary		Tree Stem Position U Category Tree
	Ancient and Veteran Tree/Ancient Woodland Buffer Zone		

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



N
W
E
S
5m 10m 20m 30m 40m 50m

T1

Symbol	Key	Symbol	Key
T1	Tree or Group Reference Number		Tree Stem Position A Category Tree
	Tree Crown		Tree Stem Position B Category Tree
	Root Protection Area		Tree Stem Position C Category Tree
	Tree Survey Boundary		Tree Stem Position U Category Tree
	Ancient and Veteran Tree/Ancient Woodland Buffer Zone		

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



N
W
E
S

5m 10m 20m 30m 40m 50m

T1

Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC


Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

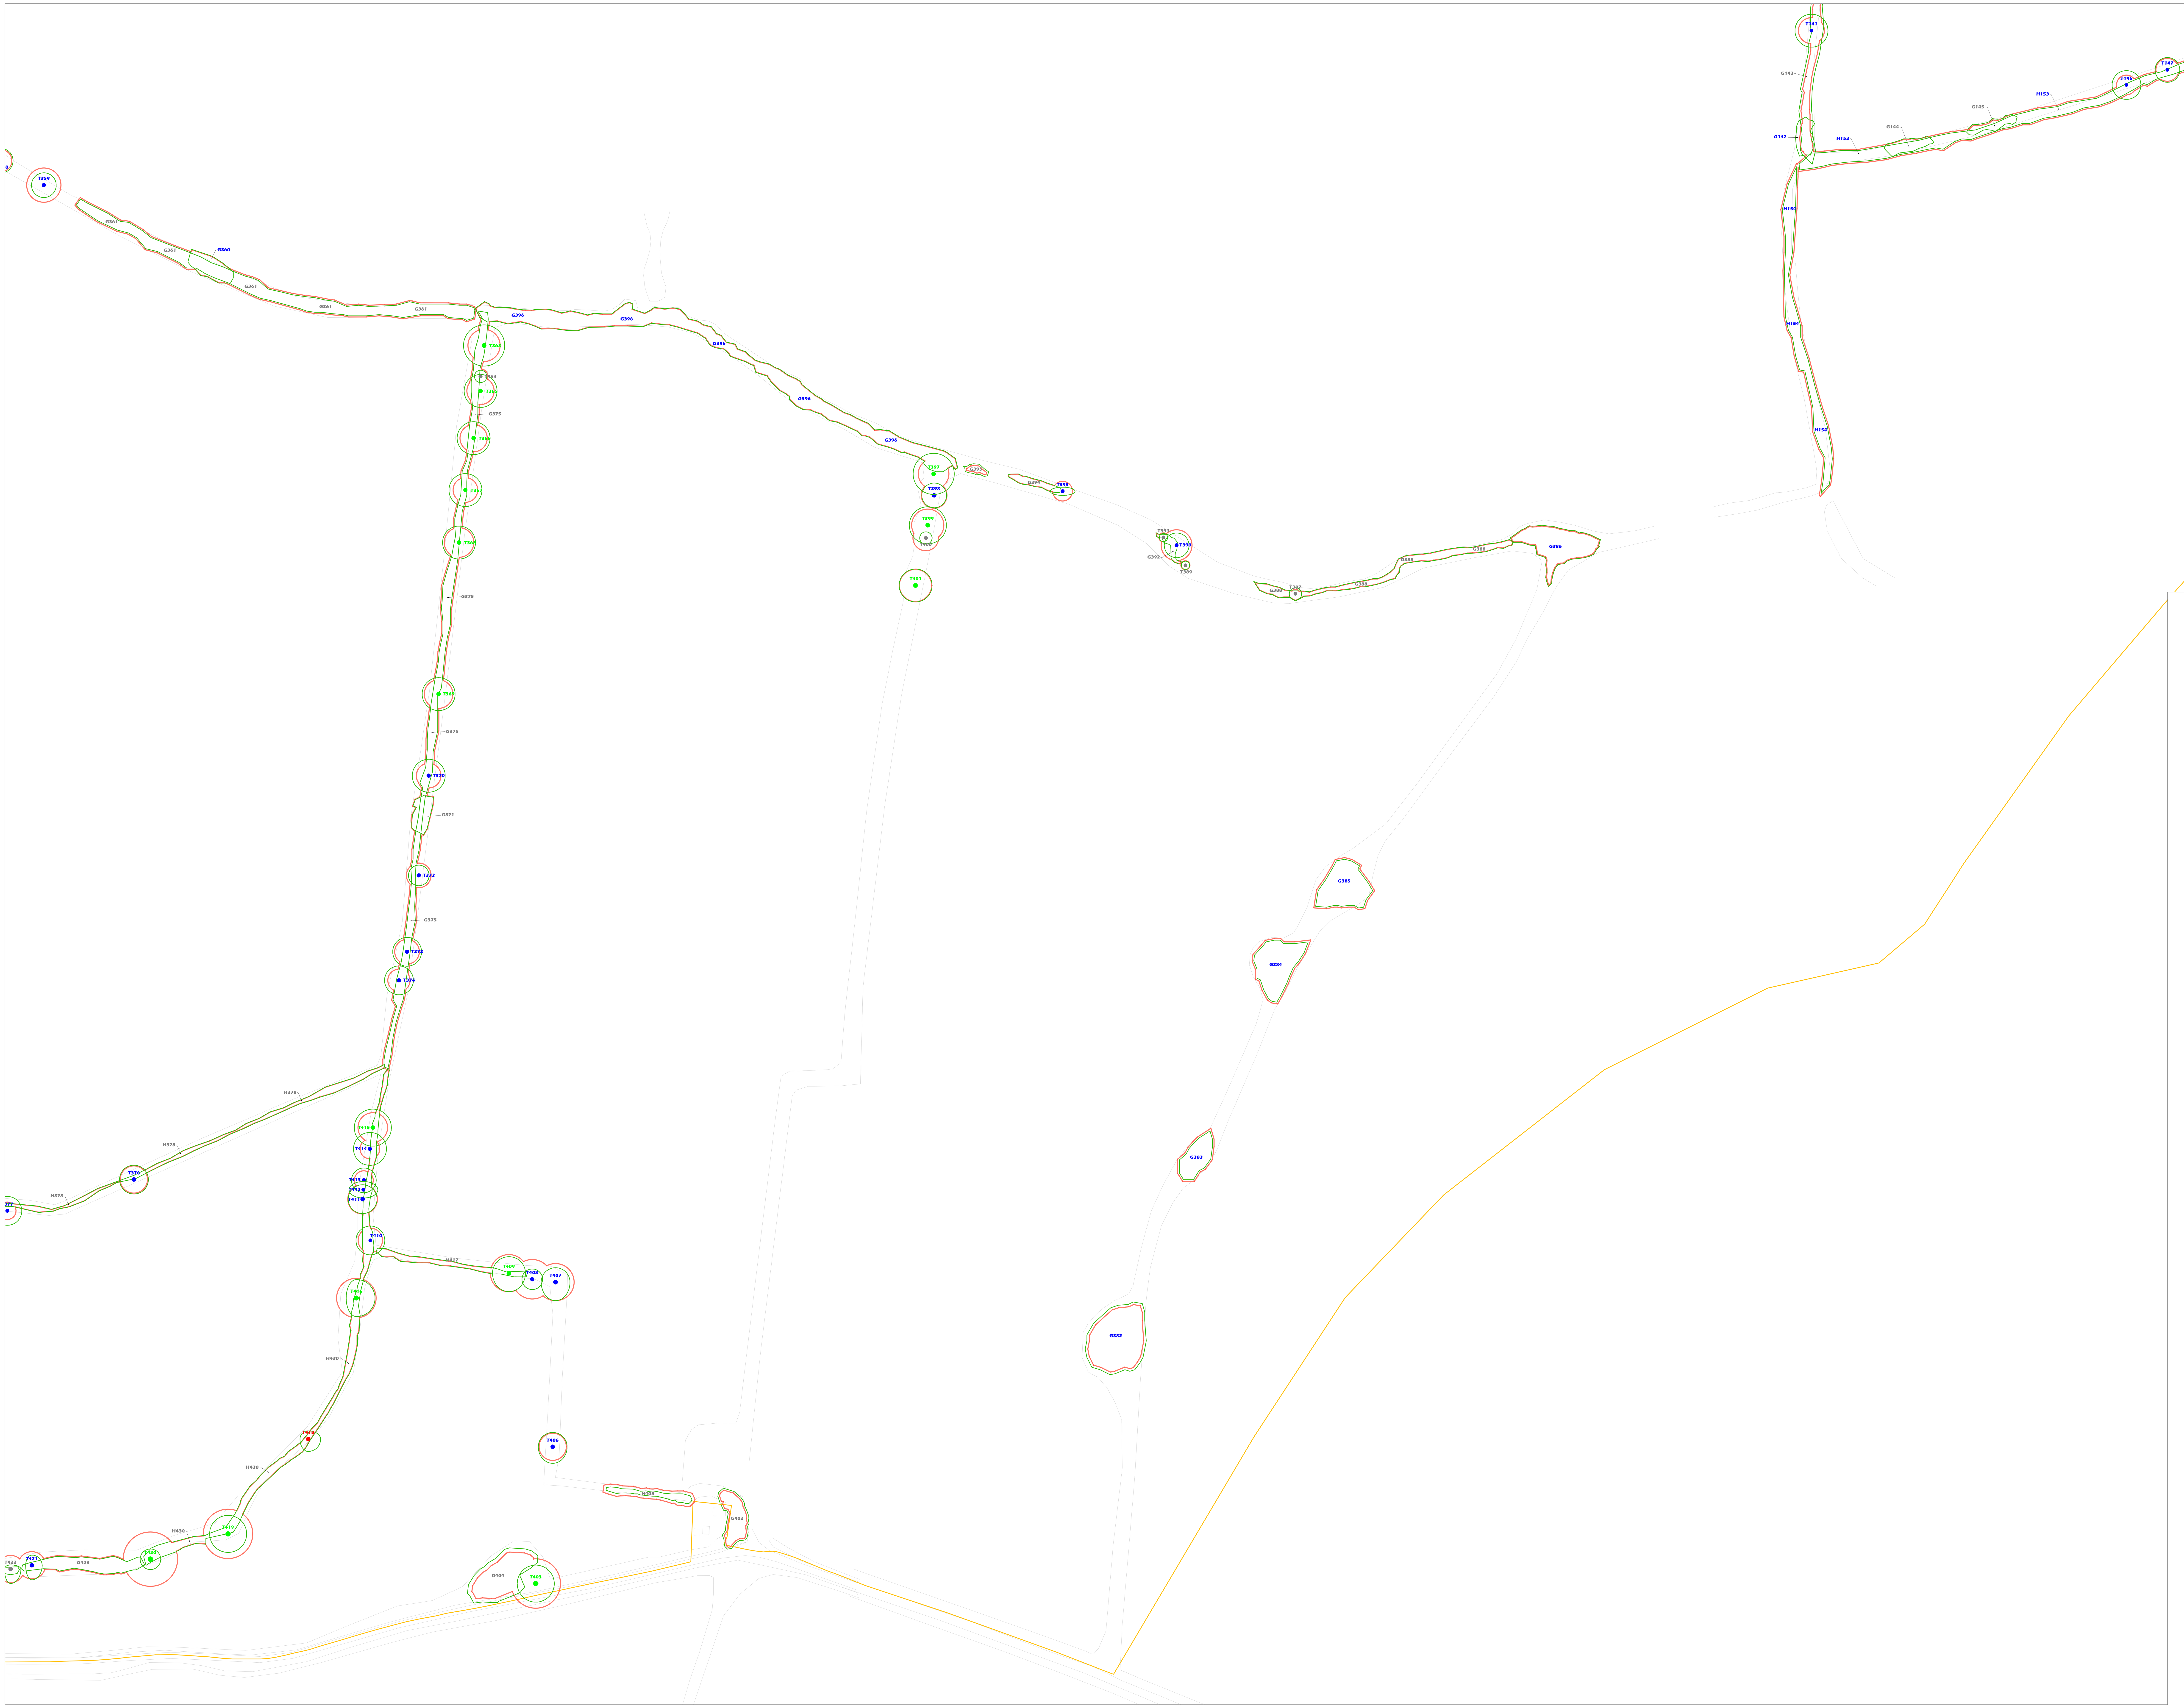

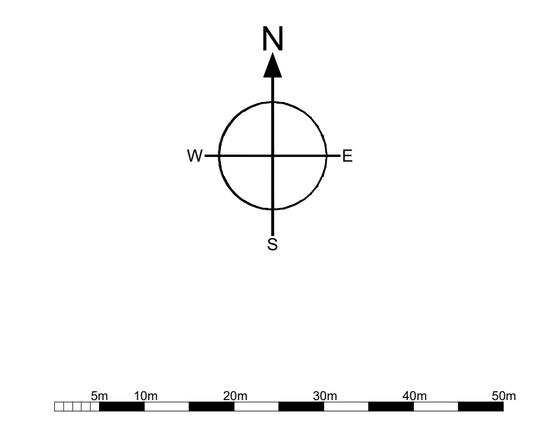

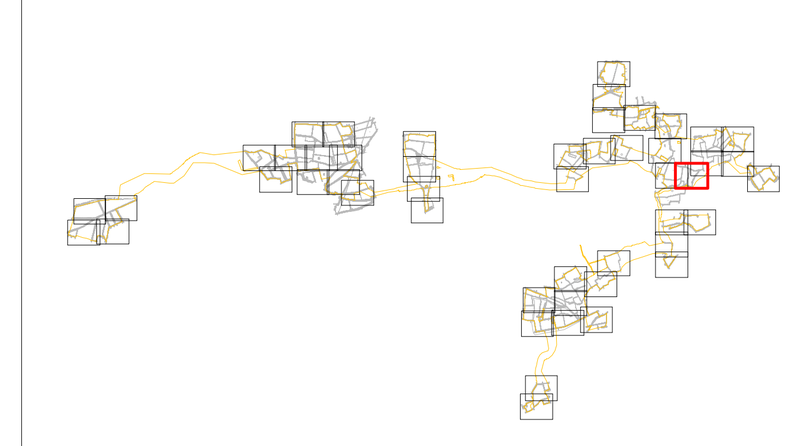

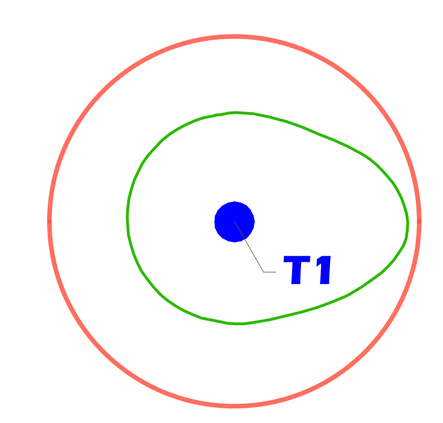

T1 Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

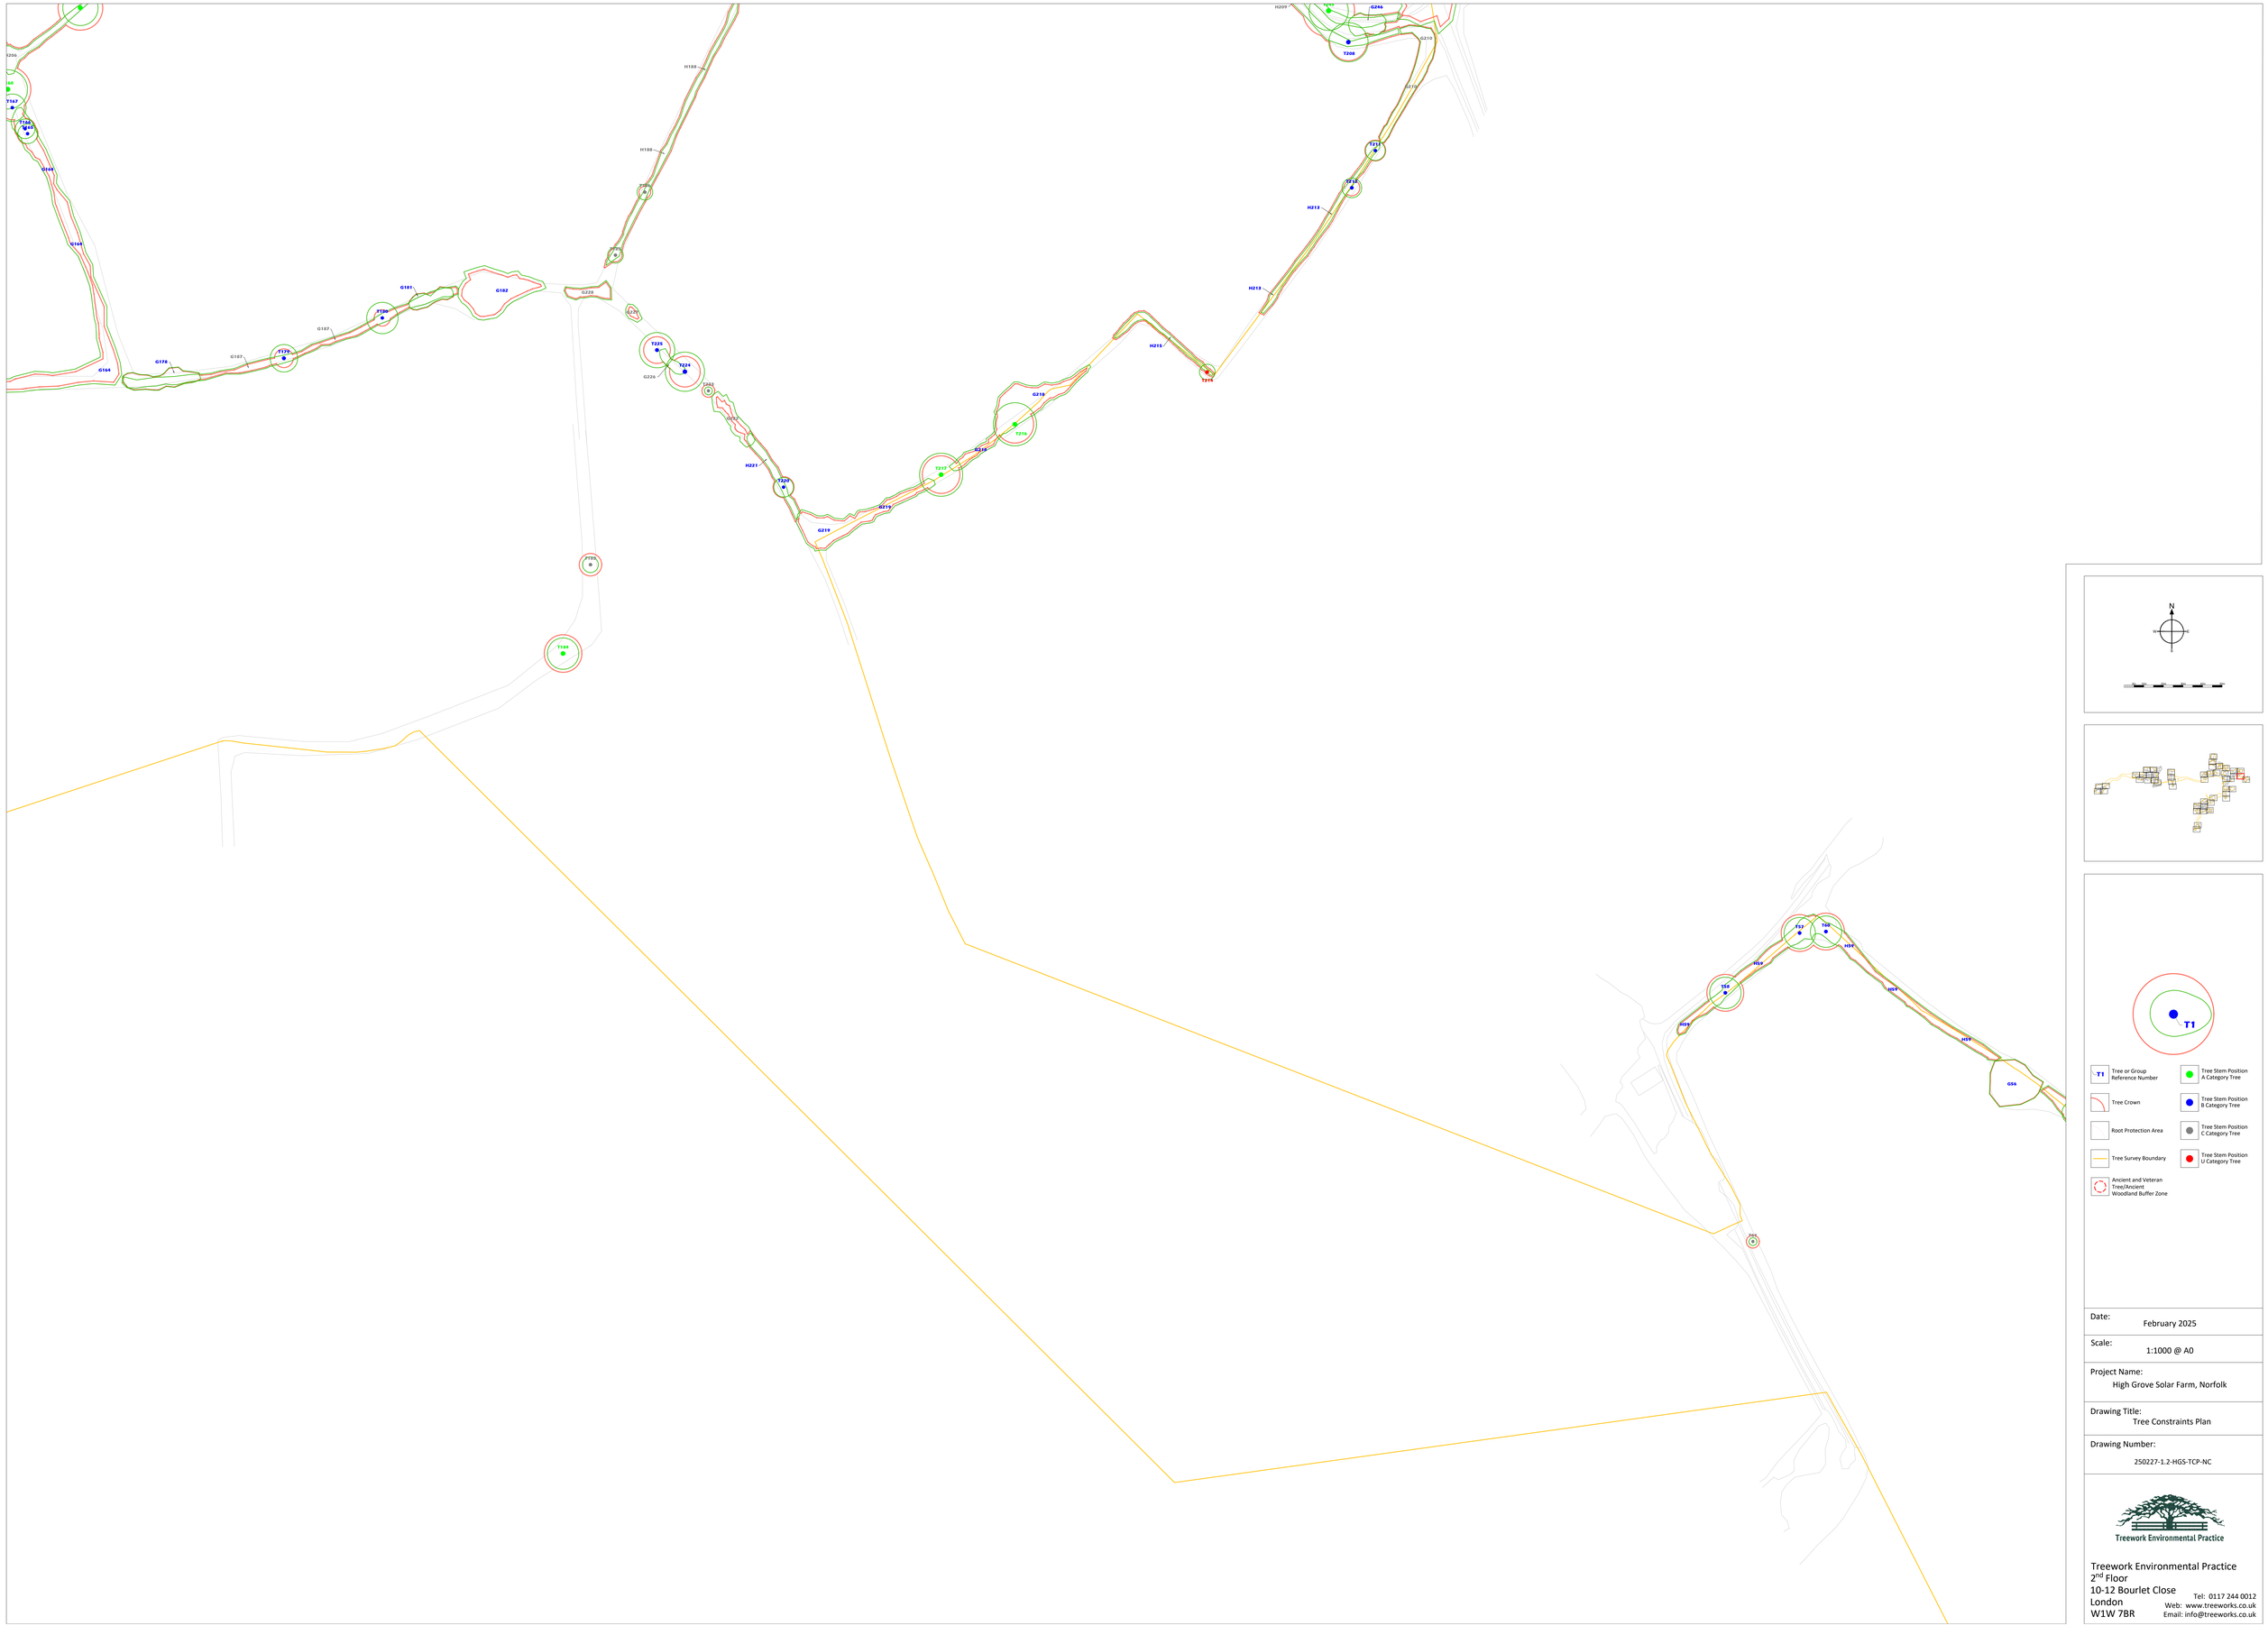

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

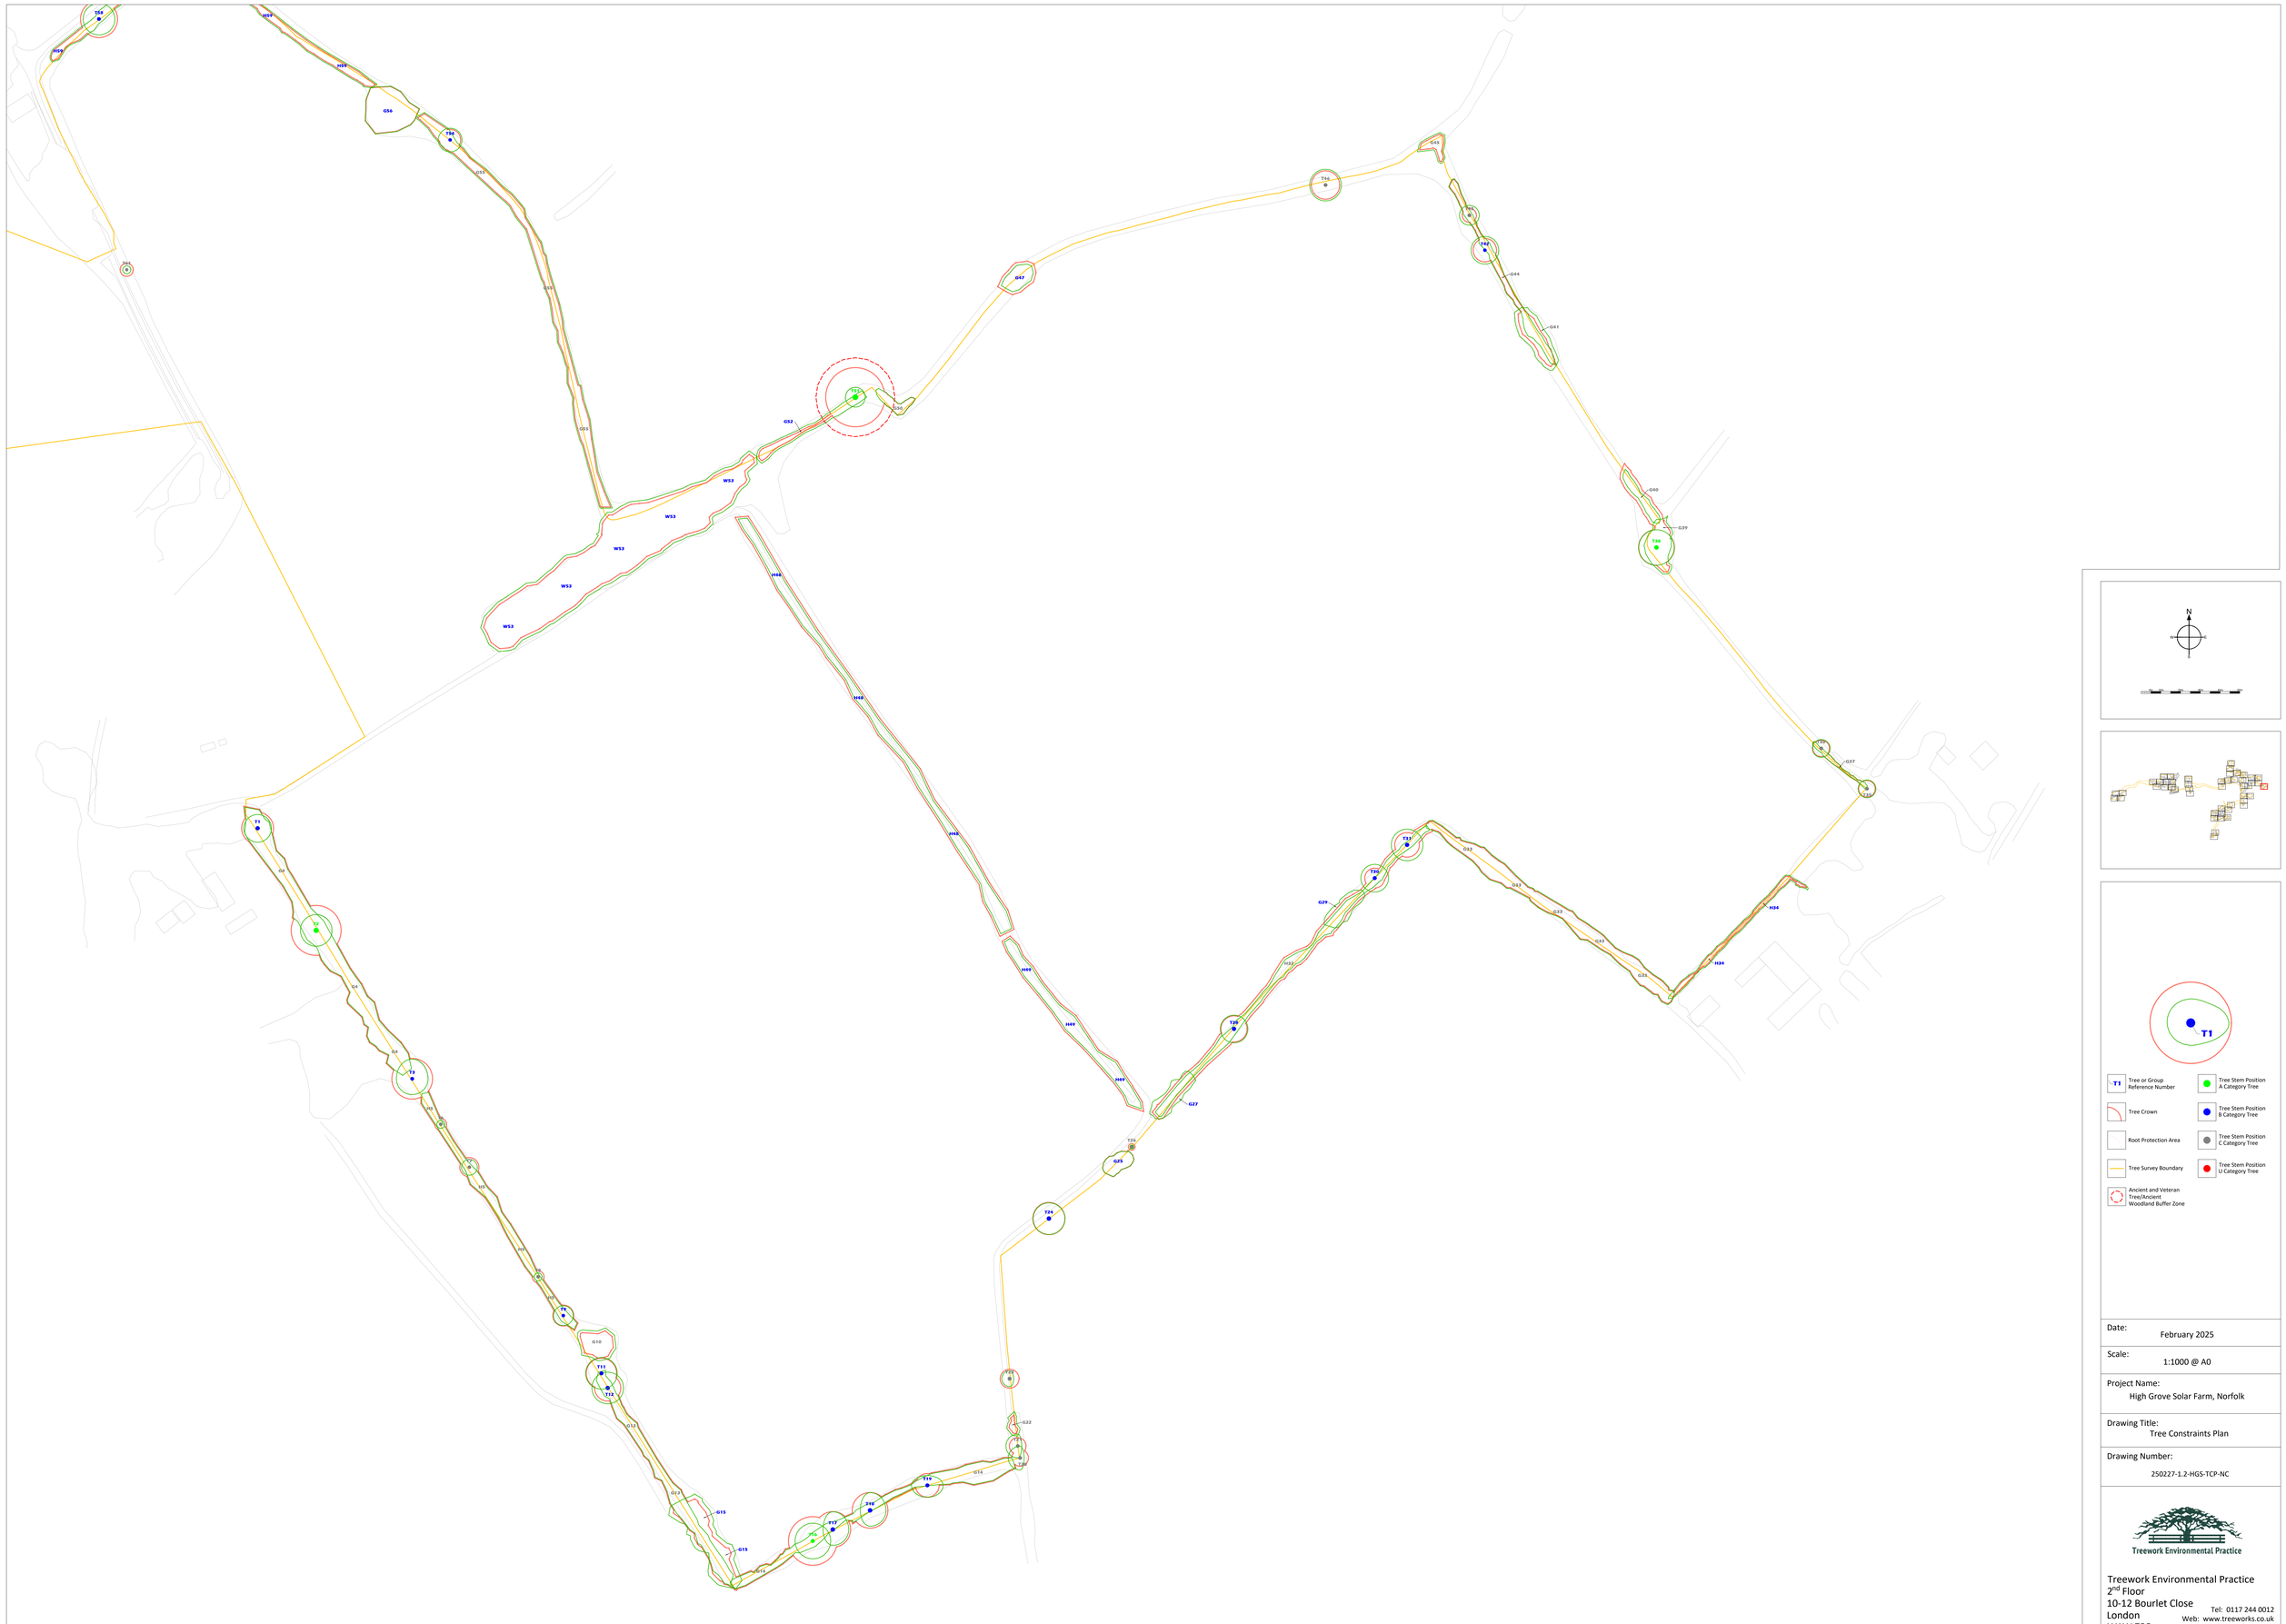


T1 Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	


Date:	February 2025
Scale:	1:1000 @ A0
Project Name:	High Grove Solar Farm, Norfolk
Drawing Title:	Tree Constraints Plan
Drawing Number:	250227-1.2-HGS-TCP-NC


Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR


Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

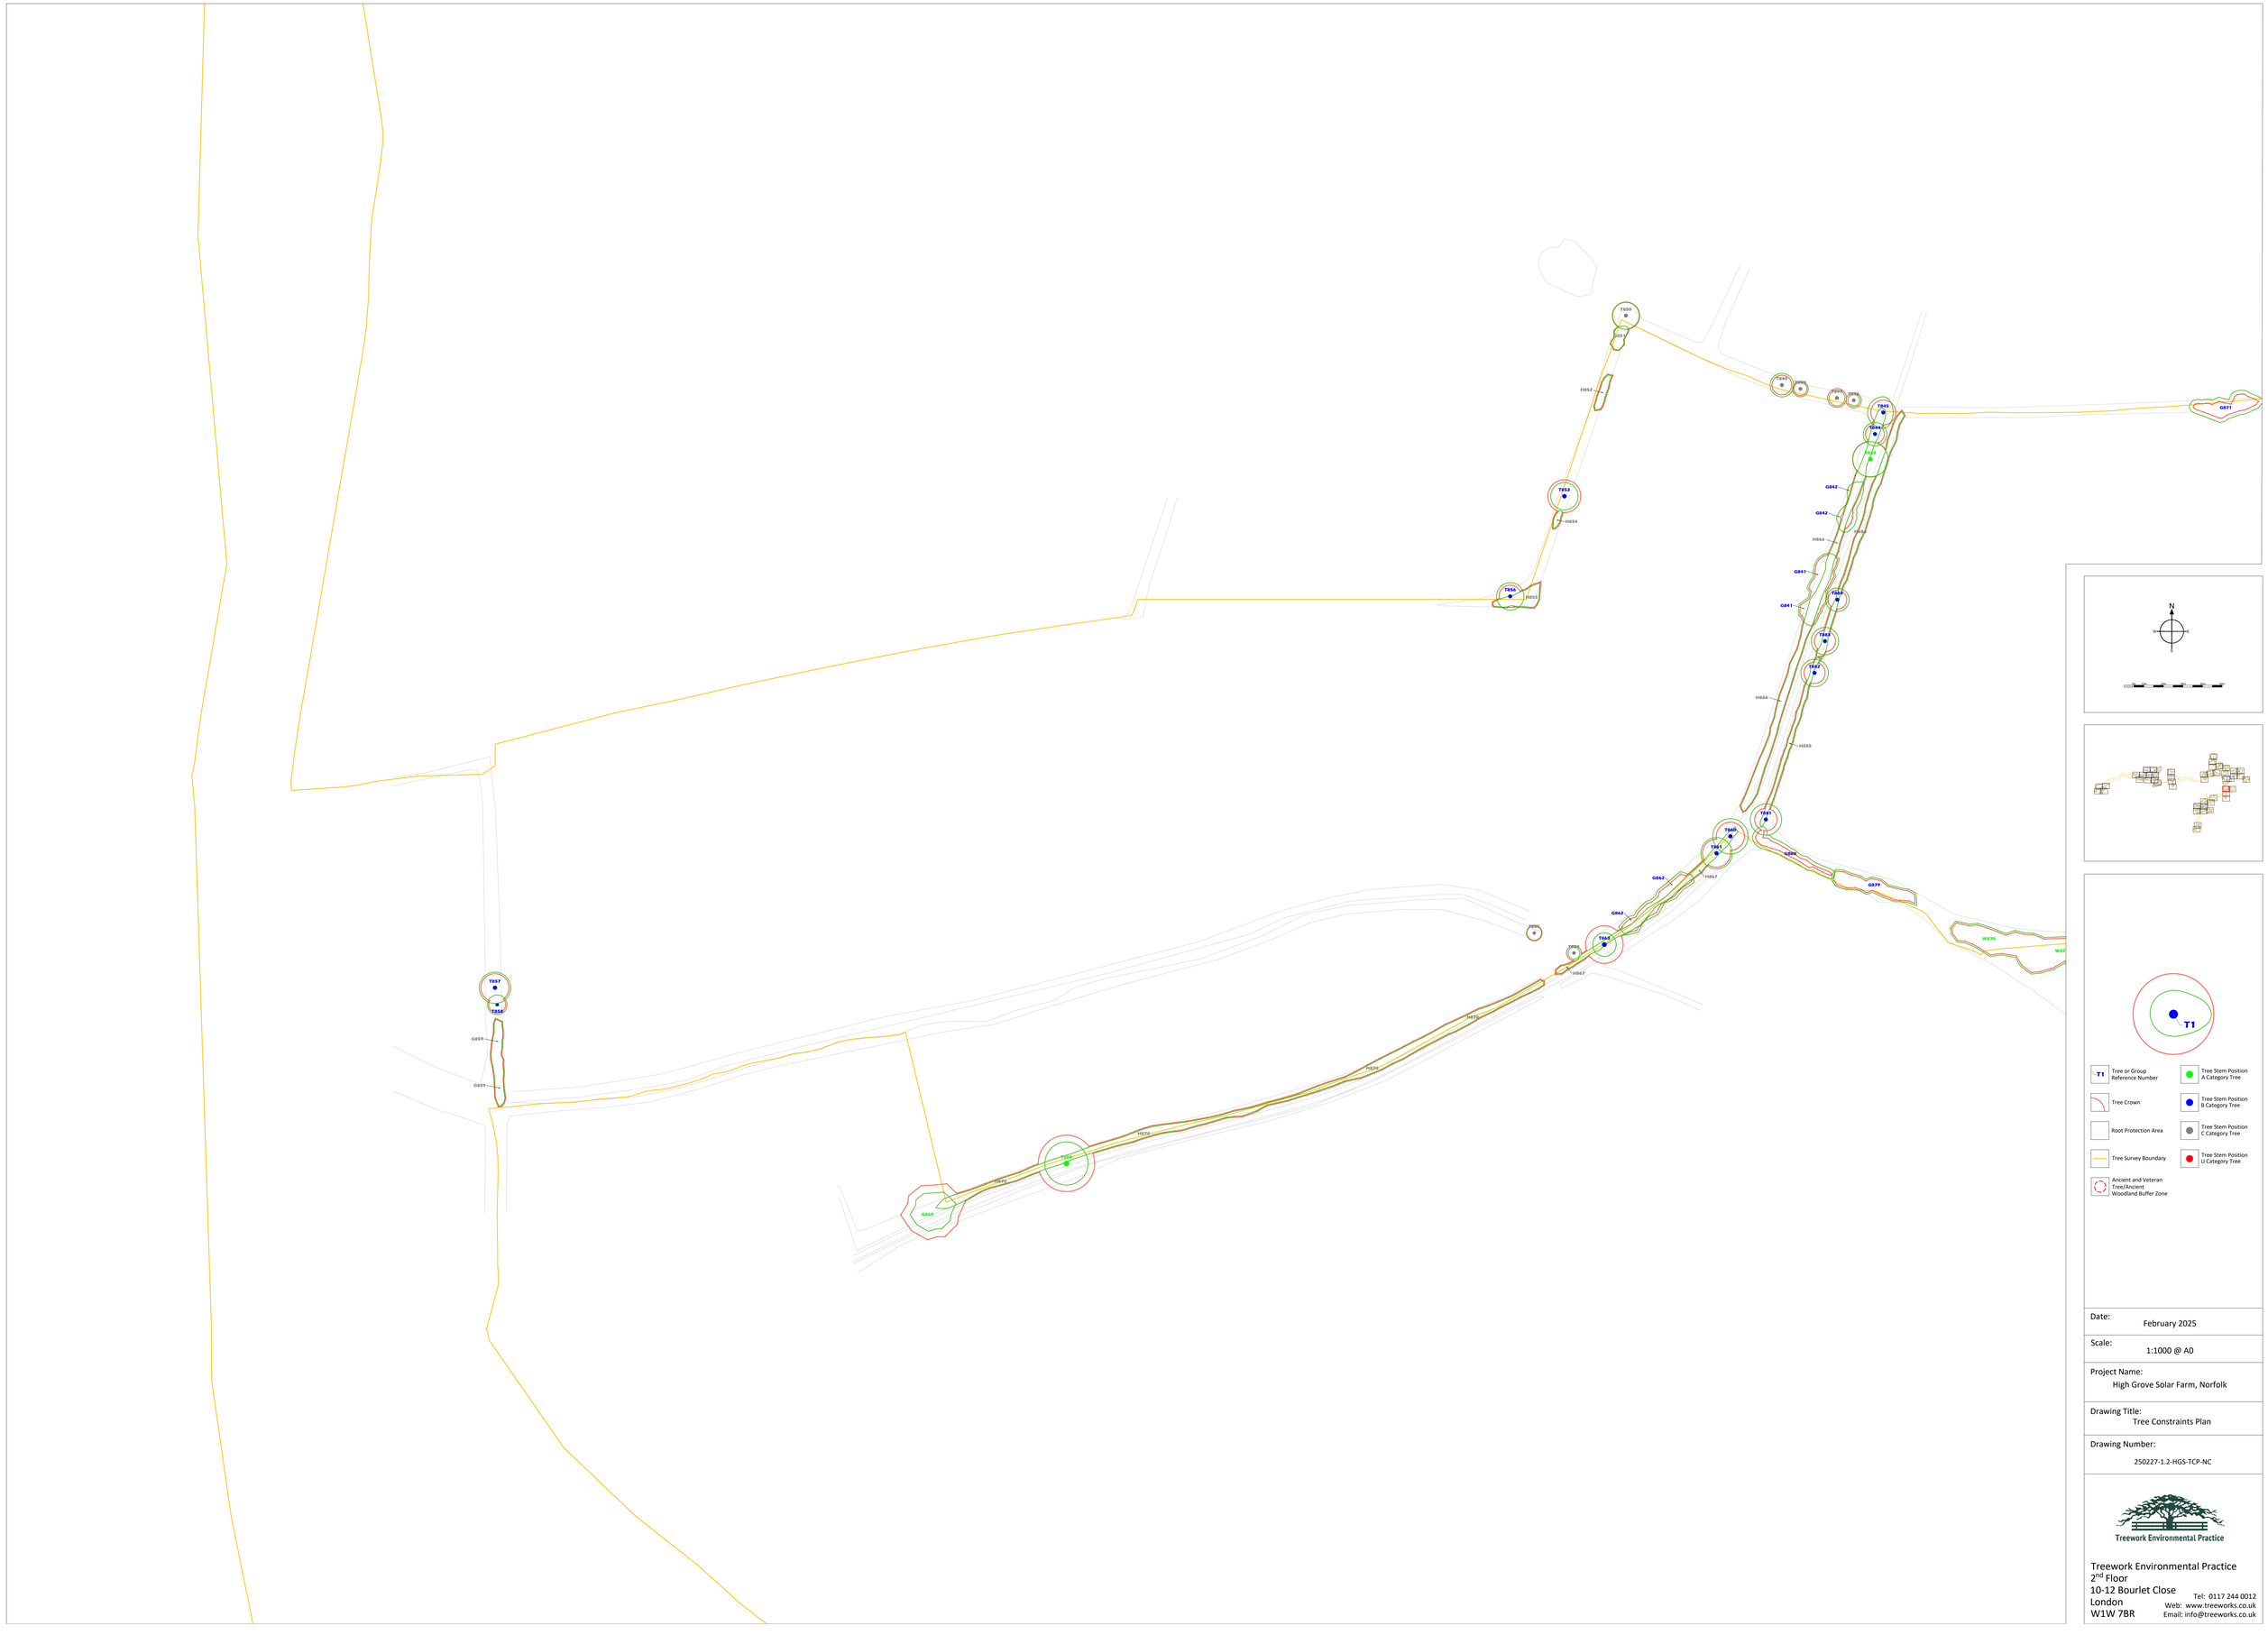
T850
H851
H852
T857
H856
T855
T854
T853
G871
H854
T852
G842
G842
H856
H855
G841
T851
G841
T849
T848
T847
H856
H855
T845
T846
T844
T843
G862
G862
H867
H867
G879
W878
W87
T857
T858
G859
G859
H858
H857
T842
G869
H858
H857
T841
T840
G862
T839
G862
H867
H867
G879
W878
W87
T1
Tree or Group Reference Number
Tree Crown
Root Protection Area
Tree Survey Boundary
Ancient and Veteran Tree/Ancient Woodland Buffer Zone
Tree Stem Position A Category Tree
Tree Stem Position B Category Tree
Tree Stem Position C Category Tree
Tree Stem Position U Category Tree
N
W
E
Date:
February 2025
Scale:
1:1000 @ A0
Project Name:
High Grove Solar Farm, Norfolk
Drawing Title:
Tree Constraints Plan
Drawing Number:
250227-1.2-HGS-TCP-NC
Treework Environmental Practice
Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

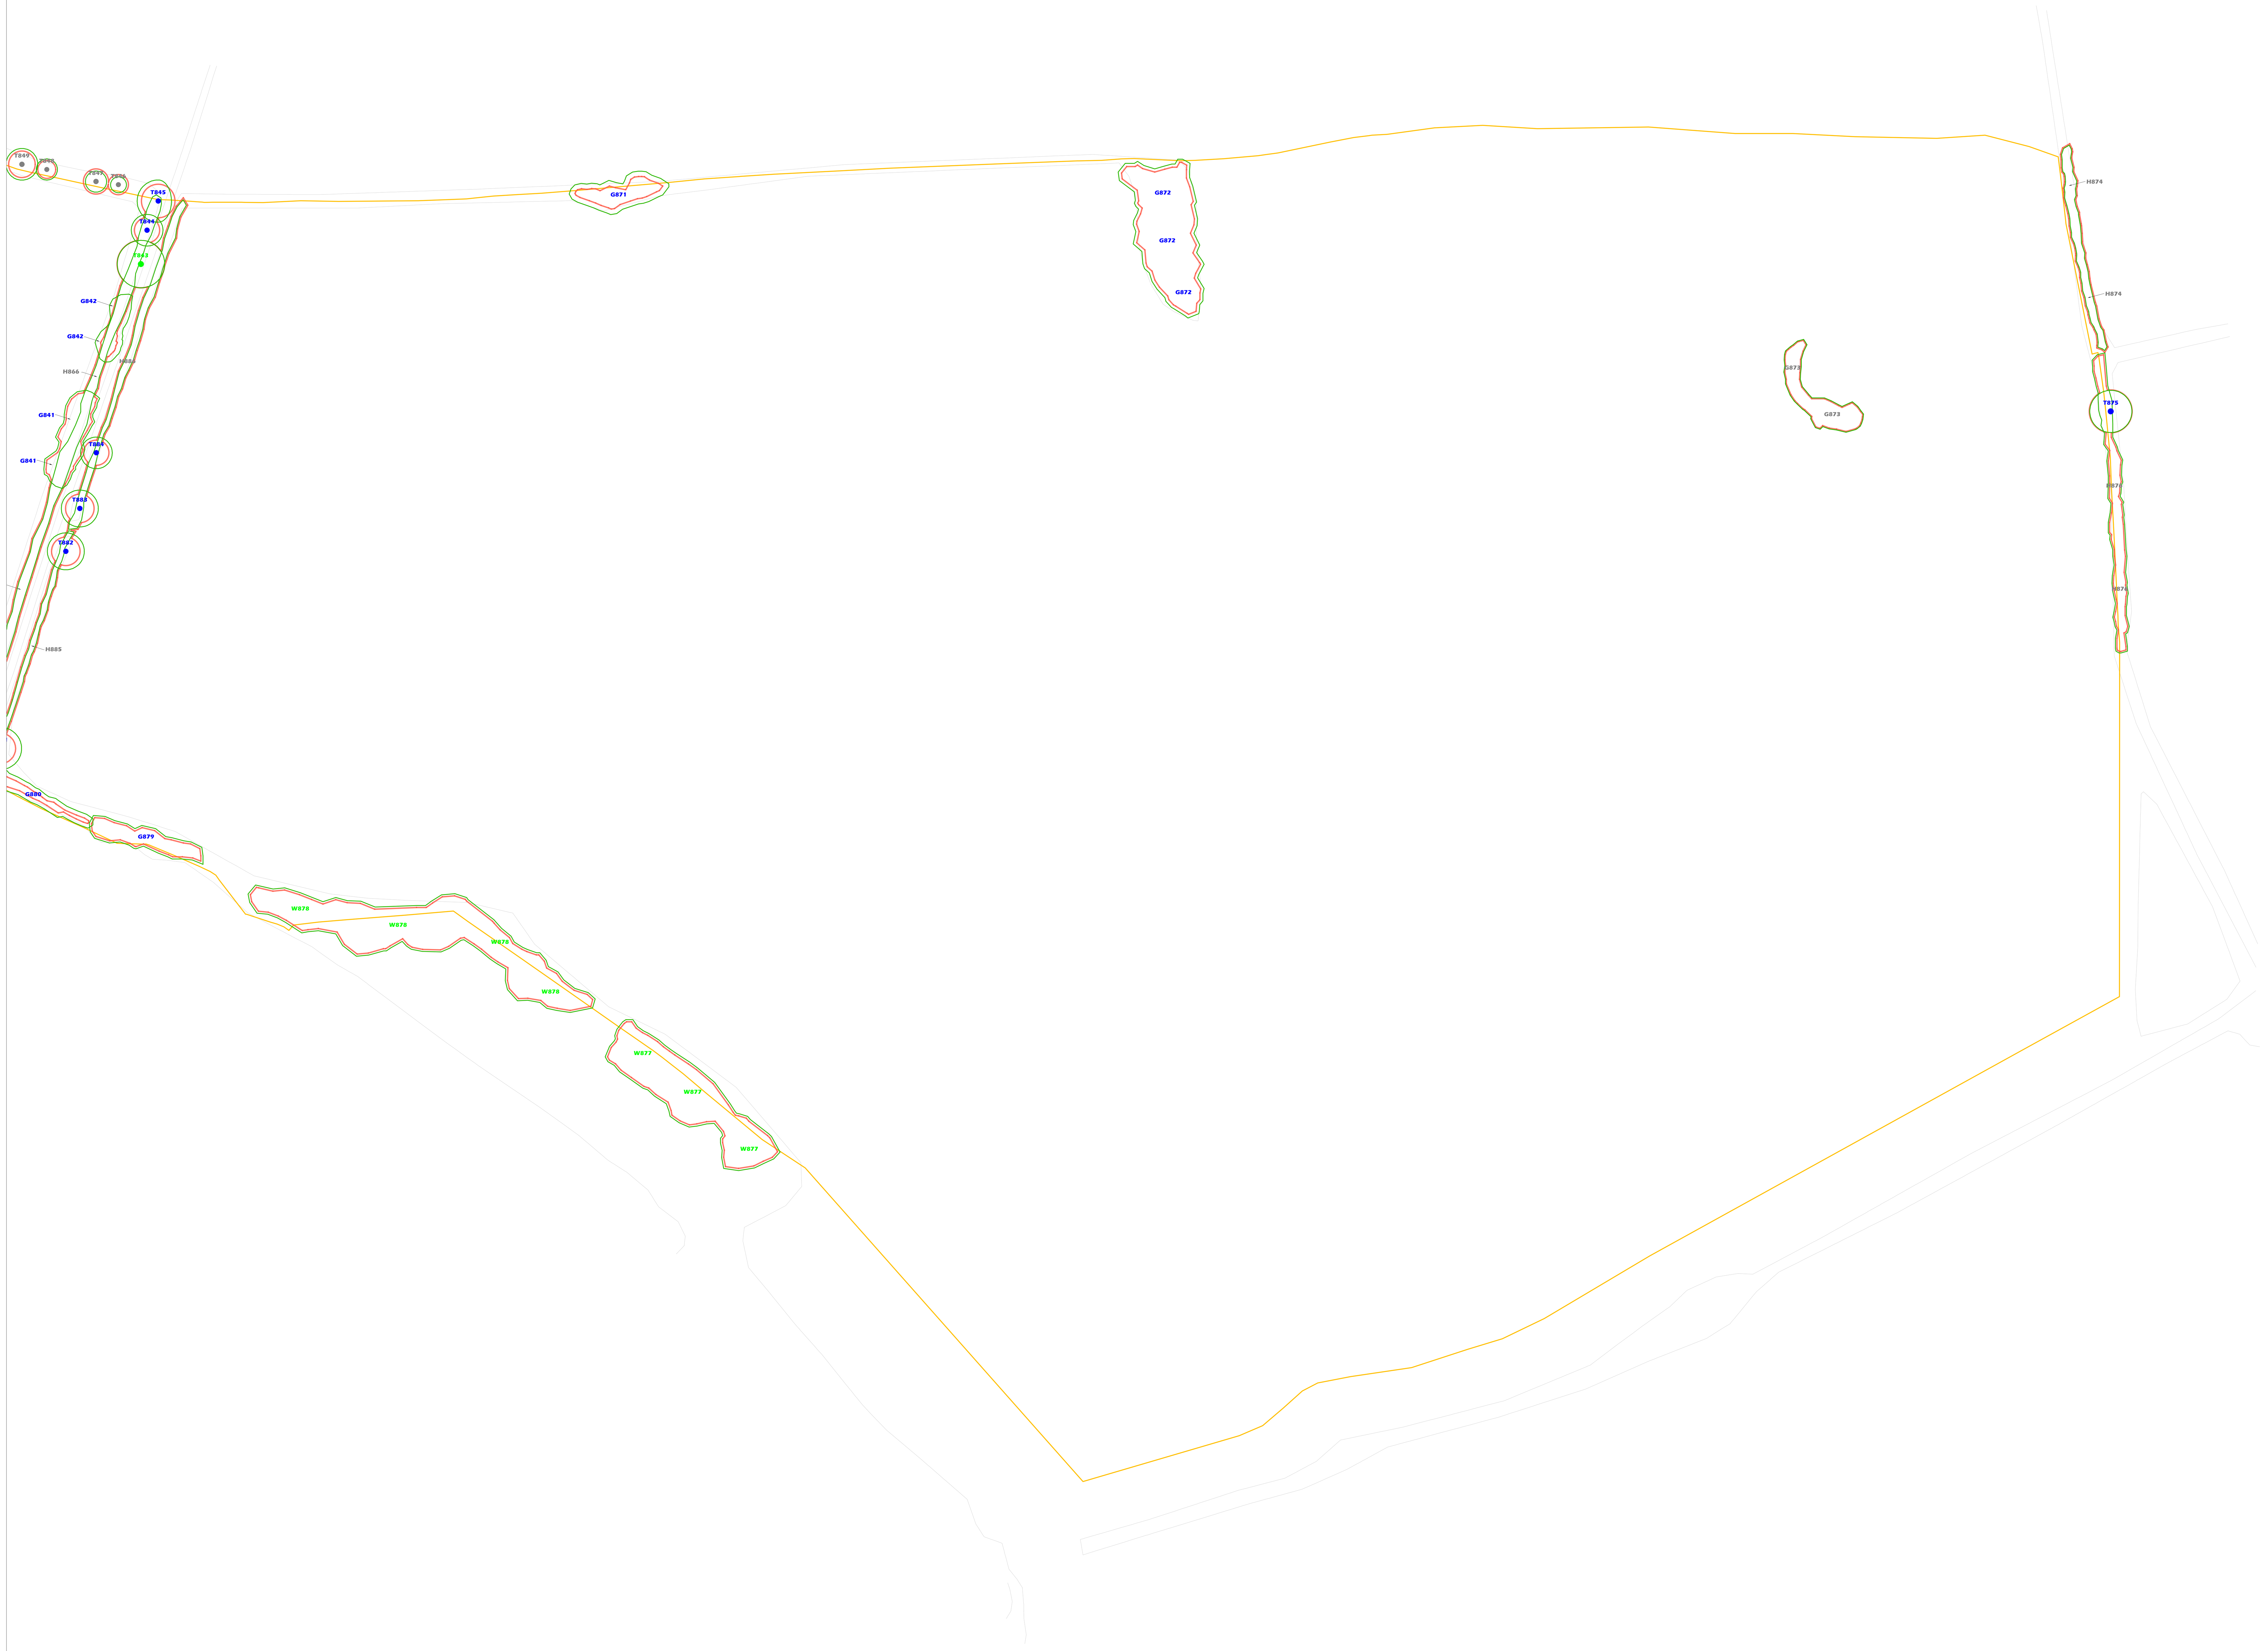

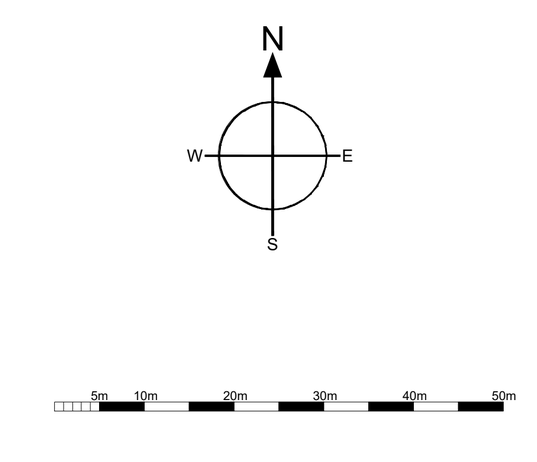

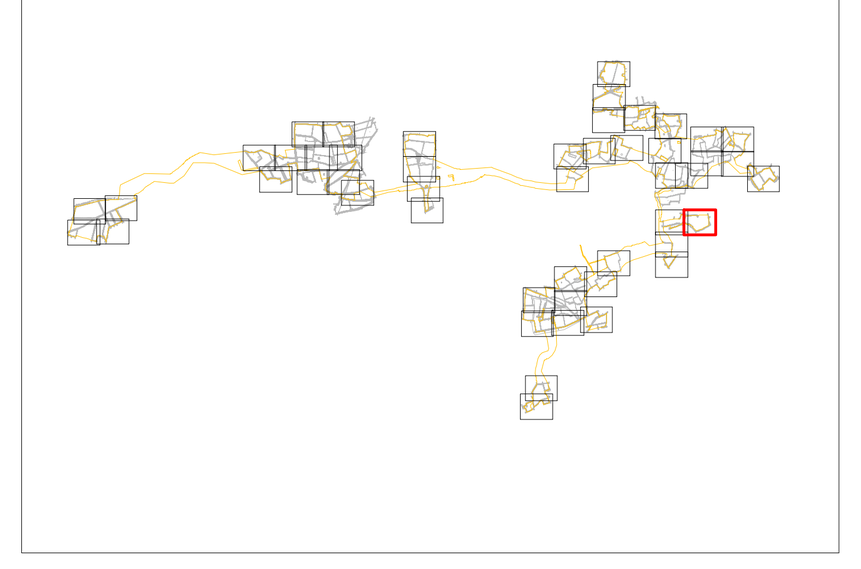

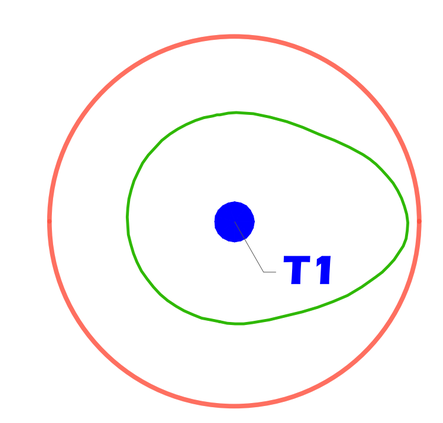

Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025


Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

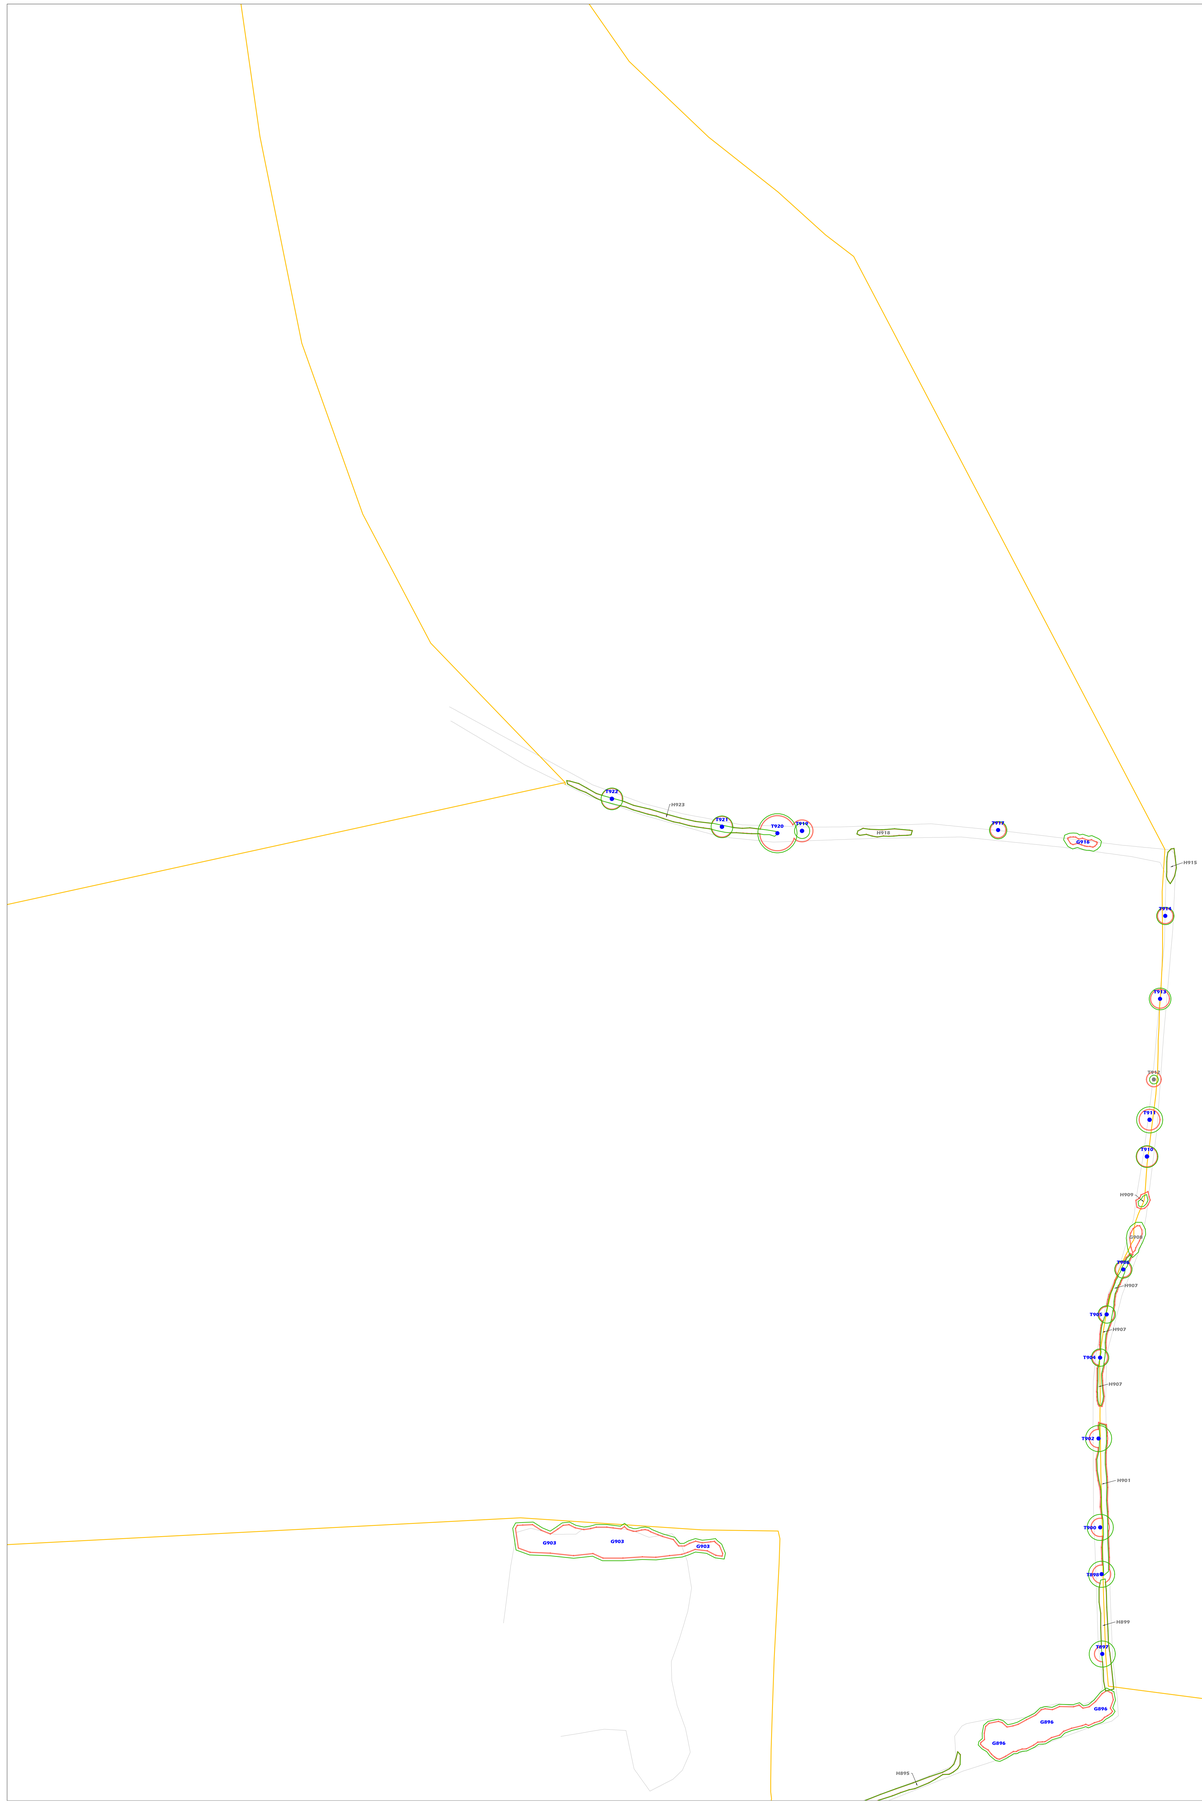

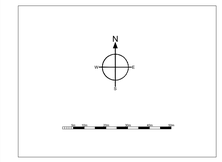

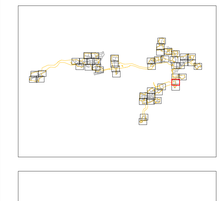



T1 Tree or Group Reference Number

Tree Crown

Root Protection Area

Tree Survey Boundary

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC


Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

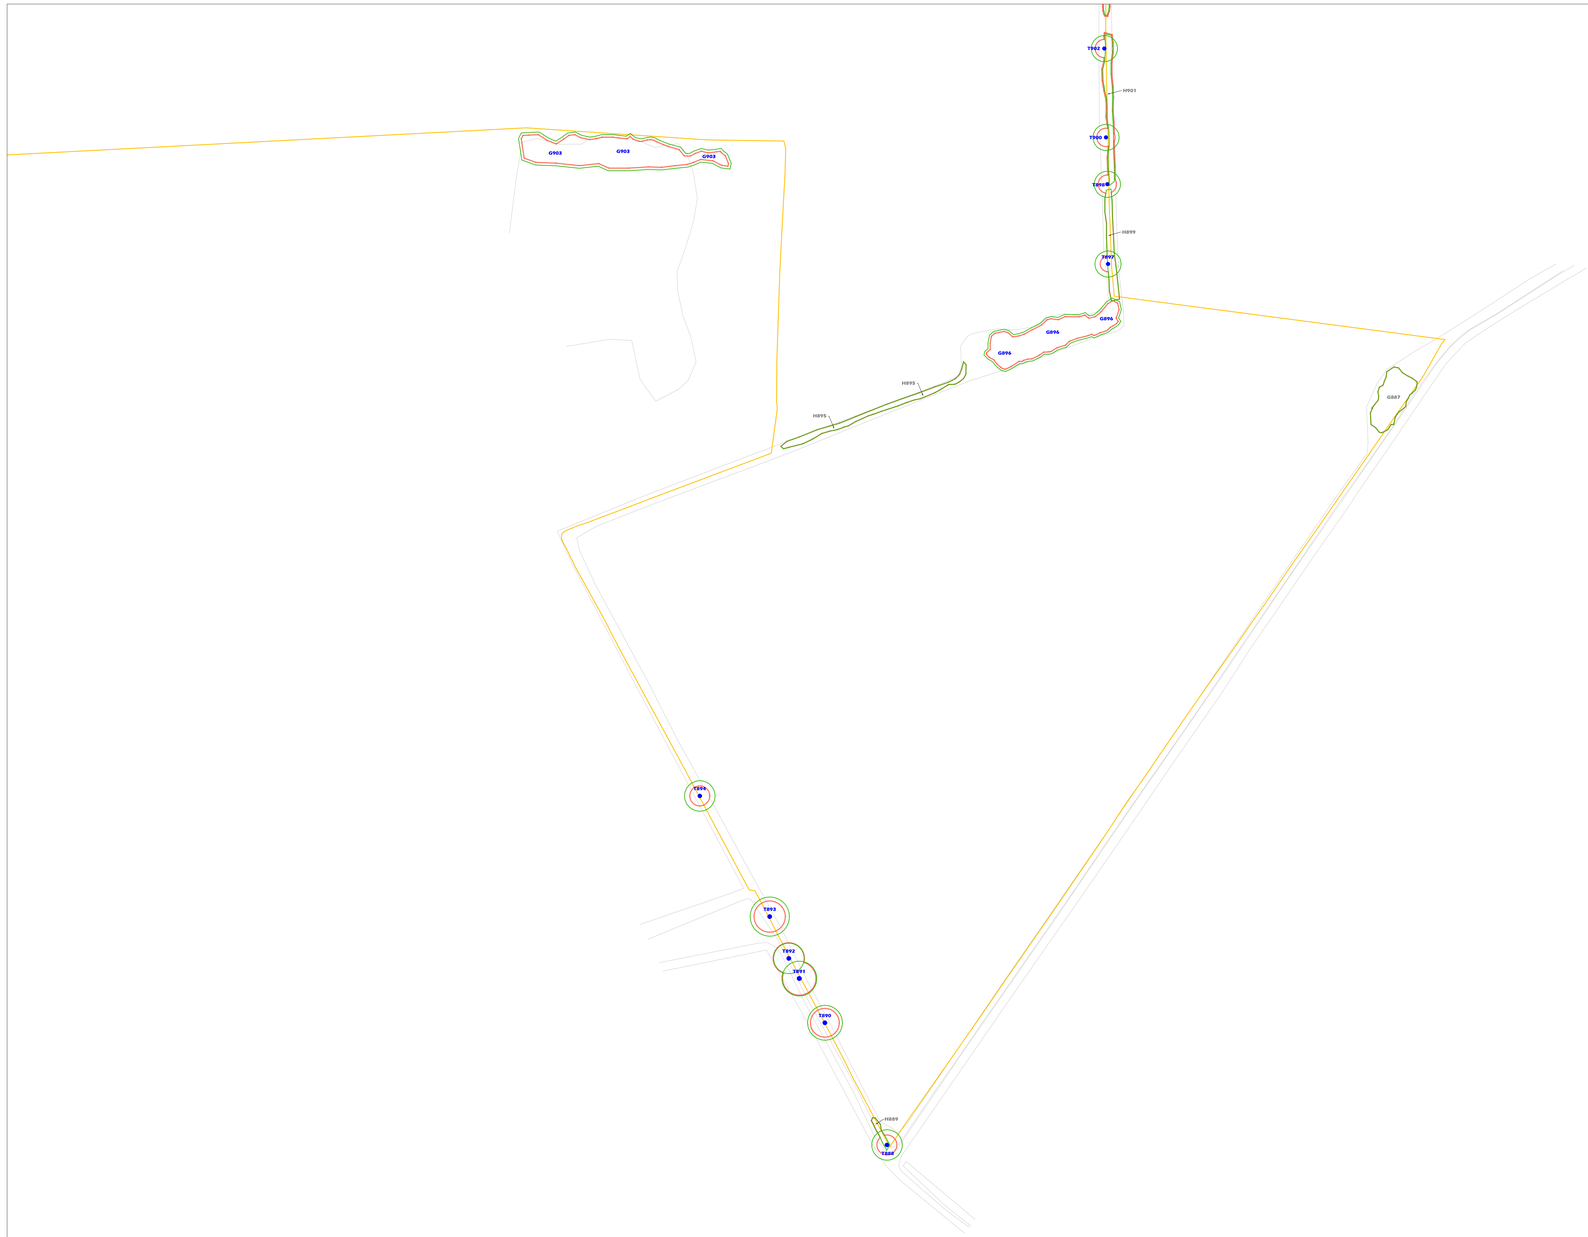

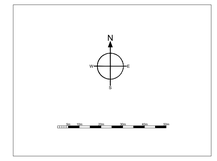





T1 Tree or Group Reference Number

Tree Crown

Root Protection Area

Tree Survey Boundary

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC


Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

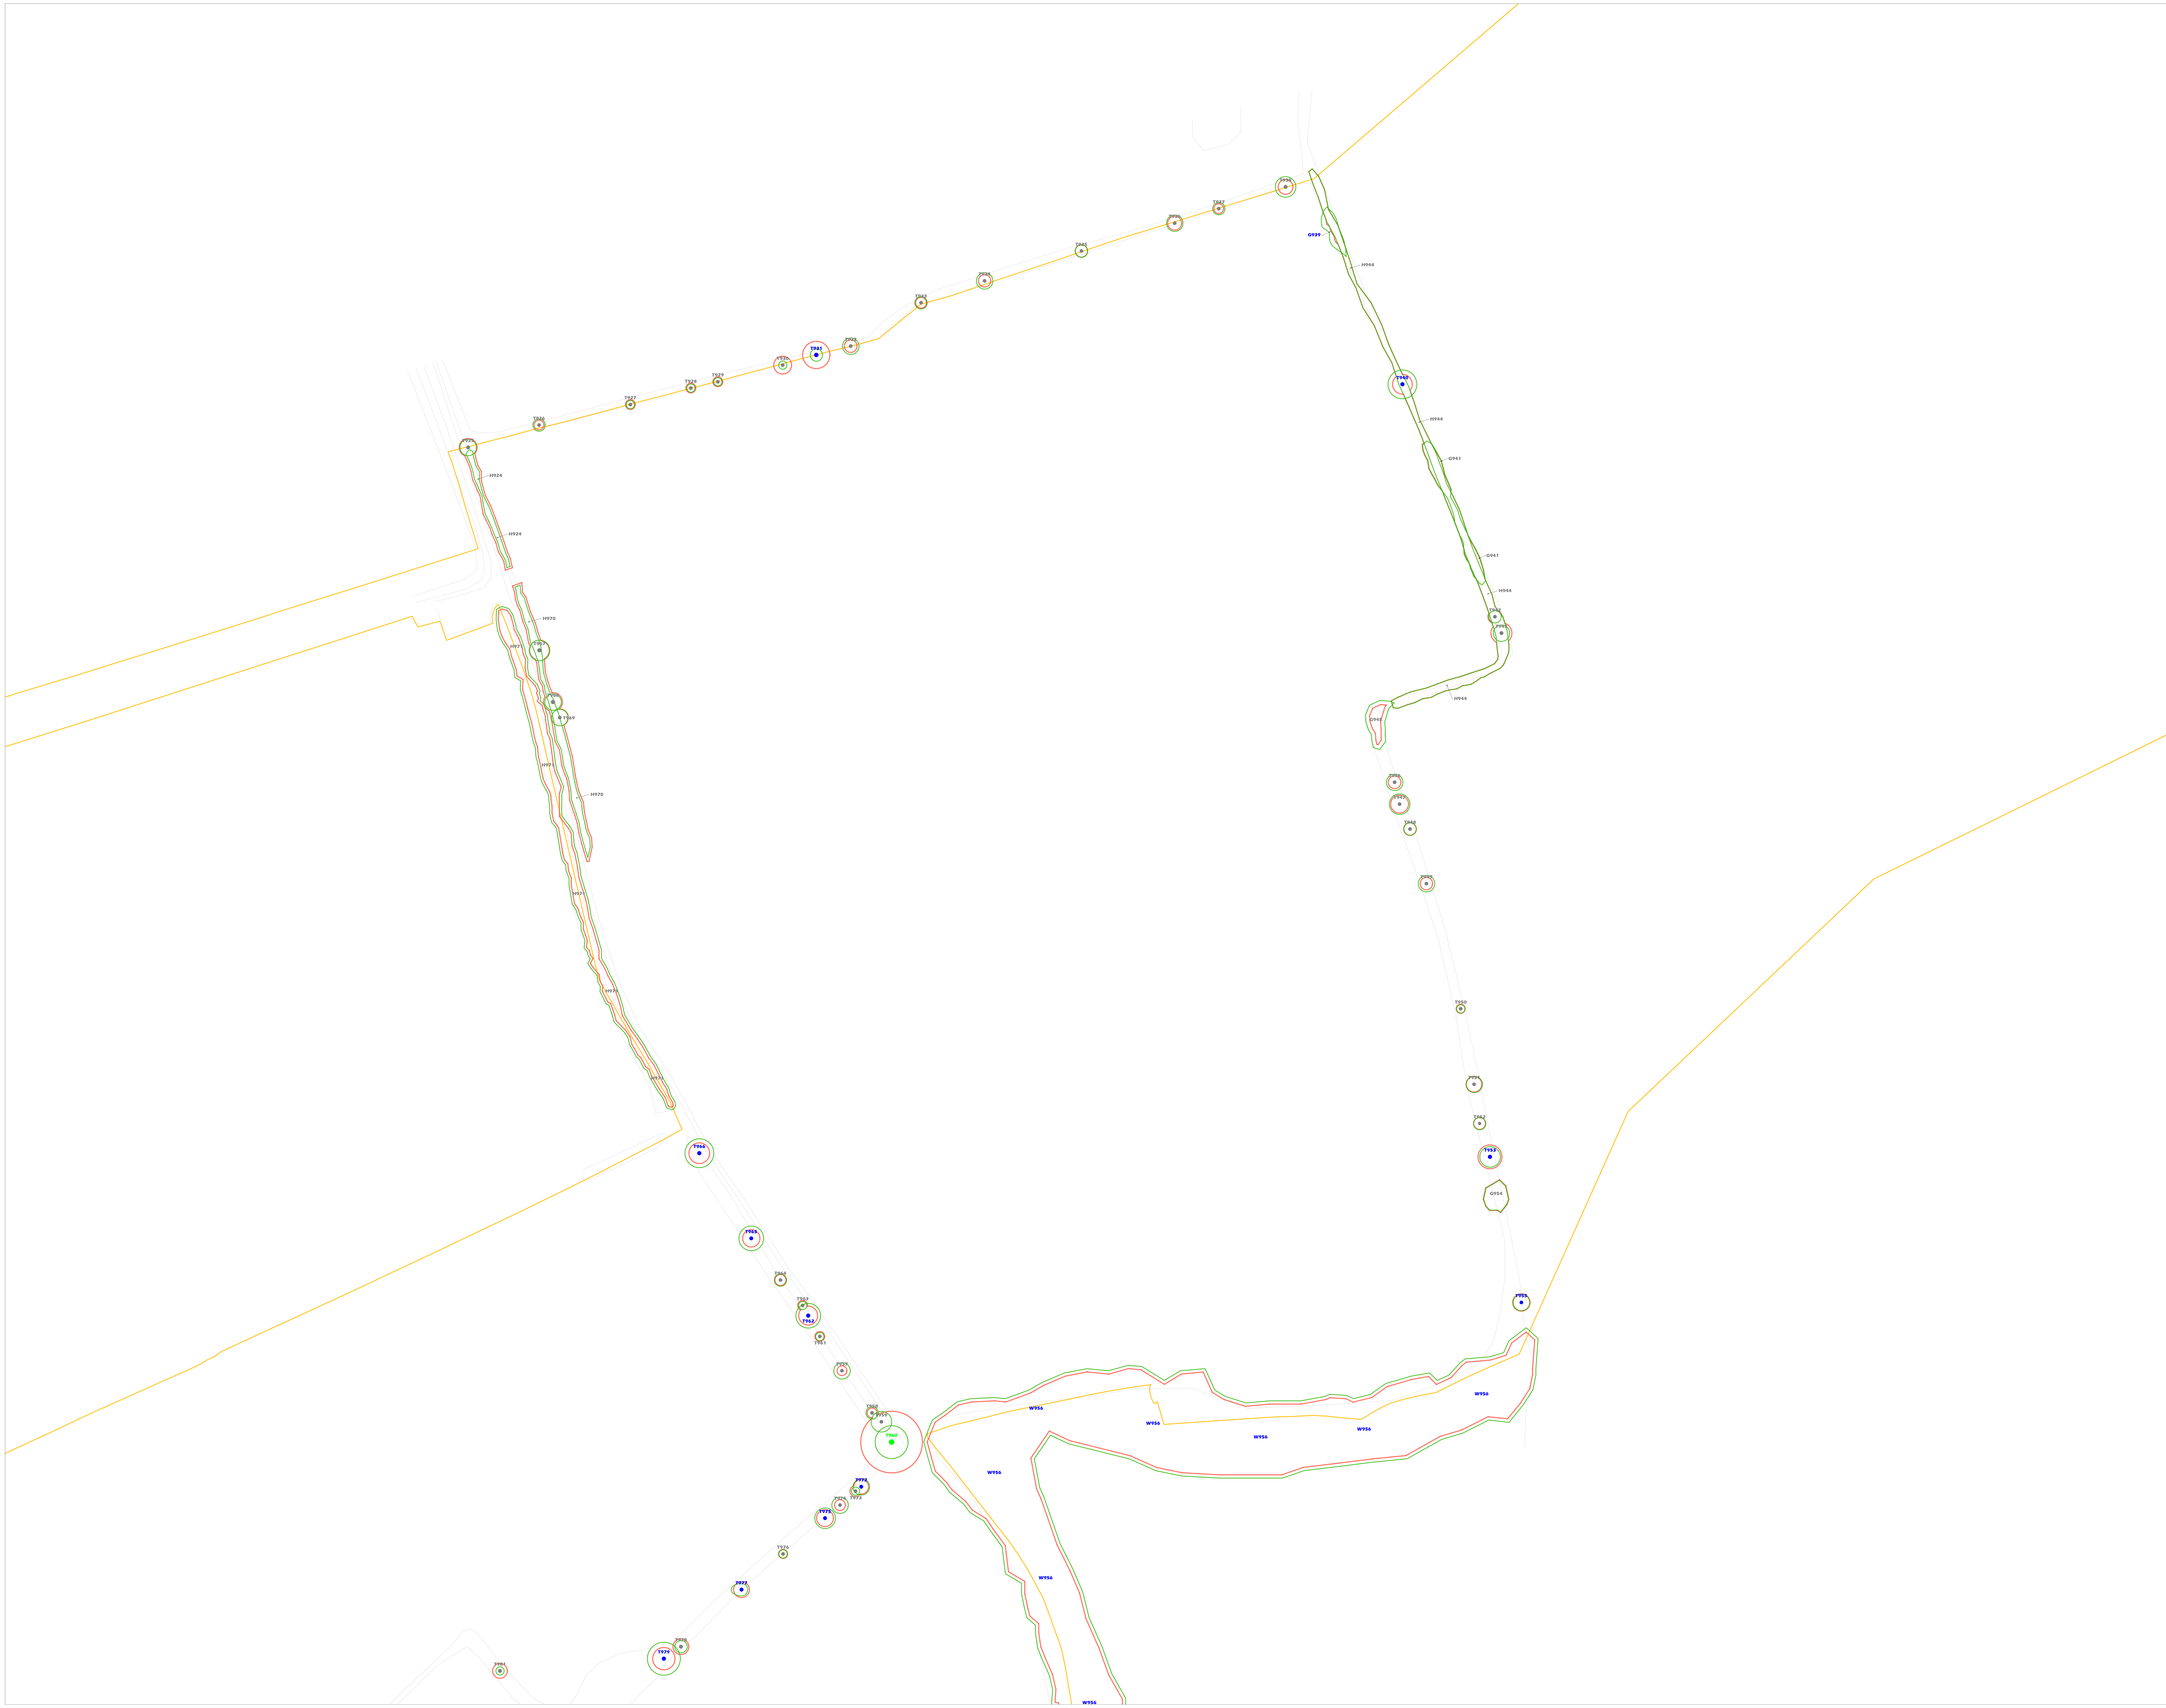

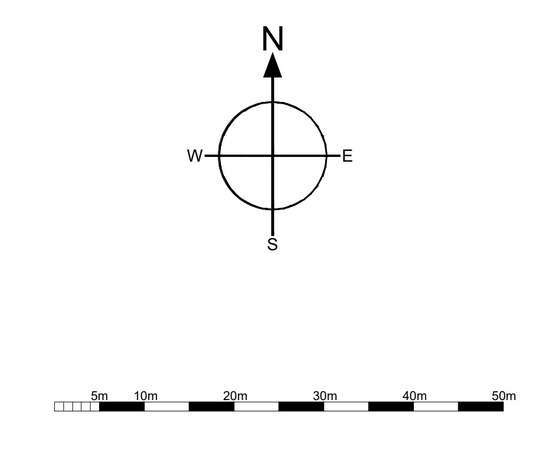

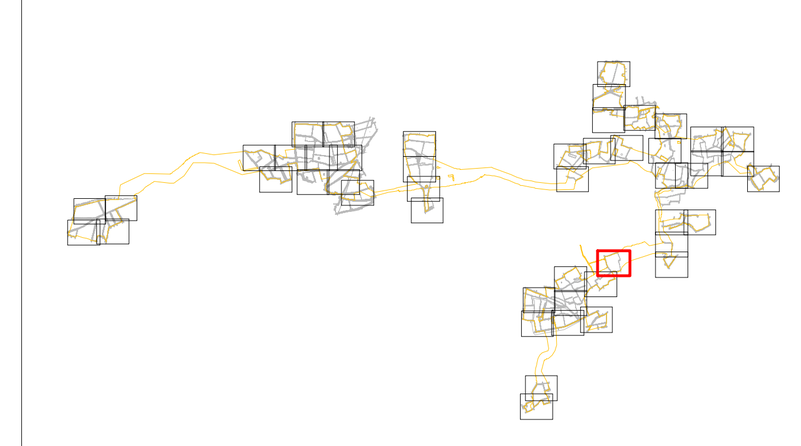

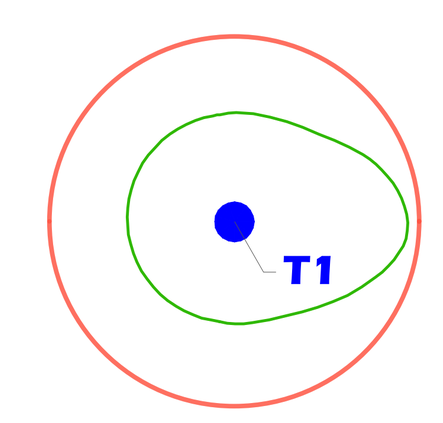

T1 Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

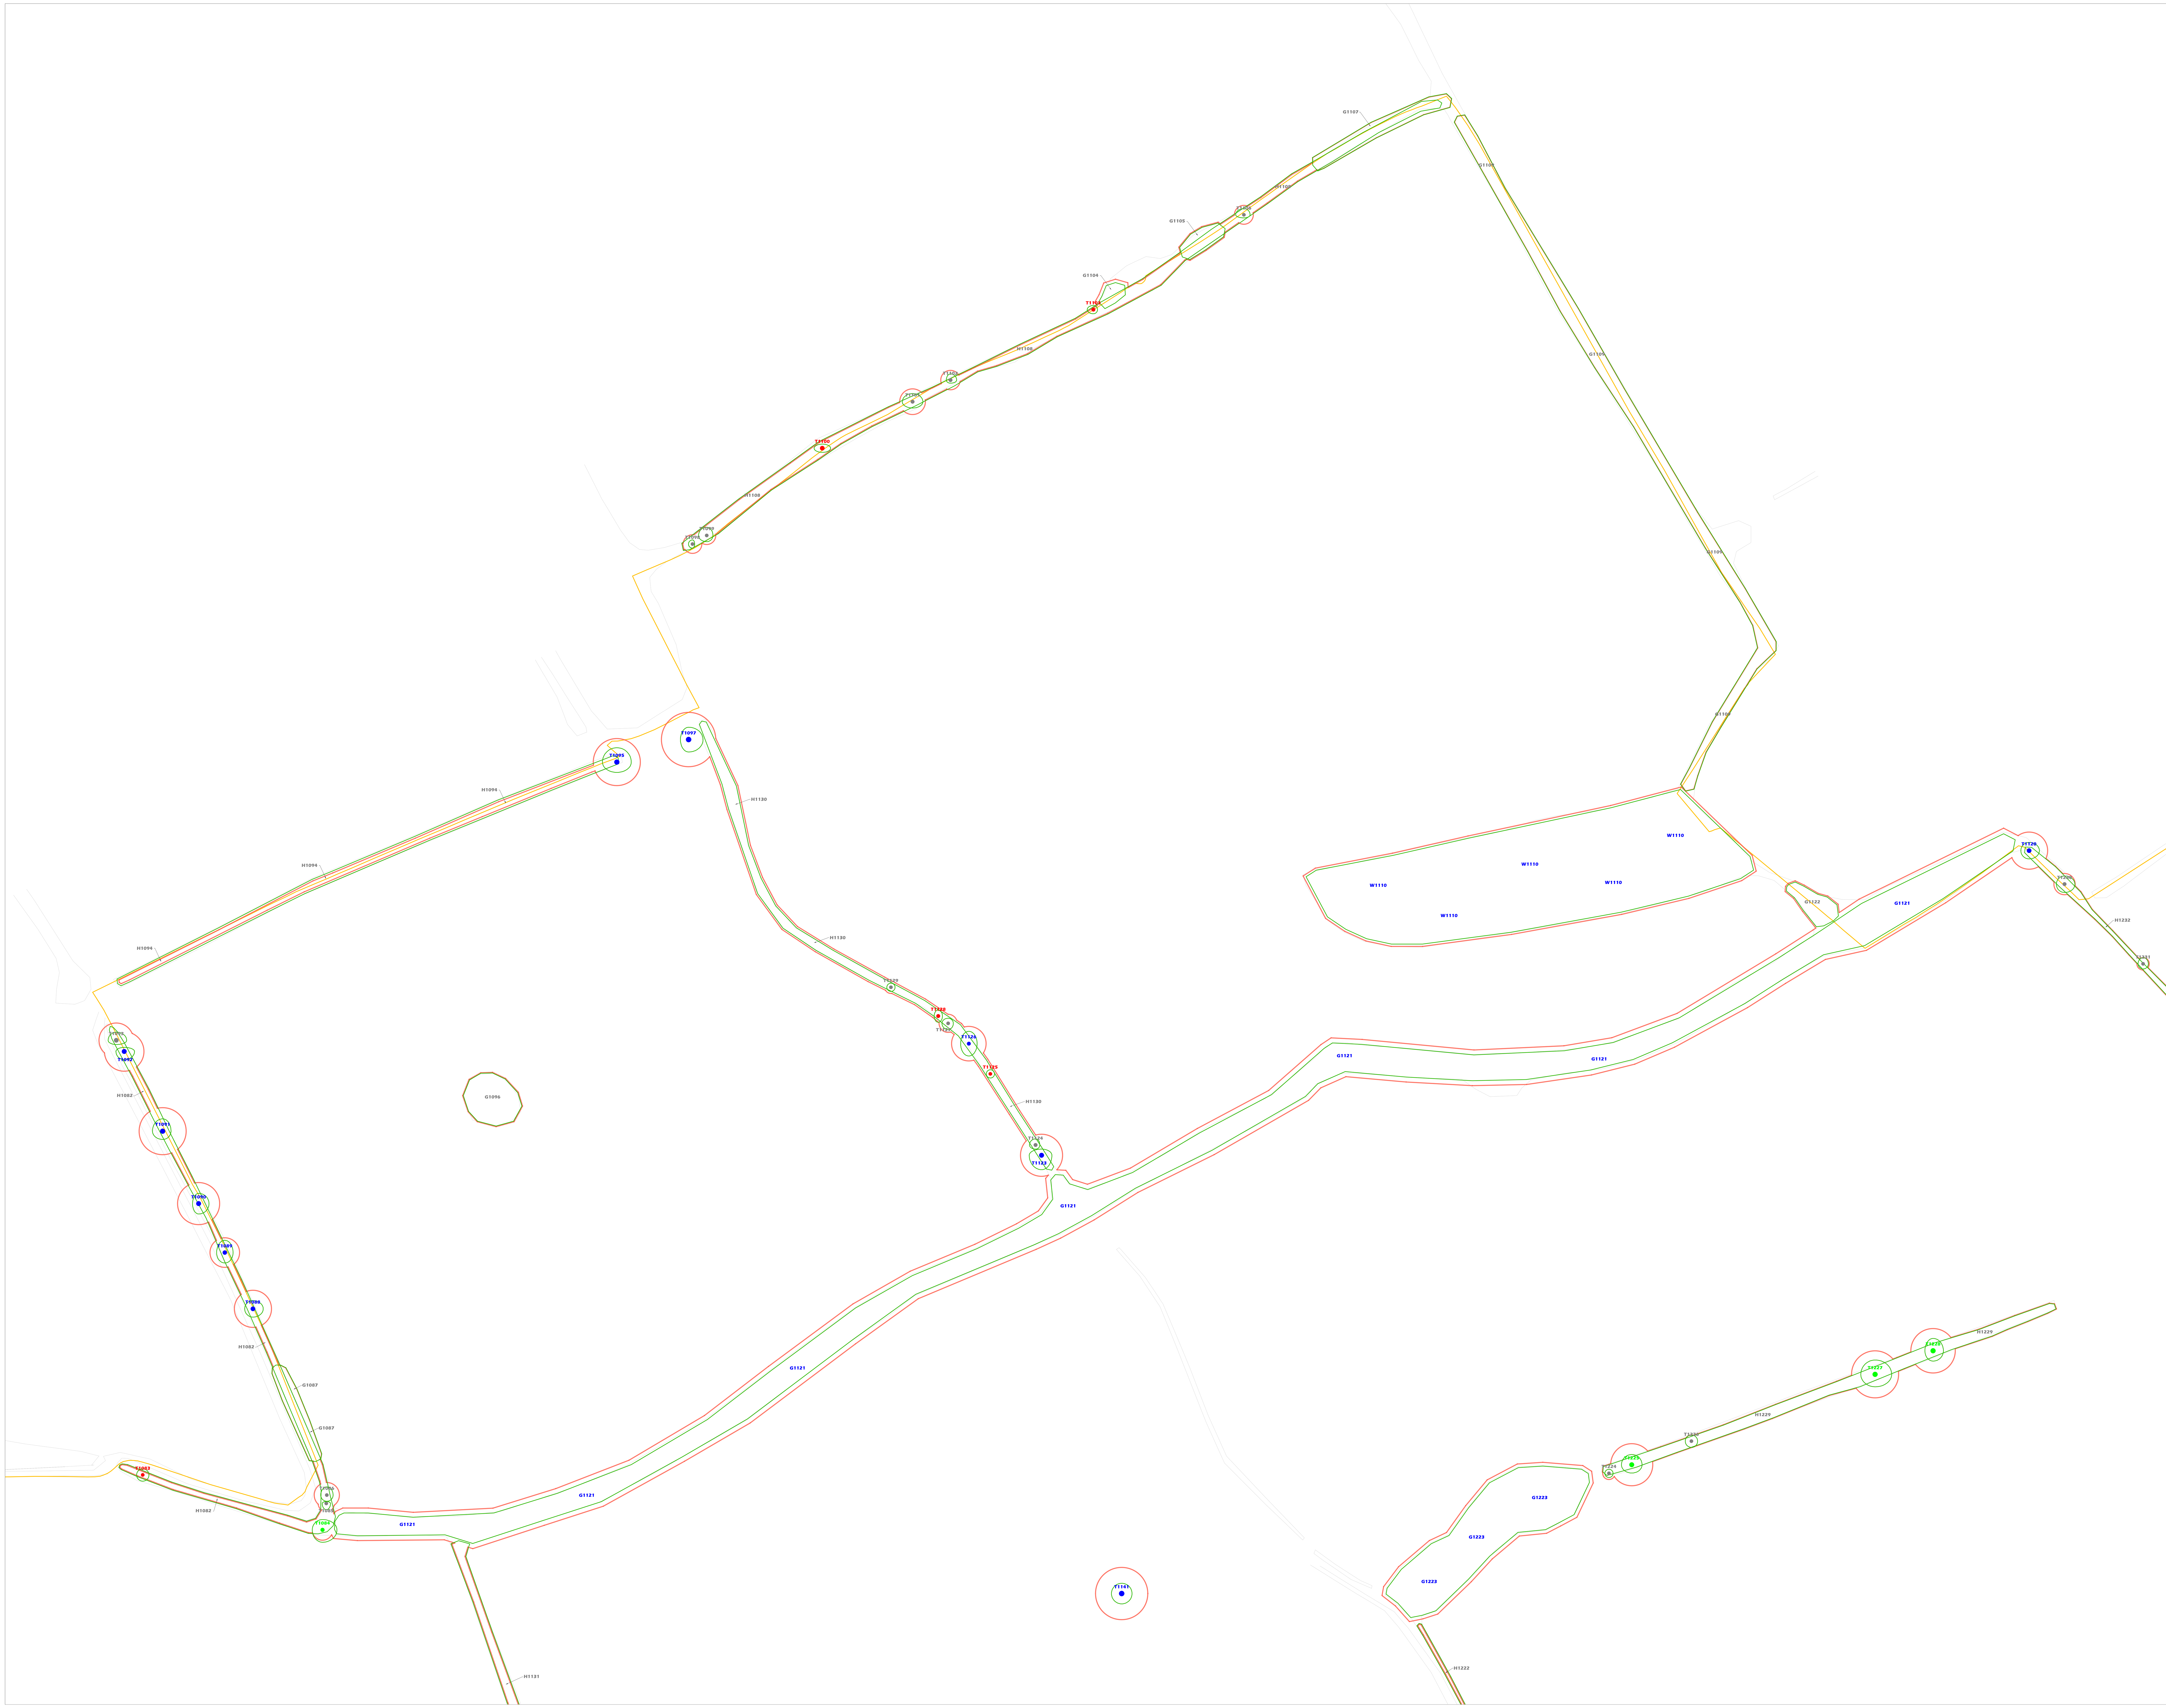

T1

T1 Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC


Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

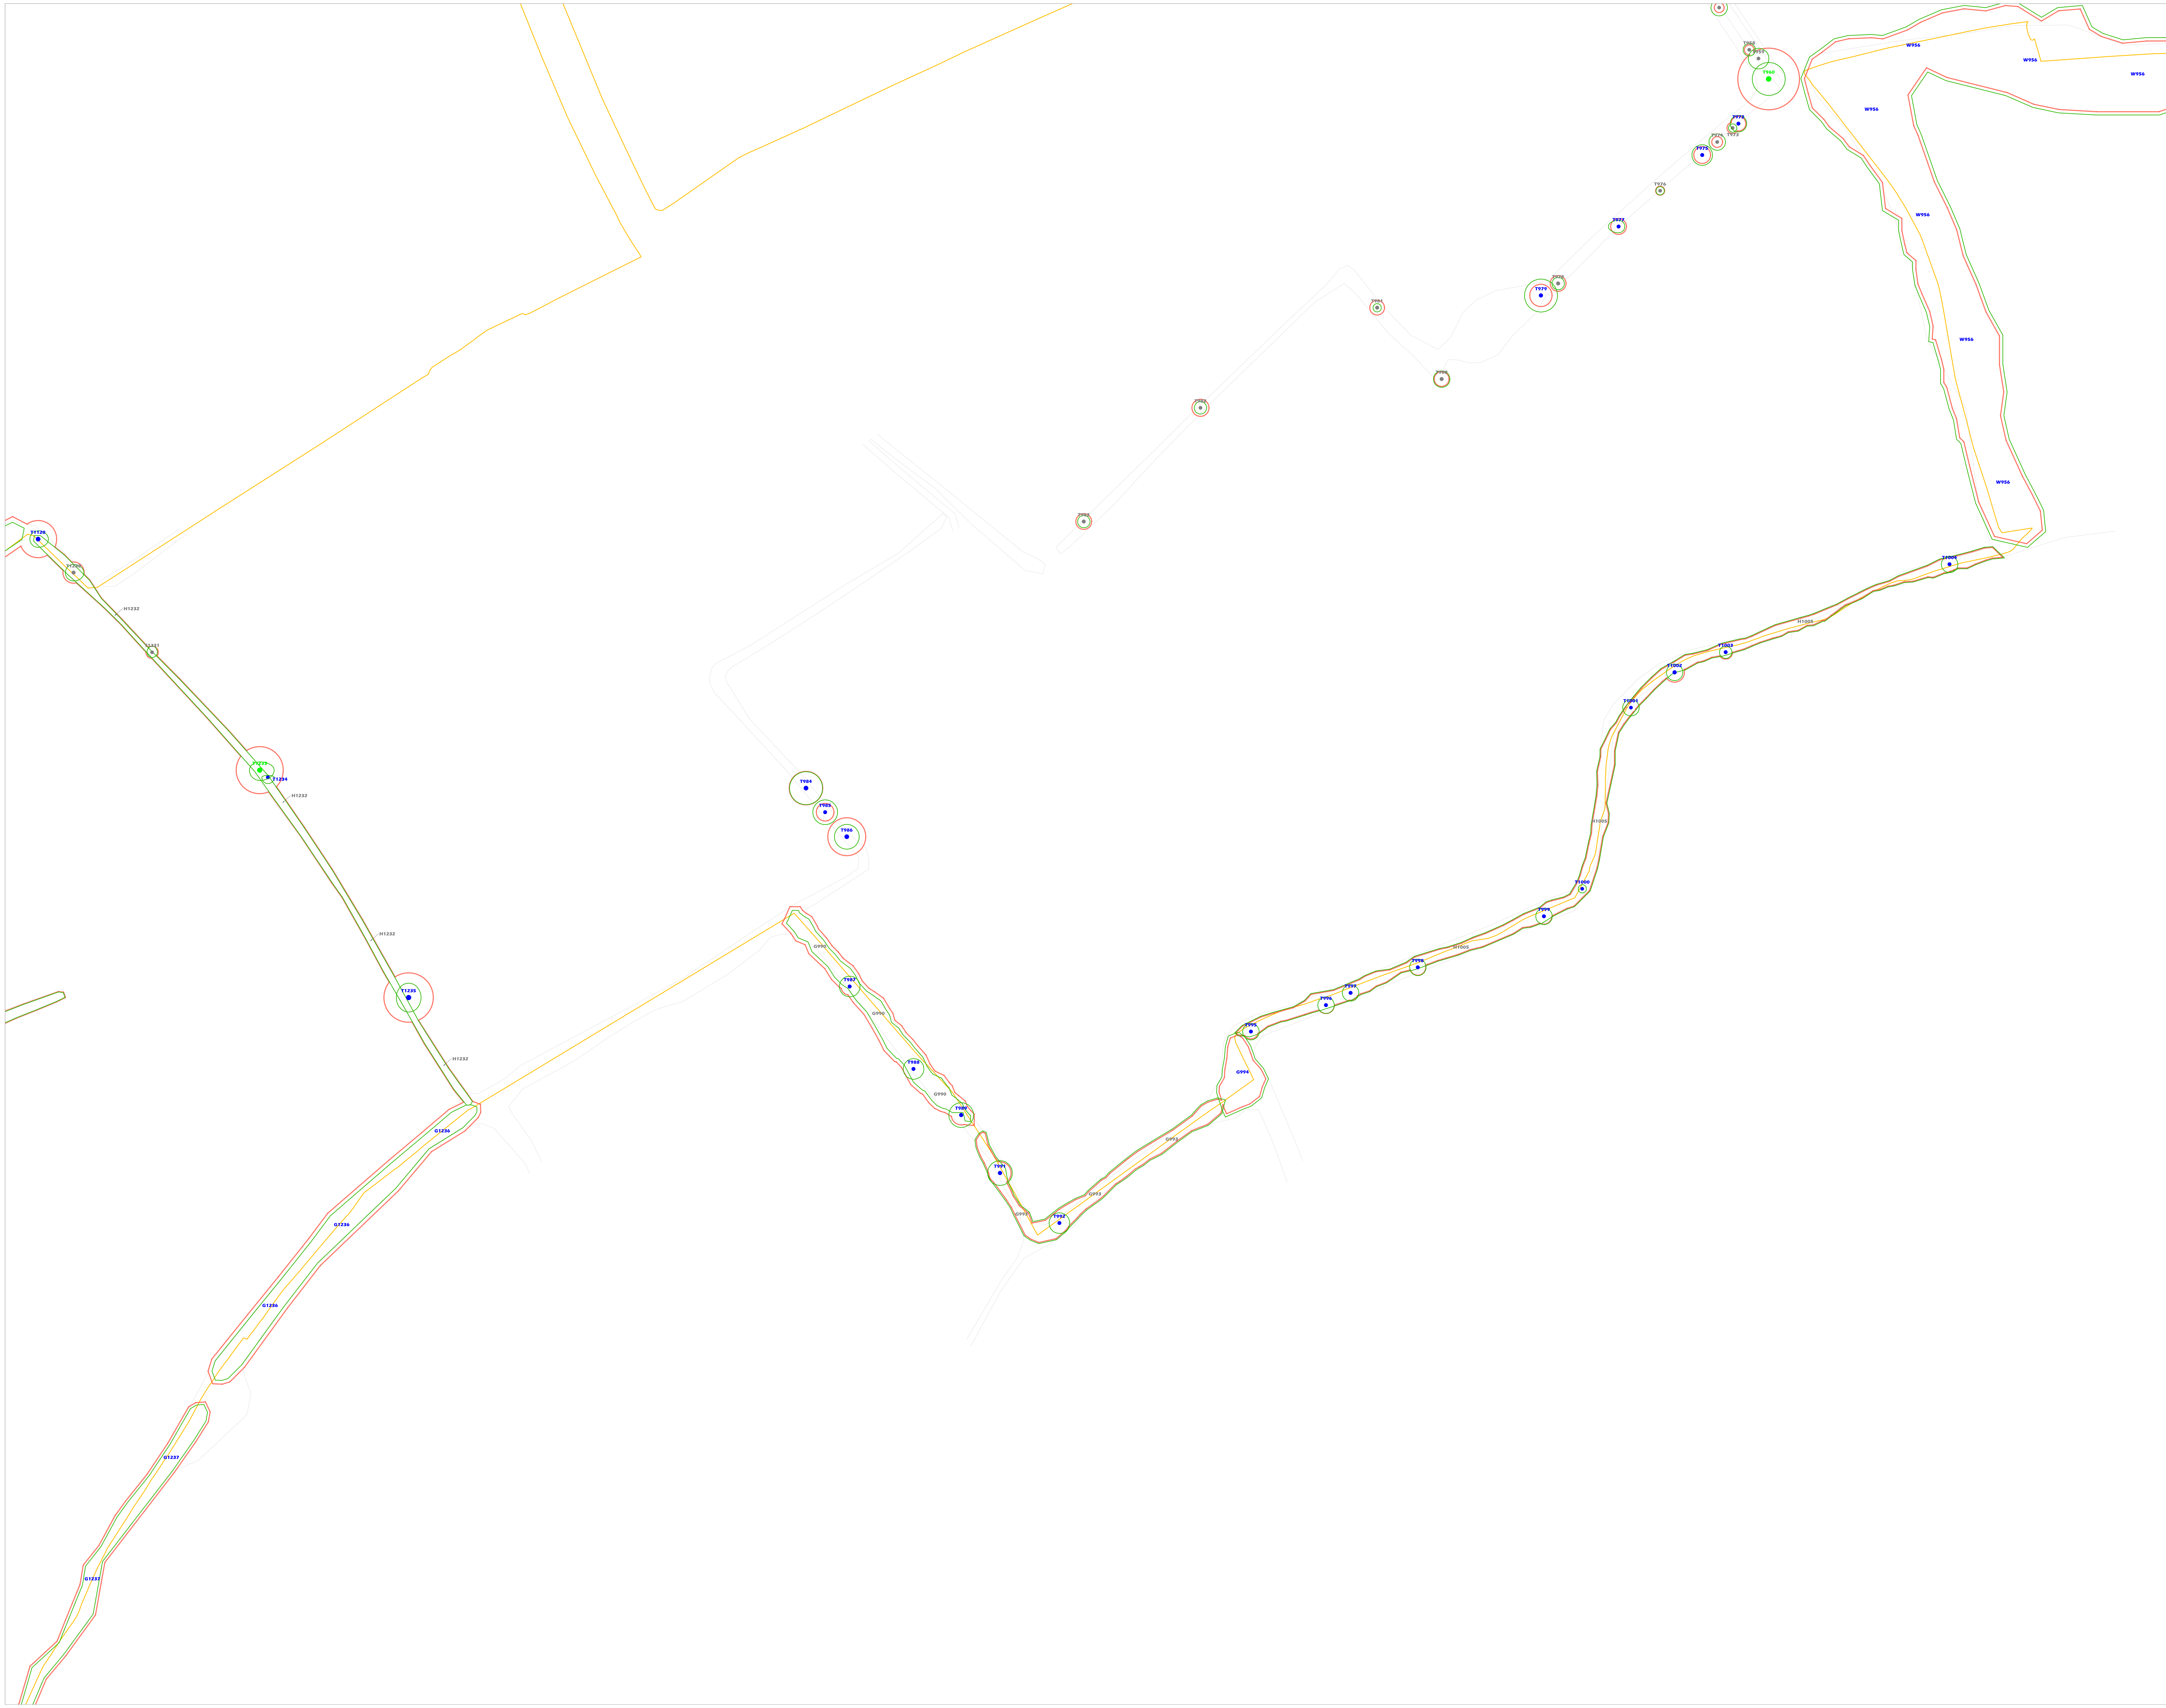

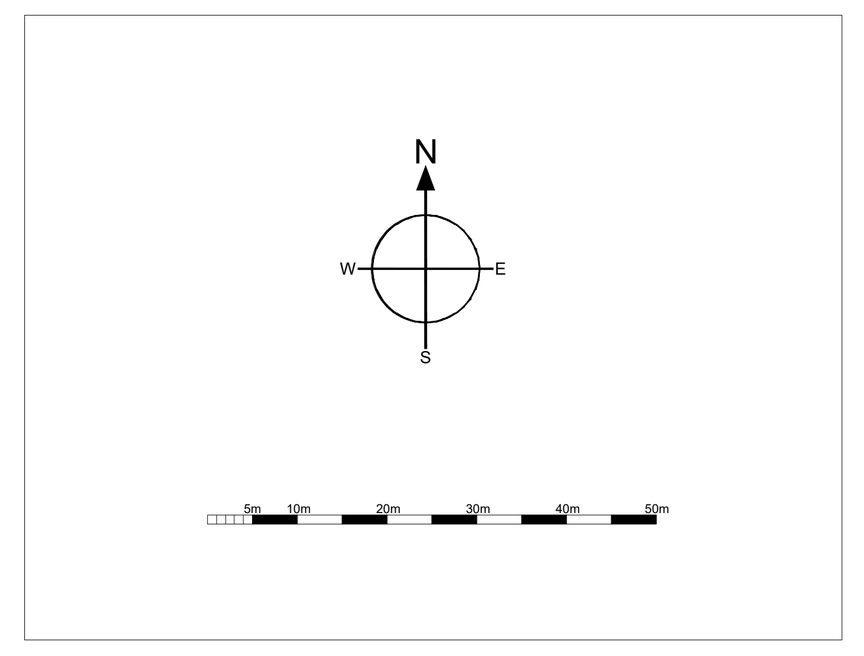

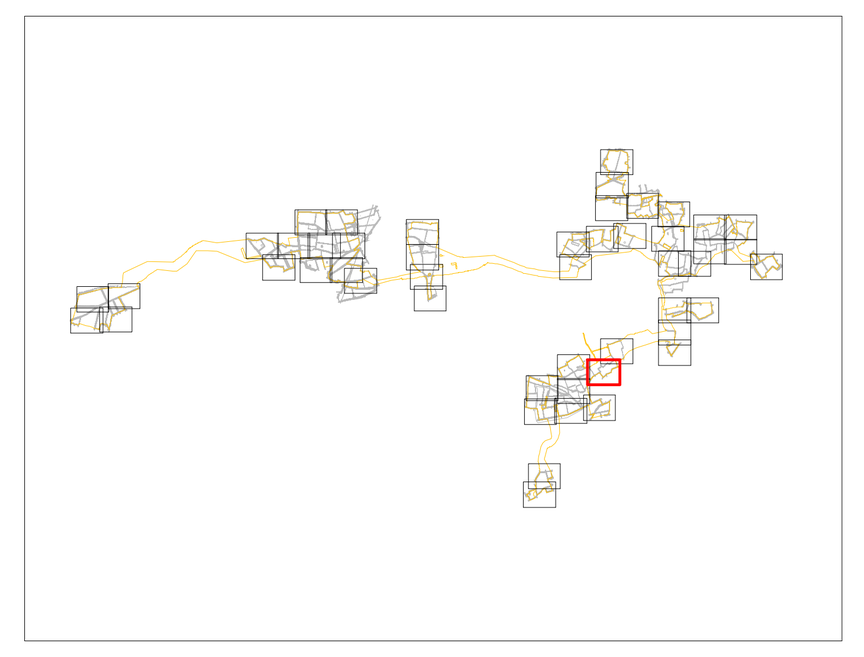

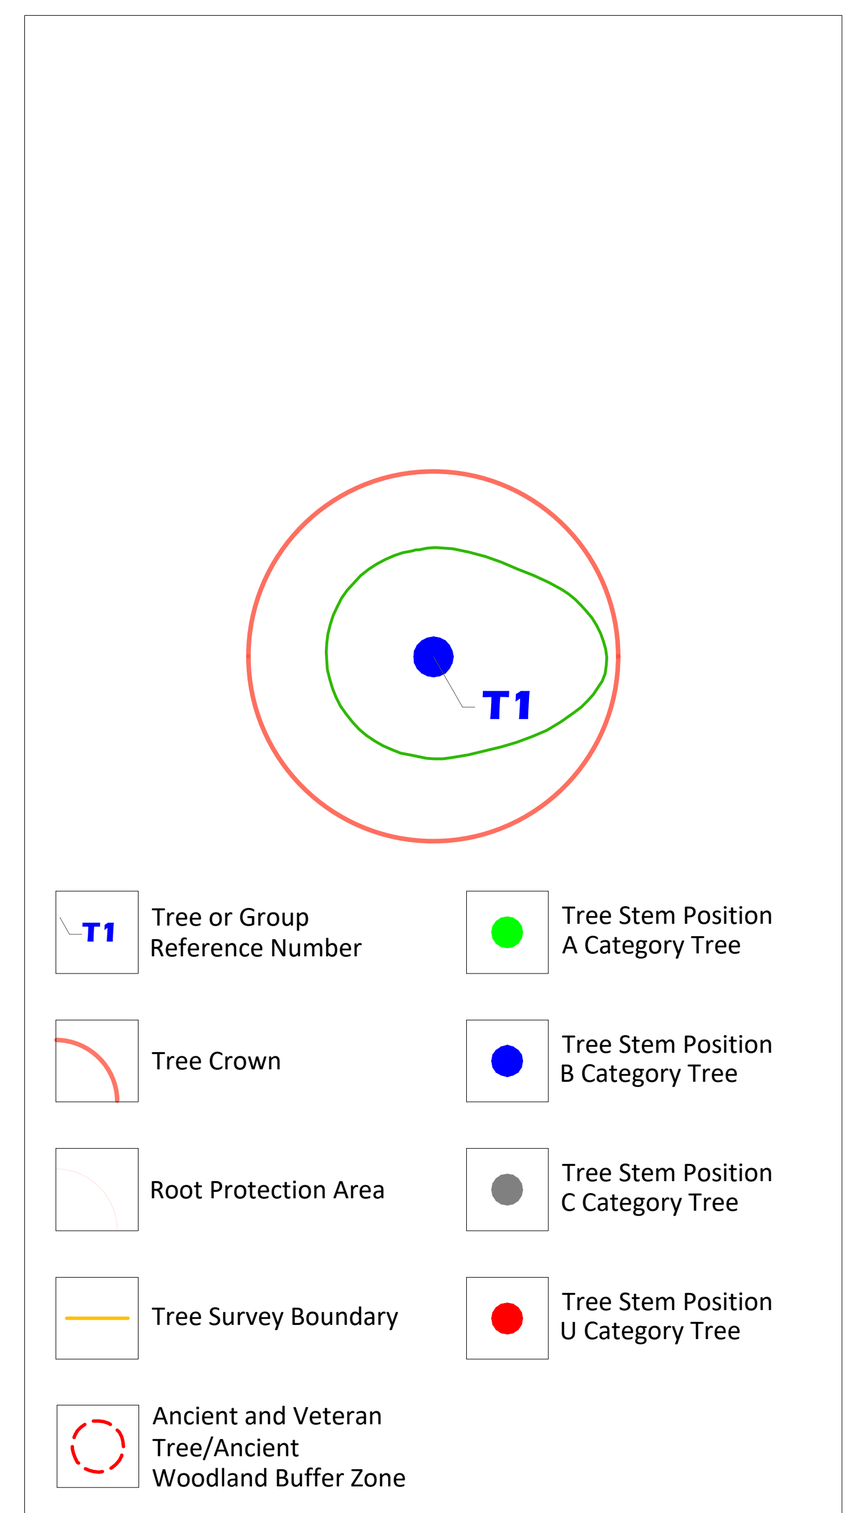

Date: February 2025

Scale: 1:1000 @ A0


Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

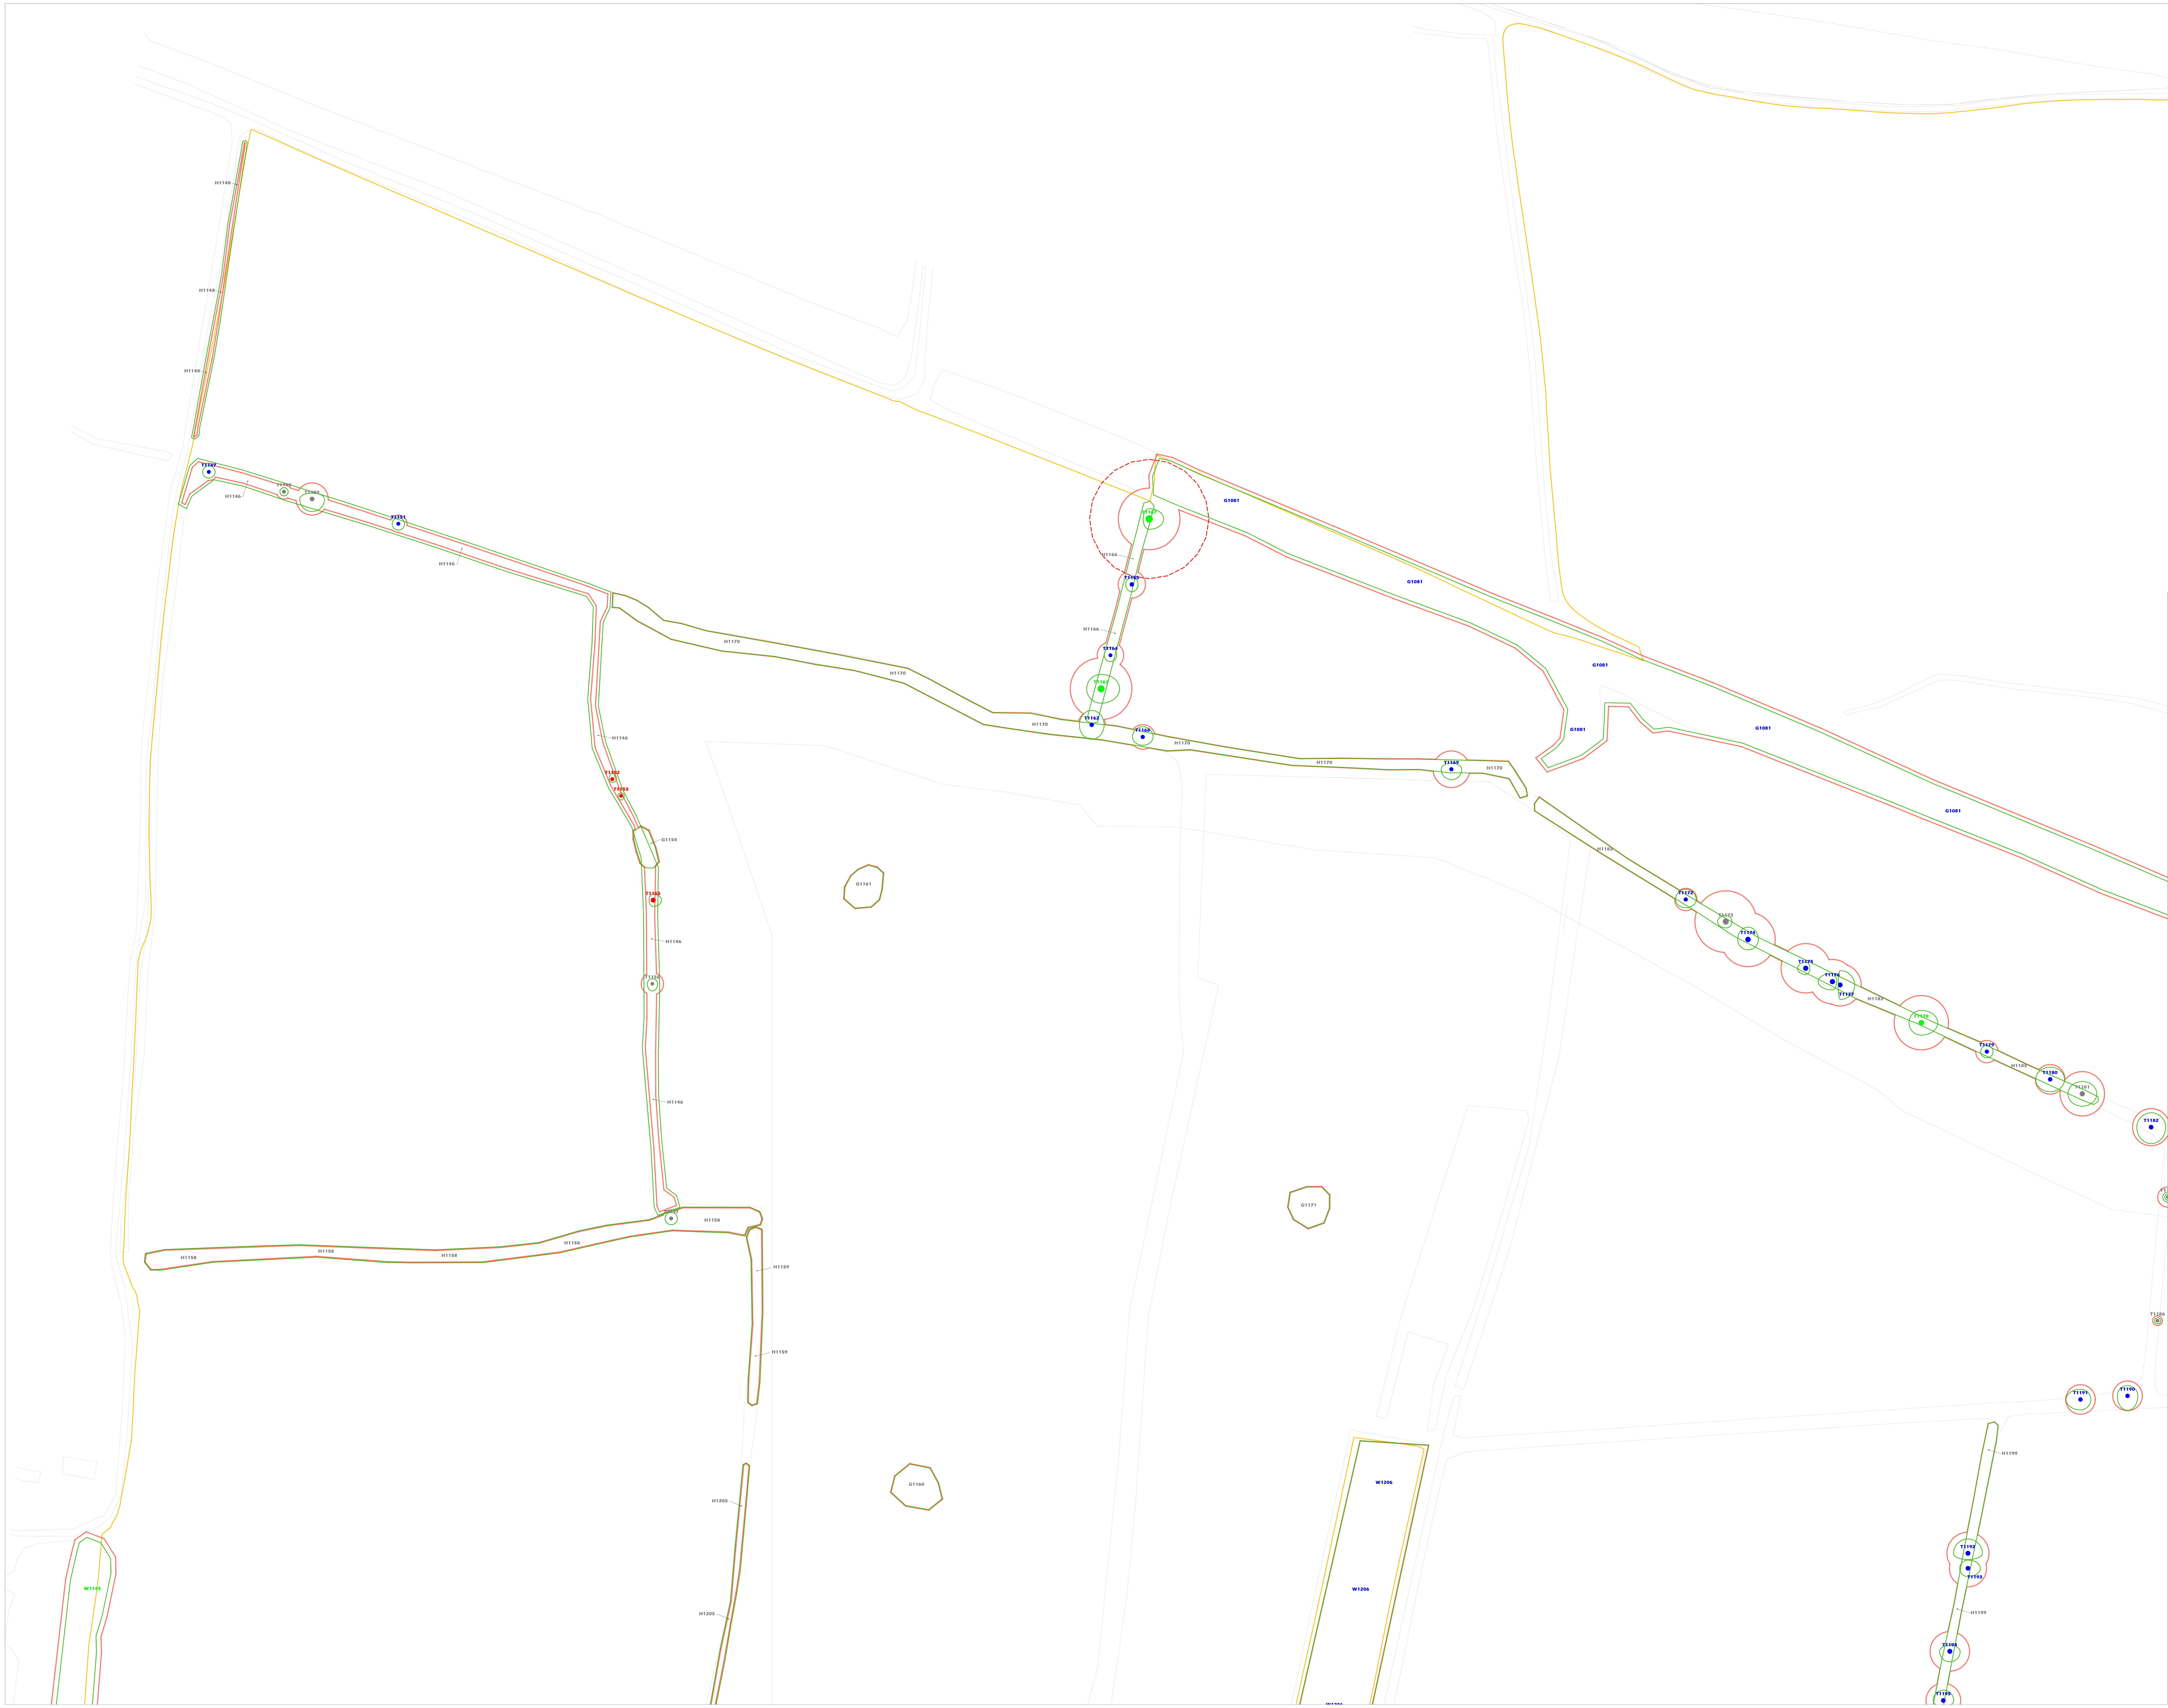

N

W E S

5m 10m 20m 30m 40m 50m

T1

T1 Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

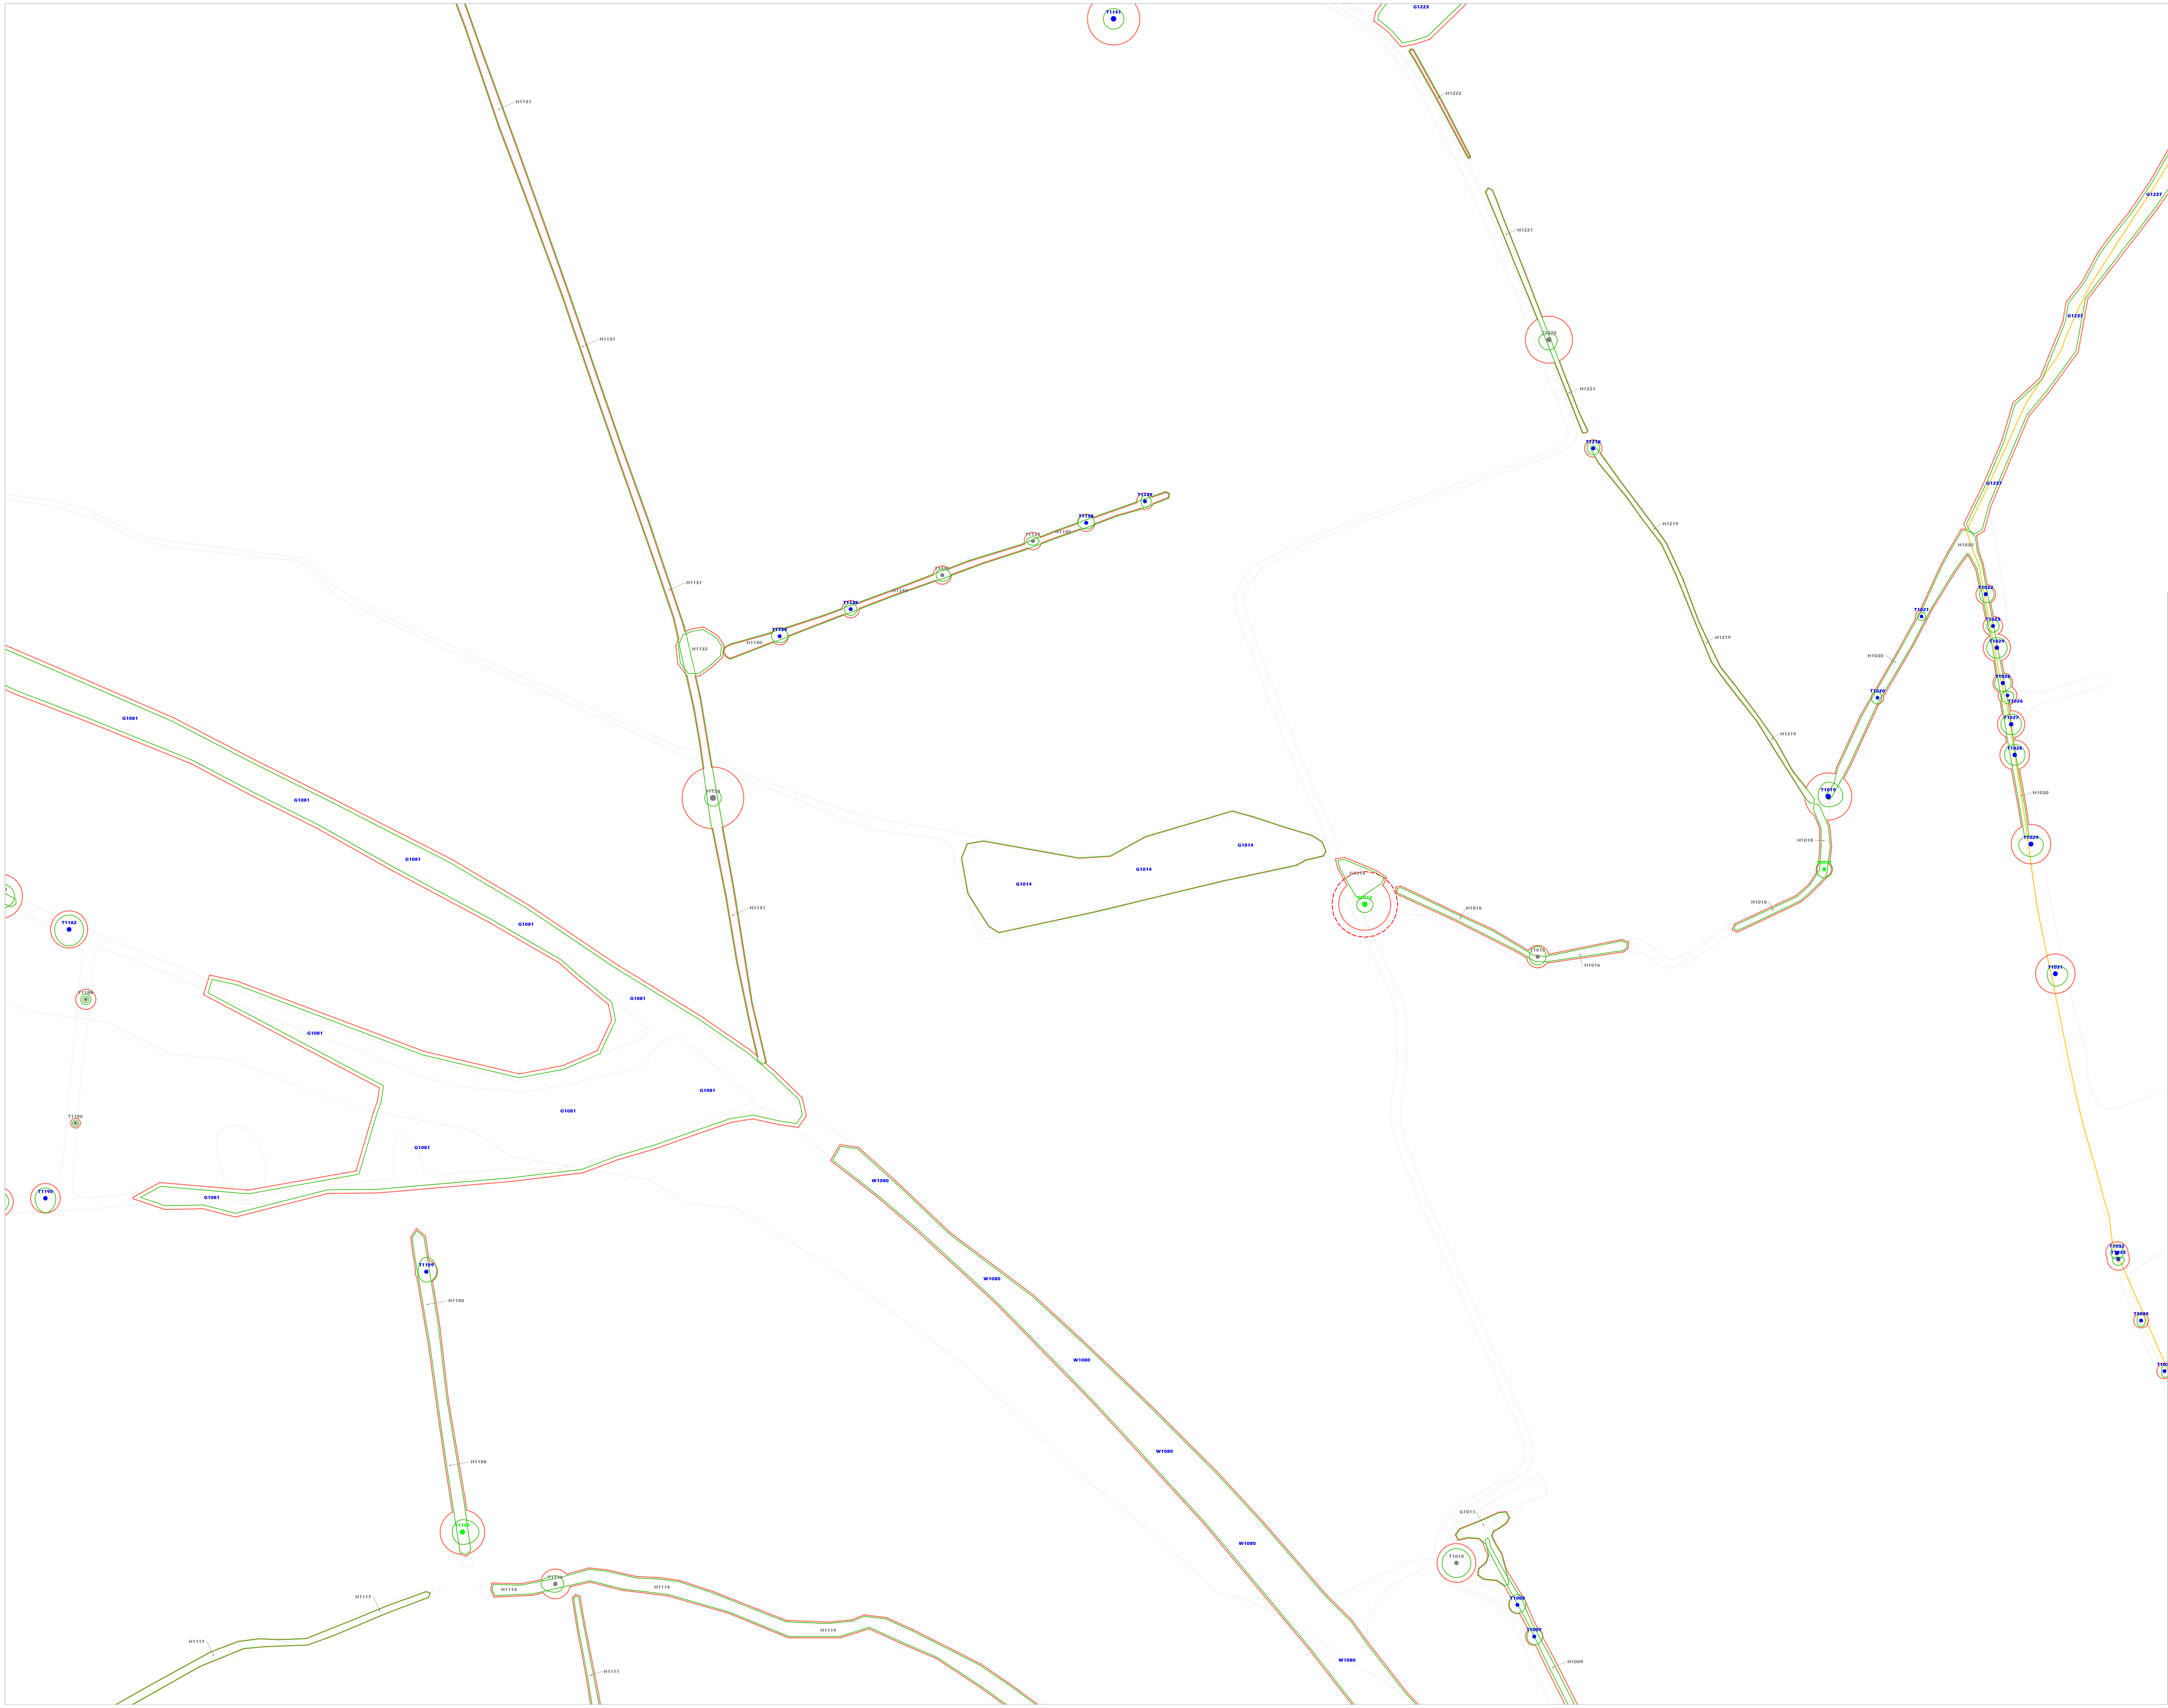

N
W
E
S
5m 10m 20m 30m 40m 50m

T1

Tree or Group Reference Number	Tree Stem Position A Category Tree
Tree Crown	Tree Stem Position B Category Tree
Root Protection Area	Tree Stem Position C Category Tree
Tree Survey Boundary	Tree Stem Position U Category Tree
Ancient and Veteran Tree/Ancient Woodland Buffer Zone	

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Date:
February 2025

Scale:
1:1000 @ A0

Project Name:
High Grove Solar Farm, Norfolk

Drawing Title:
Tree Constraints Plan

Drawing Number:
250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk


Drawing Title: Tree Constraints Plan


Drawing Number: 250227-1.2-HGS-TCP-NC


Treework Environmental Practice


Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

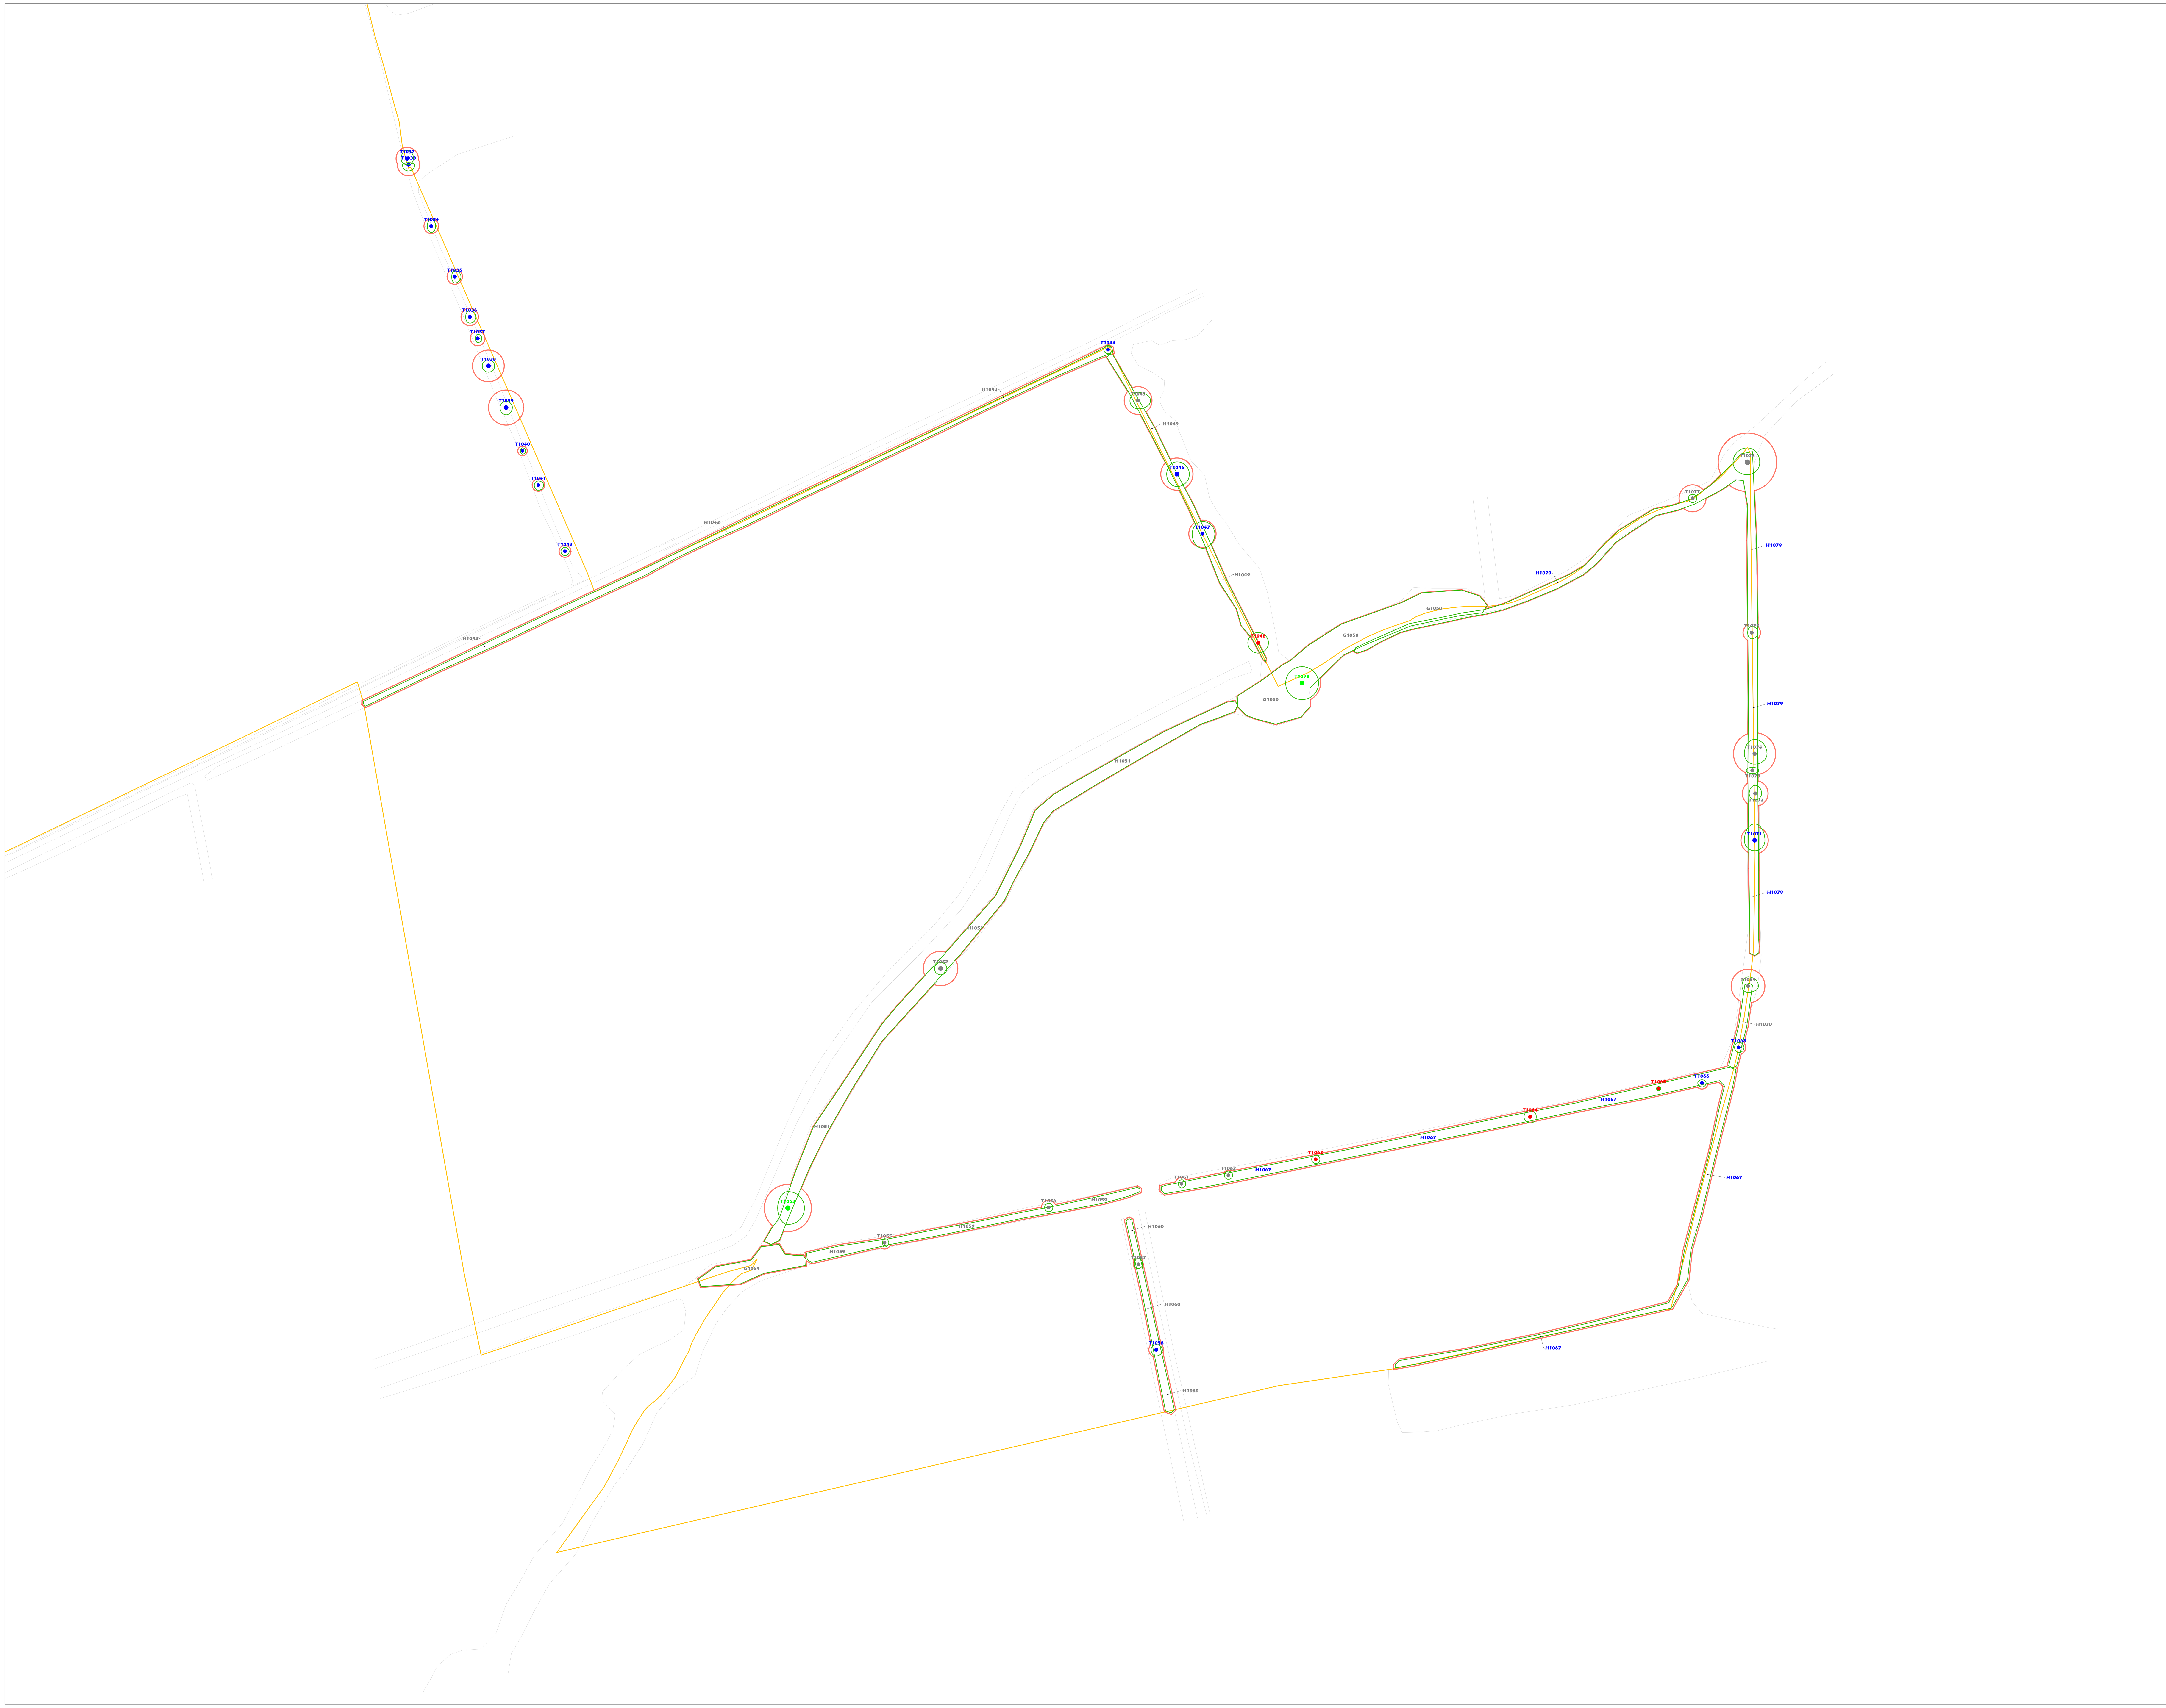

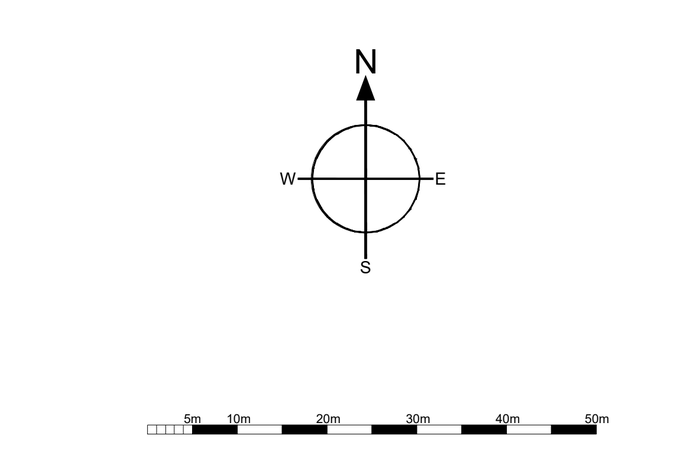

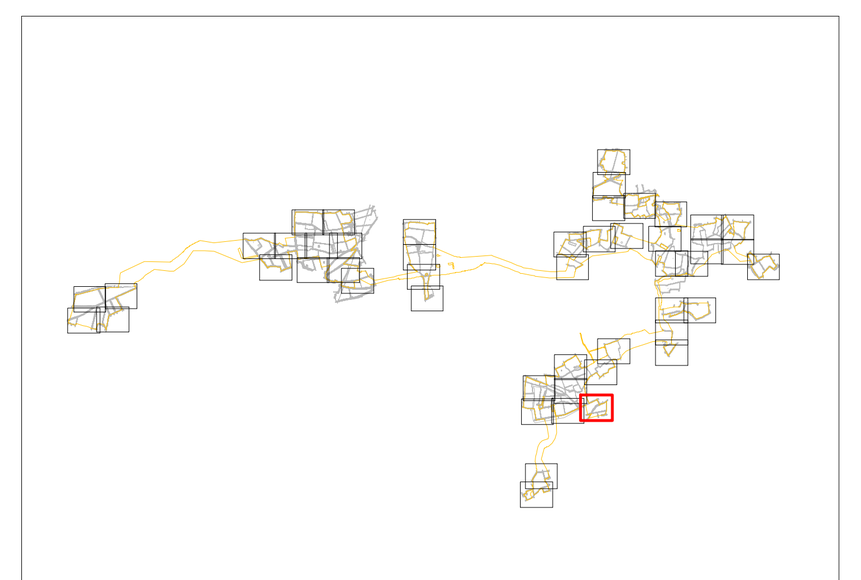

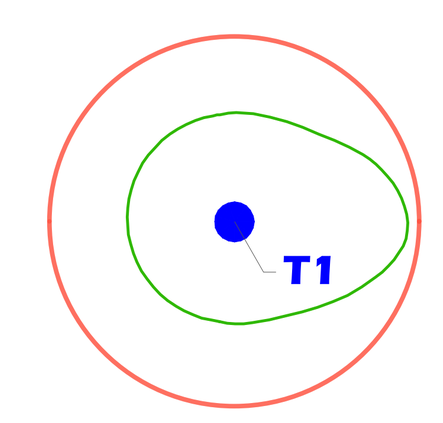

T1	Tree or Group Reference Number	●	Tree Stem Position A Category Tree
	Tree Crown	●	Tree Stem Position B Category Tree
	Root Protection Area	●	Tree Stem Position C Category Tree
	Tree Survey Boundary	●	Tree Stem Position U Category Tree
	Ancient and Veteran Tree/Ancient Woodland Buffer Zone		

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR

Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk



Date:
February 2025


Scale:
1:1000 @ A0


Project Name:
High Grove Solar Farm, Norfolk


Drawing Title:
Tree Constraints Plan


Drawing Number:
2S0227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

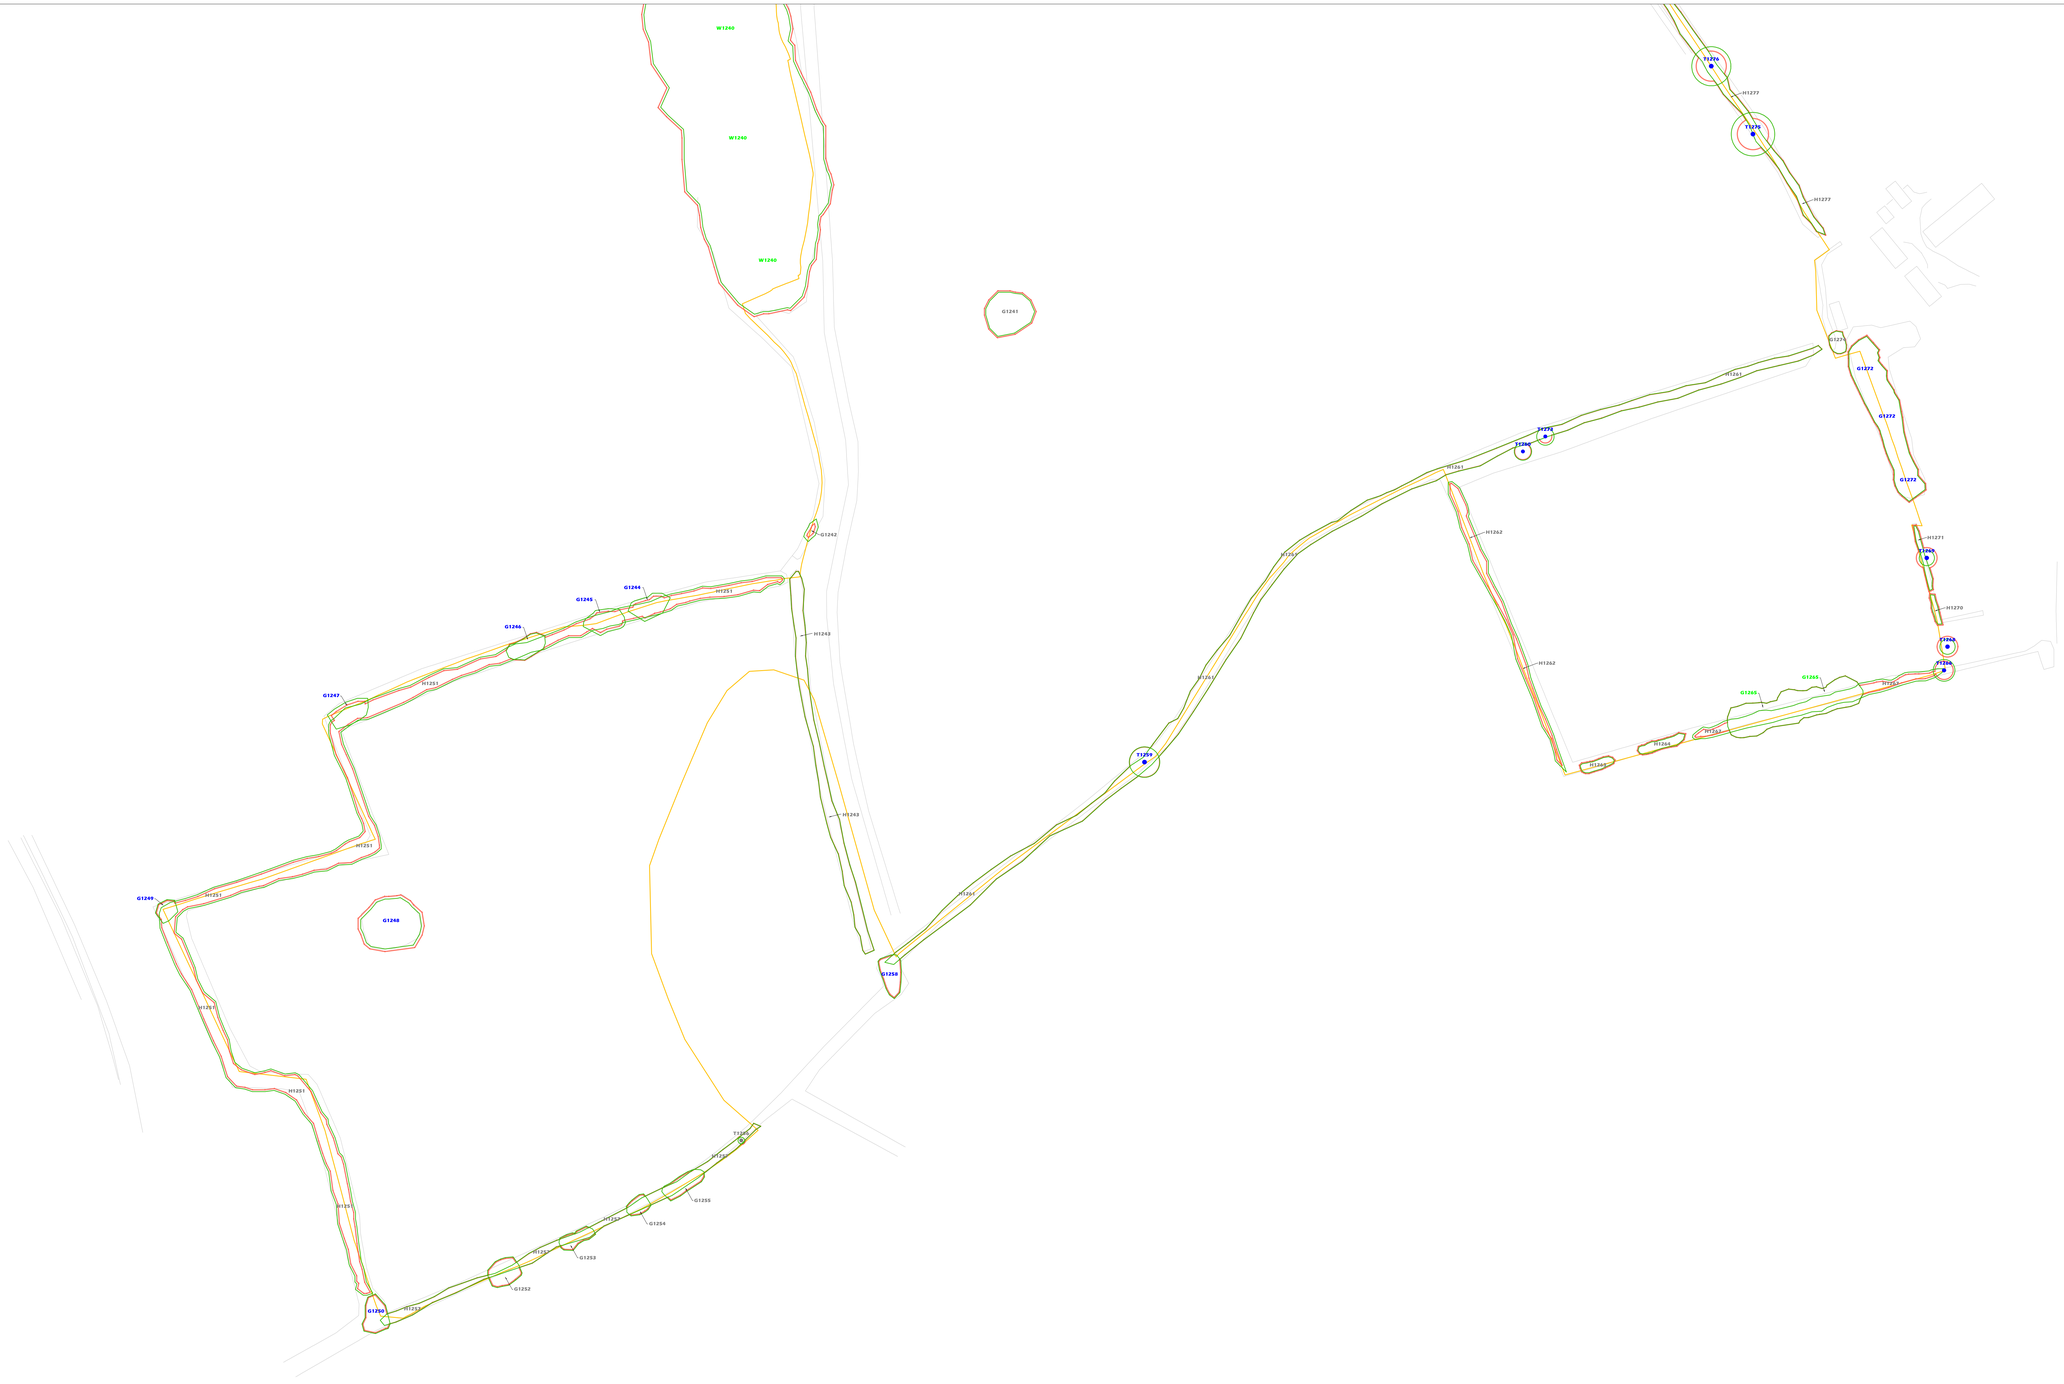

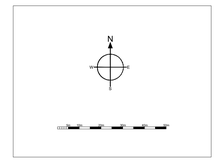

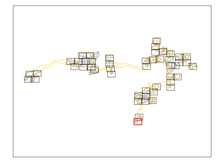



Tree or Group Reference Number

Tree Crown

Root Protection Area

Tree Survey Boundary

Ancient and Veteran Tree/Ancient Woodland Buffer Zone

Tree Stem Position A Category Tree

Tree Stem Position B Category Tree

Tree Stem Position C Category Tree

Tree Stem Position U Category Tree

Date: February 2025

Scale: 1:1000 @ A0

Project Name: High Grove Solar Farm, Norfolk

Drawing Title: Tree Constraints Plan

Drawing Number: 250227-1.2-HGS-TCP-NC

Treework Environmental Practice
2nd Floor
10-12 Bourlet Close
London
W1W 7BR
Tel: 0117 244 0012
Web: www.treeworks.co.uk
Email: info@treeworks.co.uk

Appendix C

Tree Protection Specifications

Technical Measures to Prevent Tree Damage

Tree Pruning

Tree pruning will be carried out where the design and/or planned site operations encroach into the crowns of trees and where these encroachments can be accommodated through facilitation pruning without significantly reducing the landscape value and/or viability of the tree.

Tree pruning operations would:

- be specified by an Arboriculturist
- be in accordance with current best practice
- be carried out by a suitably experienced and qualified arborist

Tree Protection Fencing


Tree protection fencing would be located at the edge of the Construction Exclusion Zone (CEZ) and would be suitably robust to provide sufficient protection for trees. The performance requirement for fencing would be determined by the type of activity that would take place in the area around the CEZ.

Typical performance requirements for the Tree Protection Fencing would be:

- Tree Protection Fencing would be installed prior to commencement of activity in the draft Order Limits.
- Tree Protection Fencing would only be removed once all works associated with the Proposed Development have been completed.
- The Tree Protection Fencing would be installed and removed without causing damage to retained trees.
- Installation, removal and, where required, replacement of Tree Protection Fencing would be supervised and signed off by an Arboriculturist.
- The Tree Protection Fencing would be stable and robust (typical construction method, in accordance with BS 5837:2012, see below).
- The area between the Tree Protection Fencing and the tree would be a Construction Exclusion Zone (CEZ)
- Fence panels would be made of mesh (e.g.: Heras fencing) or, if solid, would have 30cm windows cut into enough panels to enable conditions within the CEZ to be viewed.
- The CEZ would be clearly identified (see Construction Exclusion Zone sign example below)



Figure 1: Example Tree Protection Fencing Sign

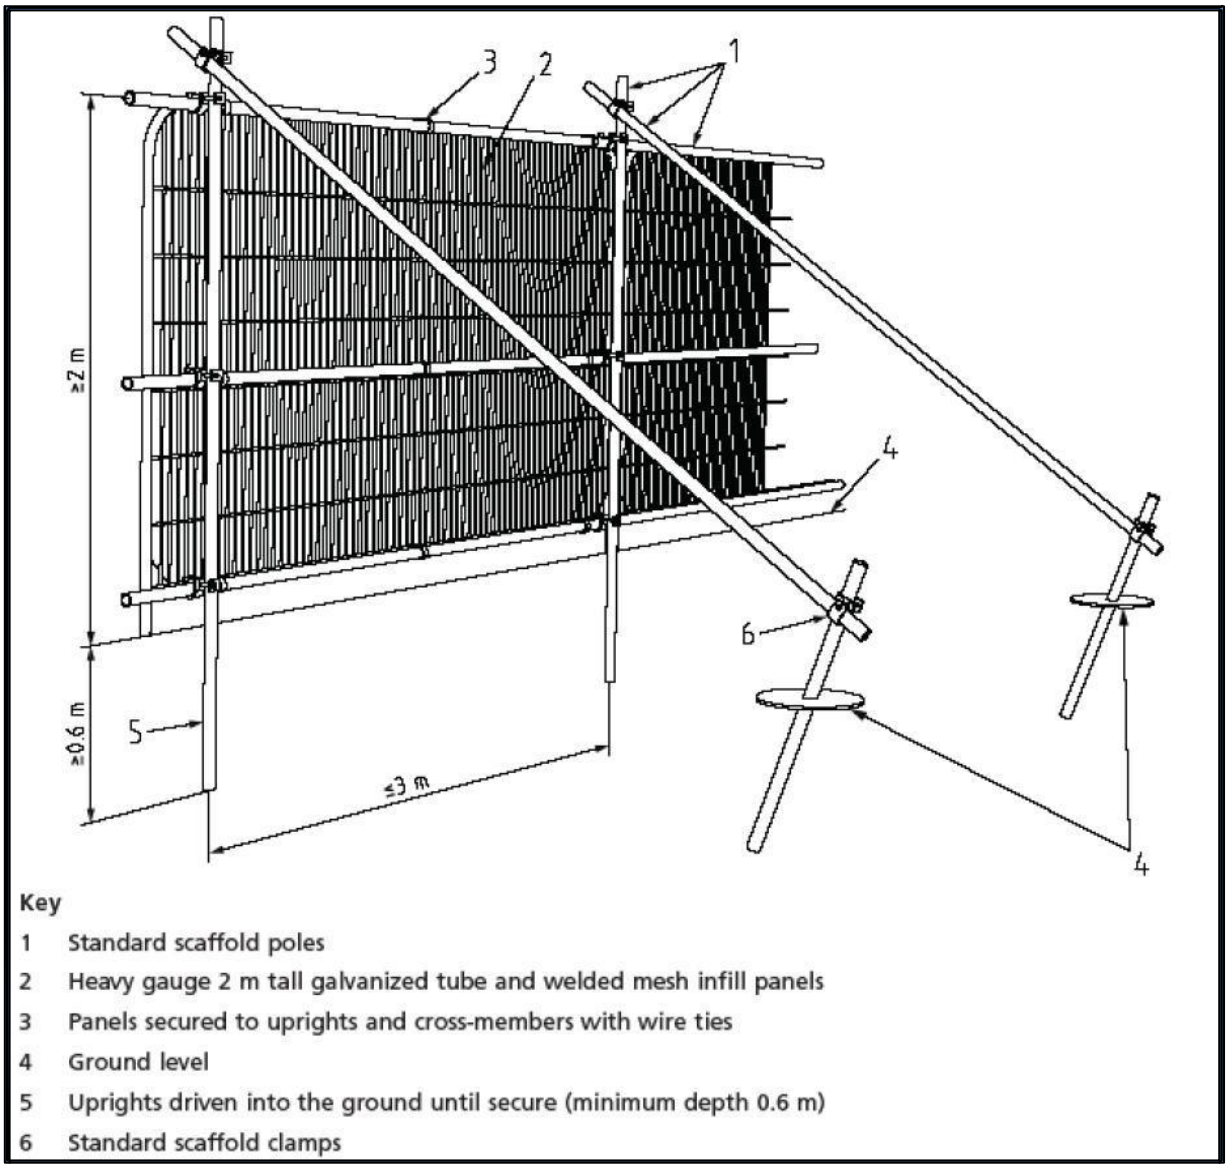

Key

1 Standard scaffold poles
2 Heavy gauge 2 m tall galvanized tube and welded mesh infill panels
3 Panels secured to uprights and cross-members with wire ties
4 Ground level
5 Uprights driven into the ground until secure (minimum depth 0.6 m)
6 Standard scaffold clamps

Figure 2: BS 5837:2012 - Tree protective barrier

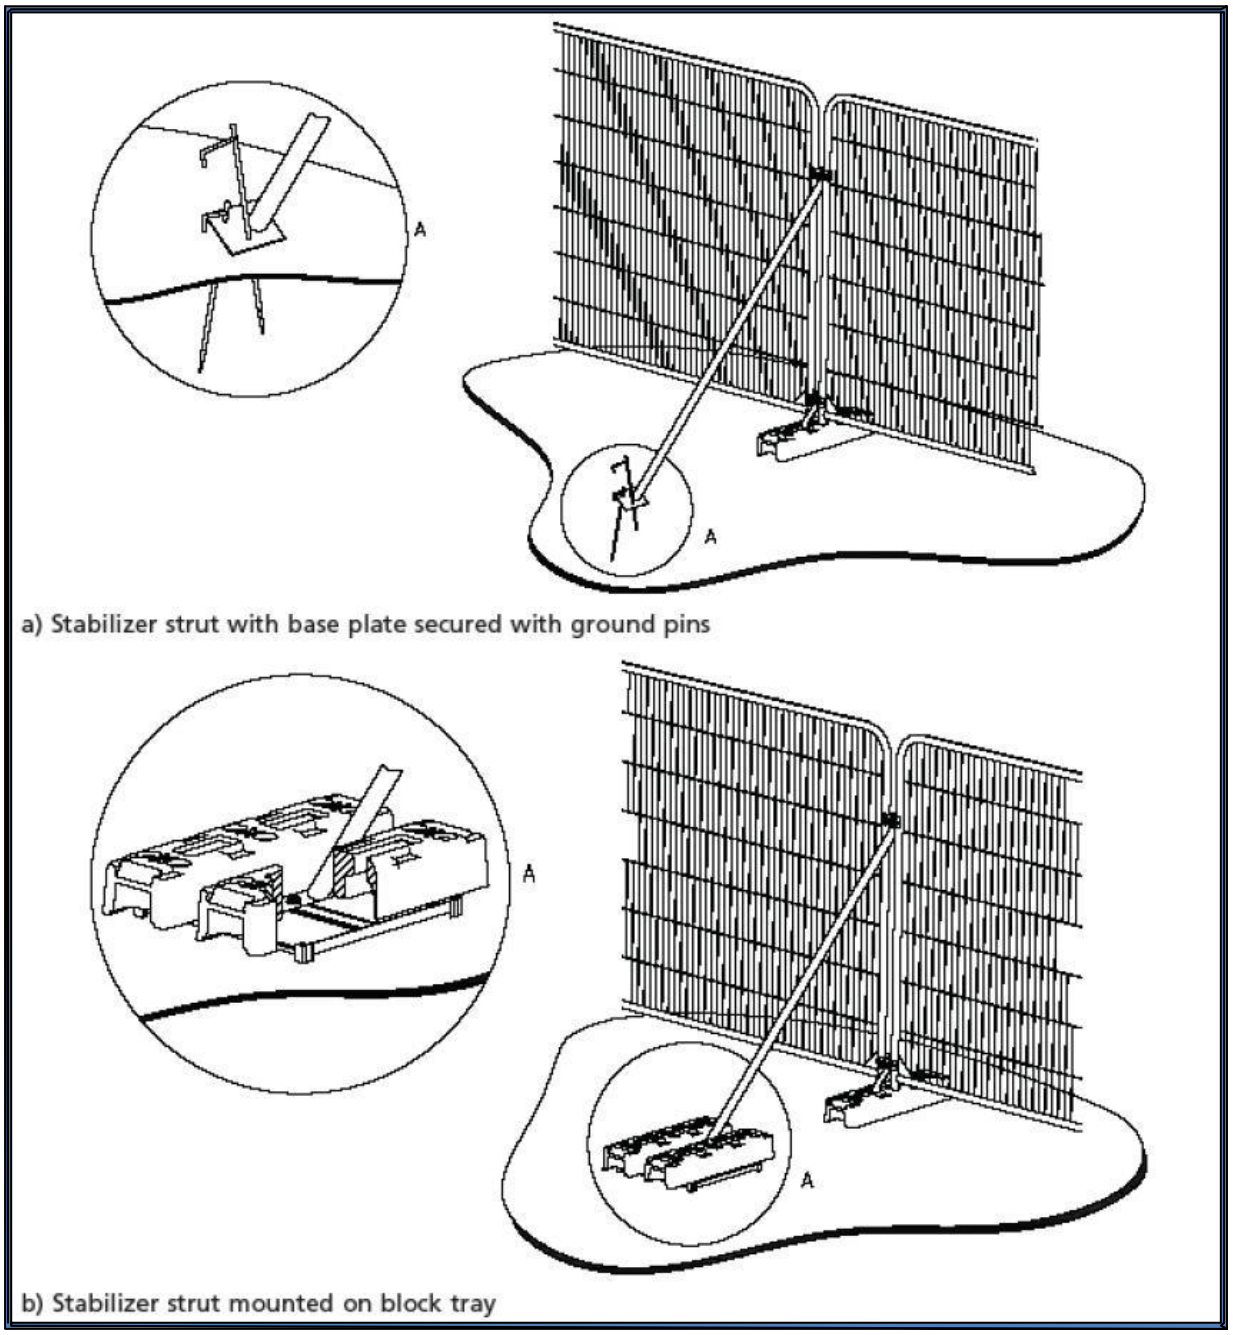


Figure 3: BS 5837:2012 - Examples of above ground stabilisation systems

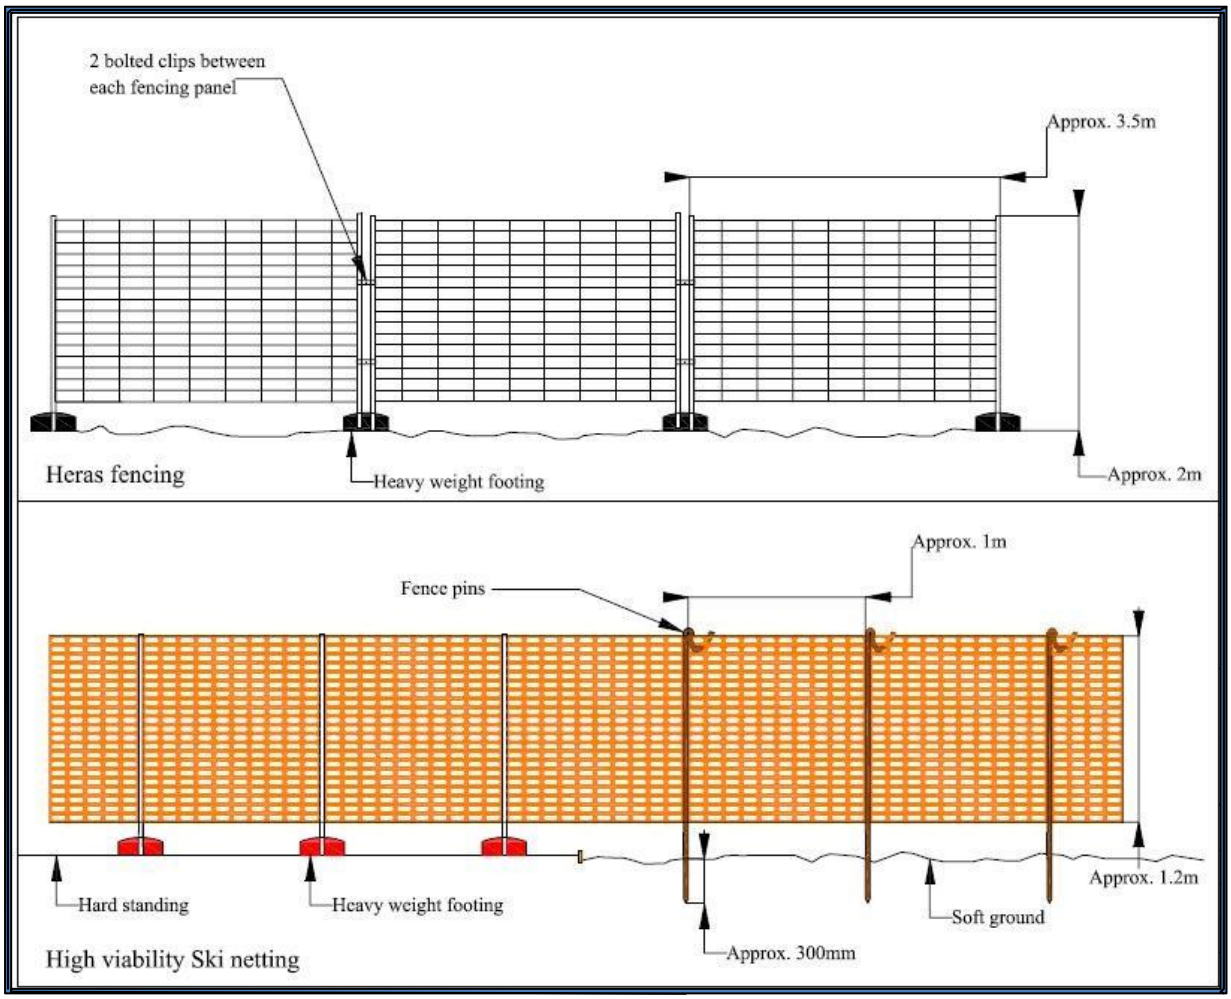


Figure 4: Examples of specification fencing that may be appropriate for areas of low-intensity activity

Ground Protection Measures

BS 5837:2012 provides the following examples of temporary ground protection measures:

a) *for pedestrian movements only, a single thickness of scaffold boards placed either on top of a driven scaffold frame, so as to form a suspended walkway, or on top of a compression resistant layer (e.g. 100 mm depth of woodchip), laid onto a geotextile membrane;*
b) *for pedestrian-operated plant up to a gross weight of 2 t, proprietary, inter-linked ground protection boards placed on top of a compression-resistant layer (e.g. 150 mm depth of woodchip), laid onto a geotextile membrane;*
c) *for wheeled or tracked construction traffic exceeding 2 t gross weight, an alternative system (e.g. proprietary systems or pre-cast reinforced concrete slabs) to an engineering specification designed in conjunction with arboricultural advice, to accommodate the likely loading to which it will be subjected.*

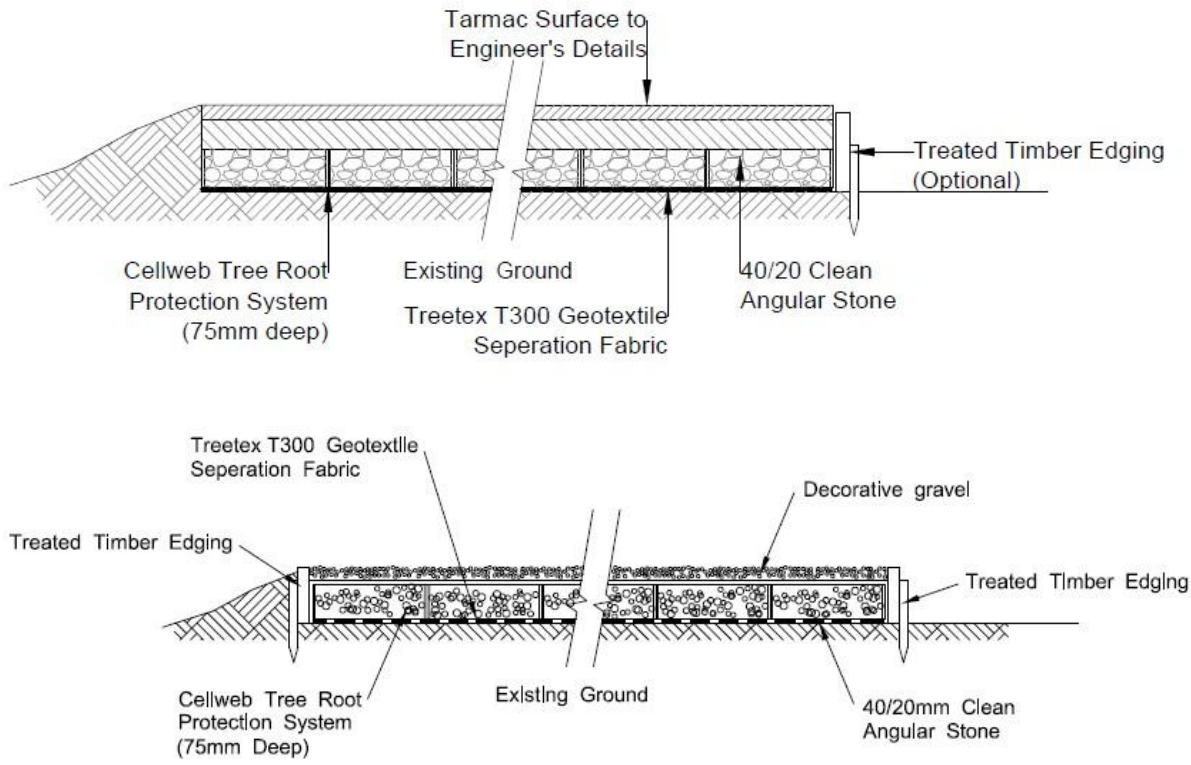


Figure 5: Examples of Cellular Confinement System Details (Cellweb)

Concrete Temporary Ground Protection

The Ground Protection would be installed using reinforced concrete slabs to an engineering specification, designed in conjunction with arboricultural advice, to accommodate the likely loading to which it would be subjected.

For the roots of the trees to remain undamaged there must be no excavation, soil stripping or site grading within the rooting areas – in other words NO DIGGING. This means that finished levels of the Temporary Ground Protection would be above existing ground level.

The Arboriculturist and Construction Manager would supervise and sign off the installation and removal of the Ground Protection and any change to the Ground Protection.

General Performance Specification

The Ground Protection would ensure that tree roots are not physically damaged

- The Ground Protection would ensure that soil within the tree root environment is not compacted
- The Ground Protection would reduce the possibility for spilled materials / substances to seep into the soil
- The Ground Protection would be designed to prevent anaerobic conditions building up under the Ground Protection allow sufficient gaseous exchange and water penetration to the covered root environment.
- The Ground Protection would only be removed once all works associated with the demolition have been completed
- The installation and removal of Ground Protection would not damage trees.

Installation of an above ground cellular confinement system (CCS)

The CCS must be installed in accordance with system supplier specifications. A typical specification is as follows:

- An above ground CCS must be installed in the area(s) shown on the tree protection plan. Excavations for connecting the cellular confinement system to the back of the footpath or drive must be carried out carefully using hand tools only.
- The CCS must be constructed of high-density polyethylene (HDPE) and able to preserve the bulk density of underlying soils.
- Any existing hard surfacing must be removed using hand tools and manual methods, without disturbing the existing sub-base if this is to be used to form the base for the new wearing surface. Surface vegetation must be removed using hand tools only.
- Any roots of diameter <25mm that are not to be retained must be pruned under the supervision of an Arboriculturist using sharp tools. Hollows must be filled using sharp sand to provide a level surface onto which the geotextile can be laid.
- The prepared ground must be covered using a non-woven geotextile fabric, overlapping all joints by 300mm. The cellular confinement panels must be expanded to their full length and pinned with staking pins to keep the cells open. Adjacent panels must be stapled together to create a continuous mattress. Each open cell must be filled with a no fines fill of crushed stone (granite, flint or basalt). Where panels of 200mm depth are used, a stone of 20-40mm diameter must be used and where panels of 100mm depth are used 4-20mm diameter stone must be used. Panels of 150mm may use either size of stone. Cells must be overcharged by approximately 50mm to protect the top edges of the panel from wear. A whacker plate must not be used to compact the stone.
- Kerb edges can be concreted in place on top of the cellular panels but a layer of heavy duty polythene sheeting must be laid on the existing ground to isolate the concrete from leaching into the underlying soil. Timber edging, where appropriate, can be installed using treated timber boards or railway sleepers held in place by wooden pegs. Soil should be placed against the timber edge and battered to provide a slope between the final surface and the existing soil level. Where there is an existing edge that can be used this would avoid or minimise excavations and tree root damage.

- During the construction phase the cellular confinement system must be finished with ground mats. At the end of construction, the ground mats shall be removed and replaced with a permeable wearing surface.

No-dig Construction and Special Engineering Measures

No-dig construction methods and special engineering measures would be employed to enable the construction of roads and other built features within the RPAs of trees without damaging tree roots. Installation of built features using no-dig and special engineering measures would meet the following performance criteria:

- The foundation type to be used must be determined following an assessment of the roots present in the area of concern.
- All excavations for the exploratory trench must be dug using hand tools and manual methods only. No machinery is permitted to be used. The exploratory trench must be dug down to a minimum depth of 1m below existing ground levels. If no significant roots are encountered (a low number of roots <25mm in diameter), traditional strip foundations can be used.
- Encountered roots must be cut back to provide a 50mm separation from new foundations.
- The foundation trenches must be lined with heavy-duty polythene sheeting prior to backfilling.
- An Arboriculturist must supervise the excavation work and provide an arboricultural supervision note.
- Where there are many significant roots (>25mm in diameter) encountered, they must be retained and the Proposed Development constructed using either a raft foundation or mini-pile and beam, with the ground beams sat at, or just below, ground level. The final foundation and internal floor specification must be provided by a qualified structural engineer and therefore is beyond the remit of this report.

If a raft foundation is to be used, then the following method must be followed:

- Any excavation required to create a level surface for the raft must be carried out carefully by hand. Any roots encountered must be cut back to 50mm beyond the area of disturbance. Roots must be cut cleanly, to minimise the exposed root surface. Where roots of diameter greater than 25mm must be retained wherever practicable.
- The area of ground beneath the slab must be lined with heavy-duty polythene sheeting prior to pouring of concrete.

If a piled foundation is to be used, then the following method must be followed:

- Prior to the installation of the piles an exploratory hole must be hand dug to establish the presence of roots. The exploratory hole must be repositioned if significant roots (diameter >25mm) are encountered. The final hole must be lined with heavy duty polythene sheeting to minimise soil contamination before cement is poured or the pile installed. The underside of the supporting beams for the internal floor must be suspended above existing ground levels and across the piles to avoid damage to tree roots.
- Roots of diameter greater than 25mm must be retained wherever possible. An Arboriculturist must advise on the appropriateness of root pruning before any root severance is carried out. Roots must be cut cleanly, to minimise the exposed root surface, and covered with a minimum of 50mm of soil and heavy-duty polythene sheeting prior to backfilling.

- Irrigation tubes must be used where practicable to redirect rainwater beneath the slab. This can be done by using a 60mm perforated pipe coiled beneath the suspended structure and bedded into gravel to help preserve underlying roots.

Appendix D

Tree Schedule

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1	1	*Fraxinus excelsior* Ash	17.0	2	67	N 7.0 E 7.0 S 7.0 W 7.0	5.0	2.5	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Major. Twin-stemmed.	203.6	8.0	40+	B	1
T2	1	*Quercus robur* English Oak	16.0	1	105	N 8.0 E 8.0 S 8.0 W 8.0	6.0	6.0	Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	498.8	12.6	40+	A	1
T3	1	*Fraxinus excelsior* Ash	17.0	6	85	N 10.0 E 8.0 S 8.0 W 8.0	2.0	0.5	Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Epicormic growth - Base. Ivy or climbing plant. Twin-stemmed.	332.5	10.3	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G4	40 25 20 20 15 15 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ilex aquifolium* Holly *Sambucus nigra* Elder *Fraxinus excelsior* Ash *Ulmus procera* English Elm *Quercus robur* English Oak	12.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Dead tree / trees. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Multi-stemmed. Natural regeneration.	18.1	2.4	40+	C	2
H5	200 100 75	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel	4.0	1	12	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. Maintained hedge, majority of which is blackthorn.	6.5	1.4	40+	C	1
T6	1	*Prunus spinosa* Blackthorn/Sloe	6.0	1	25	N 2.0 E 2.0 S 2.0 W 2.0	0.0	1.0	Early Mature	Fair	Outgrown tree from hedge.	28.3	3.0	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T7	1	*Fraxinus excelsior* Ash	10.0	2	40	N E S W 4.0 4.0 4.0 4.0	1.0	0.0	Early Mature	Good	Base / stems obscured - Vegetation. Epicormic growth - Base.	73.5	4.8	40+	C	1
T8	1	*Prunus spinosa* Blackthorn/Sloe	6.0	1	25	N E S W 2.0 2.0 2.0 2.0	0.0	1.0	Early Mature	Fair	Outgrown tree from hedge.	28.3	3.0	20-40	C	1
T9	1	*Acer campestre* Field Maple	10.0	6	44	N E S W 5.0 5.0 5.0 5.0	1.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Ivy or climbing plant.	87.9	5.3	40+	B	1
G10	10 10 10 5 1	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Sambucus nigra* Elder *Quercus robur* English Oak	7.0	1	14	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Fair	Arboricultural work - Historic. Base / stems obscured - Vegetation. Fallen tree / trees - Partial collapse. Ivy or climbing plant.	8.9	1.7	40+	C	2
T11	1	*Fraxinus excelsior* Ash	16.0	2	64	N E S W 8.0 8.0 8.0 8.0	2.0	1.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant. Twin-stemmed.	185.5	7.7	40+	B	1
T12	1	*Fraxinus excelsior* Ash	16.0	1	55	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor.	136.8	6.6	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G13	40 30 20 6 6 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Sambucus nigra* Elder *Fraxinus excelsior* Ash *Ulmus procera* English Elm *Quercus robur* English Oak	12.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Dead tree / trees. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Multi-stemmed. Natural regeneration.	18.1	2.4	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G14	30 20 10 10 2 2 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Sambucus nigra* Elder *Fraxinus excelsior* Ash *Quercus robur* English Oak *Ulmus procera* English Elm	10.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Dead tree / trees. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Multi-stemmed. Natural regeneration.	18.1	2.4	40+	C	2
G15	6	*Fraxinus excelsior* Ash	17.0	6	48	N 8.0 E 8.0 S 8.0 W 8.0	5.0	1.0	Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant.	108.6	5.9	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T16	1	*Fraxinus excelsior* Ash	18.0	4	102	N 9.0 E 9.0 S 9.0 W 9.0	5.0	2.0	Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Pruning wounds - Suspected compartmentalised. Pruning wounds - Historic.	473.9	12.3	40+	A	1
T17	1	*Quercus robur* English Oak	16.0	1	75	N 9.0 E 8.0 S 8.0 W 5.0	5.0	5.0	Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Bole / principal stems. Pruning wounds - Suspected compartmentalised.	254.5	9.0	40+	B	1
T18	1	*Quercus robur* English Oak	12.0	1	75	N 9.0 E 8.0 S 8.0 W 5.0	5.0	5.0	Mature	Fair	Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Suspected. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Habitat - High value.	254.5	9.0	40+	B	1
T19	1	*Quercus robur* English Oak	10.0	1	50	N 5.0 E 8.0 S 6.0 W 8.0	4.0	3.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor.	113.1	6.0	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T20	1	*Acer campestre* Field Maple	8.0	1	35	N 6.0 E 2.0 S 6.0 W 6.0	1.0	0.5	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect - Base. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Ivy or climbing plant.	55.4	4.2	40+	C	1
T21	1	*Quercus robur* English Oak	8.0	1	35	N 6.0 E 2.0 S 6.0 W 6.0	1.0	0.5	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	55.4	4.2	40+	C	1
G22	5	*Quercus robur* English Oak	8.0	1	20	N 4.0 E 2.0 S 4.0 W 4.0	1.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation.	18.1	2.4	40+	C	1 2
T23	1	*Quercus robur* English Oak	8.0	1	40	N 4.0 E 2.0 S 4.0 W 4.0	1.0	0.5	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	72.4	4.8	40+	C	1
T24	1	*Quercus robur* English Oak	9.0	1	68	N 8.0 E 8.0 S 8.0 W 8.0	1.0	3.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems.	209.2	8.2	40+	B	1
G25	3	*Fraxinus excelsior* Ash	15.0	2	67	N 8.0 E 8.0 S 8.0 W 8.0	3.0	2.0	Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole.	204.7	8.1	20-40	B	1
T26	1	*Ilex aquifolium* Holly	5.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.5	Semi Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation.	8.9	1.7	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G27	7	*Quercus robur* English Oak	13.0	1	45	N E S W 8.0 8.0 8.0 8.0	4.0	1.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Pruning wounds - Suspected compartmentalised. Twin-stemmed.	91.6	5.4	40+	B	1
T28	1	*Quercus robur* English Oak	15.0	1	55	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor.	136.8	6.6	40+	B	1
G29	3	*Quercus robur* English Oak	14.0	1	48	N E S W 8.0 8.0 8.0 8.0	4.0	3.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor.	104.2	5.8	40+	B	1
T30	1	*Quercus robur* English Oak	10.0	1	42	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Pruning wounds - Suspected compartmentalised.	79.8	5.0	40+	B	1
T31	1	*Quercus robur* English Oak	14.0	1	52	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Pruning wounds - Suspected compartmentalised.	122.3	6.2	40+	B	1
H32	140 30 20 20	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe	4.0	1	18	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Hedgerow - Maintained. Ivy or climbing plant.	14.7	2.2	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G33	25	*Prunus spinosa* Blackthorn/Sloe	13.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Fair	Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Dead tree / trees. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Habitat - High value. Hedgerow - Neglected / overgrown. Multi-stemmed. Twin-stemmed.	40.7	3.6	40+	C	2
	25	*Crataegus monogyna* Common Hawthorn/Quick/May														
	20	*Corylus avellana* Common Hazel														
	5	*Fraxinus excelsior* Ash														
	5	*Sambucus nigra* Elder														
	5	*Quercus robur* English Oak														
	4	*Acer campestre* Field Maple														
	3	*Ulmus procera* English Elm														
	3	*Ilex aquifolium* Holly														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H34	200 100 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer platanoides* Norway Maple *Quercus robur* English Oak	4.0	1	8	N 1.5 E 1.5 S 1.5 W 1.5	0.0	0.0	Semi Mature	Good	Base / stems obscured - Vegetation. Hedgerow - Maintained. Ivy or climbing plant. Offsite on private property.	2.9	1.0	40+	B	2
T35	1	*Fraxinus excelsior* Ash	9.0	1	35	N 4.5 E 4.5 S 4.5 W 4.5	3.0	4.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base. Ivy or climbing plant.	55.4	4.2	20-40	C	1
T36	1	*Fraxinus excelsior* Ash	9.0	1	35	N 4.5 E 4.5 S 4.5 W 4.5	3.0	4.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base. Ivy or climbing plant.	55.4	4.2	20-40	C	1
G37	40 15 10 4 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Ulmus procera* English Elm	3.0	1	8	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.9	1.0	40+	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T38	1	*Quercus robur* English Oak	16.0	1	75	N E S W 9.0 9.0 9.0 9.0	3.0	2.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor.	254.5	9.0	40+	A	1
G39	20 6 3 3 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Quercus robur* English Oak *Ulmus procera* English Elm	12.0	1	16	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent trees. Competition - Adjacent vegetation. Dead tree / trees. Fallen tree / trees - Partial collapse.	11.6	1.9	40+	C	2
G40	10 5 5 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	3.0	1	25	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Hedgerow - Maintained. Ivy or climbing plant.	28.3	3.0	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G41	6	*Salix caprea* Goat Willow/Great Sallow	12.0	1	35	N E S W 6.0 6.0 6.0 6.0	4.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Multi-stemmed.	55.4	4.2	40+	C	2
T42	1	*Quercus robur* English Oak	11.0	3	49	N E S W 7.0 7.0 7.0 7.0	4.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Multi-stemmed. Pruning wounds - Suspected compartmentalised.	111.1	5.9	40+	B	1
T43	1	*Salix caprea* Goat Willow/Great Sallow	10.0	1	30	N E S W 5.0 5.0 5.0 5.0	4.0	3.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	40.7	3.6	20-40	C	1
G44	30 10 5 4 4 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	8.0	1	10	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Hedgerow - Maintained. Ivy or climbing plant. Sides of group are flailed, top of canopy is outgrown.	4.5	1.2	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G45	10 6 4 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel	8.0	1	10	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Hedgerow - Maintained. Ivy or climbing plant. Sides of group are flailed, top of canopy is outgrown.	4.5	1.2	40+	C	2
T46	1	*Fraxinus excelsior* Ash	15.0	4	60	N 8.0 E 8.0 S 8.0 W 8.0	4.0	0.5	Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Decay / structural defect in crown limb / limbs - Extensive. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown.	162.9	7.2	10-20	C	1
G47	15 5 3 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Quercus robur* English Oak	13.0	1	45	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Decline - Suspected. Dense crown. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Fallen tree / trees - Whole tree. Hedgerow - Maintained. Maintained hedge with outgrown coppice stools dominating group.	91.6	5.4	40+	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H48	200 50 40 25 15	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm	2.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	11.6	1.9	40+	B	2
H49	100 20 15 10 5	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm	2.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	11.6	1.9	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G50	25 5 1	*Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple	8.0	1	16	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	11.6	1.9	40+	C	2
T51	1	*Quercus robur* English Oak	11.0	1	135	N E S W 5.0 5.0 5.0 5.0	4.0	4.0	Ancient or Veteran	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Tree exhibiting veteran characteristics, large cavity from base extending into central stem and creating a hollow stem. Signs of nesting in the stem.	706.9	15.0	40+	A	1 3
G52	20 15 15 5	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	12.0	1	25	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	28.3	3.0	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W53	150 150 100 50 50 40 40 15	*Acer campestre* Field Maple *Fraxinus excelsior* Ash *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Quercus robur* English Oak *Prunus spinosa* Blackthorn/Sloe *Castanea sativa* Sweet Chestnut *Ilex aquifolium* Holly	17.0	1	30	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Multi-stemmed. Twin-stemmed.	40.7	3.6	40+	B	2
T54	1	*Fraxinus excelsior* Ash	12.0	5	44	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	90.5	5.4	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G55	40 30 25 20 10 3	*Corylus avellana* Common Hazel *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm *Ilex aquifolium* Holly	9.0	1	20	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Dutch elm disease. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	18.1	2.4	40+	C	2
G56	20 15 15 10 5	*Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash	12.0	1	40	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Dead tree / trees. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Habitat - High value. Ivy or climbing plant.	72.4	4.8	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T57	1	*Fraxinus excelsior* Ash	17.0	5	78	N E S W 8.0 8.0 8.0 8.0	4.0	0.5	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	277.1	9.4	20-40	B	1
T58	1	*Fraxinus excelsior* Ash	18.0	5	78	N E S W 8.0 8.0 8.0 8.0	4.0	0.5	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	277.1	9.4	20-40	B	1
H59	109 50 50 50 30 20	*Corylus avellana* Common Hazel *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Ulmus procera* English Elm	12.0	1	20	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. Sides of hedge are flailed, top of canopy is outgrown.	18.1	2.4	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T60	1	*Fraxinus excelsior* Ash	18.0	5	78	N 8.0 E 8.0 S 8.0 W 8.0	4.0	0.5	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	277.1	9.4	20-40	B	1
T61	1	*Corylus avellana* Common Hazel	4.0	12	27	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	34.7	3.3	40+	C	1
G62	3	*Quercus robur* English Oak	19.0	1	135	N 10.0 E 10.0 S 10.0 W 10.0	3.0	4.0	Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Woodpecker holes.	706.9	15.0	40+	A	1 2 3
T63	1	*Fraxinus excelsior* Ash	12.0	3	56	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	142.6	6.7	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H64	70 25	*Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder	3.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
T65	1	*Quercus robur* English Oak	22.0	1	120	N E S W 12.0 12.0 12.0 12.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	651.4	14.4	40+	A	1
H66	40 10 5 4 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder *Ulmus procera* English Elm *Acer campestre* Field Maple *Quercus robur* English Oak	3.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T67	1	*Quercus robur* English Oak	20.0	1	65	N E S W 9.0 9.0 9.0 9.0	5.0	9.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	191.1	7.8	40+	A	1
T68	1	*Fagus sylvatica* Common Beech	16.0	1	80	N E S W 6.0 6.0 6.0 6.0	8.0	8.0	Mature	Dead	Dead tree / trees.			0-10	U	
W69	60 30 30 20 10 10 6 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Ulmus procera* English Elm *Pinus sylvestris* Scots Pine *Acer pseudoplatanus* Sycamore	20.0	1	45	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Hedgerow - Maintained. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Group is formed by a section of open woodland and a hedgerow which a sporadic gaps and outgrown trees.	91.6	5.4	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H70	5 3 3	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm	4.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	B	2
T71	1	*Quercus robur* English Oak	10.0	1	80	N E S W 5.0 5.0 5.0 5.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	289.5	9.6	40+	A	1 3
H72	150 150 75 50 50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T73	1	*Acer campestre* Field Maple	10.0	1	30	N E S W 5.0 5.0 5.0 5.0	3.0	2.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	40.7	3.6	40+	C	1
W74	40 30 25 25 20 10 6 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Pinus sylvestris* Scots Pine *Ulmus procera* English Elm	20.0	1	50	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Mature	Fair	Arboricultural work - Historic. Base / stems obscured - Vegetation. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Hedgerow - Maintained. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Group is formed by a section of open woodland which has been caused by felling, and a hedgerow with a sporadic gaps and outgrown trees.	113.1	6.0	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H75	30 20 15 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm	4.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	B	2
T76	1	*Fraxinus excelsior* Ash	17.0	3	93	N E S W 8.0 8.0 8.0 8.0	4.0	1.0	Ancient or Veteran	Good	Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base. Fungal fruiting body - structural decay suspected. Habitat - High value. Ivy or climbing plant. Pruning wounds - Decayed. Inonotus hispidus located at base and found on ground at base. Pathogenic and associated with simultaneous white rot/soft rot, and can facilitate stem and limb failure. Unable to access base due to vegetation, so couldn't apply sounding hammer.	395.8	11.2	40+	A	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T77	1	*Acer campestre* Field Maple	10.0	3	43	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	84.8	5.2	40+	B	1
H78	30 30 20 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm	4.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	B	2
G79	2 1	*Ilex aquifolium* Holly *Acer campestre* Field Maple	11.0	1	38	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	65.3	4.6	40+	B	2
T80	1	*Fraxinus excelsior* Ash	20.0	1	65	N E S W 9.0 9.0 9.0 9.0	4.0	1.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base. Ivy or climbing plant.	191.1	7.8	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T81	1	*Fraxinus excelsior* Ash	15.0	3	82	N E S W 4.0 10.0 9.0 7.0	3.0	1.0	Ancient or Veteran	Good	Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Hollow trunk - Open cavity. Lightning damage. Tree is exhibiting significant veteran characteristics. A vertical wounding of the entire main stem potentially caused by lightning strike, has resulted in a large area of decomposition extending the entire length of the stem.	308.7	9.9	40+	A	1 3
T82	1	*Quercus robur* English Oak	15.0	1	60	N E S W 7.0 8.0 4.0 10.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor.	162.9	7.2	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H83	100 50 30 15 10 10	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Sambucus nigra* Elder *Ulmus procera* English Elm	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
T84	1	*Quercus robur* English Oak	18.0	1	105	N 9.0 E 9.0 S 9.0 W 9.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Suspended. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	498.8	12.6	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T85	1	*Fraxinus excelsior* Ash	18.0	1	60	N E S W 9.0 9.0 2.0 9.0	3.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Suspended. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fungal fruiting body - structural decay suspected. Ivy or climbing plant. Poor past pruning. Inonotus hispidus (shaggy bracket) located on lower eastern limb at 4m. Pruned back from overhead conductors to south.	162.9	7.2	20-40	B	1
H86	50 30 25 15 10 10	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Sambucus nigra* Elder *Ulmus procera* English Elm	4.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T87	1	*Fraxinus excelsior* Ash	18.0	1	55	N E S W 9.0 9.0 9.0 9.0	5.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Suspended. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	136.8	6.6	20-40	B	1
H88	40 30 10 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash	4.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. Northeast section outgrown.	8.9	1.7	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H89	60 60 30 15 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. North section outgrown.	8.9	1.7	40+	C	2
H90	200 150 60 30 20 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm *Euonymus europaeus* Spindle	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. A central section is outgrown.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T91	1	*Fraxinus excelsior* Ash	18.0	3	72	N E S W 9.0 9.0 9.0 9.0	5.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Suspended. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	237.5	8.7	20-40	B	1
H92	100 75 30 25 10 10 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Swida sanguinea* Common Dogwood *Ulmus procera* English Elm	4.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T93	1	*Fraxinus excelsior* Ash	17.0	4	62	N E S W 9.0 9.0 9.0 9.0	3.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Suspended. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	174.2	7.4	20-40	B	1
T94	1	*Malus sylvestris* Wild Crab	9.0	1	30	N E S W 9.0 9.0 9.0 9.0	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	40.7	3.6	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H95	60 55 30 25 10 10 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Swida sanguinea* Common Dogwood *Ulmus procera* English Elm	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
T96	1	*Quercus robur* English Oak	11.0	1	60	N 7.0 E 7.0 S 7.0 W 7.0	4.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Reaction wood / Adaptive growth - Stem / stems.	162.9	7.2	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T97	1	*Quercus robur* English Oak	11.0	1	62	N E S W 7.0 8.0 5.0 9.0	4.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant. Reaction wood / Adaptive growth - Stem / stems.	173.9	7.4	40+	B	1
T98	1	*Fraxinus excelsior* Ash	9.0	6	44	N E S W 6.0 6.0 6.0 6.0	4.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant.	87.9	5.3	40+	B	1
T99	1	*Quercus robur* English Oak	18.0	1	75	N E S W 9.0 9.0 9.0 9.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Ivy or climbing plant. Poor past pruning.	254.5	9.0	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H100	400	*Prunus spinosa* Blackthorn/Sloe	4.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
	400	*Crataegus monogyna* Common Hawthorn/Quick/May														
	200	*Corylus avellana* Common Hazel														
	150	*Acer campestre* Field Maple														
	50	*Ulmus procera* English Elm														
	50	*Fraxinus excelsior* Ash														
	50	*Swida sanguinea* Common Dogwood														
	30	*Sambucus nigra* Elder														
	20	*Euonymus europaeus* Spindle														
	20	*Ilex aquifolium* Holly														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G101	8 5	*Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe	11.0	1	20	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	18.1	2.4	20-40	C	2
T102	1	*Quercus robur* English Oak	16.0	1	105	N E S W 8.0 8.0 8.0 8.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	498.8	12.6	40+	A	1
T103	1	*Quercus robur* English Oak	14.0	1	46	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect - Base. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	95.7	5.5	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T104	1	*Quercus robur* English Oak	9.0	1	36	N E S W 6.0 3.0 1.0 4.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning. Suppressed crown - Major. Unbalanced crown - Minor.	58.6	4.3	40+	C	1
T105	1	*Quercus robur* English Oak	14.0	1	46	N E S W 6.0 6.0 6.0 6.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect - Base. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	95.7	5.5	40+	B	1
G106	3	*Quercus robur* English Oak	13.0	1	55	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	136.8	6.6	40+	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T107	1	*Quercus robur* English Oak	18.0	1	70	N E S W 11.0 11.0 11.0 11.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	221.7	8.4	40+	A	1
G108	30 30 15 15 15 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow *Acer campestre* Field Maple	18.0	1	35	N E S W 7.0 7.0 7.0 7.0	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent trees. Deadwood - Major. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Ivy or climbing plant. Multi-stemmed.	55.4	4.2	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H109	250 250 200 150 20 15 10 10 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ulmus procera* English Elm *Sambucus nigra* Elder *Fraxinus excelsior* Ash *Swida sanguinea* Common Dogwood *Euonymus europaeus* Spindle	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
H110	4 3 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Prunus spinosa* Blackthorn/Sloe	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)				Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
						N	E	S	W										
T111	1	*Quercus robur* English Oak	17.0	1	105	9.0	9.0	9.0	9.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	498.8	12.6	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W112	110	*Quercus robur* English Oak	20.0	1	40	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	72.4	4.8	40+	A	2 3
	50	*Crataegus monogyna* Common Hawthorn/Quick/May														
	50	*Prunus spinosa* Blackthorn/Sloe														
	40	*Corylus avellana* Common Hazel														
	20	*Acer campestre* Field Maple														
	10	*Fraxinus excelsior* Ash														
	10	*Ilex aquifolium* Holly														
	10	*Sambucus nigra* Elder														
	7	*Pinus sylvestris* Scots Pine														
	5	*Ulmus procera* English Elm														
	1	*Populus x canadensis* Hybrid Black Poplars														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H113	200 200 100 50 50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
H114	200 200 100 50 50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H115	200 200 100 50 50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
G116	60 40 15 15 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Sambucus nigra* Elder *Ulmus procera* English Elm *Fraxinus excelsior* Ash *Malus sylvestris* Wild Crab	12.0	1	20	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	18.1	2.4	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T117	1	*Fraxinus excelsior* Ash	14.0	3	51	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor.	122.1	6.2	20-40	B	1
T118	1	*Quercus robur* English Oak	17.0	1	95	N 8.0 E 8.0 S 8.0 W 8.0	5.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	408.3	11.4	40+	A	1 3
T119	1	*Quercus robur* English Oak	12.0	1	80	N 7.0 E 7.0 S 7.0 W 7.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	289.5	9.6	40+	A	1
T120	1	*Quercus robur* English Oak	12.0	1	75	N 9.0 E 9.0 S 9.0 W 9.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	254.5	9.0	40+	A	1
T121	1	*Quercus robur* English Oak	9.0	1	45	N 3.5 E 3.5 S 3.5 W 3.5	4.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	91.6	5.4	40+	C	1
T122	1	*Quercus robur* English Oak	13.0	1	75	N 5.0 E 5.0 S 5.0 W 5.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	254.5	9.0	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T123	1	*Quercus robur* English Oak	9.0	1	78	N E S W 4.5 4.5 4.5 4.5	4.0	4.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant.	275.2	9.4	40+	C	1
H124	300 300 150 50 50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
T125	1	*Fraxinus excelsior* Ash	18.0	6	73	N E S W 9.0 9.0 9.0 9.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	244.3	8.8	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T126	1	*Fraxinus excelsior* Ash	17.0	2	53	N 7.0 E 7.0 S 7.0 W 7.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant.	130.7	6.4	20-40	B	1
T127	1	*Fraxinus excelsior* Ash	17.0	3	65	N 8.0 E 8.0 S 8.0 W 8.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Ivy or climbing plant.	196.0	7.9	20-40	B	1
T128	1	*Fraxinus excelsior* Ash	16.0	3	51	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Ivy or climbing plant.	122.1	6.2	20-40	B	1
T129	1	*Fraxinus excelsior* Ash	14.0	4	52	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Ivy or climbing plant.	122.3	6.2	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T130	1	*Fraxinus excelsior* Ash	14.0	2	39	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	70.9	4.8	20-40	B	1
G131	3	*Fraxinus excelsior* Ash	15.0	3	34	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	54.3	4.2	20-40	B	2 3
T132	1	*Fraxinus excelsior* Ash	16.0	4	60	N 7.0 E 7.0 S 7.0 W 7.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	162.9	7.2	20-40	B	1
T133	1	*Fraxinus excelsior* Ash	15.0	2	45	N 7.0 E 7.0 S 7.0 W 7.0	5.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	92.6	5.4	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T134	1	*Fraxinus excelsior* Ash	12.0	3	51	N E S W 6.0 6.0 6.0 6.0	5.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Fungal fruiting body - structural decay suspected. Ivy or climbing plant. Inonotus hispidus (shaggy bracket) located on central stem at 5m.	122.1	6.2	20-40	B	1
G135	7	*Fraxinus excelsior* Ash	15.0	3	38	N E S W 6.0 6.0 6.0 6.0	5.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	65.7	4.6	20-40	B	2 3
G136	2	*Fraxinus excelsior* Ash	15.0	6	44	N E S W 5.0 5.0 5.0 5.0	5.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	87.9	5.3	20-40	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G137	200 200 150 50 40 20 20 15 15	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Sambucus nigra* Elder *Ulmus procera* English Elm *Quercus robur* English Oak *Swida sanguinea* Common Dogwood	12.0	1	16	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	11.6	1.9	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G138	100 100 10 10 5 5 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Quercus robur* English Oak *Sambucus nigra* Elder *Ulmus procera* English Elm	8.0	1	16	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	11.6	1.9	40+	C	2 3
T139	1	*Fraxinus excelsior* Ash	12.0	3	51	N 6.0 E 6.0 S 6.0 W 6.0	5.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	122.1	6.2	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G140	4	*Fraxinus excelsior* Ash	15.0	4	70	N 8.0 E 8.0 S 8.0 W 8.0	5.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	221.7	8.4	20-40	B	2 3
T141	1	*Fraxinus excelsior* Ash	14.0	2	52	N 8.0 E 8.0 S 8.0 W 8.0	5.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Twin-stemmed.	124.0	6.3	20-40	B	1
G142	2	*Fraxinus excelsior* Ash	15.0	4	50	N 8.0 E 8.0 S 8.0 W 8.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant.	113.1	6.0	20-40	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G143	60 50 50 20 10 5 5 5	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Ulmus procera* English Elm *Corylus avellana* Common Hazel *Quercus robur* English Oak *Sambucus nigra* Elder	12.0	1	20	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Coppice stool - Coppice origin / Mature stems. Dutch elm disease. Dead tree / trees. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	18.1	2.4	40+	C	2 3
G144	4	*Fraxinus excelsior* Ash	12.0	2	22	N 3.0 E 3.0 S 3.0 W 3.0	5.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	23.2	2.7	20-40	C	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G145	3 1 1	*Acer campestre* Field Maple *Salix caprea* Goat Willow/Great Sallow *Ulmus procera* English Elm	12.0	2	28	N E S W 4.0 4.0 4.0 4.0	3.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	36.2	3.4	20-40	C	2 3
T146	1	*Fraxinus excelsior* Ash	12.0	4	40	N E S W 7.0 7.0 7.0 7.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown.	72.4	4.8	20-40	B	1
T147	1	*Fraxinus excelsior* Ash	15.0	4	46	N E S W 6.0 6.0 6.0 6.0	5.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown.	95.7	5.5	20-40	B	1
T148	1	*Fraxinus excelsior* Ash	12.0	4	50	N E S W 7.0 7.0 7.0 7.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	113.1	6.0	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T149	1	*Fraxinus excelsior* Ash	12.0	6	61	N 7.0 E 7.0 S 7.0 W 7.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	169.6	7.3	20-40	B	1
T150	1	*Quercus robur* English Oak	12.0	1	55	N 7.0 E 7.0 S 7.0 W 7.0	4.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor.	136.8	6.6	40+	B	1
T151	1	*Quercus robur* English Oak	15.0	2	77	N 8.0 E 8.0 S 8.0 W 8.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Twin-stemmed.	273.7	9.3	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G152	35 10 5 5 5 4 1	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Acer campestre* Field Maple *Ulmus procera* English Elm *Larix decidua* European Larch/Common Larch *Abies grandis* Giant Fir	15.0	1	45	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Dead tree / trees. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Habitat - High value. Ivy or climbing plant.	91.6	5.4	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H153	200 200 20 20 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. Maintained hedgerow with sporadic outgrown individual stems.	8.9	1.7	40+	B	2
H154	100 50 5 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. Maintained hedgerow with sporadic outgrown individual stems.	8.9	1.7	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H155	50 20	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May	3.0	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	4.5	1.2	40+	C	2
H156	30 5 3	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	3.0	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. Maintained hedgerow with sporadic outgrown stems.	4.5	1.2	40+	C	2
T157	1	*Fraxinus excelsior* Ash	15.0	3	77	N E S W 8.0 8.0 8.0 8.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	274.8	9.4	20-40	B	1
H158	50 10 3	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	3.0	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	4.5	1.2	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T159	1	*Quercus robur* English Oak	17.0	1	75	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant.	254.5	9.0	40+	A	1
T160	1	*Quercus robur* English Oak	17.0	1	78	N E S W 10.0 10.0 10.0 10.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant.	275.2	9.4	40+	A	1
T161	1	*Fraxinus excelsior* Ash	13.0	3	34	N E S W 5.0 5.0 5.0 5.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	54.3	4.2	20-40	C	1
T162	1	*Fraxinus excelsior* Ash	13.0	4	40	N E S W 5.0 5.0 5.0 5.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	72.4	4.8	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G163	25 10 6 3 1	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Ulmus procera* English Elm	16.0	2	28	N 5.0 E 5.0 S 5.0 W 5.0	3.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	36.2	3.4	20-40	B	2 3
G164	150 150 60 25 15 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm *Quercus robur* English Oak	14.0	1	30	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	40.7	3.6	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T165	1	*Fraxinus excelsior* Ash	17.0	5	44	N 5.0 E 5.0 S 5.0 W 5.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	90.5	5.4	20-40	B	1
T166	1	*Fraxinus excelsior* Ash	17.0	5	44	N 5.0 E 5.0 S 5.0 W 5.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	90.5	5.4	20-40	B	1
T167	1	*Fraxinus excelsior* Ash	17.0	5	51	N 7.0 E 7.0 S 7.0 W 7.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	119.7	6.2	20-40	B	1
T168	1	*Quercus robur* English Oak	17.0	1	98	N 10.0 E 10.0 S 10.0 W 10.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant.	434.5	11.8	40+	A	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T169	1	*Quercus robur* English Oak	16.0	1	68	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Woodpecker holes.	209.2	8.2	40+	A	1
T170	1	*Quercus robur* English Oak	14.0	1	60	N E S W 6.0 6.0 6.0 6.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Woodpecker holes.	162.9	7.2	40+	B	1
T171	1	*Quercus robur* English Oak	16.0	1	60	N E S W 6.0 6.0 6.0 6.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Woodpecker holes.	162.9	7.2	40+	B	1
T172	1	*Ulmus procera* English Elm	6.0	1	16	N E S W 4.0 6.0 2.0 2.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Suppressed crown - Major. Unbalanced crown - Major.	11.6	1.9	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T173	1	*Quercus robur* English Oak	18.0	1	80	N E S W 8.0 8.0 8.0 8.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Woodpecker holes. Torn out main limb to south.	289.5	9.6	40+	B	1
T174	1	*Quercus robur* English Oak	13.0	1	95	N E S W 7.0 7.0 7.0 7.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Woodpecker holes. Torn out main limb to north resulting in vertical decayed strip down whole stem with cavity forming.	408.3	11.4	40+	B	1
H175	150 150 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	3.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H176	150 150 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	3.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	B	2
G177	45 10 6 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Salix fragilis* Crack Willow *Ulmus procera* English Elm	9.0	1	20	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Dead tree / trees. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Habitat - High value. Ivy or climbing plant.	18.1	2.4	40+	C	2 3
G178	3 2	*Fraxinus excelsior* Ash *Acer campestre* Field Maple	15.0	4	40	N E S W 5.0 5.0 5.0 5.0	2.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Minor. Ivy or climbing plant.	72.4	4.8	20-40	B	2 3
T179	1	*Fraxinus excelsior* Ash	12.0	1	40	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Minor.	72.4	4.8	20-40	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T180	1	*Fraxinus excelsior* Ash	13.0	3	34	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor.	54.3	4.2	20-40	B	2
G181	5	*Fraxinus excelsior* Ash	15.0	4	60	N E S W 7.0 7.0 7.0 7.0	2.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Minor. Ivy or climbing plant.	162.9	7.2	20-40	B	2 3
G182	60 25 6 5 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Sambucus nigra* Elder	15.0	1	35	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Natural regeneration.	55.4	4.2	40+	B	2 3
T183	1	*Fraxinus excelsior* Ash	10.0	9	48	N E S W 4.0 4.0 4.0 4.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant. Physiological / cambial damage - Unconfirmed.	104.2	5.8	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T184	1	*Quercus robur* English Oak	11.0	1	80	N E S W 8.0 8.0 8.0 8.0	1.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Fungal fruiting body - structural decay suspected. Ganoderma applanatum at base.	289.5	9.6	40+	A	1 3
T185	1	*Fraxinus excelsior* Ash	10.0	2	28	N E S W 4.0 4.0 4.0 4.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Physiological / cambial damage - Unconfirmed.	36.2	3.4	20-40	C	1
T186	1	*Fraxinus excelsior* Ash	10.0	1	25	N E S W 4.0 4.0 4.0 4.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Physiological / cambial damage - Unconfirmed.	28.3	3.0	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G187	50 50 15 10 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Quercus robur* English Oak	14.0	1	30	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Mostly outgrown hedgerow with sporadic flailed sections.	40.7	3.6	40+	C	2 3
H188	150 150 5 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	3.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T189	1	*Fraxinus excelsior* Ash	19.0	2	42	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant.	81.4	5.1	20-40	B	2
T190	1	*Fraxinus excelsior* Ash	18.0	4	80	N 8.0 E 8.0 S 8.0 W 8.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant.	289.5	9.6	20-40	B	2
T191	1	*Fraxinus excelsior* Ash	18.0	1	85	N 9.0 E 9.0 S 9.0 W 9.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Branch - Suspended. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Principal stems. Epicormic growth - Base. Ivy or climbing plant.	326.9	10.2	20-40	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G192	30 20 10 6 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Ulmus procera* English Elm *Acer campestre* Field Maple	12.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	40.7	3.6	40+	C	2 3
G193	50 50 35 30 6 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Ulmus procera* English Elm *Quercus robur* English Oak	19.0	1	45	N E S W 8.0 8.0 8.0 8.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Flailed on field side. Hv conductors and pole located midway along group.	91.6	5.4	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G194	6	*x Cupressocyparis leylandii* Leyland Cypress	15.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Arboricultural work - Recent. Base / stems obscured - Vegetation. Outgrown leyland cypress hedge, flailed on field side.	28.3	3.0	40+	C	2
G195	6	*x Cupressocyparis leylandii* Leyland Cypress	15.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Arboricultural work - Recent. Base / stems obscured - Vegetation. Outgrown leyland cypress hedge, flailed on field side.	28.3	3.0	40+	C	2
G196	25 25 20 6 6	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Sambucus nigra* Elder *Ulmus procera* English Elm	19.0	1	45	N E S W 8.0 8.0 8.0 8.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Flailed on field side.	91.6	5.4	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T197	1	*Fraxinus excelsior* Ash	19.0	1	80	N E S W 9.0 9.0 9.0 9.0	3.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	289.5	9.6	20-40	B	2
H198	75 50 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Ulmus procera* English Elm	4.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
T199	1	*Ilex aquifolium* Holly	11.0	1	30	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Dense crown. Epicormic growth - Base / bole / principal stems.	40.7	3.6	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T200	1	*Fraxinus excelsior* Ash	16.0	4	62	N 9.0 E 9.0 S 9.0 W 9.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Suspended. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	174.2	7.4	20-40	B	1
T201	1	*Quercus robur* English Oak	10.0	1	56	N 7.0 E 7.0 S 7.0 W 7.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	141.9	6.7	40+	B	1
T202	1	*Fraxinus excelsior* Ash	11.0	2	49	N 6.0 E 6.0 S 6.0 W 10.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	110.8	5.9	40+	C	1
T203	1	*Fraxinus excelsior* Ash	18.0	2	53	N 7.0 E 7.0 S 7.0 W 7.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	130.7	6.4	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T204	1	*Fraxinus excelsior* Ash	18.0	1	58	N E S W 8.0 8.0 8.0 8.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	152.2	7.0	40+	B	1
T205	1	*Quercus robur* English Oak	12.0	1	95	N E S W 9.0 9.0 9.0 9.0	4.0	4.5	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	408.3	11.4	40+	A	1
H206	100 100 30 20 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Sambucus nigra* Elder	3.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H207	100 100 30 20 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Sambucus nigra* Elder	3.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
T208	1	*Quercus robur* English Oak	17.0	2	78	N 10.0 E 10.0 S 10.0 W 10.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Poor past pruning.	280.5	9.4	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H209	250 250 25 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	3.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
G210	45 25 10 5 2	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm *Corylus avellana* Common Hazel *Quercus robur* English Oak	8.0	1	20	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	18.1	2.4	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T211	1	*Acer campestre* Field Maple	8.0	6	44	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Base / bole / principal stems. Rubbing limbs.	87.9	5.3	40+	B	1
T212	1	*Quercus robur* English Oak	19.0	1	34	N E S W 5.0 5.0 5.0 5.0	4.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	52.3	4.1	40+	B	1
H213	100 50 5 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm *Corylus avellana* Common Hazel	3.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	B	2
T214	1	*Ulmus procera* English Elm	10.0	2	42	N E S W 4.0 4.0 4.0 4.0	4.0	4.0	Early Mature	Dead	Dead tree / trees.			0-10	U	

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H215	100 50 5 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm *Corylus avellana* Common Hazel	3.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. Mostly maintained hedgerow with 2 sections of outgrown stems.	8.9	1.7	40+	B	2
T216	1	*Quercus robur* English Oak	18.0	1	80	N 11.0 E 11.0 S 11.0 W 11.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	289.5	9.6	40+	A	1
T217	1	*Quercus robur* English Oak	18.0	1	80	N 11.0 E 11.0 S 11.0 W 11.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	289.5	9.6	40+	A	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)				Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
						N	E	S	W										
G218	60	*Prunus spinosa* Blackthorn/Sloe	16.0	1	30	7.0	7.0	7.0	7.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Natural regeneration.	40.7	3.6	40+	B	2 3
	50	*Crataegus monogyna* Common Hawthorn/Quick/May																	
	20	*Fraxinus excelsior* Ash																	
	10	*Corylus avellana* Common Hazel																	
	6	*Sambucus nigra* Elder																	
	6	*Ulmus procera* English Elm																	
	5	*Acer campestre* Field Maple																	

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G219	40 30 20 10 6 6 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Sambucus nigra* Elder *Ulmus procera* English Elm *Acer campestre* Field Maple	18.0	1	35	N 7.0 E 7.0 S 7.0 W 7.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Natural regeneration.	55.4	4.2	40+	B	2 3
T220	1	*Fraxinus excelsior* Ash	11.0	5	44	N 5.0 E 5.0 S 5.0 W 5.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	90.5	5.4	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H221	50 50 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm	3.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	B	2
G222	4 2	*Acer campestre* Field Maple *Fraxinus excelsior* Ash	15.0	4	40	N E S W 7.0 7.0 7.0 7.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	72.4	4.8	20-40	C	2 3
T223	1	*Corylus avellana* Common Hazel	4.0	15	27	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Early Mature	Good	Coppice stool - Regrown.	33.3	3.3	40+	C	1
T224	1	*Fraxinus excelsior* Ash	17.0	1	65	N E S W 10.0 10.0 10.0 10.0	4.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Poor past pruning.	191.1	7.8	20-40	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T225	1	*Quercus robur* English Oak	13.0	2	56	N E S W 9.0 9.0 9.0 9.0	4.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Poor past pruning. Twin-stemmed.	144.8	6.8	20-40	B	2
G226	15 15 6	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm	5.0	1	16	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	11.6	1.9	40+	C	2
G227	4 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	14.0	1	30	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	40.7	3.6	20-40	C	2
G228	4 3 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm	9.0	1	20	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	18.1	2.4	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G229	6	*Fraxinus excelsior* Ash	14.0	2	28	N 5.0 E 5.0 S 5.0 W 5.0	4.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	36.2	3.4	20-40	B	2
T230	1	*Fraxinus excelsior* Ash	16.0	2	50	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base. Ivy or climbing plant. Twin-stemmed.	117.3	6.1	20-40	B	2
T231	1	*Fraxinus excelsior* Ash	16.0	2	53	N 8.0 E 8.0 S 8.0 W 8.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base. Ivy or climbing plant. Twin-stemmed.	130.7	6.4	20-40	B	2
T232	1	*Fraxinus excelsior* Ash	17.0	1	48	N 7.0 E 3.0 S 7.0 W 7.0	4.0	5.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base. Epicormic growth - Crown. Ivy or climbing plant.	104.2	5.8	20-40	B	2
T233	1	*Fraxinus excelsior* Ash	17.0	4	50	N 7.0 E 3.0 S 7.0 W 7.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base. Epicormic growth - Crown. Ivy or climbing plant.	113.1	6.0	20-40	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H234	40 30 5 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	3.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. Maintained hedgerow with sporadic outgrown stems.	8.9	1.7	40+	C	2
T235	1	*Fraxinus excelsior* Ash	18.0	1	55	N 9.0 E 9.0 S 9.0 W 9.0	1.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	136.8	6.6	20-40	B	2
G236	8 1	*Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow	16.0	2	28	N 5.0 E 5.0 S 5.0 W 5.0	4.0	0.0	Early Mature	Fair	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	36.2	3.4	20-40	C	2
T237	1	*Fraxinus excelsior* Ash	15.0	2	53	N 8.0 E 8.0 S 8.0 W 8.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base. Ivy or climbing plant. Twin-stemmed.	130.7	6.4	20-40	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T238	1	*Fraxinus excelsior* Ash	15.0	1	55	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	136.8	6.6	20-40	B	2
G239	40 30 15 5 5 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Salix caprea* Goat Willow/Great Sallow *Sambucus nigra* Elder	18.0	1	40	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decline - Evident / observed. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Ivy or climbing plant.	72.4	4.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H240	100 100 10 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	3.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
H241	15 15 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	3.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H242	50 50 20 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Swida sanguinea* Common Dogwood	3.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
T243	1	*Quercus robur* English Oak	15.0	1	52	N 8.0 E 8.0 S 8.0 W 8.0	4.0	2.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Poor past pruning.	122.3	6.2	40+	B	1
T244	1	*Fraxinus excelsior* Ash	16.0	1	50	N 8.0 E 8.0 S 8.0 W 8.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Poor past pruning.	113.1	6.0	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T245	1	*Fraxinus excelsior* Ash	18.0	1	110	N E S W 10.0 10.0 10.0 10.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant. Poor past pruning. Large cavity on west side of stem from ground reaching up to 2.5m, reactive growth occuring as tree attempts to occlude over the wound/cavity.	547.4	13.2	40+	A	1 3
G246	2 1	*Quercus robur* English Oak *Ilex aquifolium* Holly	17.0	1	65	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	191.1	7.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)				Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
						N	E	S	W										
W247	250	*Quercus robur* English Oak	19.0	1	50	8.0	8.0	8.0	8.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Coppice stool - Coppice origin / Mature stems. Decline - Evident / observed. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Habitat - High value.	113.1	6.0	40+	A	1 2 3
	150	*Crataegus monogyna* Common Hawthorn/Quick/May																	
	150	*Acer campestre* Field Maple																	
	150	*Prunus spinosa* Blackthorn/Sloe																	
	60	*Fraxinus excelsior* Ash																	
	50	*Corylus avellana* Common Hazel																	
	50	*Sambucus nigra* Elder																	
	25	*Ilex aquifolium* Holly																	
	20	*Ulmus procera* English Elm																	
	5	*Salix caprea* Goat Willow/Great Sallow																	

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H248	250 250 25 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	3.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	8.9	1.7	40+	C	2
T249	1	*Ilex aquifolium* Holly	5.0	6	39	N 2.0 E 2.0 S 2.0 W 2.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Dense crown. Multi-stemmed.	69.5	4.7	40+	C	1
T250	1	*Fraxinus excelsior* Ash	14.0	4	80	N 8.0 E 8.0 S 8.0 W 8.0	4.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base. Multi-stemmed.	289.5	9.6	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T251	1	*Quercus robur* English Oak	16.0	1	100	N E S W 9.0 9.0 9.0 9.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Fungal fruiting body - structural decay suspected. Fungal fruiting body located on southern lower branch at 5m, potentially fistulina hepatica (beefsteak fungus).	452.4	12.0	40+	A	1 3
T252	1	*Fraxinus excelsior* Ash	15.0	4	70	N E S W 9.0 9.0 9.0 9.0	3.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base. Ivy or climbing plant. Multi-stemmed.	221.7	8.4	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T253	1	*Quercus robur* English Oak	16.0	1	50	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base. Epicormic growth - Crown. Fungal fruiting body - structural decay suspected. Physiological / cambial damage - Fungal. Fungal fruiting bodies located on main stem up to 5m, potentially inonotus hispidus (shaggy bracket).	113.1	6.0	40+	B	1
G254	2	*Fraxinus excelsior* Ash	16.0	1	50	N E S W 8.0 8.0 8.0 8.0	5.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Branch - Suspended. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	113.1	6.0	20-40	B	2
T255	1	*Fraxinus excelsior* Ash	9.0	3	34	N E S W 4.0 4.0 4.0 4.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Multi-stemmed.	54.3	4.2	20-40	C	1
T256	1	*Fraxinus excelsior* Ash	11.0	4	60	N E S W 6.0 6.0 6.0 6.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Multi-stemmed.	162.9	7.2	20-40	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G257	3 2 1	*Corylus avellana* Common Hazel *Salix caprea* Goat Willow/Great Sallow *Acer campestre* Field Maple	8.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	40.7	3.6	40+	C	2
H258	60 60 15 10 5 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	3.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. A central section is outgrown.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H259	200 200 100 60 25 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	3.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. A central section is outgrown.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W260	150	*Acer campestre* Field Maple	22.0	1	70	N E S W 8.0 8.0 8.0 8.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Coppice stool - Coppice origin / Mature stems. Decline - Evident / observed. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Habitat - High value.	221.7	8.4	40+	A	1 2 3
	150	*Quercus robur* English Oak														
	150	*Crataegus monogyna* Common Hawthorn/Quick/May														
	150	*Prunus spinosa* Blackthorn/Sloe														
	60	*Fraxinus excelsior* Ash														
	50	*Corylus avellana* Common Hazel														
	50	*Sambucus nigra* Elder														
	30	*Populus x canadensis* Hybrid Black Poplars														
	30	*Pinus sylvestris* Scots Pine														
	25	*Ilex aquifolium* Holly														
	20	*Ulmus procera* English Elm														
	5	*Salix caprea* Goat Willow/Great Sallow														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G261	6 5 3 3 1	*Quercus robur* English Oak *Carpinus betulus* Hornbeam *Fraxinus excelsior* Ash *Tilia cordata* Small Leaved Lime *Castanea sativa* Sweet Chestnut	13.0	1	35	N 6.0 E 6.0 S 6.0 W 6.0	4.0	2.0	Early Mature	Good	Arboricultural work - Historic. Bark wound - Mechanical. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Poor past pruning.	55.4	4.2	40+	B	2
G262	2 1	*Carpinus betulus* Hornbeam *Quercus robur* English Oak	13.0	1	35	N 6.0 E 6.0 S 6.0 W 6.0	4.0	2.0	Early Mature	Good	Arboricultural work - Historic. Bark wound - Mechanical. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Poor past pruning.	55.4	4.2	40+	B	2
G263	4 3 2	*Fraxinus excelsior* Ash *Carpinus betulus* Hornbeam *Quercus robur* English Oak	13.0	1	35	N 6.0 E 6.0 S 6.0 W 6.0	4.0	2.0	Early Mature	Good	Arboricultural work - Historic. Bark wound - Mechanical. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Poor past pruning.	55.4	4.2	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G264	2 1 1	*Carpinus betulus* Hornbeam *Quercus robur* English Oak *Tilia cordata* Small Leaved Lime	8.0	1	35	N E S W 4.0 4.0 4.0 4.0	4.0	2.0	Early Mature	Fair	Arboricultural work - Historic. Bark wound - Mechanical. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Poor past pruning.	55.4	4.2	40+	B	2
G265	2 1 1	*Fraxinus excelsior* Ash *Quercus robur* English Oak *Tilia cordata* Small Leaved Lime	9.0	1	35	N E S W 5.0 5.0 5.0 5.0	4.0	2.0	Early Mature	Fair	Arboricultural work - Historic. Bark wound - Mechanical. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Poor past pruning.	55.4	4.2	40+	B	2
T266	1	*Fraxinus excelsior* Ash	17.0	5	44	N E S W 7.0 7.0 7.0 7.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	90.5	5.4	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G267	100 25 15 10 10 5 1	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Ulmus procera* English Elm *Malus sylvestris* Wild Crab	9.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent trees. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	18.1	2.4	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G268	300 250 150 100 100 25 15 15 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Ulmus procera* English Elm *Quercus robur* English Oak *Salix caprea* Goat Willow/Great Sallow *Malus sylvestris* Wild Crab	7.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent trees. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	72.4	4.8	40+	B	2 3
G269	3	*Quercus robur* English Oak	19.0	1	85	N 10.0 E 10.0 S 10.0 W 10.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	326.9	10.2	40+	A	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G270	300 250 150 100 100 25 15 15 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Ulmus procera* English Elm *Quercus robur* English Oak *Salix caprea* Goat Willow/Great Sallow *Malus sylvestris* Wild Crab	14.0	1	40	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent trees. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	72.4	4.8	40+	B	2 3
T271	1	*Fraxinus excelsior* Ash	16.0	1	42	N 8.0 E 8.0 S 8.0 W 8.0	4.0	5.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Major. Deadwood - Minor.	79.8	5.0	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T272	1	*Quercus robur* English Oak	19.0	1	92	N E S W 10.0 10.0 10.0 10.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant. Poor past pruning.	382.9	11.0	40+	A	1
T273	1	*Quercus robur* English Oak	16.0	1	85	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant. Poor past pruning.	326.9	10.2	40+	A	1
G274	50 50 40 30 15 6	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Quercus robur* English Oak	14.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent trees. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	40.7	3.6	40+	B	2 3
T275	1	*Salix fragilis* Crack Willow	22.0	2	70	N E S W 11.0 11.0 11.0 11.0	3.0	1.0	Early Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	226.2	8.5	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T276	1	*Salix fragilis* Crack Willow	22.0	4	100	N E S W 13.0 13.0 13.0 13.0	3.0	1.0	Early Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	452.4	12.0	40+	B	1
G277	50 50 40 40 30 30 20 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow *Corylus avellana* Common Hazel *Quercus robur* English Oak *Fagus sylvatica* Common Beech	16.0	1	30	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent trees. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	40.7	3.6	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G278	50 50 40 40 30 25 20 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Ulmus procera* English Elm *Quercus robur* English Oak *Salix caprea* Goat Willow/Great Sallow	15.0	1	30	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent trees. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	40.7	3.6	40+	B	2 3
T279	1	*Populus x canadensis* Hybrid Black Poplars	25.0	2	148	N 12.0 E 12.0 S 12.0 W 12.0	4.0	2.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Twin-stemmed.	706.9	15.0	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G280	40 15 15 15 6 5 3 2	*Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow *Acer campestre* Field Maple *Ulmus procera* English Elm *Quercus robur* English Oak	16.0	1	30	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent trees. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	40.7	3.6	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G281	50 50 40 30 5 5 5 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow *Ulmus procera* English Elm *Quercus robur* English Oak	6.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Natural regeneration.	18.1	2.4	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G282	50 50 40 30 5 5 5 3 1	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Ulmus procera* English Elm *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow *Quercus robur* English Oak *Malus sylvestris* Wild Crab	5.0	1	16	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Natural regeneration.	11.6	1.9	40+	C	2 3
T283	1	*Quercus robur* English Oak	17.0	1	45	N 6.0 E 6.0 S 6.0 W 6.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	91.6	5.4	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G284	3 2 1 1	*Quercus robur* English Oak *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	16.0	1	50	N 7.0 E 7.0 S 7.0 W 7.0	4.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Branch - Suspended. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Poor past pruning. Stag-headed crown.	113.1	6.0	40+	B	2 3
T285	1	*Quercus robur* English Oak	14.0	1	130	N 7.0 E 7.0 S 7.0 W 7.0	4.0	3.0	Ancient or Veteran	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Stag-headed crown.	706.9	15.0	40+	A	1 3
T286	1	*Quercus robur* English Oak	7.0	2	28	N 4.0 E 4.0 S 4.0 W 4.0	3.0	0.0	Semi Mature	Good	Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	36.2	3.4	40+	C	1
T287	1	*Quercus robur* English Oak	9.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	3.0	0.0	Semi Mature	Good	Arboricultural work - Historic. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	18.1	2.4	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T288	1	*Quercus robur* English Oak	10.0	1	40	N 7.0 E 7.0 S 7.0 W 7.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	72.4	4.8	40+	B	1
T289	1	*Quercus robur* English Oak	7.0	1	24	N 4.0 E 4.0 S 4.0 W 4.0	3.0	3.0	Semi Mature	Good	Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	26.1	2.9	40+	C	1
T290	1	*Quercus robur* English Oak	14.0	1	65	N 9.0 E 9.0 S 9.0 W 9.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	191.1	7.8	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G291	60 60 55 50 30 30 15 10	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Quercus robur* English Oak *Cerasus avium* Wild Cherry *Salix caprea* Goat Willow/Great Sallow	18.0	1	50	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decline - Evident / observed. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	113.1	6.0	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G292	50 50 30 15 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	11.6	1.9	40+	C	2 3
G293	3 3 2	*Carpinus betulus* Hornbeam *Quercus robur* English Oak *Fraxinus excelsior* Ash	9.0	1	30	N E S W 4.0 4.0 4.0 4.0	4.0	3.0	Early Mature	Good	Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	40.7	3.6	40+	B	2
T294	1	*Quercus robur* English Oak	10.0	1	40	N E S W 6.0 6.0 6.0 6.0	4.0	4.0	Early Mature	Good	Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	72.4	4.8	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G295	3 3 2 2 2 1	*Acer campestre* Field Maple *Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Prunus spinosa* Blackthorn/Sloe *Ilex aquifolium* Holly	11.0	1	35	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	55.4	4.2	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G296	100 40 10 10 8 8 1	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Quercus robur* English Oak *Ilex aquifolium* Holly	18.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	72.4	4.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G297	25 15 10 10 5 4 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow *Corylus avellana* Common Hazel *Quercus robur* English Oak *Acer campestre* Field Maple	18.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	72.4	4.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T298	1	*Quercus robur* English Oak	13.0	1	95	N E S W 5.0 5.0 5.0 5.0	3.0	3.0	Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Crown reduction - Historic. Crown reduction - Recent. Die-back - Throughout crown. Decline - Evident / observed. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Tree in decline, but should be retained for habitat purposes. Fungal fruiting body at 3m on east side of main stem, potentially fistulina hepatica (beefsteak fungus).	408.3	11.4	10-20	C	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G299	100 80 20 15 8 8 3	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Quercus robur* English Oak *Ilex aquifolium* Holly	14.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	40.7	3.6	40+	B	2 3
G300	4 3 1	*Quercus robur* English Oak *Fraxinus excelsior* Ash *Acer campestre* Field Maple	15.0	1	50	N 7.0 E 7.0 S 7.0 W 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Poor past pruning.	113.1	6.0	40+	B	2
T301	1	*Quercus robur* English Oak	9.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	4.0	3.5	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	40.7	3.6	40+	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H302	50 50 20 15 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
H303	4	*Crataegus monogyna* Common Hawthorn/Quick/May	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
G304	2 2 1	*Carpinus betulus* Hornbeam *Fraxinus excelsior* Ash *Quercus robur* English Oak	8.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	4.0	3.0	Early Mature	Good	Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	40.7	3.6	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G305	2 1 1	*Carpinus betulus* Hornbeam *Fraxinus excelsior* Ash *Quercus robur* English Oak	8.0	1	30	N E S W 4.0 4.0 4.0 4.0	4.0	3.0	Early Mature	Good	Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	40.7	3.6	40+	B	2
T306	1	*Fraxinus excelsior* Ash	10.0	1	25	N E S W 1.5 1.5 1.5 1.5	3.0	4.0	Semi Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	28.3	3.0	20-40	C	1
T307	1	*Fraxinus excelsior* Ash	10.0	1	20	N E S W 1.5 1.5 1.5 1.5	3.0	4.0	Semi Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	18.1	2.4	20-40	C	1
T308	1	*Fraxinus excelsior* Ash	10.0	1	20	N E S W 1.5 1.5 1.5 1.5	3.0	4.0	Semi Mature	Dead	Dead tree / trees.	18.1	2.4	20-40	C	1
T309	1	*Fraxinus excelsior* Ash	12.0	1	40	N E S W 8.0 8.0 8.0 8.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	72.4	4.8	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T310	1	*Quercus robur* English Oak	11.0	1	36	N E S W 6.0 6.0 6.0 6.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	58.6	4.3	40+	B	1
T311	1	*Quercus robur* English Oak	13.0	1	36	N E S W 6.0 6.0 6.0 6.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	58.6	4.3	40+	B	1
H312	200 150 20 15 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G313	30 20 10 10 5 4 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow *Corylus avellana* Common Hazel *Quercus robur* English Oak *Acer campestre* Field Maple	18.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	72.4	4.8	40+	B	2 3
T314	1	*Fraxinus excelsior* Ash	13.0	1	36	N 4.0 E 4.0 S 4.0 W 4.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems.	58.6	4.3	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H315	300 300 150 50 25 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W316	420	*Pinus sylvestris* Scots Pine	18.0	1	35	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Ivy or climbing plant.	55.4	4.2	40+	A	2 3
	300	*Quercus robur* English Oak														
	300	*Crataegus monogyna* Common Hawthorn/Quick/May														
	250	*Acer campestre* Field Maple														
	150	*Sambucus nigra* Elder														
	100	*Prunus spinosa* Blackthorn/Sloe														
	50	*Corylus avellana* Common Hazel														
	30	*Picea abies* Norway Spruce														
	20	*Fraxinus excelsior* Ash														
	15	*Thuja plicata* Western Red Cedar														
	15	*Ulmus procera* English Elm														

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T317	1	*Fraxinus excelsior* Ash	15.0	1	38	N E S W 8.0 6.0 4.0 4.0	5.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	65.3	4.6	20-40	C	1
T318	1	*Fraxinus excelsior* Ash	15.0	2	49	N E S W 7.0 7.0 8.0 7.0	5.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Fungal fruiting body - structural decay suspected. Inonotus hispidus (shaggy bracket) located on northern stem at 2m.	110.8	5.9	20-40	C	1
H319	60 40 20 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H320	15 15 5 1 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
T321	1	*Fraxinus excelsior* Ash	17.0	1	42	N 8.0 E 8.0 S 8.0 W 8.0	5.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	79.8	5.0	20-40	B	1
T322	1	*Fraxinus excelsior* Ash	17.0	1	48	N 7.0 E 7.0 S 7.0 W 7.0	5.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	104.2	5.8	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G323	60 40 20 15 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Sambucus nigra* Elder *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash	10.0	1	30	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	40.7	3.6	40+	C	2 3
G324	25 20 10 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Sambucus nigra* Elder	10.0	1	30	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	40.7	3.6	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W325	250	*Acer campestre* Field Maple	17.0	1	38	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Coppice stool - Coppice origin / Mature stems. Decline - Evident / observed. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	65.3	4.6	40+	A	2 3
	250	*Quercus robur* English Oak														
	200	*Fraxinus excelsior* Ash														
	200	*Crataegus monogyna* Common Hawthorn/Quick/May														
	200	*Prunus spinosa* Blackthorn/Sloe														
	150	*Corylus avellana* Common Hazel														
	100	*Cerasus avium* Wild Cherry														
	100	*Carpinus betulus* Hornbeam														
	50	*Sambucus nigra* Elder														
	40	*Ulmus procera* English Elm														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H326	30 30 30 20	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
H327	60 60 40 30	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
T328	1	*Quercus robur* English Oak	10.0	1	35	N 5.0 E 5.0 S 5.0 W 5.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Poor past pruning.	55.4	4.2	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T329	1	*Quercus robur* English Oak	10.0	1	30	N E S W 5.0 5.0 5.0 5.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Poor past pruning.	40.7	3.6	40+	B	1
H330	150 150 40 30	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
G331	20 10 5 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel	10.0	1	20	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	18.1	2.4	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W332	250	*Acer campestre* Field Maple	17.0	1	38	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Coppice stool - Coppice origin / Mature stems. Decline - Evident / observed. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	65.3	4.6	40+	A	2 3
	250	*Quercus robur* English Oak														
	200	*Fraxinus excelsior* Ash														
	200	*Crataegus monogyna* Common Hawthorn/Quick/May														
	200	*Prunus spinosa* Blackthorn/Sloe														
	150	*Corylus avellana* Common Hazel														
	100	*Cerasus avium* Wild Cherry														
	100	*Carpinus betulus* Hornbeam														
	50	*Sambucus nigra* Elder														
	40	*Ulmus procera* English Elm														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T333	1	*Fraxinus excelsior* Ash	14.0	1	75	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems.	254.5	9.0	20-40	B	1 3
G334	10 10 5 5 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	9.0	1	18	N E S W 2.5 2.5 2.5 2.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	14.7	2.2	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G335	10 10 5 5 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	9.0	1	18	N 2.5 E 2.5 S 2.5 W 2.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	14.7	2.2	40+	C	2
T336	1	*Quercus robur* English Oak	14.0	1	80	N 6.0 E 6.0 S 6.0 W 6.0	4.0	4.0	Mature	Fair	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Poor past pruning.	289.5	9.6	20-40	B	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G337	4 3 3 2 2	*Acer pseudoplatanus* Sycamore *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm	8.0	1	18	N 2.5 E 2.5 S 2.5 W 2.5	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	14.7	2.2	40+	C	2
T338	1	*Quercus robur* English Oak	16.0	1	95	N 6.0 E 6.0 S 6.0 W 6.0	4.0	4.0	Ancient or Veteran	Fair	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Poor past pruning. Tree is exhibiting significant veteran characteristics, including hollowing of stem, open cavities, deadwood and a large girth indicative of age.	408.3	11.4	20-40	B	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)				Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
						N	E	S	W										
G339	25	*Prunus spinosa* Blackthorn/Sloe	17.0	1	30	6.0	6.0	6.0	6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	40.7	3.6	40+	B	2 3
	20	*Crataegus monogyna* Common Hawthorn/Quick/May																	
	12	*Fraxinus excelsior* Ash																	
	5	*Acer campestre* Field Maple																	
	5	*Ulmus procera* English Elm																	
	2	*Quercus robur* English Oak																	

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m) N	E	S	W	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G340	30	*Fraxinus excelsior* Ash	18.0	1	35	5.0	5.0	5.0	5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Coppice stool - Regrown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	55.4	4.2	40+	B	2 3
	25	*Acer campestre* Field Maple																	
	20	*Crataegus monogyna* Common Hawthorn/Quick/May																	
	15	*Carpinus betulus* Hornbeam																	
	15	*Prunus spinosa* Blackthorn/Sloe																	
	10	*Cerasus avium* Wild Cherry																	
	5	*Ulmus procera* English Elm																	
	2	*Quercus robur* English Oak																	

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T341	1	*Quercus robur* English Oak	13.0	1	80	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Ancient or Veteran	Poor	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Tree is in decline and exhibiting many veteran characteristics including hollowing of stem, cavities, major deadwood, and a large girth/diameter indicative of age.	289.5	9.6	10-20	B	1 3
H342	60 60 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
T343	1	*Quercus robur* English Oak	14.0	1	70	N E S W 8.0 8.0 8.0 8.0	5.0	3.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Poor past pruning.	221.7	8.4	40+	A	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T344	1	*Quercus robur* English Oak	14.0	1	68	N E S W 8.0 8.0 8.0 8.0	5.0	3.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Poor past pruning.	209.2	8.2	40+	A	1 3
T345	1	*Quercus robur* English Oak	14.0	1	68	N E S W 7.0 8.0 4.0 2.0	5.0	4.0	Mature	Fair	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Fire damage - Crown. Hollow trunk - Open cavity. Ivy or climbing plant. Lightning damage. Poor past pruning.	209.2	8.2	20-40	B	1 3
H346	80 80 10 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
T347	1	*Quercus robur* English Oak	10.0	1	31	N E S W 5.0 5.0 5.0 5.0	4.0	3.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Poor past pruning.	43.5	3.7	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T348	1	*Quercus robur* English Oak	10.0	1	40	N E S W 5.0 5.0 5.0 5.0	4.0	3.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Poor past pruning.	72.4	4.8	40+	B	1
H349	80 80 20 15 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
H350	25 20 5 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G351	15 15 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash	18.0	1	40	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Natural regeneration.	72.4	4.8	40+	B	2 3
T352	1	*Quercus robur* English Oak	15.0	1	78	N E S W 8.0 8.0 8.0 8.0	5.0	5.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Poor past pruning.	275.2	9.4	40+	A	1 3
T353	1	*Fraxinus excelsior* Ash	17.0	2	43	N E S W 7.0 7.0 7.0 7.0	5.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Twin-stemmed.	87.0	5.3	20-40	B	1
H354	25 20 5 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H355	15 10 10 3	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
G356	60 40 20 15 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Sambucus nigra* Elder *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash	12.0	1	30	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	40.7	3.6	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T357	1	*Fraxinus excelsior* Ash	17.0	8	45	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant.	92.6	5.4	20-40	B	1
T358	1	*Fraxinus excelsior* Ash	17.0	8	45	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant.	92.6	5.4	20-40	B	1
T359	1	*Fraxinus excelsior* Ash	17.0	3	69	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant.	217.1	8.3	20-40	B	1
G360	3	*Fraxinus excelsior* Ash	15.0	5	40	N 5.0 E 5.0 S 5.0 W 5.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	73.3	4.8	20-40	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G361	60 60 30 15 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Sambucus nigra* Elder *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash	12.0	1	30	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	40.7	3.6	40+	C	2 3
G362	15 10 8	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	18.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Natural regeneration.	72.4	4.8	40+	B	2 3
T363	1	*Quercus robur* English Oak	16.0	1	65	N 10.0 E 10.0 S 10.0 W 10.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	191.1	7.8	40+	A	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T364	1	*Fraxinus excelsior* Ash	10.0	1	30	N 3.0 E 3.0 S 3.0 W 3.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	40.7	3.6	20-40	C	1
T365	1	*Quercus robur* English Oak	15.0	1	55	N 8.0 E 8.0 S 8.0 W 8.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	136.8	6.6	40+	A	1
T366	1	*Quercus robur* English Oak	14.0	1	55	N 8.0 E 8.0 S 8.0 W 8.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	136.8	6.6	40+	A	1
T367	1	*Quercus robur* English Oak	14.0	1	50	N 8.0 E 8.0 S 8.0 W 8.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	113.1	6.0	40+	A	1
T368	1	*Quercus robur* English Oak	14.0	1	60	N 8.0 E 8.0 S 8.0 W 8.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	162.9	7.2	40+	A	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T369	1	*Quercus robur* English Oak	12.0	1	58	N E S W 8.0 8.0 8.0 8.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	152.2	7.0	40+	A	1
T370	1	*Quercus robur* English Oak	12.0	1	50	N E S W 8.0 8.0 8.0 8.0	2.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	113.1	6.0	40+	B	1
G371	3 1	*Fraxinus excelsior* Ash *Quercus robur* English Oak	15.0	1	35	N E S W 4.0 4.0 4.0 4.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	55.4	4.2	40+	C	2 3
T372	1	*Quercus robur* English Oak	12.0	1	50	N E S W 5.0 5.0 5.0 5.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	113.1	6.0	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T373	1	*Quercus robur* English Oak	13.0	1	50	N 7.0 E 7.0 S 7.0 W 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	113.1	6.0	40+	B	1
T374	1	*Quercus robur* English Oak	14.0	1	45	N 7.0 E 7.0 S 7.0 W 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	91.6	5.4	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G375	150 150 40 35 30 15 12	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Sambucus nigra* Elder *Quercus robur* English Oak	12.0	1	30	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Maintained. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	40.7	3.6	40+	C	2 3
T376	1	*Quercus robur* English Oak	14.0	1	55	N 7.0 E 7.0 S 7.0 W 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	136.8	6.6	40+	B	1
T377	1	*Fraxinus excelsior* Ash	14.0	1	35	N 7.0 E 7.0 S 7.0 W 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	55.4	4.2	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H378	60 60 10 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
H379	5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
H380	100 100 10 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H381	10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
G382	25 25 15 8 4 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Salix caprea* Goat Willow/Great Sallow *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Quercus robur* English Oak	17.0	1	40	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	72.4	4.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G383	25 25 4 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow	14.0	1	40	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	72.4	4.8	40+	B	2 3
G384	25 25 15 4 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Salix caprea* Goat Willow/Great Sallow *Acer campestre* Field Maple *Fraxinus excelsior* Ash	17.0	1	40	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	72.4	4.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G385	25 25 15 4 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Salix caprea* Goat Willow/Great Sallow *Acer campestre* Field Maple *Fraxinus excelsior* Ash	15.0	1	40	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	72.4	4.8	40+	B	2 3
G386	25 25 8 8 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Salix caprea* Goat Willow/Great Sallow *Corylus avellana* Common Hazel	12.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	40.7	3.6	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T387	1	*Quercus robur* English Oak	7.0	1	18	N 3.0 E 3.0 S 3.0 W 3.0	2.0	3.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation.	14.7	2.2	40+	C	1
G388	150	*Prunus spinosa* Blackthorn/Sloe	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Natural regeneration.	2.2	0.8	40+	C	2
T389	1	*Quercus robur* English Oak	6.0	1	18	N 2.0 E 2.0 S 2.0 W 2.0	0.0	1.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	14.7	2.2	40+	C	1
T390	1	*Quercus robur* English Oak	11.0	5	62	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor.	177.3	7.5	40+	B	1
T391	1	*Quercus robur* English Oak	6.0	1	18	N 2.0 E 2.0 S 2.0 W 2.0	0.0	1.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	14.7	2.2	40+	C	1
G392	30	*Prunus spinosa* Blackthorn/Sloe	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Natural regeneration.	2.2	0.8	40+	C	2
T393	1	*Quercus robur* English Oak	7.0	2	39	N 2.0 E 6.0 S 2.0 W 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor.	70.9	4.8	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G394	40	*Prunus spinosa* Blackthorn/Sloe	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Natural regeneration.	2.2	0.8	40+	C	2
G395	12	*Acer campestre* Field Maple	10.0	1	18	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Natural regeneration.	14.7	2.2	40+	C	2
G396	60 60 30 15 10 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Sambucus nigra* Elder	16.0	1	40	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Natural regeneration.	72.4	4.8	40+	B	2 3
T397	1	*Quercus robur* English Oak	16.0	1	62	N E S W 10.0 10.0 10.0 10.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	173.9	7.4	40+	A	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T398	1	*Quercus robur* English Oak	14.0	1	52	N E S W 6.0 6.0 6.0 6.0	2.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	122.3	6.2	40+	B	1
T399	1	*Quercus robur* English Oak	16.0	1	65	N E S W 9.0 9.0 9.0 9.0	2.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	191.1	7.8	40+	A	1
T400	1	*Fraxinus excelsior* Ash	11.0	3	51	N E S W 3.0 3.0 3.0 3.0	2.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Bole / principal stems. Fungal fruiting body - structural decay suspected. Ivy or climbing plant. Poor past pruning. Inonotus hispidus (shaggy bracket) located on northern stem at 3m.	122.1	6.2	20-40	C	1
T401	1	*Quercus robur* English Oak	14.0	1	65	N E S W 8.0 8.0 8.0 8.0	2.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	191.1	7.8	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G402	30 20 10 2 2	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Sambucus nigra* Elder	10.0	1	18	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	14.7	2.2	40+	C	2 3
T403	1	*Quercus robur* English Oak	18.0	1	100	N 9.0 E 9.0 S 9.0 W 9.0	1.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	452.4	12.0	40+	A	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G404	30 10 5 2	*Salix caprea* Goat Willow/Great Sallow *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel	14.0	1	50	N 8.0 E 8.0 S 8.0 W 8.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	113.1	6.0	40+	C	2 3
H405	50 5 4 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel	6.0	1	20	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	18.1	2.4	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T406	1	*Quercus robur* English Oak	14.0	1	55	N E S W 7.0 7.0 8.0 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	136.8	6.6	40+	B	1
T407	1	*Quercus robur* English Oak	15.0	1	75	N E S W 7.0 7.0 9.0 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	254.5	9.0	40+	B	1
T408	1	*Fraxinus excelsior* Ash	16.0	4	80	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Branch - Suspended. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	289.5	9.6	20-40	B	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T409	1	*Quercus robur* English Oak	17.0	1	75	N E S W 8.0 8.0 9.0 8.0	4.0	6.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	254.5	9.0	40+	A	1
T410	1	*Fraxinus excelsior* Ash	16.0	5	49	N E S W 7.0 7.0 7.0 7.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	109.5	5.9	20-40	B	1
T411	1	*Quercus robur* English Oak	16.0	1	60	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Branch - Suspended. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Bole / principal stems. Poor past pruning.	162.9	7.2	20-40	B	1
T412	1	*Quercus robur* English Oak	12.0	1	28	N E S W 4.0 7.0 4.0 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems.	35.5	3.4	40+	B	1
T413	1	*Quercus robur* English Oak	14.0	1	38	N E S W 6.0 6.0 6.0 6.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems.	65.3	4.6	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T414	1	*Quercus robur* English Oak	15.0	1	40	N E S W 8.0 8.0 8.0 8.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Poor past pruning.	72.4	4.8	40+	B	1
T415	1	*Quercus robur* English Oak	17.0	1	60	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	162.9	7.2	40+	A	1
T416	1	*Quercus robur* English Oak	18.0	1	80	N E S W 9.0 9.0 9.0 5.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	289.5	9.6	40+	A	1
H417	35 35 10 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T418	1	*Quercus robur* English Oak	16.0	1	60	N E S W 4.0 6.0 6.0 4.0	6.0	4.0	Mature	Dead	Dead tree / trees. Habitat - High value. Tree to be retained as a monolith for habitat purposes.			0-10	U	
T419	1	*Quercus robur* English Oak	19.0	1	100	N E S W 9.0 9.0 9.0 9.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Poor past pruning.	452.4	12.0	40+	A	1
T420	1	*Quercus robur* English Oak	10.0	1	110	N E S W 5.0 5.0 5.0 5.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	547.4	13.2	40+	A	1
T421	1	*Quercus robur* English Oak	13.0	1	55	N E S W 5.0 5.0 7.0 3.0	1.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	136.8	6.6	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T422	1	*Fraxinus excelsior* Ash	13.0	1	55	N E S W 2.0 5.0 7.0 3.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning. Suppressed crown - Major.	136.8	6.6	20-40	C	1
G423	15 15 10 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple	6.0	1	20	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	18.1	2.4	40+	C	2
T424	1	*Fraxinus excelsior* Ash	10.0	1	30	N E S W 3.0 3.0 3.0 3.0	3.0	3.0	Early Mature	Poor	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	40.7	3.6	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T425	1	*Fraxinus excelsior* Ash	18.0	1	60	N 8.0 E 8.0 S 8.0 W 10.0	3.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	162.9	7.2	20-40	B	1 3
T426	1	*Fraxinus excelsior* Ash	10.0	1	40	N 6.0 E 6.0 S 5.0 W 4.0	5.0	4.0	Early Mature	Poor	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	72.4	4.8	10-20	C	1 3
T427	1	*Fraxinus excelsior* Ash	12.0	3	55	N 7.0 E 7.0 S 7.0 W 7.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	139.0	6.7	10-20	B	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H428	100 100 10 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
H429	150 150 30 22 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H430	150 150 30 22 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
H431	150 150 30 25 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T432	1	*Quercus robur* English Oak	12.0	1	125	N E S W 8.0 6.0 8.0 6.0	3.0	3.0	Ancient or Veteran	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Die-back - Upper crown. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant.	706.9	15.0	40+	A	1 3
T433	1	*Quercus robur* English Oak	19.0	1	65	N E S W 10.0 10.0 10.0 10.0	4.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems.	191.1	7.8	40+	A	1
G434	2 1 1	*Tilia cordata* Small Leaved Lime *Carpinus betulus* Hornbeam *Fraxinus excelsior* Ash	18.0	1	50	N E S W 8.0 8.0 8.0 8.0	1.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	113.1	6.0	40+	A	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W435	50 40 40 30 30 30	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Cerasus avium* Wild Cherry *Corylus avellana* Common Hazel *Quercus robur* English Oak	11.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	1.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	40.7	3.6	40+	B	2 3
T436	1	*Quercus robur* English Oak	17.0	1	70	N 10.0 E 10.0 S 10.0 W 10.0	4.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Minor. Epicormic growth - Bole / principal stems.	221.7	8.4	40+	A	1
T437	1	*Quercus robur* English Oak	12.0	1	130	N 9.0 E 9.0 S 9.0 W 9.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Minor. Epicormic growth - Bole / principal stems.	706.9	15.0	40+	A	1
T438	1	*Acer campestre* Field Maple	7.0	1	20	N 3.0 E 3.0 S 3.0 W 3.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	18.1	2.4	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T439	1	*Fraxinus excelsior* Ash	19.0	3	69	N E S W 9.0 9.0 9.0 9.0	1.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	217.1	8.3	20-40	B	1
G440	2 1	*Quercus robur* English Oak *Fraxinus excelsior* Ash	12.0	3	60	N E S W 5.0 5.0 5.0 5.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	166.3	7.3	40+	B	2
G441	2 1	*Quercus robur* English Oak *Fraxinus excelsior* Ash	12.0	4	60	N E S W 5.0 5.0 5.0 5.0	2.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Bacterial. Cankers on stem, potentially pseudomonas savastnoi pv. fraxini (bacterial canker of ash).	162.9	7.2	40+	B	2
T442	1	*Fraxinus excelsior* Ash	14.0	6	39	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	69.5	4.7	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T443	1	*Quercus robur* English Oak	16.0	1	90	N E S W 9.0 9.0 9.0 9.0	4.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	366.4	10.8	40+	A	1
H444	150 150 60 60 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H445	20 20 15 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
H446	5 5 5 5	*Acer campestre* Field Maple *Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H447	30 25 10 6 5 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Salix caprea* Goat Willow/Great Sallow *Acer campestre* Field Maple *Corylus avellana* Common Hazel	19.0	1	65	N 8.0 E 8.0 S 8.0 W 8.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Natural regeneration.	191.1	7.8	40+	A	2 3
G448	14 2 1	*Salix caprea* Goat Willow/Great Sallow *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel	6.0	1	16	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Natural regeneration.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T449	1	*Quercus robur* English Oak	18.0	1	65	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Poor past pruning.	191.1	7.8	40+	A	1
T450	1	*Fraxinus excelsior* Ash	14.0	2	35	N E S W 5.0 5.0 5.0 5.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	56.5	4.2	20-40	A	1
T451	1	*Fraxinus excelsior* Ash	15.0	2	42	N E S W 6.0 6.0 6.0 6.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	81.4	5.1	20-40	A	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H452	50 50 25 25 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
H453	75 75 25 25 10 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. Sporadic outgrown young trees.	2.2	0.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T454	1	*Fraxinus excelsior* Ash	10.0	1	28	N 3.0 E 3.0 S 3.0 W 3.0	4.0	4.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Poor past pruning.	35.5	3.4	20-40	C	1
T455	1	*Quercus robur* English Oak	19.0	1	125	N 10.0 E 10.0 S 10.0 W 10.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	706.9	15.0	40+	A	1
T456	1	*Quercus robur* English Oak	15.0	1	50	N 6.0 E 6.0 S 6.0 W 6.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	113.1	6.0	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H457	50 30 25 25 10 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
T458	1	*Quercus robur* English Oak	18.0	1	75	N 9.0 E 9.0 S 9.0 W 9.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	254.5	9.0	40+	A	1
T459	1	*Fraxinus excelsior* Ash	15.0	1	45	N 7.0 E 7.0 S 7.0 W 7.0	4.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	91.6	5.4	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H460	15 15 4 3 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
T461	1	*Fraxinus excelsior* Ash	13.0	1	30	N 5.0 E 5.0 S 5.0 W 5.0	4.0	4.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	40.7	3.6	20-40	C	1
T462	1	*Quercus robur* English Oak	9.0	1	30	N 2.0 E 2.0 S 2.0 W 2.0	4.0	4.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Minor. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	40.7	3.6	20-40	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T463	1	*Quercus robur* English Oak	17.0	1	65	N E S W 9.0 4.0 9.0 9.0	5.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	191.1	7.8	40+	B	1
T464	1	*Quercus robur* English Oak	17.0	1	85	N E S W 9.0 9.0 9.0 4.0	5.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	326.9	10.2	40+	B	1
T465	1	*Fraxinus excelsior* Ash	20.0	1	80	N E S W 12.0 9.0 6.0 9.0	6.0	2.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Die-back - Throughout crown. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Fungal fruiting body - structural decay suspected. Ivy or climbing plant. Physiological / cambial damage - Bacterial. Poor past pruning. Inonotus hispidus (shaggy bracket) located on eastern limb at 5m. Tree infected with pseudomonas savastanoi pv. fraxini (bacterial canker of ash).	289.5	9.6	20-40	B	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T466	1	*Fraxinus excelsior* Ash	20.0	2	58	N E S W 8.0 8.0 8.0 4.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Minor. Fungal fruiting body - structural decay suspected. Ivy or climbing plant. Inonotus hispidus (shaggy bracket) located On western stem at 4m.	153.8	7.0	20-40	B	1
G467	10 5 5 1	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Acer pseudoplatanus cv.* Sycamore cv.	14.0	1	25	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	28.3	3.0	40+	B	2
T468	1	*Quercus robur* English Oak	17.0	1	60	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Bark exudation. Base / stems obscured - Structure. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	162.9	7.2	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H469	40 40 20 10 10 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Quercus robur* English Oak	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
G470	3	*Fraxinus excelsior* Ash	18.0	1	50	N 7.0 E 7.0 S 7.0 W 7.0	2.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Suspended. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems.	113.1	6.0	20-40	B	2
T471	1	*Fraxinus excelsior* Ash	24.0	1	80	N 11.0 E 11.0 S 11.0 W 11.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Structure. Deadwood - Minor. Fungal fruiting body - structural decay suspected. Ivy or climbing plant. Physiological / cambial damage - Bacterial. Poor past pruning.	289.5	9.6	20-40	B	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H472	120 120 15 10 8	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
H473	50 40 8 2	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
T474	1	*Quercus robur* English Oak	8.0	1	34	N 4.0 E 4.0 S 4.0 W 4.0	4.0	4.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Poor past pruning.	52.3	4.1	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H475	60 50 10 8	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
T476	1	*Fraxinus excelsior* Ash	10.0	3	64	N E S W 5.0 5.0 9.0 5.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Fallen tree / trees - Partial collapse. Hollow trunk - Open cavity. Pollard - Lapsed / Mature stems. Main mature pollard stem (with hollowed stem) has collapsed, with two remaining mature epicormic stems upright.	189.1	7.8	20-40	C	1 3
T477	1	*Quercus robur* English Oak	10.0	1	70	N E S W 7.0 7.0 7.0 7.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Hollow trunk - Open cavity. Ivy or climbing plant.	221.7	8.4	40+	B	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H478	120 120 30 25 10 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
G479	20 15 10 6	*Ulmus procera* English Elm *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	10.0	1	20	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Semi Mature	Poor	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Dutch elm disease. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Hedgerow - Neglected / overgrown.	18.1	2.4	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H480	20 20 10 5 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ulmus procera* English Elm	4.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
G481	5 4	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	10.0	1	20	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	18.1	2.4	20-40	C	2
T482	1	*Quercus robur* English Oak	16.0	1	50	N 10.0 E 10.0 S 10.0 W 10.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	113.1	6.0	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T483	1	*Fraxinus excelsior* Ash	10.0	10	44	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Bacterial. Stem(s) infected by pseudomona savastanoi pv. fraxini (bacterial canker of Ash).	88.7	5.3	20-40	B	1
G484	3 1 1	*Quercus robur* English Oak *Acer pseudoplatanus* Sycamore *Fraxinus excelsior* Ash	13.0	3	31	N E S W 5.0 5.0 5.0 5.0	2.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Tree(s) affected by hymenosyphus fraxineus (ash dieback).	44.0	3.7	40+	C	2
T485	1	*Fraxinus excelsior* Ash	10.0	10	31	N E S W 3.0 3.0 3.0 3.0	2.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Bacterial.	45.2	3.8	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T486	1	*Quercus robur* English Oak	11.0	1	48	N E S W 2.0 2.0 2.0 2.0	5.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Decay / structural defect in crown limb / limbs - Suspected. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	104.2	5.8	20-40	C	1 3
G487	4	*Fraxinus excelsior* Ash	13.0	3	31	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Tree(s) affected by hymenosyphus fraxineus (ash dieback).	44.0	3.7	40+	C	2
T488	1	*Quercus robur* English Oak	17.0	1	85	N E S W 10.0 10.0 10.0 10.0	3.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	326.9	10.2	40+	A	1
T489	1	*Fraxinus excelsior* Ash	9.0	3	31	N E S W 3.0 4.0 4.0 4.0	1.0	0.0	Early Mature	Good	Arboricultural work - Historic. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	44.0	3.7	40+	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G490	40 40 20 20 15 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak *Ulmus procera* English Elm *Fraxinus excelsior* Ash *Acer campestre* Field Maple	17.0	1	40	N 7.0 E 7.0 S 7.0 W 7.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	72.4	4.8	40+	B	2 3
T491	1	*Fraxinus excelsior* Ash	18.0	2	63	N 8.0 E 12.0 S 8.0 W 12.0	4.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant. Physiological / cambial damage - Fungal. Twin-stemmed. Affected by hymenoscyphus fraxineus (ash dieback).	183.2	7.6	20-40	B	1
T492	1	*Fraxinus excelsior* Ash	15.0	1	85	N 8.0 E 8.0 S 10.0 W 8.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	326.9	10.2	40+	A	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T493	1	*Fraxinus excelsior* Ash	18.0	1	105	N E S W 8.0 8.0 8.0 8.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	498.8	12.6	40+	A	1
G494	15 15 6 5 5 3 2	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Salix fragilis 'Bullata'* Crack Willow cv. *Acer campestre* Field Maple *Salix caprea* Goat Willow/Great Sallow *Quercus robur* English Oak	9.0	1	18	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	14.7	2.2	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T495	1	*Quercus robur* English Oak	18.0	1	75	N 9.0 E 9.0 S 9.0 W 9.0	4.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	254.5	9.0	40+	A	1
T496	1	*Quercus robur* English Oak	15.0	1	55	N 7.0 E 7.0 S 7.0 W 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	136.8	6.6	40+	B	1
T497	1	*Quercus robur* English Oak	15.0	1	55	N 7.0 E 7.0 S 7.0 W 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	136.8	6.6	40+	B	1
T498	1	*Quercus robur* English Oak	15.0	1	55	N 9.0 E 9.0 S 9.0 W 9.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	136.8	6.6	40+	B	1
T499	1	*Quercus robur* English Oak	12.0	1	45	N 6.0 E 9.0 S 6.0 W 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	91.6	5.4	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T500	1	*Ilex aquifolium* Holly	11.0	1	40	N E S W 5.0 5.0 7.0 5.0	4.0	4.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Bole / principal stems. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	72.4	4.8	40+	B	1
H501	150 150 50 25 20 8	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2
T502	1	*Fraxinus excelsior* Ash	10.0	1	30	N E S W 3.0 3.0 3.0 3.0	4.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant. Poor past pruning.	40.7	3.6	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T503	1	*Quercus robur* English Oak	11.0	1	70	N E S W 8.0 8.0 8.0 8.0	4.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Poor past pruning.	221.7	8.4	40+	A	1 3
H504	150 150 50 25 20 8	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Ulmus procera* English Elm *Fraxinus excelsior* Ash	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	2.2	0.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G505	25 10 10 6 4 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Salix caprea* Goat Willow/Great Sallow	17.0	1	40	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Tree(s) infected with hymenoscyphus fraxineus (ash dieback). HV conductors intersect group.	72.4	4.8	40+	B	2 3
T506	1	*Quercus robur* English Oak	18.0	1	75	N 9.0 E 9.0 S 9.0 W 9.0	0.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Poor past pruning. Bird box located on stem at 4m.	254.5	9.0	40+	A	1 3
G507	8 1	*Fraxinus excelsior* Ash *Acer pseudoplatanus* Sycamore	18.0	3	51	N 11.0 E 7.0 S 7.0 W 7.0	4.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	122.1	6.2	20-40	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T508	1	*Acer campestre* Field Maple	11.0	5	35	N 5.0 E 5.0 S 5.0 W 5.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	57.9	4.3	40+	B	1
T509	1	*Acer campestre* Field Maple	11.0	5	35	N 5.0 E 5.0 S 5.0 W 5.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	57.9	4.3	40+	B	1
T510	1	*Quercus robur* English Oak	15.0	1	35	N 9.0 E 9.0 S 9.0 W 9.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Poor past pruning.	55.4	4.2	40+	B	1
T511	1	*Acer campestre* Field Maple	14.0	5	44	N 7.0 E 7.0 S 7.0 W 7.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	90.5	5.4	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G512	30 20 15 10 10 5 3	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ulmus procera* English Elm *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Quercus robur* English Oak	10.0	1	20	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	18.1	2.4	40+	B	2 3
G513	25 15 15 10 9	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Quercus robur* English Oak	19.0	1	50	N 9.0 E 9.0 S 9.0 W 9.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Group comprises of early mature oak trees along the boundary, with an unmanaged hedgerow occupying the lower canopy.	113.1	6.0	40+	A	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G514	10 10 10 7 6 1	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak *Corylus avellana* Common Hazel *Ilex aquifolium* Holly	18.0	1	50	NW 9.0 NE 9.0 SE 9.0 SW 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Crown reduction - Historic. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Poor past pruning. Group comprises of early mature oak trees along the boundary, with an unmanaged hedgerow occupying the lower canopy. Canopies have been pruned back from HV conductors to the southwest.	113.1	6.0	40+	B	2 3
G515	25 20 20 20 13 6	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Fraxinus excelsior* Ash	19.0	1	50	N 9.0 E 9.0 S 9.0 W 9.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Group comprises of early mature oak trees along the boundary, with an unmanaged hedgerow occupying the lower canopy. Ash trees affected by hymenoscyphus fraxineus (ash dieback).	113.1	6.0	40+	A	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G516	10 5 4 4 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Quercus robur* English Oak	14.0	1	50	N 7.0 E 7.0 S 7.0 W 7.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Coalesced decay seam - Suspected. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	113.1	6.0	40+	B	2
T517	1	*Quercus robur* English Oak	16.0	1	75	N 8.0 E 8.0 S 8.0 W 8.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Woodpecker holes.	254.5	9.0	40+	A	1 3
T518	1	*Quercus robur* English Oak	18.0	1	75	N 10.0 E 10.0 S 10.0 W 10.0	3.0	3.0	Mature	Good	Arboricultural work - Historic. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems.	254.5	9.0	40+	A	1 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T519	1	*Quercus robur* English Oak	16.0	1	70	N E S W 3.0 6.0 6.0 6.0	3.0	3.0	Mature	Good	Arboricultural work - Historic. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Bole / principal stems.	221.7	8.4	40+	B	1 3
T520	1	*Quercus robur* English Oak	18.0	1	80	N E S W 9.0 9.0 5.0 9.0	1.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Poor past pruning.	289.5	9.6	40+	A	1
G521	4 4 2 1	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash	11.0	1	20	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	18.1	2.4	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T522	1	*Quercus robur* English Oak	18.0	1	80	N E S W 9.0 9.0 5.0 9.0	1.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Poor past pruning.	289.5	9.6	40+	A	1
T523	1	*Corylus avellana* Common Hazel	5.0	15	15	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Regrown. Epicormic growth - Base / bole / principal stems.	10.9	1.9	40+	C	1
T524	1	*Quercus robur* English Oak	15.0	1	95	N E S W 9.0 9.0 9.0 9.0	1.0	3.0	Ancient or Veteran	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Hollow trunk - Open cavity. Pollard - Lapsed / Mature stems. Poor past pruning.	408.3	11.4	40+	A	1
G525	21 21	*Acer campestre* Field Maple *Quercus robur* English Oak	12.0	1	30	N E S W 4.0 4.0 4.0 4.0	1.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Branch - Broken. Die-back - Throughout crown. Epicormic growth - Base / bole / principal stems.	40.7	3.6	40+	B	2
G526	4 2	*Quercus robur* English Oak *Acer campestre* Field Maple	12.0	1	30	N E S W 4.0 4.0 4.0 4.0	1.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Branch - Broken. Die-back - Throughout crown. Epicormic growth - Base / bole / principal stems.	40.7	3.6	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T527	1	*Fraxinus excelsior* Ash	11.0	5	40	N 4.0 E 4.0 S 4.0 W 4.0	2.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal.	73.3	4.8	20-40	B	1
T528	1	*Crataegus monogyna* Common Hawthorn/Quick/May	3.0	2	14	N 2.0 E 2.0 S 2.0 W 2.0	1.0	0.0	Early Mature	Good	Arboricultural work - Recent. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	9.0	1.7	20-40	C	1
T529	1	*Fraxinus excelsior* Ash	5.0	1	16	N 2.0 E 2.0 S 2.0 W 2.0	1.0	1.0	Semi Mature	Good	Arboricultural work - Historic. Epicormic growth - Bole / principal stems.	11.6	1.9	20-40	C	1
G530	2	*Fraxinus excelsior* Ash	11.0	4	36	N 4.0 E 4.0 S 4.0 W 4.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	58.6	4.3	20-40	C	2
G531	10 6 6	*Fraxinus excelsior* Ash *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	11.0	4	36	N 4.0 E 4.0 S 4.0 W 4.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Physiological / cambial damage - Fungal. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	58.6	4.3	20-40	C	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T532	1	*Fraxinus excelsior* Ash	15.0	5	44	N E S W 6.0 6.0 6.0 6.0	3.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal.	90.5	5.4	20-40	B	1
T533	1	*Crataegus monogyna* Common Hawthorn/Quick/May	7.0	2	19	N E S W 3.0 3.0 3.0 3.0	1.0	0.0	Early Mature	Good	Arboricultural work - Recent. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	17.7	2.4	20-40	C	1
T534	1	*Malus sylvestris* Wild Crab	7.0	2	19	N E S W 4.0 4.0 4.0 4.0	1.0	0.0	Early Mature	Good	Arboricultural work - Recent. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	17.7	2.4	20-40	C	1
G535	6 2 1 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ilex aquifolium* Holly *Quercus robur* English Oak	11.0	4	36	N E S W 4.0 4.0 4.0 4.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Whole tree. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	58.6	4.3	20-40	C	2
G536	4	*Quercus robur* English Oak	22.0	1	85	N E S W 10.0 10.0 10.0 10.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	326.9	10.2	40+	A	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G537	16	*Crataegus monogyna* Common Hawthorn/Quick/May	11.0	4	36	N 4.0 E 4.0 S 4.0 W 4.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	58.6	4.3	20-40	C	2
T538	1	*Fraxinus excelsior* Ash	14.0	5	89	N 8.0 E 8.0 S 8.0 W 8.0	4.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	361.9	10.7	20-40	B	1 3
T539	1	*Salix caprea* Goat Willow/Great Sallow	10.0	7	37	N 4.0 E 4.0 S 4.0 W 4.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	62.1	4.4	40+	C	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H540	20 20 6 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	11.6	1.9	40+	C	2
G541	6	*Crataegus monogyna* Common Hawthorn/Quick/May	7.0	1	14	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	8.9	1.7	40+	C	2
H542	200 150 50 18	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Sorbus aria* Whitebeam	2.5	1	12	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained. A maintained hedgerow with sporadic young planted trees.	6.5	1.4	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H543	120 120 50 10	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ilex aquifolium* Holly	2.5	1	12	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	6.5	1.4	40+	B	2
G544	40 15 10 8 6 4 3	*Fagus sylvatica* Common Beech *Cerasus avium* Wild Cherry *Fraxinus excelsior* Ash *Pinus nigra* Black Pine *Pinus sylvestris* Scots Pine *x Cupressocyparis leylandii* Leyland Cypress *Aesculus hippocastanum* Horse Chestnut	20.0	1	50	N E S W 6.0 6.0 6.0 6.0	2.0	0.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	113.1	6.0	40+	A	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T545	1	*Acer campestre* Field Maple	8.0	1	35	N E S W 6.0 6.0 6.0 6.0	1.0	0.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	55.4	4.2	40+	C	1
H546	65 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	3.0	1	12	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	6.5	1.4	40+	C	2
T547	1	*Fraxinus excelsior* Ash	14.0	1	42	N E S W 7.0 7.0 7.0 7.0	4.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	79.8	5.0	20-40	B	1
T548	1	*Fraxinus excelsior* Ash	14.0	1	36	N E S W 7.0 7.0 7.0 7.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	58.6	4.3	20-40	B	1
T549	1	*Fraxinus excelsior* Ash	17.0	1	36	N E S W 6.0 6.0 6.0 6.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	58.6	4.3	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T550	1	*Fraxinus excelsior* Ash	16.0	1	36	N E S W 5.0 5.0 5.0 5.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	58.6	4.3	20-40	B	1
G551	7	*Salix fragilis* Crack Willow	14.0	1	32	N E S W 4.0 4.0 4.0 4.0	4.0	4.0	Early Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Structure. Bark wound - Mechanical.	46.3	3.8	40+	B	2
G552	9	*Salix fragilis* Crack Willow	14.0	1	32	N E S W 4.0 4.0 4.0 4.0	4.0	4.0	Early Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Structure. Bark wound - Mechanical.	46.3	3.8	40+	B	2
T553	1	*Fraxinus excelsior* Ash	16.0	1	44	N E S W 7.0 7.0 3.0 7.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	87.6	5.3	20-40	B	1
T554	1	*Salix fragilis* Crack Willow	19.0	3	143	N E S W 8.0 11.0 10.0 8.0	4.0	0.0	Ancient or Veteran	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Hollow trunk - Suspected. Ivy or climbing plant.	706.9	15.0	40+	A	1 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H555	50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	2.0	1	12	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	6.5	1.4	40+	C	2
G556	20 10 8 3 2	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Quercus robur* English Oak	15.0	1	35	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Natural regeneration.	55.4	4.2	40+	B	2
H557	50 40 15 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash	5.0	1	12	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. Flailed from field side to north.	6.5	1.4	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H558	40 30 30 10 10	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm *Acer campestre* Field Maple *Fraxinus excelsior* Ash	12.0	1	18	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Dutch elm disease. Dead tree / trees. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Flailed from field side to north.	14.7	2.2	40+	C	2
H559	40 30 30 10 10	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm *Acer campestre* Field Maple *Fraxinus excelsior* Ash	8.0	1	18	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Dutch elm disease. Dead tree / trees. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Flailed from field side to north.	14.7	2.2	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T560	1	*Acer pseudoplatanus* Sycamore	17.0	5	67	N 6.0 E 6.0 S 6.0 W 6.0	5.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Recent. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Lower crown. Deadwood - Minor. Ivy or climbing plant.	203.6	8.0	40+	B	1
H561	20 20 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Salix fragilis* Crack Willow	8.0	1	16	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Dutch elm disease. Dead tree / trees. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Flailed from field side to north.	11.6	1.9	40+	C	2
H562	50 20 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Salix fragilis* Crack Willow	9.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Dutch elm disease. Dead tree / trees. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Flailed from field side to north.	18.1	2.4	40+	C	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G563	5 5 5 5 5 1	*Acer campestre* Field Maple *Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak	20.0	1	60	N E S W 9.0 9.0 9.0 9.0	4.0	0.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	162.9	7.2	40+	A	2 3
T564	1	*Quercus robur* English Oak	22.0	1	120	N E S W 10.0 10.0 10.0 10.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Poor past pruning.	651.4	14.4	40+	A	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G565	50 16 5 5 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak	18.0	1	50	N 7.0 E 7.0 S 7.0 W 7.0	4.0	0.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	113.1	6.0	40+	B	2 3
H566	60 40 30 10 10 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Quercus robur* English Oak *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ilex aquifolium* Holly	9.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Dutch elm disease. Dead tree / trees. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Flailed from field side to north.	18.1	2.4	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W567	80 80 60 50 40 30 20	*Acer campestre* Field Maple *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Quercus robur* English Oak *Cerasus avium* Wild Cherry *Alnus glutinosa* Common Alder *Crataegus monogyna* Common Hawthorn/Quick/May	16.0	1	40	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Bark exudation. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning. HV pole and conductors intersecting group.	72.4	4.8	40+	B	2
H568	50 40 40 40 15	*Acer campestre* Field Maple *Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Swida sanguinea* Common Dogwood	4.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Hedgerow - Maintained.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W569	70 10	*Salix caprea* Goat Willow/Great Sallow *Alnus glutinosa* Common Alder	16.0	1	40	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Bark exudation. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	72.4	4.8	40+	B	2
W570	60 10 2	*Salix caprea* Goat Willow/Great Sallow *Alnus glutinosa* Common Alder *Fraxinus excelsior* Ash	16.0	1	40	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Bark exudation. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	72.4	4.8	40+	B	2
G571	50 50 45 35 10 10	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Quercus robur* English Oak *Acer campestre* Field Maple *Alnus glutinosa* Common Alder	16.0	1	40	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Bark exudation. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	72.4	4.8	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T572	1	*Quercus robur* English Oak	17.0	1	55	N 9.0 E 9.0 S 9.0 W 9.0	3.0	3.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor. Rubbing limbs.	136.8	6.6	40+	B	1
T573	1	*Quercus robur* English Oak	13.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	3.0	2.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor. Rubbing limbs.	72.4	4.8	40+	B	1
T574	1	*Fraxinus excelsior* Ash	13.0	2	35	N 6.0 E 6.0 S 6.0 W 6.0	3.0	0.0	Early Mature	Fair	Arboricultural work - Historic. Buttresses / buttress roots - Buried. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Rubbing limbs.	56.5	4.2	40+	C	1
T575	1	*Fraxinus excelsior* Ash	13.0	2	35	N 6.0 E 6.0 S 6.0 W 6.0	3.0	0.0	Early Mature	Fair	Arboricultural work - Historic. Buttresses / buttress roots - Buried. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Rubbing limbs.	56.5	4.2	40+	C	1
T576	1	*Fraxinus excelsior* Ash	13.0	1	45	N 6.0 E 6.0 S 6.0 W 6.0	3.0	0.0	Early Mature	Fair	Arboricultural work - Historic. Buttresses / buttress roots - Buried. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Rubbing limbs.	91.6	5.4	40+	C	1
T577	1	*Fraxinus excelsior* Ash	13.0	1	45	N 6.0 E 6.0 S 6.0 W 6.0	3.0	0.0	Early Mature	Fair	Arboricultural work - Historic. Buttresses / buttress roots - Buried. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Rubbing limbs.	91.6	5.4	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G578	80 60 30 30 25 10 6	*Alnus glutinosa* Common Alder *Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Malus sylvestris* Wild Crab	16.0	1	40	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Bark exudation. Base / stems obscured - Vegetation. Buttresses / buttress roots - Buried. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	72.4	4.8	40+	B	2
W579	50 30 20 10 5	*Alnus glutinosa* Common Alder *Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash	16.0	1	40	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Bark exudation. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	72.4	4.8	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T580	1	*Quercus robur* English Oak	17.0	1	60	N E S W 9.0 9.0 9.0 9.0	3.0	3.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor. Rubbing limbs.	162.9	7.2	40+	B	1
T581	1	*Crataegus monogyna* Common Hawthorn/Quick/May	8.0	1	20	N E S W 3.0 3.0 3.0 3.0	0.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Rubbing limbs.	18.1	2.4	40+	B	1
T582	1	*Crataegus monogyna* Common Hawthorn/Quick/May	8.0	1	20	N E S W 3.0 3.0 3.0 3.0	0.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Rubbing limbs.	18.1	2.4	40+	B	1
T583	1	*Crataegus monogyna* Common Hawthorn/Quick/May	8.0	1	20	N E S W 3.0 3.0 3.0 3.0	0.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Rubbing limbs.	18.1	2.4	40+	B	1
T584	1	*Crataegus monogyna* Common Hawthorn/Quick/May	8.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Rubbing limbs.	40.7	3.6	40+	B	1
T585	1	*Quercus robur* English Oak	17.0	1	40	N E S W 7.0 7.0 7.0 7.0	0.5	3.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Rubbing limbs.	72.4	4.8	40+	B	1
G586	4 1	*Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May	14.0	1	45	N E S W 6.0 6.0 6.0 6.0	1.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	91.6	5.4	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T587	1	*Crataegus monogyna* Common Hawthorn/Quick/May	4.0	1	20	N 3.0 E 3.0 S 3.0 W 3.0	0.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Rubbing limbs.	18.1	2.4	40+	C	1
G588	5 4 3 2	*Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May *Alnus glutinosa* Common Alder *Acer pseudoplatanus* Sycamore	15.0	1	45	N 6.0 E 6.0 S 6.0 W 6.0	1.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	91.6	5.4	40+	B	2
T589	1	*Ulmus sp.* Elm sp.	5.0	7	26	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Rubbing limbs.	31.7	3.2	40+	C	1
T590	1	*Ulmus sp.* Elm sp.	5.0	7	26	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Rubbing limbs.	31.7	3.2	40+	C	1
T591	1	*Fraxinus excelsior* Ash	9.0	14	29	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Rubbing limbs.	40.5	3.6	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G592	2	*Quercus robur* English Oak	17.0	1	65	N E S W 10.0 10.0 10.0 10.0	0.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Poor past pruning. Twin-stemmed.	191.1	7.8	40+	B	2
T593	1	*Alnus glutinosa* Common Alder	13.0	1	35	N E S W 1.0 1.0 1.0 1.0	4.0	0.0	Early Mature	Dead	Dead tree / trees.			0-10	U	
G594	3 1	*Alnus glutinosa* Common Alder *Acer campestre* Field Maple	10.0	1	20	N E S W 3.0 3.0 3.0 3.0	1.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	18.1	2.4	40+	C	2
G595	50 10 10 10 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Quercus robur* English Oak *Corylus avellana* Common Hazel	16.0	1	45	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Bark exudation. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	91.6	5.4	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T596	1	*Acer campestre* Field Maple	8.0	2	25	N E S W 4.0 4.0 4.0 4.0	1.0	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	29.3	3.1	40+	C	1
H597	50 50 20 15 15 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Swida sanguinea* Common Dogwood *Fraxinus excelsior* Ash	6.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. Outgrown at time of survey, however usually maintained at 4m under HV conductors.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H598	50 50 50 20 15 10	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Swida sanguinea* Common Dogwood *Fraxinus excelsior* Ash	6.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. Outgrown at time of survey, however usually maintained at 4m under HV conductors.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G599	40 40 40 30 20 20 20 5	*Salix caprea* Goat Willow/Great Sallow *Cerasus avium* Wild Cherry *Fraxinus excelsior* Ash *Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Pinus sylvestris* Scots Pine	19.0	1	40	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Bark exudation. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning. HV pole and conductors positioned adjacent to group.	72.4	4.8	40+	B	2
T600	1	*Fraxinus excelsior* Ash	17.0	1	55	N 4.0 E 9.0 S 9.0 W 9.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	136.8	6.6	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T601	1	*Fraxinus excelsior* Ash	17.0	1	50	N E S W 9.0 9.0 4.0 9.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	113.1	6.0	20-40	B	1
T602	1	*Fraxinus excelsior* Ash	15.0	1	50	N E S W 9.0 9.0 9.0 9.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	113.1	6.0	40+	B	1
T603	1	*Quercus robur* English Oak	11.0	1	40	N E S W 8.0 8.0 8.0 8.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	72.4	4.8	40+	B	1
G604	3 1 1 1	*Fraxinus excelsior* Ash *Quercus robur* English Oak *Aesculus hippocastanum* Horse Chestnut *Acer campestre* Field Maple	12.0	1	40	N E S W 7.0 7.0 7.0 7.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	72.4	4.8	40+	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T605	1	*Quercus robur* English Oak	14.0	1	50	N E S W 8.0 8.0 8.0 8.0	3.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	113.1	6.0	40+	B	1
T606	1	*Quercus robur* English Oak	10.0	1	35	N E S W 6.0 6.0 6.0 6.0	1.0	1.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	55.4	4.2	40+	C	1
T607	1	*Fraxinus excelsior* Ash	11.0	4	36	N E S W 4.0 4.0 4.0 4.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	58.6	4.3	40+	C	1
T608	1	*Fraxinus excelsior* Ash	18.0	1	45	N E S W 6.0 4.0 6.0 10.0	5.0	2.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant. Poor past pruning.	91.6	5.4	40+	C	1
T609	1	*Betula pendula* Silver Birch	16.0	1	35	N E S W 4.0 4.0 4.0 3.0	1.0	1.0	Early Mature	Good	Access to inspect base - Not possible. Deadwood - Minor.	55.4	4.2	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G610	5 4 2	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ilex aquifolium* Holly	4.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	11.6	1.9	40+	C	2
T611	1	*Salix babylonica* Weeping Willow	17.0	1	50	N E S W 8.0 8.0 8.0 8.0	1.0	3.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Deadwood - Minor.	113.1	6.0	40+	B	1
G612	2 1 1	*Pseudotsuga menziesii* Douglas Fir *Salix babylonica* Weeping Willow *Prunus domestica* Plum	10.0	1	25	N E S W 5.0 5.0 5.0 5.0	1.0	1.0	Early Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation.	28.3	3.0	40+	B	2
G613	1 1	*Quercus robur* English Oak *Aesculus hippocastanum* Horse Chestnut	17.0	1	50	N E S W 8.0 8.0 8.0 8.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	113.1	6.0	40+	B	2
T614	1	*Quercus robur* English Oak	14.0	1	30	N E S W 6.0 6.0 4.0 6.0	1.0	1.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Crown. Poor past pruning.	40.7	3.6	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T615	1	*Quercus robur* English Oak	9.0	1	25	N E S W 6.0 6.0 4.0 6.0	1.0	1.0	Early Mature	Fair	Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Crown. Poor past pruning.	28.3	3.0	40+	C	1
G616	2 1	*Quercus robur* English Oak *Fraxinus excelsior* Ash	17.0	1	50	N E S W 8.0 8.0 8.0 8.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	113.1	6.0	40+	B	2
G617	10 9 1	*Quercus robur* English Oak *Fraxinus excelsior* Ash *Aesculus hippocastanum* Horse Chestnut	17.0	1	50	N E S W 7.0 7.0 7.0 7.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	113.1	6.0	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m) N	E	S	W	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G618	100	*Acer campestre* Field Maple	14.0	1	40	5.0	5.0	5.0	5.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Bark exudation. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. Poor past pruning. Maintained hedgerow with sporadic outgrown trees.	72.4	4.8	40+	B	2 3
	100	*Crataegus monogyna* Common Hawthorn/Quick/May																	
	50	*Prunus spinosa* Blackthorn/Sloe																	
	40	*Corylus avellana* Common Hazel																	
	30	*Quercus robur* English Oak																	
	25	*Fraxinus excelsior* Ash																	

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)				Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
						N	E	S	W										
W619	40	*Crataegus monogyna* Common Hawthorn/Quick/May	18.0	1	50	8.0	8.0	8.0	8.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Bark exudation. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Poor past pruning. Outgrown hedge along woodland boundary.	113.1	6.0	40+	B	2 3
	25	*Fraxinus excelsior* Ash																	
	20	*Acer campestre* Field Maple																	
	20	*Prunus spinosa* Blackthorn/Sloe																	
	10	*Corylus avellana* Common Hazel																	
	10	*Quercus robur* English Oak																	
	3	*Ilex aquifolium* Holly																	

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H620	200 150 100 100 25 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Swida sanguinea* Common Dogwood *Fraxinus excelsior* Ash	6.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. HV conductors and pole at northern point of group.	11.6	1.9	40+	C	2
T621	1	*Acer pseudoplatanus* Sycamore	11.0	1	50	N 8.0 E 8.0 S 8.0 W 8.0	1.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	113.1	6.0	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H622	100 50 20 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	6.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant. HV conductors and pole at northern point of group.	11.6	1.9	40+	C	2
T623	1	*Acer campestre* Field Maple	8.0	1	25	N 3.0 E 3.0 S 3.0 W 3.0	1.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	28.3	3.0	40+	C	1
G624	40 20 16 15	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Acer campestre* Field Maple	17.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Physiological / cambial damage - Fungal. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	72.4	4.8	20-40	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W625	25 25 15 10 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Quercus robur* English Oak	18.0	1	55	N 9.0 E 9.0 S 9.0 W 9.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Physiological / cambial damage - Fungal.	136.8	6.6	40+	B	2 3
W626	50 50 50 40 25 25	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow	16.0	1	30	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Physiological / cambial damage - Fungal.	40.7	3.6	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H627	5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Ivy or climbing plant.	11.6	1.9	40+	C	2
G628	15 10 5 3 3	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Quercus robur* English Oak *Fraxinus excelsior* Ash	17.0	1	60	N E S W 7.0 7.0 7.0 7.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Hedgerow - Maintained. Physiological / cambial damage - Fungal.	162.9	7.2	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W629	30 25 15 15 6	*Fraxinus excelsior* Ash *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak	17.0	1	60	N 9.0 E 9.0 S 9.0 W 9.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Trees growing on descending bank.	162.9	7.2	40+	B	2 3
T630	1	*Quercus robur* English Oak	15.0	1	40	N 8.0 E 8.0 S 8.0 W 8.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Buttresses / buttress roots - Buried. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	72.4	4.8	40+	B	1
T631	1	*Quercus robur* English Oak	13.0	1	36	N 7.0 E 7.0 S 7.0 W 7.0	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Buttresses / buttress roots - Buried. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	58.6	4.3	40+	B	1
T632	1	*Quercus robur* English Oak	12.0	1	30	N 5.0 E 5.0 S 5.0 W 5.0	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Buttresses / buttress roots - Buried. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	40.7	3.6	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T633	1	*Quercus robur* English Oak	10.0	1	22	N 4.0 E 4.0 S 4.0 W 4.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Buttresses / buttress roots - Buried. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	21.9	2.6	40+	C	1
T634	1	*Quercus robur* English Oak	13.0	2	49	N 8.0 E 8.0 S 8.0 W 8.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Buttresses / buttress roots - Buried. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Twin-stemmed.	110.8	5.9	40+	B	1
T635	1	*Quercus robur* English Oak	15.0	1	45	N 7.0 E 7.0 S 7.0 W 7.0	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Buttresses / buttress roots - Buried. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	91.6	5.4	40+	B	1
T636	1	*Quercus robur* English Oak	15.0	1	109	N 8.0 E 8.0 S 8.0 W 7.0	5.0	2.5	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Crack - Longitudinal / shear crack. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Bole.	537.5	13.1	40+	A	3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G637	40 30 30 10	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Quercus robur* English Oak	10.0	1	30	N E S W 3.5 3.5 3.5 3.5	0.0	0.0	Mature	Fair	Deadwood - Minor. Hedgerow with sides trimmed. Bramble throughout.	40.7	3.6	40+	B	2
G638	15 15 10 5	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak	10.0	1	25	N E S W 3.5 3.5 3.5 3.5	0.0	0.0	Semi Mature	Fair	Deadwood - Minor. Hedgerow with sides trimmed. Bramble throughout.	28.3	3.0	40+	B	2
T639	1	*Fraxinus excelsior* Ash	14.0	1	35	N E S W 6.0 6.0 5.0 5.0	3.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant. Multi-stemmed.	55.4	4.2	40+	B	2
G640	20 7	*Ulmus procera* English Elm *Acer campestre* Field Maple	10.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Poor	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Dutch elm disease. Deadwood - Major.	28.3	3.0	10-20	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H641	20 20 10	*Acer campestre* Field Maple *Ulmus procera* English Elm *Prunus spinosa* Blackthorn/Sloe	3.5	1	7	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained. Beneath power lines.	2.2	0.8	40+	B	2
T642	1	*Quercus robur* English Oak	17.0	1	108	N E S W 9.0 8.0 9.0 8.0	2.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Bark wound - Minor. Die-back - Upper crown. Deadwood - Major. Fungal fruiting body - structural decay suspected. Ivy or climbing plant.	527.7	13.0	40+	B	2
G643	50 20 10 10 10	*Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Quercus robur* English Oak	11.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Semi Mature	Fair	Deadwood - Minor. Multi-stemmed. Hedgerow with sides trimmed. Bramble throughout.	40.7	3.6	40+	B	2
T644	1	*Quercus robur* English Oak	18.0	1	114	N E S W 9.0 9.0 9.0 9.0	2.0	2.5	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Shedding limb / limbs - Minor.	587.9	13.7	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T645	1	*Quercus robur* English Oak	18.0	1	114	N E S W 9.0 9.0 9.0 9.0	2.0	2.5	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Branch - Broken. Buttresses / buttress roots - Undeveloped. Bark wound - Minor. Deadwood - Minor. Ivy or climbing plant. Shedding limb / limbs - Minor.	587.9	13.7	40+	B	2
G646	50 50 40 40 10 10 5	*Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm *Populus sp.* Poplar sp. *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Quercus robur* English Oak *Salix caprea* Goat Willow/Great Sallow	11.0	1	25	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Semi Mature	Fair	Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Root environment - Restricted. Large poplar roots in ploughed field. Pond in east not accessed.	28.3	3.0	10-20	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G647	100 30 25 10 10	*Ulmus procera* English Elm *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Populus sp.* Poplar sp.	10.0	1	15	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Semi Mature	Fair	Die-back - Throughout crown. Dutch elm disease. Dead tree / trees. Deadwood - Major. Root environment - Restricted. Trees east of ditch.	10.2	1.8	10-20	C	2
T648	1	*Fraxinus excelsior* Ash	14.0	1	36	N 7.0 E 6.0 S 7.0 W 6.0	3.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Minor. North of ditch.	58.6	4.3	20-40	B	2
G649	150	*Ulmus procera* English Elm	10.0	1	12	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Semi Mature	Poor	Dutch elm disease. Dead tree / trees. Deadwood - Major. Fallen tree / trees - Whole tree. Root environment - Restricted.	6.5	1.4	10-20	C	2
T650	1	*Acer campestre* Field Maple	11.0	2	22	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.5	Early Mature	Good	Branch - Broken. Deadwood - Minor. Epicormic growth - Bole / principal stems. Fork - Suspected structurally sound. South of ditch.	23.2	2.7	40+	B	2
T651	1	*Fraxinus excelsior* Ash	13.0	1	36	N 4.0 E 7.0 S 5.0 W 7.0	1.0	4.0	Early Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Weak live growth. Possible coppice as several small ash around base.	58.6	4.3	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H652	10 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	5.0	1	8	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Mature	Fair	Deadwood - Minor. Hedgerow - Neglected / overgrown. Multi-stemmed. Root environment - Restricted. North of ditch. Hedge with occasional gaps.	2.9	1.0	20-40	B	2
G653	1 1 1	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm	8.0	1	20	N E S W 2.5 2.5 2.5 2.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Root environment - Restricted. North of ditch.	18.1	2.4	20-40	C	2
G654	180	*Ulmus procera* English Elm	11.0	1	10	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Poor	Dutch elm disease. Dead tree / trees. Ivy or climbing plant.	4.5	1.2	10-20	C	2
T655	1	*Fraxinus excelsior* Ash	17.0	1	98	N E S W 7.0 9.0 5.0 7.0	4.0	2.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Decay / structural defect - Base. Fungal fruiting body - structural decay suspected. Raised surface roots. Ash heart in several locations. North of ditch.	434.5	11.8	20-40	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G656	10 2 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash	7.0	1	8	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Deadwood - Minor. Hedgerow - Neglected / overgrown. Ivy or climbing plant. North of ditch.	2.9	1.0	40+	B	2
T657	1	*Quercus robur* English Oak	9.0	1	34	N E S W 4.0 4.0 4.0 4.0	3.0	3.0	Semi Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Ivy or climbing plant. East of ditch.	52.3	4.1	40+	B	1 2
T658	1	*Quercus robur* English Oak	14.0	1	56	N E S W 7.0 6.0 6.0 5.0	5.0	2.5	Early Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant. East of ditch.	141.9	6.7	40+	B	1 2
T659	1	*Salix caprea* Goat Willow/Great Sallow	8.0	2	51	N E S W 6.0 5.0 6.0 5.0	2.0	1.0	Mature	Fair	Access to inspect base - Not possible. Branch - Broken. Epicormic growth - Bole / principal stems. Fork - Weak with included bark. Ivy or climbing plant.	120.7	6.2	20-40	C	1 2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G660	100 100 60 50 50 20	*Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Quercus robur* English Oak	10.0	1	10	N 1.5 E 1.5 S 1.5 W 1.5	0.0	0.0	Semi Mature	Fair	Dutch elm disease. Dead tree / trees. Deadwood - Minor. Occasional standard oak and ash. East of ditch.	4.5	1.2	20-40	B	2
T661	1	*Salix caprea* Goat Willow/Great Sallow	11.0	2	52	N 7.0 E 7.0 S 7.0 W 5.0	3.0	1.0	Mature	Fair	Access to inspect base - Not possible. Branch - Broken. Deadwood - Minor. Fork - Weak with included bark. In centre of ditch. Flail damaged branches over field.	122.3	6.2	20-40	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H662	10 10 5 5 1	*Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel	4.0	1	5	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Hedgerow - Maintained.	1.1	0.6	40+	B	2
G663	80 20 20	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	14.0	1	25	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Poor	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Ring of trees around a pond.	28.3	3.0	20-40	B	2
H664	300	*Crataegus monogyna* Common Hawthorn/Quick/May	6.0	1	7	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown.	2.2	0.8	40+	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W665	400 400 100	*Fagus sylvatica* Common Beech *Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May	17.0	1	50	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	113.1	6.0	40+	A	2
H666	150 150 100 50 50 10 5	*Acer campestre* Field Maple *Ulmus procera* English Elm *Corylus avellana* Common Hazel *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Fraxinus excelsior* Ash	4.0	1	7	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Good	Hedgerow - Maintained. East of ditch.	2.2	0.8	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T667	1	*Acer campestre* Field Maple	8.0	3	54	N E S W 8.0 4.0 5.0 5.0	5.0	5.0	Mature	Poor	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Base. Ivy or climbing plant. Weak live growth. East of ditch.	133.4	6.5	20-40	B	2 3
H668	60 60 30 15	*Acer campestre* Field Maple *Ulmus procera* English Elm *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel	4.0	1	7	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Good	Hedgerow - Maintained. East of ditch.	2.2	0.8	40+	B	2
T669	1	*Quercus robur* English Oak	18.0	1	106	N E S W 10.0 10.0 9.0 11.0	5.0	5.0	Mature	Poor	Deadwood - Minor. Decay / structural defect - Base. Fungal fruiting body - structural decay suspected. Ivy or climbing plant. Beef steak fungus all around base.o	508.3	12.7	10-20	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H670	90 90 50 25 15	*Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ulmus procera* English Elm *Crataegus monogyna* Common Hawthorn/Quick/May	6.0	1	8	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Mature	Good	Base / stems obscured - Vegetation. Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	2.9	1.0	40+	B	2 3
T671	1	*Fraxinus excelsior* Ash	14.0	2	38	N 5.0 E 5.0 S 4.0 W 5.0	1.5	2.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	66.0	4.6	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G672	150 100 50 50 20 7 5 1	*Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm *Fraxinus excelsior* Ash *Tilia cordata* Small Leaved Lime *Sambucus nigra* Elder *Ilex aquifolium* Holly	11.0	1	28	N E S W 3.5 3.5 3.5 3.5	0.0	0.0	Semi Mature	Good	Base / stems obscured - Vegetation. Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	35.5	3.4	40+	B	2
T673	1	*Fraxinus excelsior* Ash	9.0	3	51	N E S W 5.0 6.0 5.0 5.0	3.0	1.0	Mature	Fair	Access to inspect base - Not possible. Arboricultural work - Recent. Base / stems obscured - Vegetation. Topped beneath power line.	122.1	6.2	20-40	C	1 2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G674	50 35 30 25 25 20	*Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Ulmus procera* English Elm *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May	9.0	1	25	N 3.5 E 3.5 S 3.5 W 3.5	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Dutch elm disease. Dead tree / trees. Fallen tree / trees - Whole tree. Ivy or climbing plant. Pond area not accessed.	28.3	3.0	20-40	B	2 3
T675	1	*Fraxinus excelsior* Ash	14.0	1	125	N 5.0 E 2.0 S 7.0 W 6.0	4.0	3.0	Ancient or Veteran	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Decay / structural defect - Open cavity / cavities. Ivy or climbing plant. Lesion or fracture on stem / bole - Major. Woodpecker holes.	706.9	15.0	20-40	A	3
T676	1	*Quercus robur* English Oak	17.0	1	98	N 11.0 E 10.0 S 11.0 W 10.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Fungal fruiting body - structural decay suspected.	434.5	11.8	40+	A	1 2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T677	1	*Quercus robur* English Oak	10.0	1	83	N E S W 1.0 4.0 6.0 4.0	2.0	3.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Major. Decay / structural defect - Bole. Hollow trunk - Open cavity. Ivy or climbing plant. Leaning trunk - Minor.	311.7	10.0	40+	A	3
T678	1	*Quercus robur* English Oak	14.0	1	87	N E S W 5.0 8.0 8.0 7.0	5.0	3.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Major. Decay / structural defect - Open cavity / cavities. Ivy or climbing plant.	342.4	10.4	40+	A	3
T679	1	*Fraxinus excelsior* Ash	16.0	1	52	N E S W 4.0 4.0 6.0 4.0	5.0	8.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Decay / structural defect - Principal stems. Fungal fruiting body - structural decay suspected. Ivy or climbing plant.			0-10	U	

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G680	35 35 30 25 20 15	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Quercus robur* English Oak *Corylus avellana* Common Hazel *Ulmus procera* English Elm	11.0	1	30	N E S W 3.5 3.5 3.5 3.5	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	40.7	3.6	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G681	50 45 30 20 20 15 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Ulmus procera* English Elm *Carpinus betulus* Hornbeam	13.0	1	33	N 4.0 E 4.0 S 4.0 W 4.0	1.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	49.3	4.0	40+	B	2 3
G682	7 5 5 2 1	*Cerasus avium* Wild Cherry *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Ilex aquifolium* Holly	12.0	1	35	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Natural regeneration.	55.4	4.2	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G683	150 50 1 1	*Ulmus procera* English Elm *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Malus sylvestris* Wild Crab	9.0	1	8	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Semi Mature	Poor	Access to inspect base - Restricted / obscured. Dutch elm disease. Dead tree / trees. Ivy or climbing plant.	2.9	1.0	10-20	C	2
T684	1	*Quercus robur* English Oak	16.0	1	62	N 8.0 E 8.0 S 8.0 W 8.0	4.0	2.5	Mature	Good	Access to inspect base - Not possible. Bark wound - Minor. Deadwood - Minor. Epicormic growth - Bole / principal stems.	173.9	7.4	40+	B	2
G685	100 75 2	*Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm *Ilex aquifolium* Holly	7.0	1	9	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown. Dense bramble throughout.	3.7	1.1	40+	B	2
T686	1	*Quercus robur* English Oak	11.0	1	153	N 6.0 E 4.0 S 8.0 W 4.0	5.0	2.0	Ancient or Veteran	Good	Access to inspect base - Restricted / obscured. Decay / structural defect - Principal stems. Hollow trunk - Open cavity. Ivy or climbing plant. Leaning trunk - Minor. Pollard - Lapsed / Mature stems. Root environment - Restricted. East of ditch.	706.9	15.0	40+	A	3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W687	2000 350 300	*Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel	17.0	1	33	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Ditches surround woodland with a hedge like edge.	49.3	4.0	40+	A	2 3
G688	100	*Prunus spinosa* Blackthorn/Sloe	5.0	1	7	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Natural regeneration. East of ditch. dense thicket below power lines.	2.2	0.8	40+	C	2 3
T689	1	*Quercus robur* English Oak	17.0	1	48	N E S W 4.0 7.0 7.0 7.0	1.0	0.0	Early Mature	Good	Coppice stool - Coppice origin / Mature stems. Rubbing limbs.	104.2	5.8	40+	B	2
T690	1	*Quercus robur* English Oak	18.0	2	80	N E S W 8.0 8.0 5.0 8.0	2.0	2.0	Mature	Good	Deadwood - Minor. Epicormic growth - Crown. Fork - Weak with included bark. Twin stem from base.	291.6	9.6	40+	B	2 3
T691	1	*Fraxinus excelsior* Ash	15.0	5	59	N E S W 3.0 9.0 7.0 8.0	0.5	0.0	Mature	Fair	Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Decay / structural defect - Base. Epicormic growth - Crown.	158.3	7.1	40+	B	2 3
T692	1	*Fraxinus excelsior* Ash	15.0	6	58	N E S W 6.0 7.0 4.0 9.0	4.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Branch - Broken. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Rubbing limbs.	156.3	7.1	40+	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G693	50 50 50 30 30 5	*Fraxinus excelsior* Ash *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Quercus robur* English Oak *Prunus spinosa* Blackthorn/Sloe *Ilex aquifolium* Holly	14.0	1	40	N E S W 4.5 4.5 4.5 4.5	0.0	0.0	Mature	Good	Coppice stool - Coppice origin / Mature stems. Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	72.4	4.8	40+	B	2 3
T694	1	*Quercus robur* English Oak	15.0	3	58	N E S W 6.0 7.0 8.0 5.0	4.0	3.0	Mature	Good	Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Epicormic growth - Crown.	154.4	7.0	40+	B	2 3
T695	1	*Quercus robur* English Oak	15.0	3	62	N E S W 7.0 8.0 8.0 8.0	1.0	1.0	Mature	Good	Branch - Broken. Deadwood - Major.	177.2	7.5	40+	B	2 3
T696	1	*Fraxinus excelsior* Ash	15.0	7	58	N E S W 7.0 8.0 7.0 8.0	1.0	0.0	Mature	Good	Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown.	153.3	7.0	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G697	40 30 30 20 15 7	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Quercus robur* English Oak *Ilex aquifolium* Holly	10.0	1	40	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Mature	Good	Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Hedgerow - Neglected / overgrown.	72.4	4.8	40+	B	2 3
T698	1	*Quercus robur* English Oak	8.0	1	60	N 1.0 E 3.0 S 6.0 W 5.0	1.0	3.0	Ancient or Veteran	Fair	Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Hollow trunk - Open cavity. Storm damage. Exposed heartwood from trunk / crown breakage.	162.9	7.2	40+	A	2 3
T699	1	*Fraxinus excelsior* Ash	15.0	5	62	N 6.0 E 6.0 S 6.0 W 6.0	2.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Localised. Deadwood - Minor. Fused stems.	176.8	7.5	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T700	1	*Fraxinus excelsior* Ash	10.0	1	121	N 5.0 E 1.0 S 4.0 W 9.0	2.0	0.0	Ancient or Veteran	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect - Base. Decay / structural defect - Bole. Hollow trunk - Open cavity. Storm damage. Woodpecker holes.	662.3	14.5	20-40	A	2 3
T701	1	*Fraxinus excelsior* Ash	15.0	1	61	N 6.0 E 7.0 S 6.0 W 8.0	4.0	4.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Minor. Decay / structural defect - Base. Ivy or climbing plant.	168.3	7.3	10-20	C	2 3
T702	1	*Quercus robur* English Oak	16.0	1	59	N 8.0 E 7.0 S 7.0 W 5.0	2.0	1.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Base. Ivy or climbing plant.	157.5	7.1	40+	B	2 3
T703	1	*Fraxinus excelsior* Ash	17.0	1	36	N 6.0 E 5.0 S 5.0 W 6.0	4.0	4.0	Early Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	58.6	4.3	40+	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G704	80 80 80 50 10	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak *Ilex aquifolium* Holly	10.0	1	25	N E S W 2.5 2.5 2.5 2.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Bramble throughout.	28.3	3.0	40+	B	2 3
T705	1	*Quercus robur* English Oak	17.0	1	66	N E S W 2.0 2.0 2.0 2.0	5.0	6.0	Mature	Dead	Dead tree / trees. Ivy or climbing plant. Only stem and stubs of limbs remain.			0-10	U	
T706	1	*Quercus robur* English Oak	17.0	1	82	N E S W 8.0 9.0 9.0 3.0	4.0	5.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Major. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	304.2	9.8	40+	B	2
T707	1	*Quercus robur* English Oak	18.0	1	102	N E S W 10.0 8.0 9.0 3.0	2.5	6.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Bark wound - Mechanical. Bark wound - Minor. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	470.7	12.2	40+	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T708	1	*Quercus robur* English Oak	18.0	1	97	N E S W 10.0 9.0 10.0 6.0	2.0	6.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Major. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Storm damage.	425.7	11.6	40+	B	2 3
H709	200 50 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ilex aquifolium* Holly	2.5	1	6	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Hedgerow - Maintained. Ivy or climbing plant. Bramble throughout.	1.6	0.7	40+	B	2 3
G710	30 8	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	6.0	1	15	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Root environment - Restricted. Weak live growth. North of pond.	10.2	1.8	20-40	C	2
T711	1	*Salix alba* White Willow	16.0	4	76	N E S W 6.0 9.0 7.0 5.0	4.0	0.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Multi-stemmed.	261.3	9.1	20-40	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W712	3000 2500 1200 500	*Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May *Pinus sylvestris* Scots Pine *Castanea sativa* Sweet Chestnut	16.0	1	38	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Fallen tree / trees - Whole tree. Perimeter of hawthorn, then a row of Scots pine.	65.3	4.6	40+	B	2 3
T713	1	*Quercus robur* English Oak	14.0	1	42	N 6.0 E 6.0 S 6.0 W 5.0	2.0	3.0	Early Mature	Good	No significant faults observed. North of ditch.	79.8	5.0	40+	B	1 2
T714	1	*Quercus robur* English Oak	14.0	1	45	N 5.0 E 6.0 S 5.0 W 6.0	3.0	3.0	Semi Mature	Good	Lesion or fracture on stem / bole - Minor.	91.6	5.4	40+	B	1 2
T715	1	*Quercus robur* English Oak	14.0	1	44	N 6.0 E 6.0 S 6.0 W 6.0	2.0	2.5	Semi Mature	Good	No significant faults observed.	87.6	5.3	40+	B	1 2
T716	1	*Quercus robur* English Oak	14.0	1	44	N 6.0 E 5.0 S 6.0 W 6.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Ivy or climbing plant. No significant faults observed.	87.6	5.3	40+	B	1 2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H717	150 70 70 10	*Corylus avellana* Common Hazel *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Ilex aquifolium* Holly	3.5	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Coppice stool - Regrown. Hedgerow - Maintained. Multi-stemmed.	2.2	0.8	40+	B	2
G718	10 3 3 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel	14.0	1	40	N E S W 4.5 4.5 4.5 4.5	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Ivy or climbing plant. West of ditch. Northern section removed for a Murphy construction project. Bramble throughout.	72.4	4.8	40+	B	2
T719	1	*Quercus robur* English Oak	17.0	1	98	N E S W 9.0 10.0 9.0 10.0	5.0	3.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Major. Decay / structural defect - Principal stems. Ivy or climbing plant. Lesion or fracture on stem / bole - Major. South of ditch.	434.5	11.8	40+	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H720	150 150 80	*Corylus avellana* Common Hazel *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Hedgerow - Maintained. South of ditch.	2.2	0.8	40+	B	2 3
T721	1	*Quercus robur* English Oak	8.0	1	25	N E S W 4.0 3.0 4.0 4.0	3.0	3.0	Semi Mature	Good	Bark wound - Mechanical. Epicormic growth - Bole / principal stems. Branch stubs from flailing	28.3	3.0	40+	C	1 2
G722	6	*Ulmus procera* English Elm	11.0	1	16	N E S W 5.0 5.0 5.0 5.0	5.0	0.0	Semi Mature	Poor	Dutch elm disease. Dead tree / trees.			0-10	U	
H723	150 100 50 40	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Ulmus procera* English Elm	2.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Hedgerow - Maintained.	2.2	0.8	40+	B	2
T724	1	*Ilex aquifolium* Holly	6.0	1	24	N E S W 2.5 2.5 3.0 2.5	3.0	3.0	Mature	Good	Base / stems obscured - Vegetation. Ivy or climbing plant. Part flailed with hedge.	26.1	2.9	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H725	50 40 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ilex aquifolium* Holly	2.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Hedgerow - Maintained.	2.2	0.8	40+	B	2
T726	1	*Quercus robur* English Oak	17.0	1	84	N E S W 10.0 5.0 9.0 8.0	3.0	6.0	Mature	Good	Base / stems obscured - Vegetation. Deadwood - Major. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Woodpecker holes.	319.2	10.1	40+	B	2 3
T727	1	*Quercus robur* English Oak	17.0	1	89	N E S W 8.0 6.0 10.0 9.0	4.0	5.0	Mature	Good	Base / stems obscured - Vegetation. Deadwood - Major. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	358.3	10.7	40+	B	2 3
T728	1	*Quercus robur* English Oak	17.0	1	85	N E S W 10.0 7.0 9.0 10.0	2.0	5.0	Mature	Good	Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Major. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	326.9	10.2	40+	B	2 3
T729	1	*Quercus robur* English Oak	17.0	1	86	N E S W 5.0 7.0 7.0 7.0	2.0	6.0	Mature	Fair	Base / stems obscured - Vegetation. Bark wound - Minor. Deadwood - Major. Decay / structural defect - Base. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	334.6	10.3	40+	B	2 3
T730	1	*Quercus robur* English Oak	17.0	1	72	N E S W 6.0 6.0 7.0 6.0	3.0	5.0	Mature	Fair	Base / stems obscured - Vegetation. Deadwood - Major. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	234.5	8.6	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T731	1	*Quercus robur* English Oak	18.0	1	87	N E S W 6.0 7.0 7.0 7.0	3.0	5.0	Mature	Good	Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Major. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	342.4	10.4	40+	B	2 3
H732	200 50 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ilex aquifolium* Holly	2.5	1	6	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Hedgerow - Maintained. Ivy or climbing plant. Bramble throughout.	1.6	0.7	40+	B	2 3
G733	120 6	*Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak	17.0	1	90	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Root environment - Waterlogged.	366.4	10.8	40+	B	2 3
H734	75 50 50 15	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm	7.0	1	15	N E S W 2.5 2.5 2.5 2.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Root environment - Waterlogged.	10.2	1.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G735	15 15 6	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak	16.0	1	31	N E S W 5.0 5.0 5.0 5.0	3.0	0.0	Early Mature	Good	Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Flailed South side to 4m.	43.5	3.7	40+	B	2
G736	5	*Quercus robur* English Oak	18.0	1	60	N E S W 7.0 7.0 7.0 7.0	1.0	0.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. North of ditch.	162.9	7.2	40+	B	2 3
T737	1	*Quercus robur* English Oak	17.0	1	94	N E S W 7.0 9.0 8.0 8.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Lesion or fracture on stem / bole - Major.	399.7	11.3	40+	B	2 3
G738	150 100 100 15	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ilex aquifolium* Holly	9.0	1	15	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Mature	Good	Base / stems obscured - Vegetation. Hedgerow - Neglected / overgrown. Ivy or climbing plant. South side flailed.	10.2	1.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T739	1	*Fraxinus excelsior* Ash	15.0	3	45	N 7.0 E 7.0 S 7.0 W 6.0	4.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Multi-stemmed.	94.2	5.5	20-40	B	2 3
T740	1	*Fraxinus excelsior* Ash	15.0	3	45	N 6.0 E 6.0 S 4.0 W 6.0	2.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant.	92.1	5.4	40+	B	2 3
T741	1	*Quercus robur* English Oak	15.0	1	48	N 7.0 E 6.0 S 6.0 W 8.0	2.0	0.5	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Crown. Fused stem with adjacent smaller tree. Low branches flailed to stubs.	104.2	5.8	40+	B	2 3
T742	1	*Quercus robur* English Oak	16.0	1	97	N 9.0 E 10.0 S 8.0 W 9.0	2.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Epicormic growth - Bole / principal stems. South of ditch. Twin stem from 2m.	425.7	11.6	40+	B	2 3
T743	1	*Fraxinus excelsior* Ash	15.0	2	65	N 6.0 E 5.0 S 6.0 W 8.0	3.0	3.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Minor. Deadwood - Major. Ivy or climbing plant. South of ditch.	192.9	7.8	10-20	C	1 2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G744	80 80 45 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Quercus robur* English Oak	14.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Hedgerow - Neglected / overgrown. Ivy or climbing plant. East of ditch. Sides flailed.	40.7	3.6	40+	B	2 3
T745	1	*Quercus robur* English Oak	20.0	1	127	N 9.0 E 9.0 S 9.0 W 9.0	4.0	5.0	Mature	Good	Deadwood - Major. Decay / structural defect - Base. Decay / structural defect - Localised. Epicormic growth - Crown.	706.9	15.0	40+	A	1 2
T746	1	*Ilex aquifolium* Holly	6.0	4	22	N 2.0 E 2.0 S 3.0 W 3.0	0.0	0.5	Mature	Good	Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Field side flailed.	21.9	2.6	40+	B	2 3
G747	2 1	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May	5.0	25	15	N 2.5 E 2.5 S 2.5 W 2.5	0.5	0.0	Mature	Good	Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Hedgerow - Neglected / overgrown.	10.2	1.8	20-40	C	2 3
G748	40 15 1	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak	7.0	1	8	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Hedgerow - Neglected / overgrown. Ivy or climbing plant. East of ditch.	2.9	1.0	20-40	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G749	20 6 2 1	*Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak *Ilex aquifolium* Holly *Fraxinus excelsior* Ash	15.0	1	50	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Root environment - Restricted. Pond to the northwest.	113.1	6.0	40+	B	2 3
T750	1	*Fraxinus excelsior* Ash	14.0	3	42	N E S W 3.0 6.0 4.0 5.0	3.0	3.0	Early Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Multi-stemmed. Cankers and burrs. North of ditch.	80.6	5.1	20-40	C	1 2
T751	1	*Quercus robur* English Oak	8.0	1	18	N E S W 2.0 4.0 6.0 4.0	3.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Leaning trunk - Major. Root plate movement - Historic (suspected stablised). North of ditch.	14.7	2.2	10-20	C	2
T752	1	*Quercus robur* English Oak	10.0	1	42	N E S W 5.0 5.0 5.0 5.0	4.0	3.0	Semi Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Ivy or climbing plant. North of ditch. Pruning stub to south.	79.8	5.0	40+	B	1 2
T753	1	*Quercus robur* English Oak	7.0	1	36	N E S W 2.0 4.0 3.0 2.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Ivy or climbing plant. Poor past pruning. North of ditch.	58.6	4.3	40+	C	1 2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T754	1	*Quercus robur* English Oak	11.0	1	66	N E S W 3.0 6.0 6.0 6.0	2.5	3.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Ivy or climbing plant. Storm damage. North of ditch.	197.1	7.9	40+	B	2 3
T755	1	*Fraxinus excelsior* Ash	10.0	3	43	N E S W 5.0 7.0 4.0 6.0	2.0	0.5	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant. Weak live growth. North of ditch.	84.8	5.2	10-20	C	1 2
H756	150 150	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	2.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Hedgerow - Maintained. Ivy or climbing plant. North of ditch.	2.2	0.8	40+	B	2 3
T757	1	*Quercus robur* English Oak	11.0	1	27	N E S W 6.0 3.0 5.0 6.0	3.0	2.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Ivy or climbing plant. North of ditch.	33.0	3.2	40+	C	1 2
G758	50	*Chamaecyparis lawsoniana* Lawson Cypress	18.0	1	30	N E S W 5.0 5.0 5.0 5.0	2.0	2.0	Mature	Fair	Die-back - Throughout crown. Deadwood - Minor. South of ditch. Height reduced below power line to east.	40.7	3.6	10-20	C	2
T759	1	*Ulmus procera* English Elm	11.0	1	30	N E S W 9.0 3.0 0.0 4.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Leaning trunk - Major. Flailed branches. South of ditch.	40.7	3.6	10-20	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T760	1	*Ulmus procera* English Elm	11.0	1	50	N E S W 9.0 6.0 0.0 4.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Not possible. Leaning trunk - Major. Flailed branches. South of ditch.	113.1	6.0	10-20	C	2
T761	1	*Quercus robur* English Oak	15.0	1	165	N E S W 6.0 9.0 8.0 10.0	4.0	3.0	Ancient or Veteran	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Buttresses / buttress roots - Major adaptive growth / strong development. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Base. Ivy or climbing plant. Pollard - Lapsed / Mature stems. Root environment - Waterlogged. Water pocket.	706.9	15.0	40+	A	3
G762	3 2 1 1	*Ulmus procera* English Elm *Salix alba* White Willow *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	15.0	1	37	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Dead tree / trees. Deadwood - Minor. Fallen tree / trees - Partial collapse. Ivy or climbing plant. North of ditch.	61.9	4.4	40+	C	2 3
T763	1	*Fraxinus excelsior* Ash	19.0	1	72	N E S W 10.0 10.0 10.0 10.0	5.0	4.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Major. Ivy or climbing plant. South of ditch.	234.5	8.6	20-40	B	1 2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G764	4 4	*Fraxinus excelsior* Ash *Ulmus procera* English Elm	8.0	1	24	N E S W 3.5 3.5 3.5 3.5	2.0	2.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Competition - Adjacent trees. Hedgerow - Neglected / overgrown. Ivy or climbing plant. North of ditch.	26.1	2.9	20-40	C	2
H765	75 75 75	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	3.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	2.2	0.8	40+	C	2
T766	1	*Quercus robur* English Oak	14.0	1	34	N E S W 5.0 7.0 4.0 0.0	3.0	4.0	Semi Mature	Good	Access to inspect base - Not possible. Leaning trunk - Minor.	52.3	4.1	40+	C	1 2
T767	1	*Acer pseudoplatanus* Sycamore	16.0	5	78	N E S W 7.0 6.0 7.0 9.0	3.0	0.0	Mature	Good	Access to inspect base - Not possible. Deadwood - Minor. Epicormic growth - Base. Multi-stemmed.	277.1	9.4	20-40	B	2
G768	3	*Chamaecyparis lawsoniana* Lawson Cypress	13.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible.	40.7	3.6	20-40	C	2
T769	1	*Tilia sp.* Lime sp.	18.0	1	50	N E S W 5.0 5.0 5.0 6.0	0.0	3.0	Mature	Fair	Access to inspect base - Not possible. Epicormic growth - Base / bole / principal stems. A second similar tree is 1m to northwest.	113.1	6.0	40+	B	1 2
H770	120	*Fagus sylvatica* Common Beech	2.5	1	5	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Not possible. Hedgerow - Maintained.	1.1	0.6	40+	C	1 2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G771	8	*Aesculus hippocastanum* Horse Chestnut	14.0	1	63	N 6.0 E 6.0 S 6.0 W 6.0	1.0	2.0	Mature	Fair	Access to inspect base - Not possible.	179.6	7.6	20-40	C	2
T772	1	*Quercus robur* English Oak	17.0	1	109	N 8.0 E 10.0 S 8.0 W 8.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Base. Hollow trunk - Open cavity. Holding on to leaves longer than others nearby. Flailed branch stubs. South of ditch.	537.5	13.1	40+	B	2
T773	1	*Quercus robur* English Oak	18.0	1	94	N 7.0 E 9.0 S 7.0 W 8.0	2.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Bark wound - Major. Deadwood - Major. Flailed branch stubs. South of ditch.	399.7	11.3	20-40	B	2
T774	1	*Quercus robur* English Oak	11.0	1	63	N 3.0 E 2.0 S 1.0 W 5.0	4.0	3.0	Mature	Poor	Access to inspect base - Restricted / obscured. Die-back - Throughout crown. Deadwood - Major. Decay / structural defect - Open cavity / cavities. South of ditch.	179.6	7.6	10-20	C	1 3
T775	1	*Quercus robur* English Oak	13.0	1	63	N 4.0 E 5.0 S 5.0 W 3.0	4.0	4.0	Mature	Poor	Access to inspect base - Restricted / obscured. Deadwood - Minor. Flailed branch stubs. South of ditch.	179.6	7.6	40+	C	1 2 3
T776	1	*Quercus robur* English Oak	14.0	1	74	N 6.0 E 5.0 S 7.0 W 6.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Ivy or climbing plant. Storm damage. Flailed branch stubs. South of ditch.	247.7	8.9	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G777	90 20 20 20 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak	12.0	1	30	N 4.5 E 4.5 S 4.5 W 4.5	0.0	0.0	Mature	Fair	Hedgerow - Neglected / overgrown. Ivy or climbing plant. South of ditch. Flailed branch stubs.	40.7	3.6	40+	B	2
T778	1	*Quercus robur* English Oak	15.0	1	67	N 7.0 E 8.0 S 7.0 W 6.0	2.0	3.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. West of ditch.	203.1	8.0	40+	B	2
T779	1	*Quercus robur* English Oak	12.0	1	64	N 7.0 E 7.0 S 8.0 W 8.0	4.0	2.0	Mature	Fair	Access to inspect base - Not possible. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant. West of ditch.	185.3	7.7	40+	B	2
T780	1	*Quercus robur* English Oak	17.0	1	66	N 8.0 E 5.0 S 8.0 W 6.0	5.0	4.0	Mature	Fair	Access to inspect base - Not possible. Die-back - Upper crown. Deadwood - Major. Ivy or climbing plant. West of ditch.	197.1	7.9	40+	B	2 3
T781	1	*Quercus robur* English Oak	14.0	1	59	N 6.0 E 6.0 S 7.0 W 6.0	5.0	2.5	Mature	Good	Access to inspect base - Not possible. Deadwood - Major. Ivy or climbing plant. West of ditch.	157.5	7.1	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G782	150 150 60 50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Salix caprea* Goat Willow/Great Sallow *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Populus sp.* Poplar sp.	10.0	1	28	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Fallen tree / trees - Whole tree. Hedgerow - Neglected / overgrown. Ivy or climbing plant. East of ditch.	35.5	3.4	40+	B	2 3
H783	10 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	2.0	1	6	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Hedgerow - Maintained. Adjoining hedge removed.	1.6	0.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W784	45 45 5 3 2	*Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak	18.0	1	40	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Mature	Good	Access to inspect base - Not possible.	72.4	4.8	40+	A	2 3
T785	1	*Quercus robur* English Oak	15.0	1	69	N 6.0 E 6.0 S 6.0 W 6.0	3.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Ivy or climbing plant. North of ditch.	215.4	8.3	40+	B	2 3
T786	1	*Quercus robur* English Oak	14.0	1	41	N 5.0 E 5.0 S 6.0 W 5.0	3.0	2.0	Early Mature	Good	Access to inspect base - Not possible. Ivy or climbing plant. Flailed branch stubs. North of ditch.	76.0	4.9	40+	C	2
T787	1	*Quercus robur* English Oak	11.0	1	98	N 4.0 E 5.0 S 6.0 W 7.0	3.0	4.0	Mature	Fair	Access to inspect base - Not possible. Die-back - Upper crown. Ivy or climbing plant. Stag-headed crown. North of ditch.	434.5	11.8	40+	B	2 3
T788	1	*Fraxinus excelsior* Ash	12.0	1	34	N 4.0 E 5.0 S 4.0 W 4.0	3.0	3.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Epicormic growth - Crown. Fork - Weak with included bark. Ivy or climbing plant. North of ditch.	52.3	4.1	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T789	1	*Quercus robur* English Oak	14.0	1	61	N E S W 5.0 5.0 6.0 6.0	3.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Ivy or climbing plant. Stag-headed crown. North of ditch.	168.3	7.3	40+	B	2 3
T790	1	*Quercus robur* English Oak	15.0	1	86	N E S W 7.0 7.0 7.0 7.0	2.0	3.0	Mature	Fair	Access to inspect base - Not possible. Deadwood - Major. Ivy or climbing plant. North of ditch.	334.6	10.3	40+	B	2 3
T791	1	*Quercus robur* English Oak	14.0	1	134	N E S W 6.0 7.0 7.0 7.0	3.0	2.0	Mature	Fair	Access to inspect base - Restricted / obscured. Deadwood - Major. Hollow trunk - Open cavity. Ivy or climbing plant. Pollard - Lapsed / Mature stems. Stag-headed crown. North of ditch.	706.9	15.0	40+	B	2 3
H792	300 100 100 50 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Quercus robur* English Oak	7.0	1	18	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Hedgerow - Neglected / overgrown. Ivy or climbing plant. North of ditch.	14.7	2.2	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G793	6 1	*Salix caprea* Goat Willow/Great Sallow *Crataegus monogyna* Common Hawthorn/Quick/May	7.0	1	19	N E S W 2.0 2.0 2.0 2.0	1.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Ivy or climbing plant. Multi-stemmed. Part of hedgerow, cleared to west for new ditch.	16.3	2.3	20-40	C	1 2 3
T794	1	*Quercus robur* English Oak	13.0	1	56	N E S W 7.0 4.0 7.0 7.0	3.0	3.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Major. Root environment - Waterlogged. Stag-headed crown.	141.9	6.7	40+	B	2
T795	1	*Quercus robur* English Oak	15.0	1	56	N E S W 7.0 8.0 8.0 5.0	5.0	5.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Leaning trunk - Minor. Root environment - Waterlogged.	141.9	6.7	40+	B	2
G796	40	*Acer campestre* Field Maple	6.0	1	7	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown. Natural regeneration.	2.2	0.8	40+	B	2 3
G797	50 50 20	*Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm *Acer campestre* Field Maple	8.0	1	9	N E S W 2.5 2.5 2.5 2.5	0.0	0.0	Semi Mature	Poor	Access to inspect base - Restricted / obscured. Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown. Ivy or climbing plant. North of ditch.	3.7	1.1	10-20	C	2 3
H798	150 75	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	3.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Hedgerow - Maintained. Natural regeneration. North of ditch.	2.2	0.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G799	40 40	*Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe	10.0	1	10	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown. North of ditch.	4.5	1.2	40+	B	2 3
H800	40 10 1	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash	2.5	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. North of ditch. Ash has extensive dieback.	2.2	0.8	40+	B	2 3
T801	1	*Fraxinus excelsior* Ash	9.0	10	28	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. North of ditch.	36.6	3.4	40+	C	1 2 3
T802	1	*Quercus robur* English Oak	14.0	1	59	N E S W 7.0 6.0 6.0 7.0	1.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. North of ditch. Flailed branch stubs.	157.5	7.1	40+	B	2 3
H803	60 25 10	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash	8.0	1	10	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Deadwood - Minor. Hedgerow - Maintained. North of ditch.	4.5	1.2	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T804	1	*Quercus robur* English Oak	17.0	1	88	N E S W 6.0 7.0 8.0 7.0	2.0	5.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Ivy or climbing plant. Storm damage.	350.3	10.6	40+	B	2 3
T805	1	*Fraxinus excelsior* Ash	2.0	1	90	N E S W 0.0 0.0 0.0 0.0	0.0	0.0	Mature	Dead	Fallen tree / trees - Whole tree.			0-10	U	
T806	1	*Quercus robur* English Oak	16.0	1	96	N E S W 5.0 8.0 6.0 4.0	4.0	3.5	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Buttresses / buttress roots - Minor adaptive growth / moderate development. Deadwood - Major. Epicormic growth - Bole / principal stems. Ivy or climbing plant. North of ditch.	416.9	11.5	40+	B	2 3
T807	1	*Fraxinus excelsior* Ash	15.0	1	43	N E S W 4.0 6.0 6.0 5.0	2.0	3.5	Early Mature	Fair	Access to inspect base - Restricted / obscured. Leaning trunk - Minor. Weak live growth. North of ditch.	83.6	5.2	40+	C	1 2 3
H808	60 20	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	3.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. North of ditch.	2.2	0.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H809	120 80 80 20	*Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Fraxinus excelsior* Ash	3.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. North of ditch.	2.2	0.8	40+	B	2 3
T810	1	*Quercus robur* English Oak	7.0	1	12	N 3.0 E 3.0 S 3.0 W 3.0	3.5	3.0	Young	Good	No significant faults observed.	6.5	1.4	40+	C	2
T811	1	*Quercus robur* English Oak	9.0	1	37	N 4.5 E 4.5 S 4.5 W 4.5	3.0	3.0	Semi Mature	Good	No significant faults observed.	61.9	4.4	40+	B	1 2
T812	1	*Quercus robur* English Oak	5.0	1	8	N 2.0 E 3.0 S 1.0 W 2.0	2.0	2.0	Young	Good	Bark wound - Mechanical. Epicormic growth - Bole / principal stems.	2.9	1.0	40+	C	1 2
T813	1	*Quercus robur* English Oak	12.0	1	35	N 6.0 E 7.0 S 5.0 W 5.0	3.0	2.5	Semi Mature	Good	Deadwood - Minor. Ivy or climbing plant.	55.4	4.2	40+	B	2
T814	1	*Quercus robur* English Oak	15.0	1	68	N 7.0 E 7.0 S 7.0 W 7.0	3.0	2.0	Early Mature	Good	Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Root environment - Restricted. Weak live growth. On mound with hedge planting.	209.2	8.2	40+	B	2 3
T815	1	*Fraxinus excelsior* Ash	15.0	1	38	N 6.0 E 3.0 S 4.0 W 4.0	6.0	4.0	Mature	Poor	Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Major. Ivy or climbing plant.			10-20	U	

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T816	1	*Quercus robur* English Oak	6.0	1	11	N 3.0 E 3.0 S 3.0 W 3.0	3.0	2.0	Young	Good	No significant faults observed.	5.5	1.3	40+	C	1 2
T817	1	*Quercus robur* English Oak	6.0	1	13	N 3.0 E 3.0 S 3.0 W 3.0	3.0	2.0	Young	Good	No significant faults observed.	7.6	1.6	40+	C	1 2
T818	1	*Quercus robur* English Oak	6.0	1	19	N 4.0 E 4.0 S 4.0 W 4.0	3.0	2.0	Young	Good	No significant faults observed.	16.3	2.3	40+	C	1 2
T819	1	*Quercus robur* English Oak	6.0	1	19	N 4.0 E 4.0 S 4.0 W 4.0	3.0	2.0	Young	Good	No significant faults observed.	16.3	2.3	40+	C	1 2
H820	200 200 30	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash	3.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. South of ditch.	2.2	0.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W821	1 1 1 1 1 1 1 1	*Quercus robur* English Oak *Prunus spinosa* Blackthorn/Sloe *Pinus sylvestris* Scots Pine *Ilex aquifolium* Holly *Fraxinus excelsior* Ash *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer campestre* Field Maple	17.0	1	40	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Ivy or climbing plant.	72.4	4.8	40+	B	2 3
T822	1	*Quercus robur* English Oak	15.0	1	105	N 6.0 E 6.0 S 6.0 W 6.0	3.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Decay / structural defect - Base. Ivy or climbing plant. South of ditch.	498.8	12.6	40+	B	2 3
T823	1	*Quercus robur* English Oak	7.0	1	79	N 1.0 E 4.0 S 2.0 W 1.0	4.0	3.0	Mature	Poor	Access to inspect base - Restricted / obscured. Bark wound - Minor. Deadwood - Major. Epicormic growth - Bole / principal stems. Stag-headed crown. Storm damage. South of ditch.	282.3	9.5	40+	B	3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T824	1	*Quercus robur* English Oak	17.0	1	97	N 6.0 E 6.0 S 6.0 W 8.0	4.0	6.0	Mature	Fair	Die-back - Upper crown. Deadwood - Major. Decay / structural defect - Base.	425.7	11.6	20-40	B	3
T825	1	*Quercus robur* English Oak	15.0	1	43	N 6.0 E 4.0 S 7.0 W 6.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. South of ditch.	83.6	5.2	40+	B	2 3
T826	1	*Quercus robur* English Oak	11.0	1	54	N 6.0 E 6.0 S 6.0 W 6.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Epicormic growth - Bole / principal stems. Ivy or climbing plant. South of ditch.	131.9	6.5	40+	B	2 3
T827	1	*Quercus robur* English Oak	15.0	1	39	N 6.0 E 6.0 S 6.0 W 6.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Bark wound - Minor. Deadwood - Minor. South of ditch.	68.8	4.7	40+	B	2 3
T828	1	*Quercus robur* English Oak	16.0	1	54	N 7.0 E 7.0 S 7.0 W 6.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Branch - Broken. Deadwood - Minor. South of ditch.	131.9	6.5	40+	B	2 3
T829	1	*Quercus robur* English Oak	15.0	1	53	N 7.0 E 5.0 S 7.0 W 7.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Bark wound - Minor. Deadwood - Minor. Epicormic growth - Bole / principal stems. South of ditch.	127.1	6.4	40+	B	2 3
T830	1	*Quercus robur* English Oak	15.0	1	64	N 7.0 E 7.0 S 7.0 W 7.0	5.0	3.5	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. South of ditch, recent ditch crossing built to the west.	185.3	7.7	40+	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H831	150 100 50 20 5	*Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Quercus robur* English Oak	2.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Hedgerow - Maintained. South of ditch.	2.2	0.8	40+	B	2 3
H832	60 50 10	*Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel	2.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Hedgerow - Maintained. South of ditch.	2.2	0.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G833	150 150 80 50 15	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Quercus robur* English Oak *Fraxinus excelsior* Ash *Ilex aquifolium* Holly	15.0	1	40	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Hedgerow - Neglected / overgrown. Ivy or climbing plant. West of ditch.	72.4	4.8	40+	B	2 3
T834	1	*Quercus robur* English Oak	18.0	1	97	N 8.0 E 8.0 S 8.0 W 8.0	5.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Bark wound - Major. Deadwood - Minor. Ivy or climbing plant. West of ditch.	425.7	11.6	40+	B	2
T835	1	*Quercus robur* English Oak	18.0	1	103	N 8.0 E 8.0 S 8.0 W 8.0	5.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Bark wound - Major. Deadwood - Minor. Ivy or climbing plant. West of ditch.	479.9	12.4	40+	B	2
T836	1	*Quercus robur* English Oak	18.0	1	91	N 8.0 E 8.0 S 9.0 W 6.0	5.0	6.0	Mature	Good	Access to inspect base - Restricted / obscured. Bark wound - Major. Deadwood - Minor. Ivy or climbing plant. Storm damage. West of ditch.	374.6	10.9	40+	B	2
T837	1	*Quercus robur* English Oak	18.0	1	86	N 8.0 E 8.0 S 7.0 W 7.0	5.0	6.0	Mature	Good	Access to inspect base - Restricted / obscured. Bark wound - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. West of ditch.	334.6	10.3	40+	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T838	1	*Quercus robur* English Oak	15.0	1	87	N E S W 5.0 5.0 5.0 5.0	4.0	5.0	Mature	Poor	Access to inspect base - Restricted / obscured. Decline - Evident / observed. Deadwood - Major. Ivy or climbing plant. West of ditch.	342.4	10.4	40+	C	2
G839	6	*Quercus robur* English Oak	20.0	1	95	N E S W 8.0 8.0 8.0 8.0	5.0	4.0	Mature	Good	Buttresses / buttress roots - Minor adaptive growth / moderate development. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Decay / structural defect - Base. Ivy or climbing plant.	408.3	11.4	40+	A	2 3
W840	1400 700 600 300 2 2 1	*Quercus robur* English Oak *Fraxinus excelsior* Ash *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Pinus sylvestris* Scots Pine *Larix decidua* European Larch/Common Larch *Picea abies* Norway Spruce	19.0	1	38	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Mature	Good	Deadwood - Minor. Ivy or climbing plant.	65.3	4.6	40+	A	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G841	3	*Quercus robur* English Oak	15.0	1	60	N E S W 8.0 8.0 8.0 8.0	5.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems.	162.9	7.2	40+	B	2 3
G842	2	*Quercus robur* English Oak	14.0	1	50	N E S W 8.0 8.0 8.0 8.0	5.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems.	113.1	6.0	40+	B	2 3
T843	1	*Quercus robur* English Oak	17.0	1	75	N E S W 9.0 9.0 9.0 9.0	4.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	254.5	9.0	40+	A	1
T844	1	*Fraxinus excelsior* Ash	13.0	1	40	N E S W 6.0 6.0 6.0 6.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	72.4	4.8	20-40	B	1
T845	1	*Fraxinus excelsior* Ash	13.0	2	53	N E S W 8.0 5.0 8.0 8.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Fork - Weak with included bark. Ivy or climbing plant.	127.8	6.4	20-40	B	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T846	1	*Acer pseudoplatanus* Sycamore	9.0	1	32	N 3.0 E 3.0 S 3.0 W 3.0	3.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	46.3	3.8	20-40	C	1
T847	1	*Acer pseudoplatanus* Sycamore	9.0	1	40	N 4.0 E 4.0 S 4.0 W 4.0	3.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	72.4	4.8	20-40	C	1
T848	1	*Acer pseudoplatanus* Sycamore	8.0	1	28	N 4.0 E 4.0 S 4.0 W 4.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	35.5	3.4	20-40	C	1
T849	1	*Acer pseudoplatanus* Sycamore	11.0	1	42	N 6.0 E 6.0 S 6.0 W 6.0	1.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	79.8	5.0	20-40	C	1
T850	1	*Fraxinus excelsior* Ash	12.0	3	56	N 7.0 E 7.0 S 7.0 W 7.0	1.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	145.9	6.8	20-40	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G851	1 1	*Acer campestre* Field Maple *Fraxinus excelsior* Ash	10.0	5	35	N E S W 4.0 4.0 4.0 4.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	57.9	4.3	20-40	C	2
H852	40	*Prunus spinosa* Blackthorn/Sloe	3.0	1	12	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	6.5	1.4	40+	C	2 3
T853	1	*Quercus robur* English Oak	14.0	1	70	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Stag-headed crown.	221.7	8.4	40+	B	1 3
H854	6	*Prunus spinosa* Blackthorn/Sloe	3.0	1	12	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	6.5	1.4	40+	C	2 3
H855	40 15	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May	9.0	1	12	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown.	6.5	1.4	40+	C	2 3
T856	1	*Fraxinus excelsior* Ash	17.0	2	47	N E S W 7.0 7.0 7.0 7.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Stems - Co-dominant.	100.7	5.7	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T857	1	*Quercus robur* English Oak	16.0	1	60	N 8.0 E 8.0 S 8.0 W 8.0	1.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	162.9	7.2	40+	B	1
T858	1	*Quercus robur* English Oak	13.0	4	36	N 5.0 E 5.0 S 5.0 W 5.0	1.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	58.6	4.3	40+	B	1
G859	30	*Prunus spinosa* Blackthorn/Sloe	4.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown.	18.1	2.4	40+	C	2
T860	1	*Quercus robur* English Oak	17.0	1	60	N 9.0 E 9.0 S 9.0 W 9.0	4.0	6.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	162.9	7.2	40+	B	1
T861	1	*Quercus robur* English Oak	17.0	1	60	N 8.0 E 8.0 S 8.0 W 8.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	162.9	7.2	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G862	4	*Quercus robur* English Oak	15.0	1	65	N E S W 9.0 9.0 9.0 9.0	5.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Branch - Suspended. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	191.1	7.8	40+	B	2 3
T863	1	*Quercus robur* English Oak	14.0	1	80	N E S W 6.0 6.0 6.0 6.0	4.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	289.5	9.6	40+	B	1
T864	1	*Crataegus monogyna* Common Hawthorn/Quick/May	8.0	5	31	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	44.3	3.8	40+	C	1
T865	1	*Salix caprea* Goat Willow/Great Sallow	8.0	5	31	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	44.3	3.8	40+	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H866	60 40 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	4.0	1	12	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	6.5	1.4	40+	C	2
H867	60 40 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	4.0	1	12	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	6.5	1.4	40+	C	2
T868	1	*Quercus robur* English Oak	20.0	1	120	N E S W 11.0 11.0 11.0 11.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Fungal fruiting body - structural decay suspected. Ivy or climbing plant. Ganoderma australe at base.	651.4	14.4	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G869	3	*Quercus robur* English Oak	20.0	3	190	N E S W 11.0 11.0 11.0 11.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	706.9	15.0	40+	A	2 3
H870	200 150 60	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	4.0	1	12	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	6.5	1.4	40+	C	2
G871	20 5 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Prunus spinosa* Blackthorn/Sloe	14.0	1	25	N E S W 5.0 5.0 5.0 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	28.3	3.0	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G872	10 5 5 4 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Quercus robur* English Oak	15.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	72.4	4.8	40+	B	2
G873	10 5 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Salix caprea* Goat Willow/Great Sallow	9.0	1	14	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H874	40 20 15 6	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm	4.0	1	12	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	6.5	1.4	40+	C	2
T875	1	*Quercus robur* English Oak	15.0	1	68	N E S W 8.0 8.0 8.0 8.0	0.0	4.0	Early Mature	Good	Access to inspect base - Not possible. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	209.2	8.2	40+	B	1
H876	20 6 5 3	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ulmus procera* English Elm	6.0	1	12	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Hedgerow - Neglected / overgrown.	6.5	1.4	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W877	20 10 8 6 4 2	*Acer pseudoplatanus* Sycamore *Fraxinus excelsior* Ash *Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder *Acer campestre* Field Maple	22.0	1	60	N E S W 8.0 8.0 8.0 8.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Fallen tree / trees - Whole tree. Ivy or climbing plant.	162.9	7.2	40+	A	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W878	15 10 10 10 5 4 2 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Sambucus nigra* Elder *Acer pseudoplatanus* Sycamore *Acer campestre* Field Maple *Salix fragilis* Crack Willow	22.0	1	60	N 8.0 E 8.0 S 8.0 W 8.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Fallen tree / trees - Whole tree. Ivy or climbing plant.	162.9	7.2	40+	A	2 3
G879	7 2 1 1	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Ulmus procera* English Elm	13.0	1	35	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Branch - Suspended. Deadwood - Minor. Ivy or climbing plant.	55.4	4.2	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G880	7 2 1 1	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm *Quercus robur* English Oak	9.0	1	20	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	18.1	2.4	40+	B	2
T881	1	*Quercus robur* English Oak	16.0	1	48	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	104.2	5.8	40+	B	1
T882	1	*Quercus robur* English Oak	14.0	1	45	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	91.6	5.4	40+	B	1
T883	1	*Quercus robur* English Oak	14.0	1	45	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	91.6	5.4	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T884	1	*Quercus robur* English Oak	14.0	1	40	N E S W 6.0 6.0 6.0 6.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	72.4	4.8	40+	B	1
H885	40 40 5 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Quercus robur* English Oak	4.0	1	12	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	6.5	1.4	40+	C	2
H886	40 40 5 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Quercus robur* English Oak	4.0	1	12	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	6.5	1.4	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G887	25 1	*Salix caprea* Goat Willow/Great Sallow *Quercus robur* English Oak	10.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Ivy or climbing plant. Natural regeneration.	28.3	3.0	40+	C	2
T888	1	*Quercus robur* English Oak	13.0	1	38	N E S W 7.0 7.0 7.0 7.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	65.3	4.6	40+	B	1
H889	14	*Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
T890	1	*Quercus robur* English Oak	12.0	1	55	N E S W 8.0 8.0 8.0 8.0	2.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	136.8	6.6	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T891	1	*Quercus robur* English Oak	15.0	1	64	N 8.0 E 8.0 S 8.0 W 8.0	4.0	6.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	185.3	7.7	40+	B	1
T892	1	*Quercus robur* English Oak	14.0	1	60	N 7.0 E 7.0 S 7.0 W 7.0	2.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Branch - Suspended. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	162.9	7.2	40+	B	1
T893	1	*Quercus robur* English Oak	15.0	1	60	N 9.0 E 9.0 S 9.0 W 9.0	2.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Branch - Suspended. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	162.9	7.2	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T894	1	*Quercus robur* English Oak	14.0	1	38	N E S W 7.0 7.0 7.0 7.0	1.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	65.3	4.6	40+	B	1
H895	50 10 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash	2.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
G896	35 15 5 5 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow	14.0	1	25	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	28.3	3.0	40+	B	2 3
T897	1	*Quercus robur* English Oak	9.0	1	30	N E S W 6.0 6.0 6.0 6.0	2.0	2.5	Early Mature	Good	Arboricultural work - Historic.	40.7	3.6	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T898	1	*Fraxinus excelsior* Ash	9.0	1	35	N 6.0 E 6.0 S 6.0 W 6.0	2.0	2.5	Early Mature	Good	Arboricultural work - Historic.	55.4	4.2	40+	B	1
H899	40 10 2 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm *Fraxinus excelsior* Ash	5.0	1	8	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown.	2.9	1.0	40+	C	2
T900	1	*Fraxinus excelsior* Ash	10.0	1	35	N 6.0 E 6.0 S 6.0 W 6.0	3.0	2.5	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor.	55.4	4.2	40+	B	1
H901	15 10 4 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm	5.0	1	12	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown. Sporadic unmanaged hedgerow.	6.5	1.4	40+	C	2
T902	1	*Quercus robur* English Oak	10.0	1	35	N 6.0 E 6.0 S 6.0 W 6.0	3.0	2.5	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor.	55.4	4.2	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G903	40 30 25 20 5	*Fraxinus excelsior* Ash *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak	22.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Ivy or climbing plant.	72.4	4.8	40+	B	2 3
T904	1	*Fraxinus excelsior* Ash	10.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	3.0	2.5	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor.	40.7	3.6	40+	B	1
T905	1	*Fraxinus excelsior* Ash	10.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	3.0	2.5	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor.	40.7	3.6	40+	B	1
T906	1	*Fraxinus excelsior* Ash	10.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	3.0	2.5	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor.	40.7	3.6	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H907	35 20 10 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm	4.0	1	12	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. Sporadic unmanaged hedgerow.	6.5	1.4	40+	C	2
G908	3 1	*Acer campestre* Field Maple *Salix caprea* Goat Willow/Great Sallow	10.0	1	20	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	18.1	2.4	40+	C	2
H909	2	*Crataegus monogyna* Common Hawthorn/Quick/May	6.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	11.6	1.9	40+	C	2
T910	1	*Fraxinus excelsior* Ash	11.0	1	40	N 5.0 E 5.0 S 5.0 W 5.0	3.0	2.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor.	72.4	4.8	40+	B	1
T911	1	*Fraxinus excelsior* Ash	11.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	3.0	2.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor.	72.4	4.8	40+	B	1
T912	1	*Fraxinus excelsior* Ash	8.0	1	28	N 2.0 E 2.0 S 2.0 W 2.0	3.0	2.0	Early Mature	Fair	Arboricultural work - Historic. Deadwood - Minor.	35.5	3.4	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T913	1	*Fraxinus excelsior* Ash	9.0	1	36	N 5.0 E 5.0 S 5.0 W 5.0	3.0	2.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor.	58.6	4.3	40+	B	1
T914	1	*Fraxinus excelsior* Ash	10.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	3.0	2.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor.	40.7	3.6	40+	B	1
H915	30	*Prunus spinosa* Blackthorn/Sloe	4.0	1	8	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown.	2.9	1.0	40+	C	2
G916	3	*Acer campestre* Field Maple	13.0	1	35	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	55.4	4.2	40+	B	2
T917	1	*Crataegus monogyna* Common Hawthorn/Quick/May	8.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	1.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	40.7	3.6	40+	B	1
H918	20	*Prunus spinosa* Blackthorn/Sloe	2.0	1	8	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
T919	1	*Quercus robur* English Oak	10.0	1	42	N 3.5 E 3.5 S 3.5 W 3.5	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	79.8	5.0	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T920	1	*Fraxinus excelsior* Ash	18.0	5	67	N E S W 9.0 9.0 9.0 9.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Competition - Adjacent vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	203.6	8.0	20-40	B	1
T921	1	*Quercus robur* English Oak	10.0	1	40	N E S W 5.0 5.0 5.0 5.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	72.4	4.8	40+	B	1
T922	1	*Quercus robur* English Oak	11.0	1	40	N E S W 5.0 5.0 5.0 5.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	72.4	4.8	40+	B	1
H923	40 20 15	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	4.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H924	40 10 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	4.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2
T925	1	*Fraxinus excelsior* Ash	15.0	1	36	N E S W 4.0 4.0 4.0 4.0	5.0	5.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Crown.	58.6	4.3	20-40	C	1 3
T926	1	*Acer campestre* Field Maple	9.0	1	20	N E S W 3.0 3.0 3.0 3.0	2.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	18.1	2.4	40+	C	1
T927	1	*Acer campestre* Field Maple	9.0	1	20	N E S W 2.0 2.0 2.0 2.0	2.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	18.1	2.4	40+	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T928	1	*Acer campestre* Field Maple	9.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	2.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	18.1	2.4	40+	C	1
T929	1	*Acer campestre* Field Maple	9.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	2.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	18.1	2.4	40+	C	1
T930	1	*Ilex aquifolium* Holly	8.0	4	36	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Multi-stemmed.	58.6	4.3	40+	C	1
T931	1	*Acer campestre* Field Maple	9.0	1	55	N 3.0 E 3.0 S 3.0 W 3.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Epicormic growth - Base / bole / principal stems.	136.8	6.6	40+	B	1
T932	1	*Acer campestre* Field Maple	8.0	2	25	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Multi-stemmed.	29.3	3.1	40+	C	1
T933	1	*Acer campestre* Field Maple	8.0	1	22	N 3.0 E 3.0 S 3.0 W 3.0	3.0	2.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	21.9	2.6	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T934	1	*Acer campestre* Field Maple	9.0	1	25	N E S W 4.0 4.0 4.0 4.0	3.0	2.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	28.3	3.0	40+	C	1
T935	1	*Acer campestre* Field Maple	9.0	1	25	N E S W 3.0 3.0 3.0 3.0	3.0	2.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	28.3	3.0	40+	C	1
T936	1	*Acer campestre* Field Maple	9.0	2	28	N E S W 4.0 4.0 4.0 4.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	36.2	3.4	40+	C	1
T937	1	*Acer campestre* Field Maple	9.0	1	20	N E S W 3.0 3.0 3.0 3.0	3.0	2.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	18.1	2.4	40+	C	1
T938	1	*Acer campestre* Field Maple	9.0	1	30	N E S W 5.0 5.0 5.0 5.0	3.0	2.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	40.7	3.6	40+	C	1
G939	6 3 1	*Acer campestre* Field Maple *Fraxinus excelsior* Ash *Ulmus procera* English Elm	15.0	1	30	N E S W 6.0 6.0 6.0 6.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	40.7	3.6	20-40	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T940	1	*Fraxinus excelsior* Ash	15.0	1	40	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems.	72.4	4.8	20-40	B	1
G941	7 3 3	*Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	10.0	1	16	N E S W 3.0 3.0 3.0 3.0	2.0	1.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Sporadic group of outgrown hedgerow trees.	11.6	1.9	40+	C	2
T942	1	*Fraxinus excelsior* Ash	9.0	2	28	N E S W 3.0 3.0 3.0 3.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	36.2	3.4	40+	C	1
T943	1	*Fraxinus excelsior* Ash	13.0	2	42	N E S W 4.0 4.0 4.0 4.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	81.4	5.1	40+	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H944	100 40 40 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm	4.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
G945	12 6 3 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Ulmus procera* English Elm *Salix caprea* Goat Willow/Great Sallow	11.0	1	25	N E S W 5.0 5.0 5.0 5.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	28.3	3.0	40+	C	2
T946	1	*Fraxinus excelsior* Ash	13.0	2	25	N E S W 4.0 4.0 4.0 4.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	29.3	3.1	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T947	1	*Fraxinus excelsior* Ash	10.0	4	36	N 5.0 E 5.0 S 5.0 W 5.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Multi-stemmed.	58.6	4.3	40+	C	1
T948	1	*Acer campestre* Field Maple	8.0	2	25	N 3.0 E 3.0 S 3.0 W 3.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	29.3	3.1	40+	C	1
T949	1	*Fraxinus excelsior* Ash	10.0	1	25	N 4.0 E 4.0 S 4.0 W 4.0	4.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	28.3	3.0	40+	C	1
T950	1	*Fraxinus excelsior* Ash	8.0	1	18	N 2.0 E 2.0 S 2.0 W 2.0	4.0	1.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	14.7	2.2	40+	C	1
T951	1	*Fraxinus excelsior* Ash	11.0	3	31	N 4.0 E 4.0 S 4.0 W 4.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	44.0	3.7	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T952	1	*Fraxinus excelsior* Ash	10.0	4	24	N E S W 3.0 3.0 3.0 3.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	26.1	2.9	40+	C	1
T953	1	*Fraxinus excelsior* Ash	10.0	2	48	N E S W 5.0 5.0 5.0 5.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	106.0	5.8	40+	B	1
G954	1 1 1	*Carpinus betulus* Hornbeam *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow	10.0	1	35	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Base / bole / principal stems. Poor past pruning.	55.4	4.2	40+	C	2
T955	1	*Fraxinus excelsior* Ash	12.0	2	34	N E S W 4.0 4.0 4.0 4.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	55.4	4.2	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W956	65 60 50 50 40 35	*Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Prunus spinosa* Blackthorn/Sloe	20.0	1	45	N 7.0 E 7.0 S 7.0 W 7.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Whole tree.	91.6	5.4	40+	B	2 3
T957	1	*Acer campestre* Field Maple	9.0	1	20	N 4.0 E 4.0 S 4.0 W 4.0	2.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	18.1	2.4	40+	C	1
T958	1	*Acer campestre* Field Maple	8.0	1	20	N 3.0 E 3.0 S 3.0 W 3.0	1.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	18.1	2.4	40+	C	1
T959	1	*Fraxinus excelsior* Ash	13.0	2	28	N 5.0 E 5.0 S 5.0 W 5.0	4.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Poor past pruning.	36.2	3.4	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T960	1	*Quercus robur* English Oak	14.0	2	155	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Poor past pruning.	706.9	15.0	40+	A	1
T961	1	*Acer campestre* Field Maple	8.0	1	20	N E S W 2.0 2.0 2.0 2.0	2.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	18.1	2.4	40+	C	1
T962	1	*Fraxinus excelsior* Ash	15.0	1	38	N E S W 6.0 6.0 6.0 6.0	5.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	65.3	4.6	20-40	B	1
T963	1	*Quercus robur* English Oak	8.0	1	20	N E S W 2.0 2.0 2.0 2.0	2.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	18.1	2.4	40+	C	1
T964	1	*Acer campestre* Field Maple	8.0	2	22	N E S W 3.0 3.0 3.0 3.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Base / bole / principal stems.	23.2	2.7	40+	C	1
T965	1	*Fraxinus excelsior* Ash	15.0	1	35	N E S W 6.0 6.0 6.0 6.0	5.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	55.4	4.2	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T966	1	*Fraxinus excelsior* Ash	15.0	1	42	N 7.0 E 7.0 S 7.0 W 7.0	5.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	79.8	5.0	20-40	B	1
T967	1	*Fraxinus excelsior* Ash	13.0	1	40	N 5.0 E 5.0 S 5.0 W 5.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Crown.	72.4	4.8	20-40	C	1 3
T968	1	*Fraxinus excelsior* Ash	10.0	1	38	N 4.0 E 4.0 S 4.0 W 4.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Crown.	65.3	4.6	20-40	C	1 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T969	1	*Fraxinus excelsior* Ash	9.0	3	34	N E S W 4.0 4.0 4.0 4.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decay / structural defect in crown limb / limbs - Major. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Crown.	54.3	4.2	20-40	C	1 3
H970	70 30 30 25	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	4.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H971	60 60 30 25 15	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash	12.0	1	24	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Unmanaged hedge with sporadic outgrown trees.	26.1	2.9	40+	C	2
T972	1	*Quercus robur* English Oak	10.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	4.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Bark wound - Mechanical.	40.7	3.6	40+	B	1
T973	1	*Acer campestre* Field Maple	9.0	2	22	N 2.0 E 2.0 S 2.0 W 2.0	1.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Base / bole / principal stems. Poor past pruning.	23.2	2.7	40+	C	1
T974	1	*Acer campestre* Field Maple	9.0	1	22	N 4.0 E 4.0 S 4.0 W 4.0	1.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Base / bole / principal stems. Poor past pruning.	21.9	2.6	40+	C	1
T975	1	*Quercus robur* English Oak	12.0	1	34	N 5.0 E 5.0 S 5.0 W 5.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Bark wound - Mechanical. Poor past pruning.	52.3	4.1	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T976	1	*Acer campestre* Field Maple	9.0	1	18	N 2.0 E 2.0 S 2.0 W 2.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Base / bole / principal stems. Poor past pruning.	14.7	2.2	40+	C	1
T977	1	*Acer campestre* Field Maple	9.0	1	32	N 3.0 E 3.0 S 3.0 W 5.0	1.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	46.3	3.8	40+	B	1
T978	1	*Ilex aquifolium* Holly	8.0	1	32	N 3.0 E 3.0 S 3.0 W 3.0	1.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	46.3	3.8	40+	C	1
T979	1	*Ilex aquifolium* Holly	13.0	1	45	N 8.0 E 8.0 S 8.0 W 8.0	4.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	91.6	5.4	40+	B	1
T980	1	*Acer campestre* Field Maple	9.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	3.0	2.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	40.7	3.6	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T981	1	*Crataegus monogyna* Common Hawthorn/Quick/May	9.0	1	30	N 2.0 E 2.0 S 2.0 W 2.0	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	40.7	3.6	40+	C	1
T982	1	*Crataegus monogyna* Common Hawthorn/Quick/May	9.0	6	34	N 3.0 E 3.0 S 3.0 W 3.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	53.2	4.1	40+	C	1
T983	1	*Acer campestre* Field Maple	10.0	1	32	N 3.0 E 3.0 S 3.0 W 3.0	2.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Poor past pruning.	46.3	3.8	40+	C	1
T984	1	*Quercus robur* English Oak	14.0	1	68	N 8.0 E 8.0 S 8.0 W 8.0	5.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	209.2	8.2	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T985	1	*Quercus robur* English Oak	14.0	2	35	N 6.0 E 6.0 S 6.0 W 6.0	5.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	57.9	4.3	40+	B	1
T986	1	*Quercus robur* English Oak	15.0	2	76	N 6.0 E 6.0 S 6.0 W 6.0	5.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	266.1	9.2	40+	B	1
T987	1	*Populus tremula* Aspen	18.0	1	35	N 5.0 E 5.0 S 5.0 W 5.0	5.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation.	55.4	4.2	40+	B	1
T988	1	*Populus tremula* Aspen	18.0	1	35	N 5.0 E 5.0 S 5.0 W 5.0	5.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation.	55.4	4.2	40+	B	1
T989	1	*Populus tremula* Aspen	18.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	2.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation.	72.4	4.8	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G990	50 40 35 15 6 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Quercus robur* English Oak *Corylus avellana* Common Hazel	14.0	1	40	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	72.4	4.8	40+	C	2 3
T991	1	*Fraxinus excelsior* Ash	15.0	1	45	N 6.0 E 6.0 S 6.0 W 6.0	3.0	3.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems.	91.6	5.4	20-40	B	1 3
T992	1	*Fraxinus excelsior* Ash	16.0	1	35	N 5.0 E 5.0 S 5.0 W 5.0	5.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation.	55.4	4.2	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G993	35 30 20 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash	12.0	1	20	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	18.1	2.4	40+	C	2 3
G994	15 6 6 6 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Salix fragilis* Crack Willow *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash	16.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	72.4	4.8	40+	B	2 3
T995	1	*Alnus glutinosa* Common Alder	14.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation.	40.7	3.6	40+	B	1
T996	1	*Alnus glutinosa* Common Alder	14.0	1	34	N 4.0 E 4.0 S 4.0 W 4.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation.	52.3	4.1	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T997	1	*Alnus glutinosa* Common Alder	14.0	1	30	N E S W 4.0 4.0 4.0 4.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation.	40.7	3.6	40+	B	1
T998	1	*Alnus glutinosa* Common Alder	14.0	1	32	N E S W 4.0 4.0 4.0 4.0	4.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation.	46.3	3.8	40+	B	1
T999	1	*Alnus glutinosa* Common Alder	14.0	1	32	N E S W 4.0 4.0 4.0 4.0	4.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation.	46.3	3.8	40+	B	1
T1000	1	*Alnus glutinosa* Common Alder	12.0	1	20	N E S W 2.0 2.0 2.0 2.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation.	18.1	2.4	40+	B	1
T1001	1	*Alnus glutinosa* Common Alder	15.0	1	20	N E S W 4.0 4.0 4.0 4.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation.	18.1	2.4	40+	B	1
T1002	1	*Alnus glutinosa* Common Alder	15.0	1	40	N E S W 4.0 4.0 4.0 4.0	1.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation.	72.4	4.8	40+	B	1
T1003	1	*Alnus glutinosa* Common Alder	12.0	1	28	N E S W 3.0 3.0 3.0 3.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation.	35.5	3.4	40+	B	1
T1004	1	*Alnus glutinosa* Common Alder	15.0	1	28	N E S W 4.0 4.0 4.0 4.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation.	35.5	3.4	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1005	400	*Alnus glutinosa* Common Alder	4.0	1	5	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	1.1	0.6	40+	C	2
T1006	1	*Quercus robur* English Oak	15.0	1	100	N E S W 8.0 7.0 7.0 7.0	2.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant. Offsite tree Grass.	452.4	12.0	40+	A	1 2
T1007	1	*Fraxinus excelsior* Ash	8.5	1	35	N E S W 4.0 4.0 4.0 3.5	2.0	3.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Grass.	55.4	4.2	40+	B	1
T1008	1	*Fraxinus excelsior* Ash	9.0	1	35	N E S W 5.0 4.0 4.0 4.0	2.0	3.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Grass.	55.4	4.2	40+	B	1
H1009	230	*Crataegus monogyna* Common Hawthorn/Quick/May	2.5	1	15	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Fair	Hedgerow - Maintained. Grass.	10.2	1.8	10-20	C	2
T1010	1	*Fraxinus excelsior* Ash	16.0	2	78	N E S W 7.0 7.0 7.0 7.0	2.5	3.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Mid crown. Deadwood - Minor. Twin-stemmed. Grass.	276.0	9.4	10-20	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1011	5 4 4 1 1	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Salix caprea* Goat Willow/Great Sallow	2.5	1	15	N 1.5 E 1.5 S 1.5 W 1.5	0.0	1.0	Semi Mature	Fair	Deadwood - Minor. Grass.	10.2	1.8	10-20	C	2
T1012	1	*Quercus robur* English Oak	8.0	1	105	N 3.0 E 4.0 S 4.0 W 4.0	2.0	2.5	Ancient or Veteran	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Deadwood - Minor. Habitat - High value. Ivy or climbing plant. Leaning trunk - Minor. Shedding limb / limbs - Historic. Shedding limb / limbs - Major. Grass.	498.8	12.6	40+	A	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1013	4 4 2 1 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Salix caprea* Goat Willow/Great Sallow *Fraxinus excelsior* Ash *Ilex aquifolium* Holly	5.0	1	25	N E S W 2.0 2.0 2.0 2.0	0.0	1.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	28.3	3.0	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1014	125 75 50 50 50 30 15 2	*Quercus robur* English Oak *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Crataegus monogyna* Common Hawthorn/Quick/May *Salix caprea* Goat Willow/Great Sallow *Fagus sylvatica* Common Beech *Prunus sp.* Cherry sp. *Pinus sylvestris* Scots Pine	7.0	1	15	N 2.0 E 2.0 S 2.0 W 2.0	0.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Multi-stemmed. Grass.	10.2	1.8	40+	B	2
T1015	1	*Fraxinus excelsior* Ash	13.0	1	45	N 5.0 E 4.0 S 4.0 W 4.0	2.5	4.0	Early Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Upper crown. Deadwood - Minor. Ivy or climbing plant. Tree within group canopy.	91.6	5.4	10-20	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1016	50 50 5 5 2 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Ilex aquifolium* Holly *Ulmus procera* English Elm *Fraxinus excelsior* Ash	2.5	1	10	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Fair	Hedgerow - Maintained.	4.5	1.2	10-20	C	2
T1017	1	*Quercus robur* English Oak	9.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	40.7	3.6	40+	A	1
H1018	45 45	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	2.5	1	10	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Fair	Hedgerow - Maintained.	4.5	1.2	10-20	C	2
T1019	1	*Quercus robur* English Oak	13.0	1	95	N 7.0 E 7.0 S 5.0 W 5.0	2.0	2.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Principal stems.	408.3	11.4	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1020	1	*Fraxinus excelsior* Ash	7.0	1	25	N 3.0 E 2.0 S 3.0 W 3.0	2.0	2.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	28.3	3.0	40+	B	1
T1021	1	*Fraxinus excelsior* Ash	6.0	1	25	N 2.0 E 2.0 S 2.0 W 2.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	28.3	3.0	40+	B	1
T1022	1	*Populus sp.* Poplar sp.	13.0	1	40	N 4.0 E 4.0 S 4.0 W 3.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant. Offsite?	72.4	4.8	20-40	B	1
T1023	1	*Fraxinus excelsior* Ash	9.0	2	39	N 3.0 E 3.0 S 3.0 W 3.0	3.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Twin-stemmed. Offsite?	69.0	4.7	20-40	B	1
T1024	1	*Populus sp.* Poplar sp.	14.0	1	55	N 5.0 E 5.0 S 5.0 W 5.0	2.0	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Offsite?	136.8	6.6	20-40	B	1
T1025	1	*Fraxinus excelsior* Ash	8.0	1	40	N 4.0 E 4.0 S 4.0 W 4.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Offsite?	72.4	4.8	40+	B	1
T1026	1	*Fraxinus excelsior* Ash	9.0	3	37	N 2.0 E 3.0 S 4.0 W 3.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed. Offsite?	64.5	4.5	20-40	B	1
T1027	1	*Quercus robur* English Oak	10.0	1	55	N 5.0 E 5.0 S 5.0 W 5.0	2.0	2.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	136.8	6.6	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1028	1	*Populus sp.* Poplar sp.	13.0	1	60	N E S W 5.0 5.0 5.0 5.0	1.5	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	162.9	7.2	20-40	B	1
T1029	1	*Populus sp.* Poplar sp.	14.0	1	80	N E S W 4.0 6.0 6.0 6.0	0.0	1.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	289.5	9.6	20-40	B	1
H1030	35 35 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash	2.5	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Fair	Hedgerow - Neglected / overgrown.	4.5	1.2	10-20	C	2
T1031	1	*Populus sp.* Poplar sp.	15.0	1	80	N E S W 4.0 6.0 6.0 4.0	0.0	1.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	289.5	9.6	20-40	B	1
T1032	1	*Acer campestre* Field Maple	8.0	1	45	N E S W 4.0 3.0 3.0 3.0	1.0	0.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	91.6	5.4	20-40	B	1
T1033	1	*Acer campestre* Field Maple	7.0	1	45	N E S W 1.0 3.0 3.0 3.0	1.0	0.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	91.6	5.4	20-40	B	1
T1034	1	*Acer campestre* Field Maple	5.0	1	30	N E S W 3.5 2.0 3.0 2.0	1.0	1.0	Early Mature	Good	No significant faults observed.	40.7	3.6	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1035	1	*Fraxinus excelsior* Ash	7.0	1	31	N 3.0 E 3.0 S 3.0 W 1.5	1.5	1.5	Semi Mature	Good	No significant faults observed.	43.5	3.7	40+	B	1
T1036	1	*Fraxinus excelsior* Ash	7.0	1	35	N 3.0 E 3.0 S 3.0 W 2.0	2.0	1.5	Semi Mature	Good	No significant faults observed.	55.4	4.2	40+	B	1
T1037	1	*Fraxinus excelsior* Ash	7.0	1	30	N 2.0 E 2.0 S 2.0 W 1.0	3.0	2.5	Semi Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	40.7	3.6	40+	B	1
T1038	1	*Pinus sp.* Pine sp.	7.0	1	64	N 3.0 E 3.0 S 3.0 W 3.0	1.0	1.5	Mature	Good	No significant faults observed.	185.3	7.7	40+	B	1
T1039	1	*Pinus sp.* Pine sp.	8.0	1	71	N 3.0 E 3.0 S 3.5 W 3.0	1.0	1.0	Mature	Good	No significant faults observed.	228.0	8.5	40+	B	1
T1040	1	*Fraxinus excelsior* Ash	5.0	1	19	N 1.5 E 1.5 S 1.5 W 1.0	2.5	2.0	Semi Mature	Fair	No significant faults observed.	16.3	2.3	40+	B	1
T1041	1	*Fraxinus excelsior* Ash	5.0	1	25	N 2.0 E 2.5 S 2.5 W 2.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	28.3	3.0	40+	B	1
T1042	1	*Acer campestre* Field Maple	4.5	1	24	N 2.0 E 2.0 S 2.0 W 2.0	1.5	1.5	Semi Mature	Fair	No significant faults observed.	26.1	2.9	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1043	500 500 50	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash	2.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	C	2
T1044	1	*Fraxinus excelsior* Ash	9.0	1	18	N E S W 2.0 2.0 2.0 2.0	3.0	3.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	14.7	2.2	40+	B	1
T1045	1	*Fraxinus excelsior* Ash	12.0	5	56	N E S W 4.0 6.0 4.0 4.0	3.0	3.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Multi-stemmed.	142.5	6.7	20-40	C	1
T1046	1	*Fraxinus excelsior* Ash	12.0	1	65	N E S W 6.0 6.0 6.0 5.0	2.0	3.0	Mature	Fair	Access to inspect base - Not possible. Deadwood - Minor. Tree on bank.	191.1	7.8	40+	B	1
T1047	1	*Fraxinus excelsior* Ash	12.0	3	55	N E S W 6.0 6.0 7.0 5.0	2.0	4.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Multi-stemmed. Tree on bank.	136.8	6.6	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1048	1	*Fraxinus excelsior* Ash	12.0	7	92	N E S W 5.0 5.0 5.0 5.0	2.0	3.0	Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Minor. Multi-stemmed. Weak live growth. Tree on bank.			0-10	U	
H1049	78 50	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May	3.0	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown.	4.5	1.2	20-40	C	2
G1050	20 15 5	*Fraxinus excelsior* Ash *Acer campestre* Field Maple *Quercus robur* English Oak	12.0	1	35	N E S W 4.0 4.0 4.0 4.0	2.0	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant. Shedding limb / limbs - Historic.	55.4	4.2	10-20	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1051	750 750 425 50 50	*Corylus avellana* Common Hazel *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Ulmus procera* English Elm	2.5	1	10	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	C	2
T1052	1	*Quercus robur* English Oak	8.0	1	70	N 3.0 E 3.0 S 3.0 W 3.0	3.0	3.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor.	221.7	8.4	10-20	C	1
T1053	1	*Quercus robur* English Oak	14.0	1	95	N 8.0 E 8.0 S 8.0 W 5.0	2.5	3.5	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant.	408.3	11.4	40+	A	1
G1054	22 3	*Fraxinus excelsior* Ash *Acer campestre* Field Maple	8.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	18.1	2.4	20-40	C	2
T1055	1	*Fraxinus excelsior* Ash	9.0	1	25	N 2.0 E 2.0 S 2.0 W 1.0	3.0	2.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant.	28.3	3.0	10-20	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1056	1	*Fraxinus excelsior* Ash	5.5	3	29	N E S W 2.0 2.0 2.0 2.0	2.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor.	38.5	3.5	20-40	C	1
T1057	1	*Fraxinus excelsior* Ash	7.0	1	20	N E S W 3.0 2.0 2.0 2.0	2.5	2.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor.	18.1	2.4	20-40	C	1
T1058	1	*Fraxinus excelsior* Ash	6.0	1	30	N E S W 2.5 3.0 3.0 2.5	2.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor.	40.7	3.6	40+	B	1
H1059	100 100 100	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	2.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	C	2
H1060	35 35 35	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	2.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1061	1	*Fraxinus excelsior* Ash	9.0	1	25	N 2.0 E 2.0 S 2.0 W 1.5	2.5	2.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant.	28.3	3.0	40+	C	1
T1062	1	*Fraxinus excelsior* Ash	6.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	2.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor.	18.1	2.4	40+	C	1
T1063	1	*Fraxinus excelsior* Ash	8.0	3	30	N 2.0 E 2.0 S 2.0 W 2.0	2.5	2.0	Semi Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Decline - Evident / observed. Deadwood - Minor.			0-10	U	
T1064	1	*Fraxinus excelsior* Ash	11.0	2	43	N 3.0 E 3.0 S 3.0 W 3.0	2.0	2.0	Semi Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Throughout crown. Deadwood - Minor.			0-10	U	
T1065	1	*Fraxinus excelsior* Ash	6.0	1	20	N 1.0 E 1.0 S 1.0 W 1.0	3.0	3.0	Semi Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Throughout crown. Deadwood - Minor.			0-10	U	
T1066	1	*Acer campestre* Field Maple	4.5	1	25	N 1.5 E 2.0 S 2.0 W 2.0	2.0	3.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	28.3	3.0	20-40	B	1
H1067	1000 100	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	2.0	1	10	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1068	1	*Acer campestre* Field Maple	5.5	2	28	N E S W 2.5 2.5 2.5 2.0	2.0	3.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	36.2	3.4	20-40	B	1
T1069	1	*Acer campestre* Field Maple	9.0	5	68	N E S W 4.5 5.0 3.0 3.0	2.0	2.0	Early Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Throughout crown. Deadwood - Minor. Ivy or climbing plant. Multi-stemmed.	212.4	8.2	10-20	C	1
H1070	35 35	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	C	2
T1071	1	*Fraxinus excelsior* Ash	14.0	1	55	N E S W 8.0 5.0 5.0 5.0	3.0	3.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor.	136.8	6.6	20-40	B	1
T1072	1	*Fraxinus excelsior* Ash	8.0	3	51	N E S W 4.0 3.0 3.0 3.0	3.0	2.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Multi-stemmed.	121.0	6.2	20-40	C	1
T1073	1	*Quercus robur* English Oak	5.0	1	30	N E S W 1.5 3.0 1.5 3.0	3.0	3.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Suppressed crown - Major.	40.7	3.6	20-40	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1074	1	*Fraxinus excelsior* Ash	14.0	5	85	N 7.0 E 6.0 S 5.0 W 5.0	3.0	3.5	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Fungal fruiting body - structural decay suspected. Multi-stemmed. Suppressed crown - Major.	328.0	10.2	10-20	C	1
T1075	1	*Fraxinus excelsior* Ash	6.0	1	35	N 3.0 E 3.0 S 3.0 W 2.0	2.0	2.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor.	55.4	4.2	20-40	C	1
T1076	1	*Fraxinus excelsior* Ash	10.0	2	118	N 7.0 E 6.0 S 6.0 W 7.0	2.0	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant. Twin-stemmed. Tree on bank.	635.6	14.2	10-20	C	1
T1077	1	*Ilex aquifolium* Holly	6.0	5	54	N 2.0 E 2.0 S 2.0 W 2.0	1.5	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed.	135.7	6.6	20-40	C	1
T1078	1	*Quercus robur* English Oak	16.0	1	75	N 8.0 E 8.0 S 8.0 W 8.0	2.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant. Tree on bank.	254.5	9.0	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1079	1000 250 250	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe	2.0	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	B	2
W1080	500 250 100 100 50 25 25	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak *Fraxinus excelsior* Ash *Ulmus procera* English Elm *Salix caprea* Goat Willow/Great Sallow *Acer campestre* Field Maple	12.0	1	40	N E S W 4.0 4.0 4.0 4.0	2.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Tree quantities are a Conservative estimate	72.4	4.8	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1081	500 350 150 45 35 20 5 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Quercus robur* English Oak *Acer campestre* Field Maple *Sambucus nigra* Elder *Corylus avellana* Common Hazel *Salix caprea* Goat Willow/Great Sallow	10.0	1	40	N 3.0 E 3.0 S 3.0 W 3.0	2.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Deadwood - Minor. Multi-stemmed. Twin-stemmed. Tree quantities are a conservative estimate	72.4	4.8	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1082	800 200 200 25	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	2.5	1	5	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	1.1	0.6	20-40	C	2
T1083	1	*Fraxinus excelsior* Ash	8.0	5	49	N E S W 3.0 3.0 3.0 3.0	2.5	2.0	Semi Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Mid crown. Deadwood - Minor. Multi-stemmed.			0-10	U	
T1084	1	*Quercus robur* English Oak	12.0	1	42	N E S W 5.0 7.0 6.0 5.0	3.0	3.0	Early Mature	Good	Deadwood - Minor.	79.8	5.0	40+	A	1
T1085	1	*Acer campestre* Field Maple	8.0	3	32	N E S W 1.0 2.0 3.0 2.0	1.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed. Tree on bank.	48.6	3.9	20-40	C	1
T1086	1	*Acer campestre* Field Maple	8.0	9	51	N E S W 4.0 3.0 3.0 3.0	0.0	1.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed. Tree on bank.	117.7	6.1	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1087	6	*Fraxinus excelsior* Ash	8.0	1	20	N 2.5 E 2.5 S 2.5 W 2.5	1.0	1.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Throughout crown. Deadwood - Minor. Multi-stemmed.	18.1	2.4	10-20	C	2
T1088	1	*Quercus robur* English Oak	11.0	1	75	N 4.0 E 5.0 S 4.0 W 4.0	3.0	1.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Epicormic growth - Bole / principal stems. Tree on bank.	254.5	9.0	40+	B	1
T1089	1	*Quercus robur* English Oak	11.0	1	60	N 6.0 E 4.0 S 5.0 W 4.0	2.5	1.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Tree on bank.	162.9	7.2	40+	B	1
T1090	1	*Quercus robur* English Oak	8.0	1	85	N 5.0 E 5.0 S 5.0 W 3.0	2.5	2.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant. Tree on bank.	326.9	10.2	40+	B	1
T1091	1	*Quercus robur* English Oak	8.0	1	95	N 6.0 E 4.0 S 4.0 W 5.0	2.0	2.5	Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant. Weak live growth. Tree on bank.	408.3	11.4	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1092	1	*Fraxinus excelsior* Ash	10.0	1	80	N E S W 2.0 5.0 4.0 4.0	2.0	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	289.5	9.6	10-20	B	1
T1093	1	*Quercus robur* English Oak	7.0	1	70	N E S W 4.0 5.0 2.0 4.0	2.0	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Tree on bank.	221.7	8.4	40+	C	1
H1094	600 200 25 25 10 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Ilex aquifolium* Holly	2.5	1	5	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown.	1.1	0.6	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1095	1	*Quercus robur* English Oak	15.0	1	95	N E S W 7.0 7.0 5.0 7.0	2.5	3.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Ivy or climbing plant. Tree on bank.	408.3	11.4	40+	B	1
G1096	20 15	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May	5.0	1	15	N E S W 1.5 1.5 1.5 1.5	1.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant.	10.2	1.8	10-20	C	2
T1097	1	*Quercus robur* English Oak	14.0	1	110	N E S W 6.0 7.0 6.0 4.0	1.0	1.0	Late Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Ivy or climbing plant. Tree on bank.	547.4	13.2	20-40	B	1
T1098	1	*Acer campestre* Field Maple	7.0	3	37	N E S W 2.0 1.0 2.0 2.0	1.0	1.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	64.5	4.5	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1099	1	*Fraxinus excelsior* Ash	9.0	3	36	N 4.0 E 3.0 S 3.0 W 4.0	2.0	1.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	61.0	4.4	20-40	C	1
T1100	1	*Quercus robur* English Oak	6.0	1	70	N 2.0 E 4.0 S 2.0 W 4.0	3.0	2.5	Post Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Tree on bank.			0-10	U	
T1101	1	*Fraxinus excelsior* Ash	10.0	5	52	N 4.0 E 5.0 S 3.0 W 5.0	2.5	2.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed. Tree on bank.	123.3	6.3	20-40	C	1
T1102	1	*Acer campestre* Field Maple	6.0	2	39	N 3.0 E 3.0 S 1.5 W 2.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Twin-stemmed. Tree on bank.	69.0	4.7	20-40	C	1
T1103	1	*Fraxinus excelsior* Ash	8.0	5	48	N 2.0 E 2.0 S 2.0 W 3.0	2.0	2.5	Semi Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Multi-stemmed. Tree on bank.			0-10	U	

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1104	5	*Fraxinus excelsior* Ash	9.0	1	30	N E S W 2.0 2.0 2.0 2.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	40.7	3.6	20-40	C	2
G1105	5	*Fraxinus excelsior* Ash	8.0	1	20	N E S W 2.0 2.0 2.0 2.0	2.0	1.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed. Tree on bank.	18.1	2.4	20-40	C	2
T1106	1	*Fraxinus excelsior* Ash	8.0	5	38	N E S W 3.0 3.0 1.5 4.0	2.5	3.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed. Tree on bank.	66.7	4.6	10-20	C	1
G1107	12	*Fraxinus excelsior* Ash	8.0	1	20	N E S W 2.5 2.5 2.5 2.5	2.0	1.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Multi-stemmed. Tree on bank.	18.1	2.4	10-20	C	2
H1108	1200 50 25	*Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple	2.5	1	5	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	1.1	0.6	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1109	70 15 5	*Fraxinus excelsior* Ash *Quercus robur* English Oak *Acer campestre* Field Maple	9.0	1	20	N E S W 2.5 2.5 2.5 2.5	2.0	1.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Multi-stemmed. Tree on bank.	18.1	2.4	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1110	250 200 100 50 50 50 50 25 25 15 10	*Prunus spinosa* Blackthorn/Sloe *Pinus sp.* Pine sp. *Fraxinus excelsior* Ash *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Larix sp.* Larch sp. *Quercus robur* English Oak *Prunus sp.* Cherry sp. *Betula sp.* Birch *Thuja sp.* Thuja sp.	15.0	1	30	N 2.5 E 2.5 S 2.5 W 2.5	3.0	1.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Tree quantities are a conservative estimate	40.7	3.6	40+	B	2
H1111	1200	*Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	10	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1112	2	*Fraxinus excelsior* Ash	13.0	1	40	N E S W 2.5 2.5 2.5 2.5	3.0	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	72.4	4.8	20-40	C	2
G1113	4 2	*Fraxinus excelsior* Ash *Crataegus monogyna* Common Hawthorn/Quick/May	12.0	1	40	N E S W 2.5 2.5 2.5 2.5	3.0	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed. Twin-stemmed. Tree on bank.	72.4	4.8	20-40	C	2
H1114	300 5 5 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Prunus spinosa* Blackthorn/Sloe *Ilex aquifolium* Holly	2.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained. Tree on bank.	4.5	1.2	20-40	C	2
G1115	5	*Prunus spinosa* Blackthorn/Sloe	3.0	1	15	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	10.2	1.8	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1116	1	*Fraxinus excelsior* Ash	15.0	1	60	N E S W 4.0 4.0 4.0 7.0	3.0	3.5	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	162.9	7.2	20-40	C	1
H1117	1000 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel	2.0	1	5	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained. Tree on bank.	1.1	0.6	20-40	C	2
H1118	600 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	2.5	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	C	2
H1119	350 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	2.5	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	C	2
T1120	1	*Quercus robur* English Oak	12.0	1	75	N E S W 4.0 5.0 4.0 4.0	3.0	2.0	Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Upper crown. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant. Stag-headed crown. Tree on bank.	254.5	9.0	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1121	500 200 125 75 40 25 20 15 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ilex aquifolium* Holly *Quercus robur* English Oak *Corylus avellana* Common Hazel *Carpinus betulus* Hornbeam *Fagus sylvatica* Common Beech	12.0	1	45	N 3.0 E 3.0 S 3.0 W 3.0	1.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Tree quantities are a conservative estimate Tree on bank.	91.6	5.4	40+	B	2
G1122	2 2 2	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	10.0	1	30	N 3.0 E 3.0 S 3.0 W 3.0	1.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed. Tree on bank.	40.7	3.6	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1123	1	*Quercus robur* English Oak	11.0	1	85	N E S W 3.0 5.0 7.0 6.0	1.5	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Deadwood - Minor. Tree on bank.	326.9	10.2	40+	B	1
T1124	1	*Acer campestre* Field Maple	11.0	2	33	N E S W 3.0 2.0 2.0 3.0	2.5	1.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	50.9	4.0	20-40	C	1
T1125	1	*Fraxinus excelsior* Ash	8.0	3	27	N E S W 2.0 2.0 2.0 2.0	3.0	2.0	Semi Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Tree on bank.			0-10	U	
T1126	1	*Fagus sylvatica* Common Beech	10.0	3	69	N E S W 6.0 4.0 6.0 4.0	2.5	1.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Tree on bank.	219.4	8.4	40+	B	1
T1127	1	*Acer campestre* Field Maple	7.0	5	36	N E S W 2.5 2.5 3.0 3.0	3.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Multi-stemmed. Tree on bank.	61.1	4.4	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1128	1	*Fraxinus excelsior* Ash	8.0	2	40	N E S W 3.0 2.0 3.0 2.0	3.0	2.0	Semi Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Tree on bank.			0-10	U	
T1129	1	*Ilex aquifolium* Holly	6.0	5	25	N E S W 2.0 2.0 2.0 2.0	2.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed. Tree on bank.	28.3	3.0	20-40	C	1
H1130	750 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	2.5	1	15	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown. Tree on bank.	10.2	1.8	10-20	C	2
H1131	1500 500 15	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	2.5	1	5	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown. Tree on bank.	1.1	0.6	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1132	10 3 2 1	*Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow *Acer campestre* Field Maple	10.0	1	35	N 3.0 E 3.0 S 3.0 W 3.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	55.4	4.2	20-40	C	2
T1133	1	*Quercus robur* English Oak	10.0	1	130	N 4.0 E 4.0 S 4.0 W 4.0	2.0	2.0	Late Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Tree on bank.	706.9	15.0	10-20	C	1
T1134	1	*Fraxinus excelsior* Ash	10.0	1	35	N 4.0 E 4.0 S 3.0 W 4.0	2.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	55.4	4.2	20-40	B	1
T1135	1	*Fraxinus excelsior* Ash	9.0	1	35	N 3.0 E 3.0 S 3.0 W 3.0	2.5	1.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	55.4	4.2	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1136	1	*Acer campestre* Field Maple	8.0	3	36	N E S W 3.0 4.0 3.0 3.0	2.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	61.1	4.4	20-40	C	1
T1137	1	*Fraxinus excelsior* Ash	8.0	1	35	N E S W 2.0 3.0 2.0 3.0	2.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	55.4	4.2	20-40	C	1
T1138	1	*Fraxinus excelsior* Ash	10.0	1	35	N E S W 4.0 4.0 3.0 4.0	2.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	55.4	4.2	20-40	B	1
T1139	1	*Fraxinus excelsior* Ash	9.0	2	33	N E S W 3.0 3.0 3.0 2.0	2.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	50.9	4.0	20-40	B	1
H1140	250 250	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	2.5	1	5	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown. Tree on bank.	1.1	0.6	20-40	C	2
T1141	1	*Quercus robur* English Oak	14.0	1	106	N E S W 5.0 5.0 5.0 5.0	1.5	2.5	Mature	Fair	Deadwood - Major. Stag-headed crown. Shedding limb / limbs - Historic.	508.3	12.7	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1142	1000 200	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	2.5	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	C	2
G1143	23 12 4 1	*Quercus robur* English Oak *Fagus sylvatica* Common Beech *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	10.0	1	35	N E S W 2.5 2.5 2.5 2.5	1.0	0.0	Semi Mature	Good	Deadwood - Minor. Form - Low canopy.	55.4	4.2	40+	A	2
H1144	1000 10 5 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ilex aquifolium* Holly *Quercus robur* English Oak	2.0	1	5	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown.	1.1	0.6	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1145	60 5 5 5 5 1	*Fagus sylvatica* Common Beech *Quercus robur* English Oak *Pinus sp.* Pine sp. *Fraxinus excelsior* Ash *Acer pseudoplatanus* Sycamore *Larix sp.* Larch sp.	16.0	1	45	N 3.0 E 3.0 S 3.0 W 3.0	1.0	0.0	Early Mature	Good	Deadwood - Minor.	91.6	5.4	40+	A	2
H1146	1500 500 100 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm *Acer campestre* Field Maple	2.0	1	5	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	1.1	0.6	20-40	C	2
T1147	1	*Fraxinus excelsior* Ash	11.0	1	35	N 3.0 E 3.0 S 3.0 W 3.0	2.0	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	55.4	4.2	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1148	300 300	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	2.5	1	5	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	1.1	0.6	20-40	C	2
T1149	1	*Fraxinus excelsior* Ash	7.0	1	30	N E S W 2.0 2.0 2.0 2.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	40.7	3.6	20-40	C	1
T1150	1	*Fraxinus excelsior* Ash	13.0	1	65	N E S W 3.0 6.0 6.0 6.0	3.0	3.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Fungal fruiting body - structural decay suspected.	191.1	7.8	10-20	C	1
T1151	1	*Fraxinus excelsior* Ash	10.0	1	35	N E S W 3.0 3.0 3.0 3.0	2.0	3.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	55.4	4.2	20-40	B	1
T1152	1	*Fraxinus excelsior* Ash	7.0	1	30	N E S W 3.0 2.0 1.5 1.5	2.0	1.5	Early Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.			0-10	U	
T1153	1	*Fraxinus excelsior* Ash	6.0	2	29	N E S W 1.5 1.5 2.0 1.5	3.0	1.5	Early Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.			0-10	U	

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1154	4 2	*Acer campestre* Field Maple *Fraxinus excelsior* Ash	6.0	1	20	N E S W 2.0 2.0 2.0 2.0	2.0	0.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	18.1	2.4	20-40	C	2
T1155	1	*Fraxinus excelsior* Ash	11.0	1	80	N E S W 3.0 4.0 3.0 2.0	3.0	2.0	Mature	Dead	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Tree on bank.			0-10	U	
T1156	1	*Fraxinus excelsior* Ash	9.0	4	45	N E S W 2.5 2.5 3.5 2.5	3.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed. Tree on bank.	92.7	5.4	10-20	C	1
T1157	1	*Fraxinus excelsior* Ash	8.0	1	35	N E S W 3.0 3.0 3.0 3.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant. Tree on bank.	55.4	4.2	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1158	450 450 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow	2.0	1	5	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	1.1	0.6	10-20	C	2
H1159	125 125 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm	2.0	1	5	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained. Tree on bank.	1.1	0.6	10-20	C	2
G1160	15 10 1	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	5.0	1	15	N 1.5 E 1.5 S 1.5 W 1.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	10.2	1.8	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1161	15 3	*Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash	5.0	1	15	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	10.2	1.8	20-40	C	2
T1162	1	*Fraxinus excelsior* Ash	16.0	1	55	N E S W 7.0 6.0 7.0 6.0	2.0	4.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	136.8	6.6	20-40	B	1
T1163	1	*Quercus robur* English Oak	13.0	1	180	N E S W 7.0 9.0 7.0 7.0	2.5	2.5	Late Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	706.9	15.0	40+	A	1
T1164	1	*Fraxinus excelsior* Ash	10.0	4	53	N E S W 4.0 3.0 3.0 3.0	2.0	2.5	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	130.1	6.4	40+	B	1
T1165	1	*Quercus robur* English Oak	11.0	1	55	N E S W 3.5 3.0 3.5 3.0	3.0	2.5	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant.	136.8	6.6	40+	B	1
H1166	25 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm	3.0	1	15	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	10.2	1.8	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1167	1	*Quercus robur* English Oak	11.0	1	190	N E S W 5.0 7.0 5.0 3.0	1.0	2.5	Ancient or Veteran	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Foreign object - Ingrown metal. Ivy or climbing plant.	706.9	15.0	40+	A	1 3
T1168	1	*Fraxinus excelsior* Ash	16.0	1	50	N E S W 5.0 5.0 4.0 5.0	2.0	4.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	113.1	6.0	20-40	B	1
T1169	1	*Fraxinus excelsior* Ash	13.0	2	74	N E S W 3.0 5.0 5.0 5.0	2.0	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	249.9	8.9	20-40	B	1
H1170	400 50	*Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm	3.0	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	4.5	1.2	20-40	C	2
G1171	10 5	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	5.0	1	15	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	10.2	1.8	20-40	C	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1172	1	*Fraxinus excelsior* Ash	16.0	1	45	N 5.0 E 5.0 S 4.0 W 5.0	2.0	2.5	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	91.6	5.4	20-40	B	1
T1173	1	*Quercus robur* English Oak	10.0	1	130	N 3.0 E 3.0 S 3.0 W 4.0	2.0	2.5	Late Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant. Tree on bank.	706.9	15.0	10-20	C	1
T1174	1	*Quercus robur* English Oak	15.0	1	110	N 6.0 E 5.0 S 5.0 W 5.0	2.0	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant. Tree on bank.	547.4	13.2	40+	B	1
T1175	1	*Quercus robur* English Oak	12.0	1	100	N 3.0 E 2.0 S 3.0 W 4.0	2.0	2.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant. Tree on bank.	452.4	12.0	40+	B	1
T1176	1	*Fraxinus excelsior* Ash	17.0	1	90	N 4.0 E 2.0 S 4.0 W 7.0	2.0	2.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant. Tree on bank.	366.4	10.8	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1177	1	*Fraxinus excelsior* Ash	15.0	1	85	N 7.0 E 7.0 S 7.0 W 1.0	2.0	3.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Ivy or climbing plant. Unbalanced crown - Major. Tree on bank.	326.9	10.2	20-40	B	1
T1178	1	*Quercus robur* English Oak	15.0	1	110	N 6.0 E 8.0 S 6.0 W 6.0	2.5	3.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Major. Ivy or climbing plant. Tree on bank.	547.4	13.2	40+	A	1
T1179	1	*Fraxinus excelsior* Ash	13.0	1	45	N 3.0 E 3.0 S 3.0 W 3.0	2.0	2.5	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant. Tree on bank.	91.6	5.4	20-40	B	1
T1180	1	*Fraxinus excelsior* Ash	15.0	1	60	N 6.0 E 7.0 S 6.0 W 7.0	2.0	3.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant. Tree on bank.	162.9	7.2	40+	B	1
T1181	1	*Quercus robur* English Oak	10.0	1	90	N 6.0 E 7.0 S 6.0 W 7.0	2.0	2.0	Post Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Base. Ivy or climbing plant. Stag-headed crown. Tree on bank.	366.4	10.8	10-20	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1182	1	*Quercus robur* English Oak	17.0	1	75	N E S W 7.0 7.0 8.0 7.0	2.0	3.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant. Tree on bank.	254.5	9.0	20-40	B	1
H1183	200 50 50	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm	3.0	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	4.5	1.2	20-40	C	2
T1184	1	*Crataegus monogyna* Common Hawthorn/Quick/May	6.0	5	40	N E S W 2.5 2.5 2.5 2.5	1.5	1.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	75.7	4.9	10-20	C	1
T1185	1	*Crataegus monogyna* Common Hawthorn/Quick/May	5.0	1	20	N E S W 1.5 1.5 1.5 1.5	1.0	1.5	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	18.1	2.4	10-20	C	1
T1186	1	*Crataegus monogyna* Common Hawthorn/Quick/May	5.0	1	20	N E S W 1.5 1.5 1.5 1.5	1.5	1.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	18.1	2.4	10-20	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1187	1	*Quercus robur* English Oak	15.0	1	90	N E S W 6.0 8.0 6.0 5.0	0.5	0.5	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	366.4	10.8	40+	A	1
H1188	150	*Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained. Tree on bank.	4.5	1.2	20-40	C	2
T1189	1	*Fraxinus excelsior* Ash	14.0	1	45	N E S W 7.0 5.0 5.0 4.0	2.5	3.0	Semi Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	91.6	5.4	40+	B	1
T1190	1	*Quercus robur* English Oak	15.0	1	60	N E S W 5.0 5.0 7.0 5.0	2.0	3.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Ivy or climbing plant. Leaning trunk - Minor. Tree on bank.	162.9	7.2	40+	B	1
T1191	1	*Quercus robur* English Oak	13.0	1	60	N E S W 5.0 5.0 5.0 7.0	2.0	2.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Ivy or climbing plant. Leaning trunk - Minor. Tree on bank.	162.9	7.2	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1192	1	*Quercus robur* English Oak	14.0	1	85	N E S W 7.0 7.0 3.0 7.0	2.0	3.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	326.9	10.2	40+	B	1
T1193	1	*Fraxinus excelsior* Ash	14.0	1	75	N E S W 4.0 6.0 4.0 4.0	3.0	4.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Stems - Co-dominant. Tree on bank.	254.5	9.0	20-40	B	1
T1194	1	*Fraxinus excelsior* Ash	13.0	1	80	N E S W 3.0 5.0 5.0 5.0	3.0	4.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	289.5	9.6	40+	B	1
T1195	1	*Fraxinus excelsior* Ash	13.0	1	70	N E S W 5.0 5.0 3.0 5.0	2.0	2.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Branch - Broken. Deadwood - Minor. Shedding limb / limbs - Historic. Tree on bank.	221.7	8.4	20-40	B	1
T1196	1	*Fraxinus excelsior* Ash	12.0	1	80	N E S W 4.0 5.0 5.0 4.0	2.5	4.0	Late Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Hollow trunk - Open cavity. Ivy or climbing plant. Shedding limb / limbs - Historic. Tree on bank.	289.5	9.6	10-20	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1197	1	*Fraxinus excelsior* Ash	11.0	1	85	N 5.0 E 7.0 S 5.0 W 3.0	2.0	1.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	326.9	10.2	10-20	C	1
T1198	1	*Fraxinus excelsior* Ash	7.0	1	30	N 3.0 E 4.0 S 3.0 W 4.0	2.0	2.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant. Tree on bank.	40.7	3.6	20-40	C	1
H1199	550	*Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	5	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained. Tree on bank.	1.1	0.6	20-40	C	2
T1200	1	*Prunus sp.* Cherry sp.	6.0	1	35	N 2.0 E 2.0 S 2.0 W 2.0	2.0	1.0	Late Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Decline - Evident / observed. Deadwood - Minor. Weak live growth.			0-10	U	
T1201	1	*Crataegus monogyna* Common Hawthorn/Quick/May	6.0	2	36	N 2.5 E 2.5 S 2.5 W 2.5	2.0	1.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	58.8	4.3	10-20	C	1
T1202	1	*Crataegus monogyna* Common Hawthorn/Quick/May	4.5	1	20	N 2.0 E 1.0 S 2.0 W 2.0	2.0	2.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	18.1	2.4	10-20	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1203	10	*Fraxinus excelsior* Ash	6.0	1	20	N E S W 1.5 1.5 1.5 1.5	2.0	0.0	Early Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Dead tree / trees. Deadwood - Major. Tree on bank.			0-10	U	
H1204	125	*Crataegus monogyna* Common Hawthorn/Quick/May	2.5	1	5	N E S W 0.8 0.8 0.8 0.8	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained. Tree on bank.	1.1	0.6	10-20	C	2
H1205	125 25	*Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm	2.5	1	5	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained. Tree on bank.	1.1	0.6	10-20	C	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1206	300 300 150 150 100 100 50	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Salix caprea* Goat Willow/Great Sallow *Quercus robur* English Oak *Betula sp.* Birch *Acer campestre* Field Maple *Prunus sp.* Cherry sp.	8.0	1	15	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	10.2	1.8	20-40	B	2
T1207	1	*Prunus sp.* Cherry sp.	9.0	1	30	N E S W 2.5 4.0 2.5 2.5	2.0	1.5	Semi Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	40.7	3.6	20-40	B	1
T1208	1	*Prunus sp.* Cherry sp.	10.0	1	50	N E S W 2.0 4.0 4.0 3.0	3.0	2.0	Late Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Minor. Leaning trunk - Minor.	113.1	6.0	10-20	C	1
T1209	1	*Prunus sp.* Cherry sp.	8.0	1	28	N E S W 3.0 4.0 3.0 3.0	1.5	1.5	Semi Mature	Good	Deadwood - Minor.	35.5	3.4	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1210	50	*Crataegus monogyna* Common Hawthorn/Quick/May	2.5	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	4.5	1.2	10-20	C	2
G1211	12 10 1	*Fraxinus excelsior* Ash *Crataegus monogyna* Common Hawthorn/Quick/May *Ilex aquifolium* Holly	13.0	1	40	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant. Tree on bank.	72.4	4.8	20-40	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1212	15 15 15 10 10 5 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus sp.* Cherry sp. *Acer campestre* Field Maple *Pinus sp.* Pine sp. *Quercus robur* English Oak *x Cupressocyparis leylandii* Leyland Cypress *Fagus sylvatica* Common Beech	13.0	1	40	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant.	72.4	4.8	20-40	B	2
H1213	150 25	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	2.5	1	15	N 0.8 E 0.8 S 0.8 W 0.8	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	10.2	1.8	10-20	C	2
T1214	1	*Fraxinus excelsior* Ash	16.0	4	74	N 4.0 E 4.0 S 5.0 W 4.0	3.0	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	249.9	8.9	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1215	25	*Fraxinus excelsior* Ash	12.0	1	35	N E S W 3.0 3.0 3.0 3.0	0.0	1.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	55.4	4.2	20-40	B	2
G1216	10 10	*Salix caprea* Goat Willow/Great Sallow *Crataegus monogyna* Common Hawthorn/Quick/May	7.0	1	20	N E S W 2.0 2.0 2.0 2.0	0.0	1.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	18.1	2.4	20-40	C	2
G1217	25 20 15 10 5	*Fraxinus excelsior* Ash *Acer campestre* Field Maple *Prunus sp.* Cherry sp. *Quercus robur* English Oak *Fagus sylvatica* Common Beech	12.0	1	35	N E S W 3.0 3.0 3.0 3.0	0.0	1.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	55.4	4.2	40+	B	2
T1218	1	*Fraxinus excelsior* Ash	8.0	1	35	N E S W 4.0 3.0 3.0 3.0	2.5	2.5	Semi Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	55.4	4.2	20-40	B	1 2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1219	200 25 25	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	2.5	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown.	4.5	1.2	10-20	C	2
T1220	1	*Quercus robur* English Oak	11.0	1	95	N E S W 3.0 4.0 5.0 5.0	2.0	2.0	Post Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Extensive. Decay / structural defect - Major. Decay / structural defect - Principal stems. Stag-headed crown.	408.3	11.4	10-20	C	1 3
H1221	150 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	2.5	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown.	4.5	1.2	10-20	C	2
H1222	75 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	2.5	1	5	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown.	1.1	0.6	10-20	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1223	100 100 25 15 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow *Quercus robur* English Oak	13.0	1	40	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Dead tree / trees. Deadwood - Major. Ivy or climbing plant.	72.4	4.8	40+	B	2
T1224	1	*Fraxinus excelsior* Ash	7.0	1	25	N 2.0 E 2.0 S 2.0 W 2.0	1.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	28.3	3.0	20-40	C	1
T1225	1	*Quercus robur* English Oak	13.0	1	85	N 5.0 E 5.0 S 4.0 W 5.0	2.0	2.5	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	326.9	10.2	40+	A	1
T1226	1	*Fraxinus excelsior* Ash	8.0	1	25	N 3.0 E 3.0 S 3.0 W 3.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	28.3	3.0	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1227	1	*Quercus robur* English Oak	15.0	1	95	N E S W 7.0 8.0 6.0 7.0	2.0	3.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant. Tree on bank.	408.3	11.4	40+	A	1
T1228	1	*Quercus robur* English Oak	13.0	1	90	N E S W 6.0 5.0 5.0 4.0	2.0	2.5	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant. Tree on bank.	366.4	10.8	40+	A	1
H1229	500	*Crataegus monogyna* Common Hawthorn/Quick/May	2.5	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown.	4.5	1.2	10-20	C	2
T1230	1	*Fraxinus excelsior* Ash	10.0	2	43	N E S W 4.0 5.0 4.0 4.0	3.0	2.5	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	83.7	5.2	20-40	C	1
T1231	1	*Fraxinus excelsior* Ash	10.0	1	25	N E S W 3.0 2.5 2.5 2.5	2.5	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	28.3	3.0	20-40	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1232	300 200 100 10 10	*Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Salix caprea* Goat Willow/Great Sallow *Ilex aquifolium* Holly	2.5	1	10	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	4.5	1.2	10-20	C	1
T1233	1	*Quercus robur* English Oak	15.0	1	95	N 4.0 E 7.0 S 5.0 W 5.0	2.0	2.5	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant. Tree on bank.	408.3	11.4	40+	A	1
T1234	1	*Fraxinus excelsior* Ash	10.0	1	30	N 1.0 E 3.0 S 3.0 W 3.0	2.0	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Unbalanced crown - Major. Tree on bank.	40.7	3.6	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1235	1	*Quercus robur* English Oak	15.0	1	100	N E S W 7.0 6.0 7.0 6.0	2.0	1.5	Mature	Good	Access to inspect base - Not possible. Deadwood - Major. Decay / structural defect - Extensive. Decay / structural defect - Principal stems. Ivy or climbing plant. Shedding limb / limbs - Historic. Tree on bank.	452.4	12.0	20-40	B	1
G1236	50	*Populus sp.* Poplar sp.	18.0	1	40	N E S W 3.0 3.0 3.0 3.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Trees located offsite on west side of ditch Tree on bank.	72.4	4.8	20-40	B	2
G1237	25 20 20 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Salix caprea* Goat Willow/Great Sallow	12.0	1	35	N E S W 3.0 3.0 3.0 3.0	2.0	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Trees located offsite on West side of ditch Tree on bank.	55.4	4.2	20-40	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1238	200 150 50 50	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple	5.0	1	10	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown.	4.5	1.2	40+	C	2
G1239	6 3 1	*Prunus spinosa* Blackthorn/Sloe *Populus x canadensis* Hybrid Black Poplars *Fraxinus excelsior* Ash	20.0	1	60	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Die-back - Upper crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Natural regeneration.	162.9	7.2	40+	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1240	40	*Prunus spinosa* Blackthorn/Sloe	20.0	1	75	N E S W 8.0 8.0 8.0 8.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Ivy or climbing plant. Natural regeneration.	254.5	9.0	40+	A	2 3
	35	*Quercus robur* English Oak														
	30	*Crataegus monogyna* Common Hawthorn/Quick/May														
	25	*Salix fragilis* Crack Willow														
	20	*Fraxinus excelsior* Ash														
	20	*Ilex aquifolium* Holly														
	20	*Salix caprea* Goat Willow/Great Sallow														
	15	*Betula pendula* Silver Birch														
	10	*Ulmus procera* English Elm														
	10	*Corylus avellana* Common Hazel														
	6	*Populus x canadensis* Hybrid Black Poplars														
	5	*Acer campestre* Field Maple														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1240	5 5	*Tilia cordata* Small Leaved Lime *Acer pseudoplatanus* Sycamore														
G1241	8	*Prunus spinosa* Blackthorn/Sloe	10.0	1	30	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Natural regeneration.	40.7	3.6	40+	C	2
G1242	5	*Acer campestre* Field Maple	8.0	1	14	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Natural regeneration.	8.9	1.7	40+	C	2
H1243	150 100 10 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Swida sanguinea* Common Dogwood *Corylus avellana* Common Hazel *Acer campestre* Field Maple	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1244	3	*Fraxinus excelsior* Ash	14.0	1	30	N 5.0 E 5.0 S 5.0 W 5.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	40.7	3.6	20-40	B	2
G1245	2	*Fraxinus excelsior* Ash	16.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	72.4	4.8	20-40	B	2
G1246	2	*Fraxinus excelsior* Ash	18.0	3	51	N 6.0 E 6.0 S 6.0 W 6.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	122.1	6.2	20-40	B	2
G1247	3	*Fraxinus excelsior* Ash	16.0	1	30	N 5.0 E 5.0 S 5.0 W 5.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	40.7	3.6	20-40	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1248	15 10 5 5 2	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Quercus robur* English Oak	17.0	1	60	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	162.9	7.2	40+	B	2 3
G1249	2	*Fraxinus excelsior* Ash	16.0	1	30	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	40.7	3.6	20-40	B	2
G1250	3	*Acer campestre* Field Maple	14.0	1	30	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	40.7	3.6	20-40	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1251	250 200 50 50 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Swida sanguinea* Common Dogwood	7.0	1	14	N E S W 2.5 2.5 2.5 2.5	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown.	8.9	1.7	40+	C	2
G1252	2	*Salix caprea* Goat Willow/Great Sallow	12.0	1	30	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	40.7	3.6	40+	C	2
G1253	2	*Salix caprea* Goat Willow/Great Sallow	12.0	1	30	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	40.7	3.6	40+	C	2
G1254	2	*Salix caprea* Goat Willow/Great Sallow	12.0	1	30	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	40.7	3.6	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1255	5	*Salix caprea* Goat Willow/Great Sallow	12.0	1	30	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	40.7	3.6	40+	C	2
T1256	1	*Ulmus procera* English Elm	7.0	1	16	N E S W 1.5 1.5 1.5 1.5	2.0	2.0	Semi Mature	Good	Natural regeneration.	11.6	1.9	10-20	C	1
H1257	150 100 10 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Swida sanguinea* Common Dogwood *Corylus avellana* Common Hazel *Acer campestre* Field Maple	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
G1258	3	*Acer campestre* Field Maple	14.0	1	30	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	40.7	3.6	20-40	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1259	1	*Quercus robur* English Oak	13.0	1	58	N E S W 7.0 7.0 7.0 7.0	4.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems.	152.2	7.0	40+	B	1
T1260	1	*Acer campestre* Field Maple	13.0	3	31	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems.	44.0	3.7	40+	B	1
H1261	250 250 50 50 40	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Swida sanguinea* Common Dogwood *Acer campestre* Field Maple *Corylus avellana* Common Hazel	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1262	40 20 2 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Quercus robur* English Oak	7.0	1	10	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. Unmanaged hedge with sporadic outgrown trees.	4.5	1.2	40+	C	2
H1263	6 3	*Ulmus procera* English Elm *Crataegus monogyna* Common Hawthorn/Quick/May	6.0	1	16	N 1.5 E 1.5 S 1.5 W 1.5	0.0	0.0	Early Mature	Good	Decline - Evident / observed. Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown.	11.6	1.9	20-40	C	2
H1264	6 3	*Ulmus procera* English Elm *Crataegus monogyna* Common Hawthorn/Quick/May	9.0	1	16	N 1.5 E 1.5 S 1.5 W 1.5	0.0	0.0	Early Mature	Good	Decline - Evident / observed. Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown.	11.6	1.9	20-40	C	2
G1265	3 1	*Quercus robur* English Oak *Acer pseudoplatanus* Sycamore	19.0	1	75	N 9.0 E 9.0 S 9.0 W 9.0	5.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	254.5	9.0	40+	A	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1266	1	*Acer campestre* Field Maple	15.0	1	35	N E S W 5.0 5.0 5.0 5.0	0.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems.	55.4	4.2	40+	B	1
H1267	20 10 5 5 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm *Acer campestre* Field Maple *Quercus robur* English Oak	8.0	1	8	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. Unmanaged hedge with sporadic outgrown trees.	2.9	1.0	40+	C	2
T1268	1	*Malus sp.* Apple sp.	7.0	1	40	N E S W 3.5 3.5 3.5 3.5	1.0	1.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Epicormic growth - Crown. Tree located offsite on private property.	72.4	4.8	40+	B	1
T1269	1	*Malus sp.* Apple sp.	7.0	1	40	N E S W 3.5 3.5 3.5 3.5	1.0	1.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Epicormic growth - Crown. Tree located offsite on private property.	72.4	4.8	40+	B	1
H1270	40	*Fagus sylvatica* Common Beech	2.0	1	8	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1271	60	*Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	8	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
G1272	28 1 1	*Populus trichocarpa* Western Balsam Poplar (Black Cottonwood) *Ilex aquifolium* Holly *Crataegus monogyna* Common Hawthorn/Quick/May	22.0	1	45	N E S W 5.0 5.0 5.0 5.0	3.0	2.0	Early Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Trees located offsite on private property.	91.6	5.4	40+	B	2
T1273	1	*Quercus robur* English Oak	10.0	1	25	N E S W 4.0 4.0 4.0 4.0	0.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems.	28.3	3.0	40+	B	1
G1274	2 1	*Prunus spinosa* Blackthorn/Sloe *Ilex aquifolium* Holly	9.0	1	18	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	14.7	2.2	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1275	1	*Fraxinus excelsior* Ash	18.0	1	60	N E S W 10.0 10.0 10.0 10.0	4.0	4.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	162.9	7.2	20-40	B	1
T1276	1	*Fraxinus excelsior* Ash	18.0	1	58	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	152.2	7.0	20-40	B	1
H1277	150 100 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	3.0	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	4.5	1.2	40+	C	2
H1278	150 100 30 30	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Swida sanguinea* Common Dogwood *Acer campestre* Field Maple	4.0	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown.	4.5	1.2	40+	C	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1279	60 30 10 6 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm *Ilex aquifolium* Holly	7.0	1	14	N 2.5 E 2.5 S 2.5 W 2.5	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown. Unmanaged hedge with sporadic outgrown trees.	8.9	1.7	40+	C	2
G1280	8 5	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May	14.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	40.7	3.6	20-40	B	2
H1281	50 50 15 15	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer campestre* Field Maple	5.0	1	10	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown.	4.5	1.2	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1282	30 10 10 3 2	*Acer pseudoplatanus* Sycamore *Fraxinus excelsior* Ash *Quercus robur* English Oak *Fagus sylvatica* Common Beech *Picea abies* Norway Spruce	14.0	1	35	N 4.0 E 4.0 S 4.0 W 4.0	1.0	0.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Open woodland with large gaps in canopy.	55.4	4.2	40+	B	2
W1283	70 20 20	*Acer pseudoplatanus* Sycamore *Cerasus avium* Wild Cherry *Quercus robur* English Oak	14.0	1	35	N 4.0 E 4.0 S 4.0 W 4.0	1.0	0.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Fallen tree / trees - Whole tree. Closed canopy woodland. Cherry canker.	55.4	4.2	20-40	B	2
T1284	1	*Quercus robur* English Oak	13.0	1	118	N 6.0 E 4.0 S 4.0 W 6.5	2.0	4.0	Late Mature	Fair	Deadwood - Major. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems. Hollow trunk - Open cavity.	629.9	14.2	40+	A	3
T1285	1	*Quercus robur* English Oak	13.0	1	110	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Mature	Dead	Dead tree / trees. Deadwood - Major. Monolith.			0-10	U	
H1286	30	*Crataegus monogyna* Common Hawthorn/Quick/May	2.5	1	15	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Fair	Arboricultural work - Recent. Bark wound - Mammal. Hedgerow - Maintained. Ivy or climbing plant.	10.2	1.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1287	1	*Populus x canadensis* Hybrid Black Poplars	23.0	1	113	N E S W 10.0 7.0 8.0 9.0	3.0	4.0	Mature	Good	Deadwood - Major. Epicormic growth - Bole / principal stems. Excavation within root zone - Suspected. Shedding limb / limbs - Historic.	577.7	13.6	20-40	B	2
T1288	1	*Populus x canadensis* Hybrid Black Poplars	23.0	1	108	N E S W 9.0 10.0 8.0 4.0	3.0	5.0	Mature	Good	Deadwood - Major. Excavation within root zone - Suspected. Ivy or climbing plant. Shedding limb / limbs - Historic.	527.7	13.0	20-40	B	2
G1289	2 2	*Salix caprea* Goat Willow/Great Sallow *Quercus robur* English Oak	14.0	1	80	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Mature	Good	Crack - Longitudinal / shear crack. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Root environment - Waterlogged.	289.5	9.6	40+	B	2 3
T1290	1	*Populus x canadensis* Hybrid Black Poplars	24.0	1	137	N E S W 11.0 12.0 9.0 11.0	3.0	3.0	Mature	Good	Deadwood - Major. Epicormic growth - Base / bole / principal stems. Root damage - Suspected.	706.9	15.0	20-40	B	2
T1291	1	*Acer pseudoplatanus* Sycamore	7.0	1	23	N E S W 3.0 3.0 2.0 3.5	2.0	1.5	Semi Mature	Fair	Fork - Weak with included bark. Short shoot extension. Previously cut to hedge height.	23.9	2.8	40+	C	1 2
H1292	200	*Crataegus monogyna* Common Hawthorn/Quick/May	2.5	1	15	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Post Mature	Good	Arboricultural work - Recent. Hedgerow - Maintained. Multi-stemmed.	10.2	1.8	40+	B	2 3
W1293	40 20	*Acer pseudoplatanus* Sycamore *Crataegus monogyna* Common Hawthorn/Quick/May	8.0	1	17	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Young	Fair	Access to inspect base - Not possible. Coppice stool - Regrown. Hedge on eastern edge.	13.1	2.0	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1294	280	*Crataegus monogyna* Common Hawthorn/Quick/May	2.5	1	15	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained.	10.2	1.8	20-40	B	2 3
T1295	1	*Quercus robur* English Oak	14.0	1	95	N E S W 7.0 8.0 7.0 6.0	0.0	3.0	Mature	Fair	Access to inspect base - Restricted / obscured. Deadwood - Minor. Epicormic growth - Bole / principal stems. Hollow trunk - Open cavity. Shedding limb / limbs - Minor.	408.3	11.4	20-40	B	2 3
H1296	20 15 10 3 3 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Tilia cordata* Small Leaved Lime *Quercus robur* English Oak *Ilex aquifolium* Holly	2.5	1	7	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Young	Poor	Decline - Evident / observed. Young planted tree / trees. Gaps og old hedge planted, many not establishing well.	2.2	0.8	20-40	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1297	200 50 50 50 50 30 15	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ilex aquifolium* Holly *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak *Tilia cordata* Small Leaved Lime	2.5	1	7	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Semi Mature	Fair	Arboricultural work - Recent. Young planted tree / trees.	2.2	0.8	40+	C	2 3
H1298	40 7 3 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ilex aquifolium* Holly *Sorbus torminalis* Wild Service Tree	2.0	1	7	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Young	Fair	Staked tree / trees. Young planted tree / trees. Sparse hedge with large gaps.	2.2	0.8	20-40	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1299	150 30 30 15 10 10 10 10	*Acer pseudoplatanus* Sycamore *Pinus sylvestris* Scots Pine *Populus sp.* Poplar sp. *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Fraxinus excelsior* Ash *Fagus sylvatica* Common Beech *Picea abies* Norway Spruce	16.0	1	60	N 5.0 E 5.0 S 5.0 W 5.0	5.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Deadwood - Minor. Plantation rows still apparent. Dry pond to west.	162.9	7.2	40+	B	2 3
H1300	30 5 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder *Corylus avellana* Common Hazel	4.0	1	14	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Mature	Fair	Hedgerow - Neglected / overgrown. Large gaps in hedge, especially towards the east.	8.9	1.7	20-40	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1301	200 75 30 20 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Ulmus procera* English Elm	2.5	1	15	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Fair	Arboricultural work - Recent. Dutch elm disease. Hedgerow - Maintained. Ivy or climbing plant.	10.2	1.8	20-40	B	2 3
T1302	1	*Castanea sativa* Sweet Chestnut	16.0	1	132	N 7.0 E 7.0 S 6.0 W 6.0	3.0	0.0	Mature	Poor	Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Bifurcates at 3m. Short shoot extension.	706.9	15.0	40+	B	2 3
T1303	1	*Castanea sativa* Sweet Chestnut	16.0	1	89	N 6.0 E 7.0 S 6.0 W 8.0	4.0	4.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	358.3	10.7	20-40	B	2
T1304	1	*Quercus robur* English Oak	16.0	1	78	N 6.0 E 6.0 S 9.0 W 7.0	5.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Ivy or climbing plant.	275.2	9.4	40+	B	2 3
T1305	1	*Castanea sativa* Sweet Chestnut	13.0	1	100	N 7.0 E 7.0 S 6.0 W 6.0	3.0	0.5	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay / structural defect - Bole. Ivy or climbing plant.	452.4	12.0	20-40	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1306	1	*Quercus robur* English Oak	17.0	1	85	N E S W 6.0 6.0 7.0 6.0	3.0	4.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	326.9	10.2	40+	B	2
T1307	1	*Castanea sativa* Sweet Chestnut	14.0	1	74	N E S W 6.0 6.0 6.0 6.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	247.7	8.9	40+	B	3
T1308	1	*Quercus robur* English Oak	15.0	1	87	N E S W 7.0 8.0 9.0 7.0	4.0	5.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	342.4	10.4	40+	B	2 3
T1309	1	*Castanea sativa* Sweet Chestnut	15.0	1	84	N E S W 7.0 8.0 8.0 8.0	0.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Bifurcates at 4m.	319.2	10.1	40+	B	2
T1310	1	*Castanea sativa* Sweet Chestnut	15.0	1	127	N E S W 7.0 8.0 8.0 7.0	0.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Branch - Broken. Bark wound - Minor. Deadwood - Minor. Epicormic growth - Base. Ivy or climbing plant.	706.9	15.0	40+	B	2
H1311	150 5 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder *Castanea sativa* Sweet Chestnut	2.5	1	15	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Hedgerow - Maintained. Ivy or climbing plant.	10.2	1.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1312	7	*Acer campestre* Field Maple	2.5	1	15	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Arboricultural work - Recent. Hedgerow - Maintained.	10.2	1.8	40+	B	2 3
H1313	7 7 3 3	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer campestre* Field Maple	2.5	1	15	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Arboricultural work - Recent. Base / stems obscured - Vegetation. Hedgerow - Maintained.	10.2	1.8	40+	B	2 3
T1314	1	*Quercus robur* English Oak	2.5	1	13	N E S W 0.5 1.0 0.5 2.5	0.0	1.0	Young	Good	Young tree maintained like a hedgerow.	7.6	1.6	40+	C	2 3
T1315	1	*Quercus robur* English Oak	17.0	1	116	N E S W 7.0 8.0 7.0 7.0	1.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay entry points. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Epicormic growth - Base / bole / principal stems.	608.7	13.9	40+	B	2 3
G1316	8	*Ilex aquifolium* Holly	6.0	1	14	N E S W 2.0 2.0 2.0 2.0	1.0	0.0	Mature	Good	Coppice stool - Coppice origin / Mature stems. Side cut as a hedge.	8.9	1.7	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1317	25 20	*Sambucus nigra* Elder *Crataegus monogyna* Common Hawthorn/Quick/May	3.0	1	14	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Hedgerow - Neglected / overgrown. Occasional gaps within hedge.	8.9	1.7	10-20	C	2 3
W1318	200 100 100 75 50 50 50 30 25	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Salix caprea* Goat Willow/Great Sallow *Corylus avellana* Common Hazel *Ilex aquifolium* Holly *Cornus mas* Cornelian Cherry *Pinus sylvestris* Scots Pine *Cerasus avium* Wild Cherry *Malus sylvestris* Wild Crab	5.0	1	5	N E S W 1.0 1.0 1.0 1.0	1.0	1.0	Young	Good	Young planted tree / trees. 1m plastic tree guards around each tree.	1.1	0.6	40+	C	1 2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1319	250	*Crataegus monogyna* Common Hawthorn/Quick/May	6.0	1	5	N E S W 1.0 1.0 1.0 1.0	0.0	1.0	Young	Good	Young planted tree / trees. 1m plastic tree guards around trees.	1.1	0.6	40+	C	2 3
	90	*Acer campestre* Field Maple														
	90	*Prunus spinosa* Blackthorn/Sloe														
	50	*Corylus avellana* Common Hazel														
	30	*Ilex aquifolium* Holly														
	10	*Malus sylvestris* Wild Crab														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m) N	E	S	W	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1320	400	*Crataegus monogyna* Common Hawthorn/Quick/May	7.0	1	20	2.0	2.0	2.0	2.0	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Highway verge planting and hawthorn field boundary.	18.1	2.4	40+	B	2 3
	150	*Acer campestre* Field Maple																	
	50	*Quercus robur* English Oak																	
	40	*Fagus sylvatica* Common Beech																	
	20	*Ilex aquifolium* Holly																	
	20	*Alnus glutinosa* Common Alder																	
	2	*Larix decidua* European Larch/Common Larch																	

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1321	400 400 400 400 200	*Acer campestre* Field Maple *Pinus sylvestris* Scots Pine *Castanea sativa* Sweet Chestnut *Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May	16.0	1	35	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Branch - Broken. Form - Attenuated crown.	55.4	4.2	40+	B	2
H1322	25	*Sambucus nigra* Elder	3.5	1	13	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Minor. Hedgerow - Neglected / overgrown.	7.6	1.6	20-40	C	2 3
T1323	1	*Quercus robur* English Oak	16.0	1	133	N 5.0 E 6.0 S 8.0 W 6.0	0.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems. Pollard - Lapsed / Mature stems. Bark structure coarse and fissured.	706.9	15.0	40+	B	2 3
T1324	1	*Quercus robur* English Oak	15.0	2	84	N 7.0 E 8.0 S 8.0 W 7.0	1.0	1.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Bole. Epicormic growth - Crown. Bifurcates at 1.3m.	326.5	10.2	40+	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1325	1	*Quercus robur* English Oak	16.0	1	134	N 6.0 E 8.0 S 9.0 W 9.0	1.0	2.0	Mature	Good	Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Decay / structural defect - Base. Hollow trunk - Open cavity. Pollard - Lapsed / Mature stems.	706.9	15.0	40+	B	2 3
T1326	1	*Quercus robur* English Oak	16.0	1	103	N 8.0 E 7.0 S 3.0 W 7.0	1.0	4.0	Mature	Good	Deadwood - Major. Decay / structural defect - Base. Epicormic growth - Bole / principal stems. Fused stems.	479.9	12.4	40+	B	2 3
H1327	20	*Sambucus nigra* Elder	3.0	1	7	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Hedgerow - Neglected / overgrown.	2.2	0.8	20-40	C	2 3
T1328	1	*Crataegus monogyna* Common Hawthorn/Quick/May	4.0	8	19	N 2.0 E 3.0 S 2.0 W 3.0	0.0	0.5	Mature	Good	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Hedgerow - Neglected / overgrown.	17.7	2.4	20-40	C	2 3
T1329	1	*Fraxinus excelsior* Ash	16.0	6	83	N 7.0 E 7.0 S 7.0 W 7.0	1.0	0.5	Mature	Fair	Coppice stool - Coppice origin / Mature stems. Fork - Weak with included bark. Water pocket. Short shoot extension.	313.8	10.0	10-20	C	2 3
T1330	1	*Quercus robur* English Oak	16.0	1	54	N 7.0 E 6.0 S 7.0 W 5.0	1.0	2.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Epicormic growth - Bole / principal stems.	131.9	6.5	40+	C	1 2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1331	3 2 1	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus sp.* Cherry sp.	14.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Hedgerow - Maintained.	40.7	3.6	40+	B	2 3
T1332	1	*Fraxinus excelsior* Ash	16.0	1	89	N E S W 8.0 9.0 9.0 10.0	1.0	3.0	Mature	Fair	Bark wound - Minor. Deadwood - Minor. Girdling roots - Minor.	358.3	10.7	20-40	B	2 3
H1333	8 5 3	*Corylus avellana* Common Hazel *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May	4.0	1	15	N E S W 2.5 2.5 2.5 2.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Hedgerow - Neglected / overgrown.	10.2	1.8	20-40	C	2 3
T1334	1	*Quercus robur* English Oak	16.0	1	107	N E S W 8.0 8.0 8.0 3.0	1.0	3.0	Mature	Good	Branch - Broken. Deadwood - Minor. Epicormic growth - Bole / principal stems. Hollow trunk - Open cavity. Pollard - Lapsed / Mature stems.	517.9	12.8	40+	A	2 3
T1335	1	*Quercus robur* English Oak	17.0	1	74	N E S W 8.0 5.0 8.0 8.0	2.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Base. Shedding limb / limbs - Recent.	247.7	8.9	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1336	1	*Fraxinus excelsior* Ash	17.0	1	75	N E S W 6.0 7.0 8.0 7.0	0.0	4.0	Mature	Fair	Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Lesion or fracture on stem / bole - Major.	254.5	9.0	20-40	C	2 3
G1337	4 3 2	*Corylus avellana* Common Hazel *Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May	10.0	1	38	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Hedgerow - Neglected / overgrown. Shedding limb / limbs - Recent.	65.3	4.6	20-40	B	2 3
H1338	100 15	*Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm	5.0	1	6	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown.	1.6	0.7	20-40	C	2 3
T1339	1	*Fraxinus excelsior* Ash	16.0	5	82	N E S W 8.0 8.0 8.0 8.0	2.0	4.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Crown. Epicormic growth - Bole / principal stems. Short shoot extension.	309.7	9.9	20-40	C	2 3
G1340	4 1	*Acer campestre* Field Maple *Quercus robur* English Oak	7.0	1	30	N E S W 3.5 3.5 3.5 3.5	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	40.7	3.6	40+	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1341	1	*Carpinus betulus* Hornbeam	12.0	3	64	N E S W 6.0 7.0 6.0 5.0	0.5	0.5	Mature	Good	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Fork - Suspected structurally sound. Ivy or climbing plant. Rubbing limbs.	185.8	7.7	20-40	B	2 3
G1342	75 2 1	*Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm *Corylus avellana* Common Hazel	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Dutch elm disease. Dead tree / trees. Hedgerow - Neglected / overgrown.	2.2	0.8	40+	C	2 3
H1343	60 30 5 2 1 1	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Quercus robur* English Oak *Ilex aquifolium* Holly *Fraxinus excelsior* Ash	6.0	1	13	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Ivy or climbing plant.	7.6	1.6	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1344	1	*Quercus robur* English Oak	15.0	1	85	N E S W 8.0 8.0 8.0 5.0	1.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Epicormic growth - Bole / principal stems. Bark structure coarse and fissured with burrs.	326.9	10.2	40+	B	2 3
T1345	1	*Quercus robur* English Oak	16.0	1	104	N E S W 8.0 7.0 8.0 9.0	1.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Base. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	489.3	12.5	40+	B	2 3
T1346	1	*Fraxinus excelsior* Ash	12.0	10	63	N E S W 7.0 4.0 7.0 8.0	1.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Ivy or climbing plant.	181.0	7.6	40+	C	2 3
T1347	1	*Quercus robur* English Oak	17.0	1	155	N E S W 8.0 9.0 8.5 9.5	0.5	2.5	Ancient or Veteran	Fair	Deadwood - Major. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Hollow trunk - Open cavity. Ivy or climbing plant. Pollard - Lapsed / Mature stems. Woodpecker holes.	706.9	15.0	40+	A	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1348	300 50 50 40	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm	2.5	1	15	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Dutch elm disease. Hedgerow - Maintained. Ivy or climbing plant.	10.2	1.8	40+	B	2 3
T1349	1	*Quercus robur* English Oak	16.0	1	75	N 7.0 E 7.0 S 7.0 W 7.0	0.5	4.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Girdling roots - Minor. Ivy or climbing plant.	254.5	9.0	40+	B	2 3
T1350	1	*Quercus robur* English Oak	13.0	1	100	N 7.0 E 7.0 S 7.0 W 7.0	3.0	4.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Bark structure coarse and fissured.	452.4	12.0	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1351	20 10 10 10 2	*Quercus robur* English Oak *Betula pendula* Silver Birch *Sorbus sp.* Sorbus sp. *Tilia cordata* Small Leaved Lime *Picea abies* Norway Spruce	6.0	1	6	N 1.0 E 1.0 S 1.0 W 1.0	1.0	1.0	Young	Good	Young planted tree / trees. 1m plastic guards around trees. Garden planting to the west in gardens comprise laurel and cyptress.	1.6	0.7	40+	C	2 3
G1352	4	*x Cupressocyparis leylandii* Leyland Cypress	14.0	1	45	N 5.0 E 5.0 S 5.0 W 5.0	2.0	2.0	Early Mature	Fair	Access to inspect base - Not possible.	91.6	5.4	40+	C	2
H1353	350 50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ilex aquifolium* Holly	2.5	1	5	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. Spiral guards around stems.	1.1	0.6	40+	C	2
G1354	2	*Sambucus nigra* Elder	3.5	5	22	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Mature	Fair	Growing on earth mound.	22.6	2.7	20-40	C	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1355	100 30 15 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ilex aquifolium* Holly	2.5	1	5	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. Spiral guards around stems.	1.1	0.6	40+	C	2
T1356	1	*Quercus robur* English Oak	16.0	1	110	N E S W 7.0 7.0 7.0 6.0	1.0	3.0	Mature	Fair	Altered ground level - Historic. Bark wound - Major. Deadwood - Major. Decay / structural defect - Base. Shedding limb / limbs - Historic. Water pocket.	547.4	13.2	40+	B	2 3
T1357	1	*Fagus sylvatica* Common Beech	17.0	1	80	N E S W 7.0 7.0 7.0 8.0	0.5	3.0	Mature	Fair	Altered ground level - Historic. Branch - Broken. Competition - Adjacent trees. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor.	289.5	9.6	40+	B	2 3
G1358	10 4 2 1	*Sambucus nigra* Elder *Ulmus procera* English Elm *Acer pseudoplatanus* Sycamore *Salix caprea* Goat Willow/Great Sallow	10.0	1	35	N E S W 3.5 3.5 3.5 3.5	0.0	0.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Altered ground level - Historic.	55.4	4.2	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1359	1	*Fagus sylvatica* Common Beech	15.0	3	54	N E S W 6.0 6.0 6.0 6.0	1.0	2.0	Mature	Poor	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Base / stems obscured - Vegetation. Fungal fruiting body - structural decay suspected. Fallen tree / trees - Partial collapse. Ganoderma			0-10	U	
G1360	7	*Fagus sylvatica* Common Beech	17.0	2	56	N E S W 6.0 6.0 6.0 6.0	0.5	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Bole / principal stems. Stems - Co-dominant.	144.8	6.8	10-20	C	2
T1361	1	*Salix caprea* Goat Willow/Great Sallow	5.0	6	24	N E S W 4.0 4.0 3.0 5.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Branch - Broken. Multi-stemmed.	27.1	2.9	20-40	C	2
G1362	2	*Sambucus nigra* Elder	4.0	4	16	N E S W 2.5 2.5 2.5 2.5	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Deadwood - Minor. Multi-stemmed.	11.6	1.9	20-40	C	2 3
G1363	30 30 15	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Prunus sp.* Cherry sp.	7.0	1	10	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Form - Attenuated crown. Fallen tree / trees - Partial collapse.	4.5	1.2	20-40	C	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1364	1	*Castanea sativa* Sweet Chestnut	13.0	1	67	N E S W 6.0 6.0 6.0 6.0	0.0	3.0	Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decline - Evident / observed. Deadwood - Major. Ivy or climbing plant. Weak live growth.	203.1	8.0	10-20	C	2 3
H1365	15	*Sambucus nigra* Elder	3.0	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	4.5	1.2	10-20	C	3
G1366	6 3	*Ulmus sp.* Elm sp. *Crataegus monogyna* Common Hawthorn/Quick/May	9.0	1	25	N E S W 3.5 3.5 3.5 3.5	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Hedgerow - Neglected / overgrown.	28.3	3.0	20-40	B	2 3
G1367	30	*Ulmus sp.* Elm sp.	11.0	1	12	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Semi Mature	Poor	Access to inspect base - Restricted / obscured. Dutch elm disease. Dead tree / trees. Deadwood - Minor.			0-10	U	

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1368	15 6 5 3 1	*Acer campestre* Field Maple *Ilex aquifolium* Holly *Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Prunus spinosa* Blackthorn/Sloe	14.0	1	45	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Fallen tree / trees - Partial collapse. Hedgerow - Historic. Ivy or climbing plant.	91.6	5.4	40+	B	2 3
H1369	220 8	*Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak	8.0	1	20	N 2.5 E 2.5 S 2.5 W 2.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown. Established planted hedge with occasional maiden oak trees.	18.1	2.4	40+	B	2 3
T1370	1	*Fraxinus excelsior* Ash	17.0	1	74	N 7.0 E 8.0 S 7.0 W 5.0	4.0	4.0	Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base. Ivy or climbing plant. Short shoot extension.	247.7	8.9	20-40	C	2 3
T1371	1	*Quercus robur* English Oak	17.0	1	78	N 6.0 E 5.0 S 8.0 W 6.5	4.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	275.2	9.4	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1372	1	*Quercus robur* English Oak	17.0	1	137	N E S W 10.0 9.0 9.0 9.0	4.0	2.5	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Major. Decay / structural defect - Base. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Bifurcates at 2.5m, possible originally a pollard.	706.9	15.0	40+	B	2 3
H1373	100 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Castanea sativa* Sweet Chestnut	2.5	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. Ivy or climbing plant.	4.5	1.2	40+	B	2 3
T1374	1	*Castanea sativa* Sweet Chestnut	13.0	1	63	N E S W 6.0 2.0 5.0 5.0	4.0	5.0	Mature	Fair	Access to inspect base - Restricted / obscured. Competition - Adjacent trees. Ivy or climbing plant. Bifurcates at 3m.	179.6	7.6	40+	C	2 3
T1375	1	*Castanea sativa* Sweet Chestnut	14.0	1	79	N E S W 7.0 7.0 8.0 4.0	3.0	3.0	Mature	Fair	Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Base. Epicormic growth - Base. Ivy or climbing plant. Crown break at 3m typical of pollard.	282.3	9.5	20-40	C	2 3
T1376	1	*Castanea sativa* Sweet Chestnut	14.0	1	82	N E S W 5.0 5.0 6.0 6.0	2.5	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Branch - Broken. Deadwood - Minor. Ivy or climbing plant.	304.2	9.8	40+	B	1 2 3
H1377	2	*Sambucus nigra* Elder	2.5	1	12	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Coppice stool - Coppice origin / Mature stems. Hedgerow - Maintained.	6.5	1.4	40+	C	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1378	1	*Quercus robur* English Oak	13.0	1	78	N 4.0 E 5.0 S 7.0 W 6.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Base. Ivy or climbing plant.	275.2	9.4	40+	C	2 3
T1379	1	*Quercus robur* English Oak	12.0	1	73	N 4.0 E 4.0 S 7.0 W 7.0	3.0	5.0	Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Major. Ivy or climbing plant.	241.1	8.8	10-20	C	2 3
T1380	1	*Castanea sativa* Sweet Chestnut	13.0	1	98	N 4.0 E 7.0 S 8.0 W 2.0	3.0	3.0	Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Major. Epicormic growth - Base. Ivy or climbing plant. Weak live growth.	434.5	11.8	10-20	C	2 3
T1381	1	*Castanea sativa* Sweet Chestnut	14.0	1	104	N 5.0 E 6.0 S 7.0 W 6.0	3.0	2.0	Mature	Poor	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base. Ivy or climbing plant.	489.3	12.5	20-40	C	2 3
T1382	1	*Quercus robur* English Oak	12.0	1	69	N 5.0 E 3.0 S 5.0 W 6.0	3.0	3.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay / structural defect - Base. Ivy or climbing plant. Weak live growth. Bark structure coarse and fissured.	215.4	8.3	40+	C	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1383	1	*Quercus robur* English Oak	13.0	1	78	N E S W 6.5 6.5 6.0 5.0	3.0	4.0	Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Bark wound - Minor. Deadwood - Minor. Decay / structural defect - Base. Ivy or climbing plant. Weak live growth.	275.2	9.4	20-40	C	1 2 3
T1384	1	*Quercus robur* English Oak	18.0	1	124	N E S W 6.0 7.5 8.0 7.0	2.5	6.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Major. Decay / structural defect - Base. Ivy or climbing plant.	695.6	14.9	40+	B	2 3
H1385	140 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Castanea sativa* Sweet Chestnut	2.5	1	18	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. Ivy or climbing plant.	14.7	2.2	40+	B	2 3
H1386	100 10 8	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ilex aquifolium* Holly	7.0	1	20	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Hedgerow - Neglected / overgrown.	18.1	2.4	20-40	B	2 3
T1387	1	*Fraxinus excelsior* Ash	15.0	5	62	N E S W 4.0 8.0 6.0 8.0	0.5	0.0	Mature	Fair	Altered ground level - Historic. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Crown. Fungal fruiting body - structural decay suspected. Fused stems.	177.3	7.5	20-40	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1388	50	*Prunus spinosa* Blackthorn/Sloe	5.0	1	9	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown.	3.7	1.1	40+	C	2 3
T1389	1	*Sambucus nigra* Elder	4.0	12	17	N E S W 1.5 2.0 1.5 2.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor.	13.6	2.1	10-20	C	2 3
T1390	1	*Quercus robur* English Oak	10.0	2	48	N E S W 5.0 6.0 5.0 6.0	0.5	1.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Epicormic growth - Crown. Fused stems. Bifurcates at 1m. Branches torn from flailing.	106.0	5.8	40+	C	1 2 3
G1391	20 11 9 8 5 2	*Prunus spinosa* Blackthorn/Sloe *Ilex aquifolium* Holly *Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder *Acer campestre* Field Maple	11.0	1	40	N E S W 3.5 3.5 3.5 3.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Hedgerow - Historic. Hedgerow - Neglected / overgrown.	72.4	4.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1392	1	*Quercus robur* English Oak	18.0	1	151	N E S W 9.0 9.0 8.0 9.0	4.0	4.0	Ancient or Veteran	Good	Access to inspect base - Restricted / obscured. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Decay / structural defect - Base. Epicormic growth - Bole / principal stems. Hollow trunk - Open cavity. Pollard - Lapsed / Mature stems.	706.9	15.0	40+	A	2 3
T1393	1	*Carpinus betulus* Hornbeam	16.0	1	90	N E S W 8.0 8.0 8.0 7.0	0.5	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Rubbing limbs. Exposed roots. Bark fissured.	366.4	10.8	40+	A	2 3
T1394	1	*Quercus robur* English Oak	17.0	1	155	N E S W 8.0 8.0 10.0 10.0	2.0	2.0	Ancient or Veteran	Good	Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Decay / structural defect - Base. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Hollow trunk - Open cavity.	706.9	15.0	40+	A	2 3
G1395	4 2 1	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder	6.0	1	20	N E S W 2.5 2.5 2.5 2.5	0.0	0.0	Mature	Good	Coppice stool - Coppice origin / Mature stems. Hedgerow - Neglected / overgrown.	18.1	2.4	20-40	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1396	300 300 250 30 20 15	*Larix decidua* European Larch/Common Larch *Pseudotsuga menziesii* Douglas Fir *Castanea sativa* Sweet Chestnut *Fraxinus excelsior* Ash *Acer campestre* Field Maple *Quercus rubra* Red Oak	20.0	1	45	N 4.0 E 4.0 S 4.0 W 4.0	5.0	4.0	Mature	Good	Form - Attenuated crown. Fallen tree / trees - Whole tree.	91.6	5.4	20-40	C	2
T1397	1	*Quercus robur* English Oak	18.0	1	132	N 6.0 E 6.0 S 7.0 W 4.0	1.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Competition - Adjacent trees. Deadwood - Major. Decay / structural defect - Base. Epicormic growth - Bole / principal stems. Hollow trunk - Open cavity. Bark structure coarse and fissured.	706.9	15.0	40+	A	2 3
T1398	1	*Quercus robur* English Oak	17.0	1	102	N 6.0 E 6.0 S 8.0 W 5.0	1.0	3.0	Mature	Good	Branch - Broken. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Decay / structural defect - Base. Epicormic growth - Bole / principal stems. Fungal fruiting body - structural decay suspected.	470.7	12.2	40+	A	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1399	1	*Crataegus monogyna* Common Hawthorn/Quick/May	9.0	4	45	N 5.0 E 5.0 S 6.0 W 5.0	1.0	0.0	Mature	Good	Branch - Broken. Crack - Longitudinal / shear crack. Coppice stool - Coppice origin / Mature stems. Decay / structural defect - Bole. Rubbing limbs.	93.6	5.5	40+	A	2 3
T1400	1	*Quercus robur* English Oak	16.0	1	91	N 7.0 E 8.0 S 8.0 W 8.0	3.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems.	374.6	10.9	40+	B	2 3
T1401	1	*Quercus robur* English Oak	15.0	1	97	N 7.0 E 9.0 S 6.0 W 6.0	2.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Hollow trunk - Open cavity. Leaning trunk - Major.	425.7	11.6	20-40	B	2 3
T1402	1	*Fraxinus excelsior* Ash	16.0	1	67	N 7.0 E 8.0 S 7.0 W 4.0	2.0	0.0	Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Major. Epicormic growth - Base. Epicormic growth - Crown. Weak live growth.	203.1	8.0	10-20	C	2 3
T1403	1	*Fraxinus excelsior* Ash	16.0	4	79	N 7.0 E 8.0 S 6.0 W 8.0	2.5	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Leaning trunk - Major. Shedding limb / limbs - Historic.	285.4	9.5	10-20	C	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1404	1	*Quercus robur* English Oak	16.0	1	85	N E S W 7.0 8.0 7.0 7.0	1.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Major. Decay / structural defect - Localised. Lesion or fracture on limb / limbs - Minor.	326.9	10.2	40+	B	2 3
H1405	300	*Crataegus monogyna* Common Hawthorn/Quick/May	6.0	1	25	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Hedgerow - Historic. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Occasional gaps in hedge.	28.3	3.0	40+	B	2 3
T1406	1	*Quercus robur* English Oak	17.0	1	116	N E S W 10.0 6.0 10.0 3.0	1.0	3.0	Mature	Good	Competition - Adjacent trees. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Ivy or climbing plant.	608.7	13.9	40+	B	2 3
G1407	22 1 1	*Acer pseudoplatanus* Sycamore *Fraxinus excelsior* Ash *Crataegus monogyna* Common Hawthorn/Quick/May	17.0	1	50	N E S W 6.0 6.0 6.0 6.0	2.0	0.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Ivy or climbing plant. Trees on slopes of crater.	113.1	6.0	40+	C	2 3
G1408	30	*Sambucus nigra* Elder	3.0	1	15	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Poor	Access to inspect base - Not possible. Die-back - Throughout crown. Trees on banks of crater.	10.2	1.8	10-20	C	3
G1409	50	*Ulmus sp.* Elm sp.	9.0	1	14	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Semi Mature	Poor	Access to inspect base - Restricted / obscured. Dutch elm disease. Dead tree / trees. Ivy or climbing plant.	8.9	1.7	10-20	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1410	1	*Ilex aquifolium* Holly	8.0	1	37	N E S W 2.5 2.5 2.5 2.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Base. Ivy or climbing plant.	61.9	4.4	40+	B	2 3
T1411	1	*Crataegus monogyna* Common Hawthorn/Quick/May	3.0	1	14	N E S W 0.5 0.5 0.5 0.5	2.0	2.0	Mature	Poor	Ivy or climbing plant. Few live branches following recent work.			0-10	U	
T1412	1	*Crataegus monogyna* Common Hawthorn/Quick/May	3.0	1	14	N E S W 0.5 0.5 1.5 0.5	2.0	2.0	Mature	Poor	Ivy or climbing plant. Few live branches following recent work.			0-10	U	
G1413	3	*Fraxinus excelsior* Ash	17.0	1	80	N E S W 7.0 7.0 7.0 7.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Branch - Broken. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Fork - Weak with included bark. Ivy or climbing plant.	289.5	9.6	20-40	C	2 3
G1414	2 1	*Corylus avellana* Common Hazel *Quercus robur* English Oak	9.0	1	32	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown.	46.3	3.8	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1415	500 50 50 30	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe	3.0	1	15	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Hedgerow - Maintained. Ivy or climbing plant. Several gaps in hedge, continuous scrub bramble. Roadside top flailed.	10.2	1.8	20-40	C	2 3
T1416	1	*Quercus robur* English Oak	18.0	1	97	N 8.0 E 8.0 S 8.0 W 8.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Minor. Ivy or climbing plant.	425.7	11.6	40+	B	1 2 3
T1417	1	*Fraxinus excelsior* Ash	13.0	1	45	N 6.0 E 6.0 S 6.0 W 6.0	2.0	2.0	Mature	Good	Access to inspect base - Not possible.	91.6	5.4	40+	C	2 3
H1418	30 5	*Cordyline obtecta* *Ligustrum lucidum* Glossy Privet/Chinese Privet	1.0	1	7	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.2	0.8	20-40	C	2
H1419	540	*Crataegus monogyna* Common Hawthorn/Quick/May	4.0	1	12	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Hedgerow - Maintained. Highway side and top flailed.	6.5	1.4	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1420	800 800 750 400 300 200 200 200 100 50	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Pinus sylvestris* Scots Pine *Betula pendula* Silver Birch *Quercus robur* English Oak *Prunus spinosa* Blackthorn/Sloe *Castanea sativa* Sweet Chestnut *Acer pseudoplatanus* Sycamore *Fraxinus excelsior* Ash *Picea abies* Norway Spruce	17.0	1	35	N 4.0 E 4.0 S 4.0 W 4.0	3.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Established woodland, trees have plastic rubes in place. Row thinning undertaken. Northern edge is tiered with hedge type planting.	55.4	4.2	40+	C	2 3
T1421	1	*Quercus robur* English Oak	18.0	1	158	N 7.0 E 8.0 S 5.0 W 7.0	7.0	3.0	Ancient or Veteran	Good	Deadwood - Major. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems. Shedding limb / limbs - Major.	706.9	15.0	40+	A	3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1422	250 200 200 100 100	*Pinus sylvestris* Scots Pine *Castanea sativa* Sweet Chestnut *Quercus robur* English Oak *Fagus sylvatica* Common Beech *Acer pseudoplatanus* Sycamore	17.0	1	45	N 4.0 E 4.0 S 4.0 W 4.0	5.0	0.0	Mature	Good	Base / stems obscured - Vegetation. Form - Attenuated crown.	91.6	5.4	40+	B	2
H1423	250 30	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel	3.5	1	18	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Hedgerow - Maintained. Ivy or climbing plant. Not cut for at least one year.	14.7	2.2	40+	B	2 3
G1424	15	*Crataegus monogyna* Common Hawthorn/Quick/May	5.0	1	20	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Root environment - Restricted. On edge of pond.	18.1	2.4	40+	C	2 3
H1425	400 200 100	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	2.5	1	15	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. Highwayside and top have been cut.	10.2	1.8	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1426	25 10 5 1	*Quercus robur* English Oak *Cerasus avium* Wild Cherry *Fraxinus excelsior* Ash *Crataegus monogyna* Common Hawthorn/Quick/May	13.0	1	28	N E S W 4.5 4.5 4.5 4.5	3.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation.	35.5	3.4	40+	C	2 3
T1427	1	*Quercus robur* English Oak	13.0	1	46	N E S W 6.0 7.0 7.0 7.0	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Minor. North of ditch.	95.7	5.5	40+	C	2 3
T1428	1	*Quercus robur* English Oak	13.0	1	47	N E S W 7.0 6.0 8.0 7.0	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. North of ditch. Crown break at hedge height suggests historically topped.	99.9	5.6	40+	C	2 3
T1429	1	*Quercus robur* English Oak	13.0	1	42	N E S W 6.0 5.0 7.0 4.0	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant. North of ditch.	79.8	5.0	40+	C	2 3
G1430	6	*Populus sp.* Poplar sp.	16.0	1	40	N E S W 5.0 5.0 5.0 5.0	2.0	1.0	Mature	Good	Access to inspect base - Not possible. Epicormic growth - Crown. Root environment - Waterlogged.	72.4	4.8	20-40	C	1 2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1431	1	*Populus sp.* Poplar sp.	18.0	1	153	N E S W 11.0 11.0 10.0 10.0	1.0	1.0	Mature	Fair	Access to inspect base - Restricted / obscured. Branch - Broken. Deadwood - Minor. Epicormic growth - Crown. Shedding limb / limbs - Historic.	706.9	15.0	10-20	C	2
T1432	1	*Acer pseudoplatanus* Sycamore	11.0	1	32	N E S W 5.0 5.0 5.0 5.0	4.0	3.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Base. Short shoot extension.	46.3	3.8	40+	C	1 2
T1433	1	*Acer pseudoplatanus* Sycamore	12.0	1	37	N E S W 6.0 7.0 7.0 7.0	4.0	2.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base. Short shoot extension.	61.9	4.4	40+	C	1 2
T1434	1	*Acer pseudoplatanus* Sycamore	7.0	1	14	N E S W 2.5 2.5 2.5 2.5	3.0	2.0	Young	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Short shoot extension.	8.9	1.7	40+	C	1
T1435	1	*Quercus robur* English Oak	13.0	1	49	N E S W 6.0 5.0 6.0 6.0	3.0	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Minor. Ivy or climbing plant.	108.6	5.9	40+	C	1
T1436	1	*Quercus robur* English Oak	12.0	1	53	N E S W 7.0 7.0 7.0 7.0	3.0	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Minor. Ivy or climbing plant.	127.1	6.4	40+	C	1 2
T1437	1	*Quercus robur* English Oak	14.0	1	47	N E S W 7.0 7.0 7.0 7.0	2.0	3.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Ivy or climbing plant. No single leader from 3m, possibly topped when young.	99.9	5.6	40+	C	1 2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1438	1	*Quercus robur* English Oak	10.0	1	33	N E S W 4.5 4.5 4.5 4.5	3.0	2.0	Semi Mature	Good	Bark exudation. Base / stems obscured - Vegetation. Bark wound - Mechanical. Ivy or climbing plant. No single leader from 3m, possibly topped when young.	49.3	4.0	40+	C	1 2
H1439	240 90 30 30	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Corylus avellana* Common Hazel	2.5	1	15	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Hedgerow - Maintained. Ivy or climbing plant. Field side of ditch.	10.2	1.8	40+	B	2 3
T1440	1	*Quercus robur* English Oak	15.0	1	66	N E S W 7.0 8.0 7.0 7.0	3.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Ivy or climbing plant.	197.1	7.9	40+	B	2 3
T1441	1	*Quercus robur* English Oak	16.0	1	71	N E S W 6.0 6.0 5.0 5.0	3.0	3.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Ivy or climbing plant. Stag-headed crown.	228.0	8.5	40+	B	2 3
T1442	1	*Quercus robur* English Oak	16.0	1	69	N E S W 7.0 7.0 7.0 7.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	215.4	8.3	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1443	1	*Quercus robur* English Oak	16.0	1	75	N 6.0 E 8.0 S 7.0 W 8.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Base. Ivy or climbing plant.	254.5	9.0	40+	B	2 3
T1444	1	*Quercus robur* English Oak	16.0	1	67	N 7.0 E 6.0 S 5.0 W 6.0	3.0	5.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Major. Ivy or climbing plant.	203.1	8.0	40+	B	2 3
T1445	1	*Quercus robur* English Oak	16.0	1	74	N 6.0 E 7.0 S 7.0 W 6.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Base. Ivy or climbing plant.	247.7	8.9	40+	B	2 3
T1446	1	*Quercus robur* English Oak	17.0	1	74	N 8.0 E 8.0 S 7.0 W 9.0	2.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	247.7	8.9	40+	B	2 3
T1447	1	*Quercus robur* English Oak	11.0	1	79	N 7.0 E 6.0 S 4.0 W 4.5	3.0	4.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Bark structure coarse and fissured. Pruning stubs over field.	282.3	9.5	40+	B	3
T1448	1	*Quercus robur* English Oak	16.0	1	72	N 6.0 E 8.0 S 7.0 W 9.0	3.0	5.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Major. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	234.5	8.6	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1449	1	*Fraxinus excelsior* Ash	15.0	1	29	N E S W 2.0 4.0 2.0 1.0	5.0	4.0	Early Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Major. Epicormic growth - Crown. Ivy or climbing plant.			0-10	U	
T1450	1	*Quercus robur* English Oak	17.0	1	99	N E S W 6.0 8.0 7.0 8.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Bark wound - Minor. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Bark structure coarse and fissured.	443.4	11.9	40+	B	2 3
T1451	1	*Quercus robur* English Oak	17.0	1	73	N E S W 8.0 8.0 6.0 8.0	3.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	241.1	8.8	40+	B	2 3
H1452	300 50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	2.5	1	13	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Base / stems obscured - Vegetation. Hedgerow - Maintained. Ivy or climbing plant.	7.6	1.6	40+	B	2 3
H1453	20 20	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May	2.5	1	13	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good		7.6	1.6	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1454	1	*Fraxinus excelsior* Ash	16.0	1	33	N E S W 4.0 6.0 4.0 4.0	4.0	4.0	Early Mature	Poor	Access to inspect base - Not possible. Decline - Suspected. Deadwood - Major. Ivy or climbing plant.	49.3	4.0	10-20	C	2 3
H1455	400 100	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	2.5	1	14	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	8.9	1.7	40+	B	2 3
W1456	200 200 200 200 200	*Alnus glutinosa* Common Alder *Betula pendula* Silver Birch *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Quercus robur* English Oak	15.0	1	28	N E S W 4.0 4.0 4.0 4.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Not possible. Bark wound - Mammal.	35.5	3.4	40+	B	2 3
T1457	1	*Quercus robur* English Oak	14.0	1	65	N E S W 7.0 9.0 7.0 4.0	3.0	3.0	Mature	Fair	Access to inspect base - Not possible. Deadwood - Minor. Ivy or climbing plant. Leaning trunk - Minor. Root environment - Waterlogged.	191.1	7.8	40+	C	2 3
T1458	1	*Quercus robur* English Oak	18.0	1	124	N E S W 9.0 7.0 9.0 9.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Buttresses / buttress roots - Major adaptive growth / strong development. Deadwood - Major. Ivy or climbing plant. Root environment - Waterlogged.	695.6	14.9	40+	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1459	1	*Quercus robur* English Oak	14.0	1	48	N E S W 2.0 3.0 4.0 5.0	3.0	3.0	Mature	Fair	Access to inspect base - Restricted / obscured. Branch - Broken. Competition - Adjacent trees. Deadwood - Minor.	104.2	5.8	40+	C	2 3
T1460	1	*Quercus robur* English Oak	18.0	1	86	N E S W 5.0 10.0 9.0 6.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Branch - Broken. Decay / structural defect in crown limb / limbs - Minor. Deadwood - Major. Pruning wounds - Historic.	334.6	10.3	40+	B	2 3
T1461	1	*Fraxinus excelsior* Ash	18.0	1	114	N E S W 9.0 12.0 10.0 8.0	4.0	8.0	Mature	Good	Access to inspect base - Restricted / obscured. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Ivy or climbing plant. Shedding limb / limbs - Historic.	587.9	13.7	40+	B	2 3
T1462	1	*Quercus robur* English Oak	16.0	1	60	N E S W 4.0 4.0 2.0 5.0	5.0	1.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Competition - Adjacent trees. Deadwood - Minor. Decay / structural defect - Bole. Ivy or climbing plant.	162.9	7.2	20-40	C	2 3
T1463	1	*Quercus robur* English Oak	14.0	1	63	N E S W 5.0 5.0 8.0 5.0	4.0	5.0	Mature	Fair	Base / stems obscured - Vegetation. Deadwood - Major. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems.	179.6	7.6	40+	B	2 3
T1464	1	*Fraxinus excelsior* Ash	18.0	1	94	N E S W 9.0 11.0 9.0 10.0	4.0	6.0	Mature	Fair	Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Open cavity / cavities. Shedding limb / limbs - Recent.	399.7	11.3	20-40	B	2
W1465	450	*Pseudotsuga menziesii* Douglas Fir	17.0	1	40	N E S W 4.0 4.0 4.0 4.0	4.0	4.0	Early Mature	Good	Access to inspect base - Not possible.	72.4	4.8	40+	C	1 2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1466	50 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	6.0	1	15	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown. Woodland side of ditch.	10.2	1.8	20-40	B	2 3
T1467	1	*Quercus robur* English Oak	12.0	3	49	N E S W 7.0 6.0 7.0 6.0	3.0	2.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Bole. Twin-stemmed.	110.9	5.9	40+	C	2 3
H1468	60 25 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Sambucus nigra* Elder	2.5	1	13	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. East of ditch.	7.6	1.6	40+	B	2 3
H1469	90	*Ulmus sp.* Elm sp.	7.0	1	13	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Poor	Access to inspect base - Restricted / obscured. Dutch elm disease. Dead tree / trees. Fallen tree / trees - Whole tree.	7.6	1.6	10-20	C	2 3
T1470	1	*Quercus robur* English Oak	13.0	1	56	N E S W 7.0 6.0 6.0 7.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	141.9	6.7	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1471	1	*Quercus robur* English Oak	13.0	1	46	N E S W 6.0 7.0 6.0 6.0	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Minor. Decay / structural defect - Base. Pruning stubs to east.	95.7	5.5	40+	C	2 3
T1472	1	*Quercus robur* English Oak	11.0	1	48	N E S W 5.0 5.0 6.0 6.0	3.0	2.5	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay / structural defect - Base. Rubbing limbs.	104.2	5.8	40+	C	2 3
T1473	1	*Quercus robur* English Oak	7.0	1	14	N E S W 3.0 1.0 3.0 1.0	2.5	2.0	Young	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Leaning trunk - Major.	8.9	1.7	40+	C	1
T1474	1	*Quercus robur* English Oak	12.0	1	33	N E S W 5.0 5.0 5.0 5.0	3.0	3.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Fork - Weak with included bark.	49.3	4.0	40+	C	2 3
T1475	1	*Quercus robur* English Oak	13.0	1	72	N E S W 6.0 7.0 6.0 7.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Crack - Longitudinal / shear crack. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Decay / structural defect - Base. Epicormic growth - Bole / principal stems.	234.5	8.6	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1476	1	*Quercus robur* English Oak	17.0	1	79	N E S W 6.0 8.0 7.0 8.0	3.0	2.5	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Bark wound - Minor. Deadwood - Major. Ivy or climbing plant.	282.3	9.5	40+	B	2 3
H1477	120 40	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	2.5	1	14	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. Ivy or climbing plant. East of ditch.	8.9	1.7	40+	B	2 3
T1478	1	*Quercus robur* English Oak	17.0	1	92	N E S W 9.0 10.0 9.0 7.0	4.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Base. North of ditch.	382.9	11.0	40+	B	2 3
T1479	1	*Quercus robur* English Oak	8.0	1	23	N E S W 3.0 4.0 2.0 4.0	3.0	2.0	Young	Good	Access to inspect base - Restricted / obscured. Decay / structural defect - Bole. Poor past pruning. South of ditch.	23.9	2.8	40+	C	1 3
T1480	1	*Quercus robur* English Oak	11.0	1	66	N E S W 7.0 7.0 7.0 7.0	2.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Poor past pruning. North of ditch.	197.1	7.9	40+	C	1 2 3
T1481	1	*Quercus robur* English Oak	12.0	2	72	N E S W 8.0 8.0 8.0 8.0	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Epicormic growth - Crown. Twin-stemmed.	238.2	8.7	40+	C	1 2 3
T1482	1	*Quercus robur* English Oak	11.0	1	66	N E S W 7.0 7.0 7.0 7.0	2.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Epicormic growth - Crown. Poor past pruning. North of ditch.	197.1	7.9	40+	C	1 2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1483	1	*Quercus robur* English Oak	11.0	1	66	N E S W 7.0 6.0 7.0 7.0	2.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Decay / structural defect in crown limb / limbs - Minor. Epicormic growth - Crown. Poor past pruning. North of ditch.	197.1	7.9	40+	C	1 2 3
H1484	150 40 40	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer campestre* Field Maple	2.5	1	15	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Coppice stool - Coppice origin / Mature stems. Hedgerow - Maintained. North of ditch.	10.2	1.8	40+	B	2 3
G1485	200 15 5 2 2 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Cerasus avium* Wild Cherry *Pseudotsuga menziesii* Douglas Fir *Pinus sylvestris* Scots Pine *Ilex aquifolium* Holly	4.0	1	7	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Young	Good	Staked tree / trees. Young planted tree / trees. 1m plastic tubes around trees, spiral guards around hedge planting to west and east.	2.2	0.8	40+	C	1 2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1486	12	*Populus sp.* Poplar sp.	19.0	1	85	N E S W 10.0 10.0 10.0 10.0	1.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Branch - Broken. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Root environment - Waterlogged. On bank of crater.	326.9	10.2	10-20	C	2
T1487	1	*Fraxinus excelsior* Ash	12.0	7	47	N E S W 4.0 4.0 4.0 4.0	3.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Decay / structural defect - Base. Epicormic growth - Crown.	102.6	5.7	20-40	C	2
T1488	1	*Quercus robur* English Oak	12.0	1	48	N E S W 7.0 5.0 6.0 7.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Poor past pruning.	104.2	5.8	40+	C	1 2 3
T1489	1	*Quercus robur* English Oak	9.0	2	30	N E S W 4.0 4.0 4.0 4.0	1.0	1.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Poor past pruning. Twin-stemmed. South of ditch.	42.2	3.7	40+	C	1 3
H1490	90 15 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Quercus robur* English Oak	2.5	1	14	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. North of ditch.	8.9	1.7	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1491	11 1	*Populus sp.* Poplar sp. *Quercus robur* English Oak	18.0	1	85	N E S W 8.0 8.0 8.0 8.0	1.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Branch - Broken. Deadwood - Minor. Weak live growth.	326.9	10.2	20-40	C	2 3
T1492	1	*Quercus robur* English Oak	7.0	1	22	N E S W 3.0 2.0 2.0 2.0	2.0	1.0	Young	Good	Access to inspect base - Restricted / obscured. Competition - Adjacent trees. Decay / structural defect - Bole. Poor past pruning. South of ditch.	21.9	2.6	40+	C	1
H1493	50 5 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Sambucus nigra* Elder	2.5	1	14	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained.	8.9	1.7	40+	B	2 3
H1494	200 60 30 20 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Carpinus betulus* Hornbeam	2.5	1	18	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. North of ditch.	14.7	2.2	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1495	260 50 25 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Ilex aquifolium* Holly	2.5	1	18	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. Plastic guards on several sections of hedge.	14.7	2.2	40+	B	2 3
T1496	1	*Quercus robur* English Oak	16.0	1	84	N 8.0 E 8.0 S 7.0 W 5.0	2.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Decay / structural defect - Base. Epicormic growth - Bole / principal stems. Leaning trunk - Minor.	319.2	10.1	40+	B	2 3
T1497	1	*Populus sp.* Poplar sp.	22.0	1	132	N 11.0 E 12.0 S 10.0 W 9.0	3.0	4.0	Mature	Fair	Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fork - Suspected structurally sound. Rubbing limbs. Twin-stemmed.	706.9	15.0	20-40	B	2
H1498	120	*Crataegus monogyna* Common Hawthorn/Quick/May	2.5	1	16	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained.	11.6	1.9	40+	B	2 3
T1499	1	*Quercus robur* English Oak	18.0	1	167	N 8.0 E 10.0 S 10.0 W 7.0	2.5	5.0	Ancient or Veteran	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Decay / structural defect - Suspected. Epicormic growth - Bole / principal stems. Pruning wounds - Historic. Shedding limb / limbs - Historic.	706.9	15.0	40+	A	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1500	1	*Fraxinus excelsior* Ash	11.0	3	46	N 5.0 E 5.0 S 4.0 W 4.0	3.0	0.5	Early Mature	Poor	Access to inspect base - Restricted / obscured. Deadwood - Minor. Epicormic growth - Crown. Fused limb / limbs. Lesion or fracture on limb / limbs - Major. Weak live growth.	98.6	5.6	10-20	C	1
T1501	1	*Carpinus betulus* Hornbeam	15.0	1	73	N 8.0 E 8.0 S 10.0 W 9.0	2.0	3.5	Mature	Good	Access to inspect base - Restricted / obscured. Branch - Suspended. Buttresses / buttress roots - Major adaptive growth / strong development. Bark wound - Minor. Deadwood - Minor. Decay / structural defect - Base.	241.1	8.8	40+	B	1 2 3
T1502	1	*Fraxinus excelsior* Ash	13.0	1	48	N 7.0 E 6.0 S 6.0 W 7.0	2.5	2.5	Early Mature	Fair	Access to inspect base - Restricted / obscured. Deadwood - Minor. Epicormic growth - Base. Pruning wounds - Recent.	104.2	5.8	40+	C	2 3
T1503	1	*Ilex aquifolium* Holly	13.0	5	75	N 5.0 E 5.0 S 3.0 W 5.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Decay / structural defect - Bole. Epicormic growth - Base. Lesion or fracture on stem / bole - Minor. Multi-stemmed. Potentially grown from coppice with one dominant stem.	257.9	9.1	40+	B	2 3
T1504	1	*Salix caprea* Goat Willow/Great Sallow	9.0	1	29	N 4.0 E 4.0 S 3.0 W 4.0	1.0	1.5	Semi Mature	Fair	Competition - Adjacent trees. Leaning trunk - Minor. Poor past pruning.	38.0	3.5	20-40	C	1
T1505	1	*Fraxinus excelsior* Ash	13.0	1	30	N 6.0 E 3.0 S 6.0 W 6.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Competition - Adjacent trees. Leaning trunk - Minor.	40.7	3.6	20-40	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1506	170 40	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel	2.5	1	17	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained.	13.1	2.0	40+	B	2 3
G1507	13	*Populus sp.* Poplar sp.	19.0	1	85	N E S W 8.0 8.0 8.0 8.0	3.0	3.0	Mature	Fair	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Branch - Broken. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Trees in and around a depression (drainage pond).	326.9	10.2	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1508	1000	*Crataegus monogyna* Common Hawthorn/Quick/May	17.0	1	30	N E S W 3.0 3.0 3.0 3.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Bark wound - Mammal. Form - Attenuated crown. Historic row thinning.	40.7	3.6	40+	C	2 3
	750	*Quercus robur* English Oak														
	500	*Castanea sativa* Sweet Chestnut														
	300	*Corylus avellana* Common Hazel														
	150	*Cerasus avium* Wild Cherry														
	150	*Fagus sylvatica* Common Beech														
	150	*Betula pendula* Silver Birch														
	150	*Acer campestre* Field Maple														
	50	*Pinus sylvestris* Scots Pine														
	50	*Alnus glutinosa* Common Alder														
	50	*Ilex aquifolium* Holly														
	50	*Picea abies* Norway Spruce														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1508	25	*Fraxinus excelsior* Ash														
W1509	400 300 75 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Pinus sylvestris* Scots Pine *Chamaecyparis lawsoniana* Lawson Cypress *Larix decidua* European Larch/Common Larch	18.0	1	35	N E S W 4.5 4.5 4.5 4.5	0.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Form - Attenuated crown. Fallen tree / trees - Whole tree. Ivy or climbing plant. Western edge has hawthorn hedge.	55.4	4.2	40+	B	2
W1510	800 75 50	*Pinus sylvestris* Scots Pine *Fraxinus excelsior* Ash *Quercus robur* English Oak	18.0	1	45	N E S W 4.0 4.0 4.0 4.0	4.0	5.0	Mature	Good		91.6	5.4	40+	B	2 3
H1511	300	*Crataegus monogyna* Common Hawthorn/Quick/May	2.5	1	15	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained.	10.2	1.8	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1512	14 12 1	*Populus sp.* Poplar sp. *Sambucus nigra* Elder *Quercus robur* English Oak	18.0	1	85	N E S W 9.0 9.0 9.0 9.0	1.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Branch - Broken. Deadwood - Major. Form - Attenuated crown. In and around a crater (drainage basin).	326.9	10.2	20-40	C	2 3
T1513	1	*Quercus robur* English Oak	13.0	1	71	N E S W 6.0 7.0 6.0 7.0	3.0	3.5	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	228.0	8.5	40+	B	2 3
H1514	600 40 10 3 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Sambucus nigra* Elder *Ilex aquifolium* Holly *Acer pseudoplatanus* Sycamore	2.5	1	20	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. Ivy or climbing plant.	18.1	2.4	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1515	300 300 50	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ilex aquifolium* Holly	2.0	1	6	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. Young planted tree / trees.	1.6	0.7	40+	C	2 3
W1516	700 300 300 200 180 180 180 150 100	*Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Buxus sempervirens* Common Box *Picea abies* Norway Spruce *Pseudotsuga menziesii* Douglas Fir *Pinus sylvestris* Scots Pine *Ilex aquifolium* Holly *Cerasus avium* Wild Cherry	7.0	1	15	N E S W 2.0 2.0 2.0 2.0	0.0	1.0	Young	Good	Access to inspect base - Restricted / obscured. Young planted tree / trees. 1m plastic tube around trees.	10.2	1.8	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1517	1 1 1 1	*Larix decidua* European Larch/Common Larch *Picea abies* Norway Spruce *Pinus sylvestris* Scots Pine *Quercus robur* English Oak	17.0	1	40	N E S W 4.0 4.0 4.0 4.0	0.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Plantation woodland.	72.4	4.8	40+	B	2 3
T1518	1	*Quercus robur* English Oak	17.0	1	75	N E S W 7.0 8.0 10.0 6.0	5.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Branch - Broken. Deadwood - Minor. Decay / structural defect - Base. Shedding limb / limbs - Major. West of ditch.	254.5	9.0	40+	B	2 3
T1519	1	*Quercus robur* English Oak	17.0	1	65	N E S W 4.0 10.0 5.0 6.0	5.0	5.0	Mature	Good	Access to inspect base - Not possible. Competition - Adjacent trees. Deadwood - Minor. Decay / structural defect - Base. Poor past pruning.	191.1	7.8	40+	B	2 3
T1520	1	*Quercus robur* English Oak	17.0	1	85	N E S W 10.0 9.0 8.0 10.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Base. Epicormic growth - Crown. Epicormic growth - Bole / principal stems.	326.9	10.2	40+	B	2 3
T1521	1	*Quercus robur* English Oak	17.0	1	75	N E S W 9.0 9.0 8.0 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Branch - Broken. Bark wound - Minor. Deadwood - Minor. Decay / structural defect - Base. Poor past pruning. Shedding limb / limbs - Minor.	254.5	9.0	40+	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1522	1	*Quercus robur* English Oak	17.0	1	70	N 8.0 E 9.0 S 9.0 W 9.0	4.0	2.5	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Poor past pruning.	221.7	8.4	40+	B	2 3
T1523	1	*Quercus robur* English Oak	17.0	1	74	N 8.0 E 5.0 S 8.0 W 7.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Lesion or fracture on stem / bole - Major. Poor past pruning. Shedding limb / limbs - Major.	247.7	8.9	40+	B	2 3
T1524	1	*Quercus robur* English Oak	17.0	1	89	N 8.0 E 10.0 S 10.0 W 9.0	5.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Decay / structural defect - Base. Epicormic growth - Bole / principal stems. Hollow trunk - Suspected.	358.3	10.7	40+	B	2 3
T1525	1	*Quercus robur* English Oak	17.0	1	54	N 5.0 E 8.0 S 5.0 W 6.0	6.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Poor past pruning.	131.9	6.5	40+	B	2 3
T1526	1	*Quercus robur* English Oak	17.0	1	68	N 8.0 E 10.0 S 7.0 W 9.0	5.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Poor past pruning.	209.2	8.2	40+	B	2 3
T1527	1	*Quercus robur* English Oak	17.0	1	73	N 7.0 E 8.0 S 6.0 W 8.0	5.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Bark wound - Minor. Epicormic growth - Bole / principal stems.	241.1	8.8	40+	B	2 3
T1528	1	*Quercus robur* English Oak	17.0	1	71	N 9.0 E 9.0 S 10.0 W 9.0	4.0	3.5	Mature	Good	Access to inspect base - Restricted / obscured. Bark wound - Minor. Deadwood - Minor. Epicormic growth - Bole / principal stems. Poor past pruning. Shedding limb / limbs - Minor.	228.0	8.5	40+	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1529	1	*Quercus robur* English Oak	15.0	1	52	N E S W 5.0 4.0 4.0 3.0	4.0	4.0	Mature	Fair	Access to inspect base - Restricted / obscured. Competition - Adjacent trees. Decline - Suspected. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems.	122.3	6.2	20-40	C	2 3
T1530	1	*Quercus robur* English Oak	17.0	1	66	N E S W 7.0 7.0 7.0 7.0	5.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Lightning damage. Lesion or fracture on stem / bole - Major. Poor past pruning. Shedding limb / limbs - Minor.	197.1	7.9	40+	B	2 3
T1531	1	*Quercus robur* English Oak	17.0	1	62	N E S W 8.0 7.0 7.0 7.0	2.0	2.5	Mature	Good	Access to inspect base - Restricted / obscured. Bark wound - Minor. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Poor past pruning.	173.9	7.4	40+	B	2 3
H1532	24 8	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	2.0	1	17	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained.	13.1	2.0	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1533	14 1 1 1	*Quercus robur* English Oak *Acer campestre* Field Maple *Acer pseudoplatanus* Sycamore *Fraxinus excelsior* Ash	10.0	1	37	N 6.0 E 6.0 S 6.0 W 6.0	1.0	1.0	Semi Mature	Good	No significant faults observed. South of ditch.	61.9	4.4	40+	B	2
T1534	1	*Quercus robur* English Oak	10.0	1	36	N 6.0 E 6.0 S 4.0 W 6.0	1.0	1.0	Semi Mature	Good	No significant faults observed. South of ditch.	58.6	4.3	40+	B	2
G1535	13 11 6 5	*Ulmus sp.* Elm sp. *Quercus robur* English Oak *Acer campestre* Field Maple *Fraxinus excelsior* Ash	10.0	1	37	N 6.0 E 6.0 S 6.0 W 6.0	1.0	1.0	Semi Mature	Good	Dutch elm disease. South of ditch.	61.9	4.4	40+	B	2
G1536	8 5 4	*Fraxinus excelsior* Ash *Populus sp.* Poplar sp. *Crataegus monogyna* Common Hawthorn/Quick/May	20.0	1	80	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Fallen tree / trees - Whole tree. Root environment - Waterlogged. Weak live growth. Trees around drainage pond.	289.5	9.6	20-40	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1537	300 300 200 150 50	*Quercus robur* English Oak *Larix decidua* European Larch/Common Larch *Pseudotsuga menziesii* Douglas Fir *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	17.0	1	40	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Form - Attenuated crown. East of ditch.	72.4	4.8	40+	C	2 3
G1538	2	*Fraxinus excelsior* Ash	15.0	3	43	N 6.0 E 6.0 S 6.0 W 6.0	3.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. East of ditch.	84.8	5.2	20-40	C	2 3
T1539	1	*Acer campestre* Field Maple	15.0	2	42	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Ivy or climbing plant.	81.4	5.1	40+	B	2 3
G1540	2	*Acer campestre* Field Maple	14.0	1	32	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Ivy or climbing plant.	46.3	3.8	40+	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1541	70 70 30 4 2 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ulmus sp.* Elm sp. *Ilex aquifolium* Holly *Quercus robur* English Oak *Fraxinus excelsior* Ash	6.0	1	19	N 1.5 E 1.5 S 1.5 W 1.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Dutch elm disease. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	16.3	2.3	40+	B	2 3
T1542	1	*Populus sp.* Poplar sp.	22.0	1	118	N 8.0 E 8.0 S 9.0 W 9.0	4.0	6.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. North of ditch.	629.9	14.2	20-40	B	2
H1543	5 4	*Acer campestre* Field Maple *Corylus avellana* Common Hazel	2.5	1	15	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Coppice stool - Coppice origin / Mature stems. Hedgerow - Maintained. Ivy or climbing plant. North of ditch.	10.2	1.8	40+	B	2 3
G1544	1 1	*Acer campestre* Field Maple *Ilex aquifolium* Holly	8.0	1	35	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Fused stems. Poor past pruning. North of ditch.	55.4	4.2	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1545	1	*Ilex aquifolium* Holly	8.0	6	41	N E S W 3.0 5.0 2.0 2.0	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. North of ditch.	78.4	5.0	20-40	B	2 3
H1546	150 150 30 5	*Acer campestre* Field Maple *Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Ilex aquifolium* Holly	2.5	1	17	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. Ivy or climbing plant. North of ditch.	13.1	2.0	40+	B	2 3
G1547	7 6 1	*Populus sp.* Poplar sp. *Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder	18.0	1	80	N E S W 8.0 8.0 8.0 8.0	1.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Branch - Broken. Deadwood - Minor. Decay / structural defect - Open cavity / cavities. Shedding limb / limbs - Minor. Trees around dry crater (drainage pond).	289.5	9.6	20-40	C	2 3
T1548	1	*Quercus robur* English Oak	15.0	1	72	N E S W 7.0 7.0 7.0 7.0	5.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Decay / structural defect - Base. Epicormic growth - Bole / principal stems. Slime/exudate on old pruning wound.	234.5	8.6	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1549	1	*Quercus robur* English Oak	14.0	1	68	N E S W 8.0 7.0 7.0 7.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	209.2	8.2	40+	B	2 3
T1550	1	*Fraxinus excelsior* Ash	14.0	6	68	N E S W 5.0 5.0 7.0 4.0	3.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect - Base. Epicormic growth - Crown. Weak live growth.	212.8	8.2	10-20	C	2 3
T1551	1	*Quercus robur* English Oak	16.0	1	65	N E S W 6.0 6.0 6.0 6.0	3.0	3.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Pruning wounds - Historic. Bark structure coarse and fissured.	191.1	7.8	40+	B	2 3
T1552	1	*Quercus robur* English Oak	14.0	1	66	N E S W 7.0 7.0 7.0 7.0	3.0	3.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Major. Epicormic growth - Bole / principal stems. Reaction wood / Adaptive growth - Base.	197.1	7.9	40+	B	2 3
T1553	1	*Quercus robur* English Oak	14.0	1	72	N E S W 8.0 8.0 8.0 7.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Bark exudation. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Bole / principal stems.	234.5	8.6	40+	B	3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1554	1	*Quercus robur* English Oak	15.0	1	68	N E S W 8.0 9.0 9.0 7.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Base. Epicormic growth - Bole / principal stems. Poor past pruning.	209.2	8.2	40+	B	2 3
T1555	1	*Quercus robur* English Oak	16.0	1	92	N E S W 6.0 7.0 7.0 7.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems. Hollow trunk - Suspected. Leaning trunk - Minor. Poor past pruning.	382.9	11.0	40+	B	2 3
T1556	1	*Quercus robur* English Oak	16.0	1	81	N E S W 6.0 8.0 7.0 7.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Bark structure coarse and fissured.	296.8	9.7	40+	B	2 3
H1557	450	*Crataegus monogyna* Common Hawthorn/Quick/May	2.5	1	15	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained.	10.2	1.8	40+	B	2 3
G1558	15 1	*Ulmus sp.* Elm sp. *Quercus robur* English Oak	10.0	1	15	N E S W 1.5 1.5 1.5 1.5	1.0	1.0	Semi Mature	Fair	No significant faults observed.	10.2	1.8	20-40	C	1 2
T1559	1	*Sambucus nigra* Elder	3.0	1	25	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Multi-stemmed.	28.3	3.0	20-40	C	1 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1560	1	*Sambucus nigra* Elder	3.0	1	25	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Multi-stemmed.	28.3	3.0	20-40	C	1 3
T1561	1	*Sambucus nigra* Elder	3.0	1	25	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Multi-stemmed.	28.3	3.0	20-40	C	1 3
T1562	1	*Prunus spinosa* Blackthorn/Sloe	4.0	15	27	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Multi-stemmed. Weak live growth.	33.3	3.3	20-40	C	1 3
T1563	1	*Acer pseudoplatanus* Sycamore	14.0	1	44	N E S W 5.0 5.0 5.0 5.0	4.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Base. Ivy or climbing plant. Leaning trunk - Minor. Short shoot extension.	87.6	5.3	40+	C	2 3
T1564	1	*Quercus robur* English Oak	17.0	1	103	N E S W 8.0 8.0 7.0 5.0	4.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Decay / structural defect - Base. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Indications of early stages dieback with spars areas of the crown.	479.9	12.4	40+	B	2 3
T1565	1	*Quercus robur* English Oak	11.0	1	43	N E S W 5.0 5.0 4.5 5.0	0.5	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Bark wound - Minor. Poor past pruning.	83.6	5.2	40+	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1566	3 2	*Cerasus avium* Wild Cherry *Castanea sativa* Sweet Chestnut	9.0	1	30	N E S W 4.0 4.0 4.0 4.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Form - Poor crown structure. Poor past pruning.	40.7	3.6	40+	C	1 2
T1567	1	*Quercus robur* English Oak	13.0	1	41	N E S W 5.5 5.5 5.5 5.5	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Bark wound - Minor. Poor past pruning.	76.0	4.9	40+	C	1 2
H1568	360 45 45	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel	2.5	1	18	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained.	14.7	2.2	40+	B	2 3
G1569	15 15 15	*Castanea sativa* Sweet Chestnut *Fraxinus excelsior* Ash *Quercus robur* English Oak	13.0	1	40	N E S W 4.0 4.0 4.0 4.0	1.0	1.0	Early Mature	Good	Bark wound - Mammal. Poor past pruning. Plantation trees with occasional young tree in plastic tube.	72.4	4.8	40+	C	1 2
T1570	1	*Fraxinus excelsior* Ash	13.0	3	40	N E S W 6.0 5.0 4.0 4.0	3.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Crown. Multi-stemmed. Poor past pruning. Pruning wounds - Recent. Short shoot extension.	75.5	4.9	20-40	C	1 2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1571	1	*Fraxinus excelsior* Ash	11.0	1	34	N E S W 4.0 5.0 4.5 4.0	3.0	3.0	Early Mature	Poor	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Leaning trunk - Minor. Weak live growth.	52.3	4.1	10-20	C	1 2
T1572	1	*Fraxinus excelsior* Ash	17.0	6	68	N E S W 7.0 6.0 6.0 4.5	3.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Fork - Weak with included bark. Multi-stemmed.	212.8	8.2	20-40	C	1 2
H1573	240 40	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	2.5	1	18	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. Plastic guards around many stems.	14.7	2.2	40+	B	2 3
T1574	1	*Fraxinus excelsior* Ash	13.0	1	50	N E S W 5.0 5.0 5.0 5.0	4.0	2.0	Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Ivy or climbing plant. Weak live growth. Sparse crown. Stem not visible due to dense ivy and hedge.	113.1	6.0	10-20	C	1 2
T1575	1	*Fraxinus excelsior* Ash	13.0	1	39	N E S W 4.5 5.5 5.0 5.0	3.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant. Pruning wounds - Historic.	68.8	4.7	20-40	C	1 2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1576	275 80 30	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	2.5	1	17	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained. Ivy or climbing plant.	13.1	2.0	40+	B	2 3
W1577	450 280 70 50 5 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Pinus sylvestris* Scots Pine *Larix decidua* European Larch/Common Larch *Chamaecyparis lawsoniana* Lawson Cypress *Quercus robur* English Oak *Malus sylvestris* Wild Crab	18.0	1	35	N E S W 4.5 4.5 4.5 4.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Form - Attenuated crown. Fallen tree / trees - Whole tree. Ivy or climbing plant. Hedgerow with sides trimmed. Bramble throughout.	55.4	4.2	40+	B	2
G1578	20	*Cerasus avium* Wild Cherry	13.0	1	43	N E S W 5.0 5.0 5.0 5.0	1.0	1.0	Mature	Fair	Access to inspect base - Restricted / obscured. Competition - Adjacent trees. Deadwood - Minor. Fork - Weak with included bark. 3 mature trees with natural regeneration.	83.6	5.2	20-40	C	1 2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1579	600 350 70 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Pinus sylvestris* Scots Pine *Larix decidua* European Larch/Common Larch *Chamaecyparis lawsoniana* Lawson Cypress	17.0	1	35	N 4.5 E 4.5 S 4.5 W 4.5	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Deadwood - Major. Form - Attenuated crown. Fallen tree / trees - Whole tree. Hedgerow with sides trimmed. Bramble throughout.	55.4	4.2	40+	B	2 3
H1580	45 3 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe	6.0	1	17	N 1.5 E 1.5 S 1.5 W 1.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Decay / structural defect - Minor. Hedgerow - Neglected / overgrown.	13.1	2.0	20-40	B	2 3
G1581	8	*Fraxinus excelsior* Ash	13.0	1	45	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Decay / structural defect - Base. Multi-stemmed.	91.6	5.4	10-20	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1582	6 2 1 1	*Fraxinus excelsior* Ash *Acer campestre* Field Maple *Malus sylvestris* Wild Crab *Quercus robur* English Oak	13.0	1	45	N 5.0 E 5.0 S 5.0 W 5.0	1.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Decay / structural defect - Base. Hedgerow - Neglected / overgrown. Multi-stemmed.	91.6	5.4	10-20	C	2
T1583	1	*Fraxinus excelsior* Ash	13.0	10	37	N 5.0 E 5.0 S 5.0 W 5.0	2.0	0.0	Mature	Poor	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Epicormic growth - Crown. Multi-stemmed.	65.1	4.6	20-40	C	2 3
T1584	1	*Crataegus monogyna* Common Hawthorn/Quick/May	6.0	1	36	N 3.5 E 3.5 S 3.5 W 3.5	0.0	1.0	Mature	Good	Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown. Single stem to 1m above ground level.	58.6	4.3	20-40	B	2
H1585	6	*Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	17	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained.	13.1	2.0	40+	B	2 3
T1586	1	*Fraxinus excelsior* Ash	16.0	2	56	N 6.0 E 8.0 S 7.0 W 7.0	2.0	1.0	Mature	Fair	Deadwood - Minor. Decay / structural defect - Base. Epicormic growth - Crown. Twin-stemmed.	144.8	6.8	10-20	C	2
H1587	15	*Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	17	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained.	13.1	2.0	40+	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1588	4 1	*Fraxinus excelsior* Ash *Quercus robur* English Oak	14.0	5	40	N E S W 5.0 5.0 5.0 5.0	1.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Decay / structural defect - Base. Epicormic growth - Crown. Multi-stemmed.	73.3	4.8	10-20	C	2
H1589	30	*Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	17	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Hedgerow - Maintained.	13.1	2.0	40+	B	2 3
T1590	1	*Quercus robur* English Oak	13.0	1	84	N E S W 4.0 6.0 6.0 5.5	3.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Major. Decay / structural defect - Open cavity / cavities. Ivy or climbing plant. Woodpecker holes.	319.2	10.1	40+	B	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1591	800	*Crataegus monogyna* Common Hawthorn/Quick/May	15.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Bark wound - Mammal. Row thinned plantation. South edge is a mature field boundary hedge, rest of boundary is planted hawthorn maintained to 2.5m high.	40.7	3.6	40+	C	2
	200	*Acer pseudoplatanus* Sycamore														
	200	*Betula pendula* Silver Birch														
	200	*Castanea sativa* Sweet Chestnut														
	200	*Cerasus avium* Wild Cherry														
	200	*Fraxinus excelsior* Ash														
	200	*Quercus robur* English Oak														
	100	*Alnus glutinosa* Common Alder														
	50	*Pinus sylvestris* Scots Pine														
	40	*Picea abies* Norway Spruce														
	20	*Ilex aquifolium* Holly														
T1592	1	*Quercus cerris* Turkey Oak	12.0	1	31	N E S W 4.0 4.5 4.0 3.0	0.0	0.5	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Structure. Adjacent to building.	43.5	3.7	20-40	C	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1593	1	*Salix caprea* Goat Willow/Great Sallow	8.0	2	9	N E S W 2.5 2.5 2.0 2.5	1.0	1.0	Semi Mature	Fair	Bark wound - Mammal. Fork - Suspected structurally sound.	4.4	1.2	20-40	C	1
W1594	1100	*Crataegus monogyna* Common Hawthorn/Quick/May	15.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Bark wound - Mammal. Ivy or climbing plant. Row thinned plantation. Boundary is planted hawthorn maintained to 2.5m high.	40.7	3.6	40+	C	2
	600	*Pinus sylvestris* Scots Pine														
	250	*Quercus robur* English Oak														
	250	*Acer pseudoplatanus* Sycamore														
	250	*Castanea sativa* Sweet Chestnut														
	250	*Fraxinus excelsior* Ash														
	200	*Betula pendula* Silver Birch														
	200	*Alnus glutinosa* Common Alder														
	50	*Picea abies* Norway Spruce														
	50	*Corylus avellana* Common Hazel														
	30	*Ilex aquifolium* Holly														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1595	1	*Populus sp.* Poplar sp.	22.0	1	110	N E S W 9.0 10.0 9.0 10.0	2.0	3.0	Mature	Good	Deadwood - Minor. Fork - Suspected structurally sound. Ivy or climbing plant. 4 stems from 1.5m above ground level.	547.4	13.2	20-40	C	2
H1596	250 50 30 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ilex aquifolium* Holly	2.5	1	18	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Base / stems obscured - Vegetation. Hedgerow - Maintained. Ivy or climbing plant.	14.7	2.2	40+	B	2 3
G1597	25 15 11 5	*Salix caprea* Goat Willow/Great Sallow *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	11.0	1	18	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Fallen tree / trees - Partial collapse. Ivy or climbing plant. Natural regeneration.	14.7	2.2	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1598	20 15 6 5 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Ulmus procera* English Elm *Fraxinus excelsior* Ash	14.0	1	25	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Natural regeneration.	28.3	3.0	40+	C	2
T1599	1	*Fraxinus excelsior* Ash	18.0	1	85	N 6.0 E 6.0 S 6.0 W 8.0	1.0	2.5	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems.	326.9	10.2	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1600	10 5 3 2	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash	14.0	1	25	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Natural regeneration.	28.3	3.0	40+	C	2
G1601	2	*Fraxinus excelsior* Ash	14.0	1	25	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant. Physiological / cambial damage - Fungal. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	28.3	3.0	40+	C	2
G1602	25 5 2	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash	14.0	1	25	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Natural regeneration.	28.3	3.0	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1603	10	*Quercus robur* English Oak	19.0	1	85	N E S W 9.0 9.0 9.0 9.0	1.0	4.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Die-back - Upper crown. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems.	326.9	10.2	40+	A	2 3
T1604	1	*Quercus robur* English Oak	18.0	1	80	N E S W 9.0 9.0 9.0 9.0	1.0	6.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	289.5	9.6	40+	A	1
H1605	5 4 3	*Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm *Sambucus nigra* Elder	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1606	35 10 4 3	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm *Sambucus nigra* Elder	3.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2
G1607	1 1 1	*Quercus robur* English Oak *Fraxinus excelsior* Ash *Acer campestre* Field Maple	17.0	1	70	N 8.0 E 8.0 S 8.0 W 8.0	2.0	3.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	221.7	8.4	40+	B	2
G1608	2	*Acer campestre* Field Maple	14.0	1	40	N 6.0 E 6.0 S 6.0 W 6.0	5.0	2.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	72.4	4.8	40+	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1609	2	*Quercus robur* English Oak	16.0	1	50	N 8.0 E 8.0 S 8.0 W 8.0	5.0	4.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	113.1	6.0	40+	B	2
T1610	1	*Quercus robur* English Oak	18.0	1	90	N 10.0 E 10.0 S 10.0 W 10.0	1.0	7.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Poor past pruning.	366.4	10.8	40+	A	1
T1611	1	*Fraxinus excelsior* Ash	16.0	6	48	N 6.0 E 6.0 S 6.0 W 6.0	2.0	0.0	Mature	Good	Access to inspect base - Not possible. Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	108.6	5.9	20-40	A	1
T1612	1	*Fraxinus excelsior* Ash	10.0	1	25	N 4.0 E 4.0 S 4.0 W 4.0	4.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	28.3	3.0	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1613	1	*Fraxinus excelsior* Ash	16.0	1	105	N E S W 8.0 8.0 8.0 8.0	6.0	7.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Hollow trunk - Suspected.	498.8	12.6	20-40	B	1 3
H1614	50 35 6 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Sambucus nigra* Elder *Ulmus procera* English Elm	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2
T1615	1	*Fraxinus excelsior* Ash	7.0	2	19	N E S W 4.0 4.0 4.0 4.0	1.0	0.5	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Ivy or climbing plant.	17.7	2.4	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1616	1	*Fraxinus excelsior* Ash	13.0	4	50	N E S W 6.0 6.0 6.0 6.0	1.0	0.5	Early Mature	Good	Arboricultural work - Historic. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	113.1	6.0	20-40	B	1
G1617	10	*Fraxinus excelsior* Ash	14.0	1	30	N E S W 5.0 5.0 5.0 5.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant. Pollard - Lapsed / Mature stems.	40.7	3.6	20-40	B	2
H1618	50 50 25 6 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Sambucus nigra* Elder *Ulmus procera* English Elm	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. Managed hedge with sporadic outgrown trees.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1619	40 10	*Acer campestre* Field Maple *Fagus sylvatica* Common Beech	11.0	1	25	N E S W 4.0 4.0 4.0 4.0	0.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	28.3	3.0	40+	B	2
T1620	1	*Populus nigra* Black Poplar	20.0	1	100	N E S W 11.0 11.0 11.0 11.0	1.0	2.5	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor.	452.4	12.0	40+	B	1
G1621	8 1	*Acer campestre* Field Maple *Fraxinus excelsior* Ash	16.0	1	30	N E S W 5.0 5.0 5.0 5.0	1.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	40.7	3.6	40+	B	2
T1622	1	*Populus nigra* Black Poplar	20.0	1	80	N E S W 11.0 11.0 6.0 11.0	4.0	5.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	289.5	9.6	40+	B	1
G1623	3	*Quercus robur* English Oak	19.0	1	16	N E S W 9.0 9.0 9.0 9.0	4.0	0.0	Ancient or Veteran	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Pollard - Lapsed / Mature stems.	11.6	1.9	40+	A	2 3
T1624	1	*Populus nigra* Black Poplar	20.0	1	75	N E S W 10.0 10.0 10.0 10.0	4.0	5.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	254.5	9.0	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1625	1	*Fraxinus excelsior* Ash	17.0	1	65	N 7.0 E 7.0 S 7.0 W 7.0	4.0	5.0	Early Mature	Fair	Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	191.1	7.8	10-20	C	1 3
T1626	1	*Populus nigra* Black Poplar	19.0	1	60	N 8.0 E 8.0 S 8.0 W 8.0	4.0	7.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	162.9	7.2	40+	B	1
T1627	1	*Fraxinus excelsior* Ash	17.0	1	80	N 7.0 E 7.0 S 7.0 W 7.0	4.0	5.0	Early Mature	Poor	Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	289.5	9.6	10-20	C	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1628	50 10 10 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ulmus procera* English Elm	4.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2
H1629	50 10 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Ulmus procera* English Elm	3.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2
T1630	1	*Quercus robur* English Oak	16.0	1	60	N 7.0 E 7.0 S 7.0 W 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	162.9	7.2	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1631	1	*Fraxinus excelsior* Ash	17.0	1	65	N 7.0 E 7.0 S 7.0 W 7.0	4.0	5.0	Early Mature	Poor	Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	191.1	7.8	10-20	C	1 3
T1632	1	*Fraxinus excelsior* Ash	12.0	1	35	N 5.0 E 5.0 S 5.0 W 5.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	55.4	4.2	20-40	C	1 3
T1633	1	*Fraxinus excelsior* Ash	10.0	1	30	N 5.0 E 5.0 S 5.0 W 5.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation.	40.7	3.6	20-40	C	1 3
T1634	1	*Quercus robur* English Oak	19.0	1	82	N 9.0 E 9.0 S 9.0 W 9.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	304.2	9.8	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1635	1	*Quercus robur* English Oak	16.0	1	60	N E S W 7.0 7.0 7.0 7.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant.	162.9	7.2	40+	B	1
T1636	1	*Fraxinus excelsior* Ash	10.0	1	30	N E S W 5.0 5.0 5.0 5.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	40.7	3.6	20-40	C	1 3
T1637	1	*Fraxinus excelsior* Ash	10.0	1	30	N E S W 5.0 5.0 5.0 5.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	40.7	3.6	20-40	C	1 3
T1638	1	*Populus nigra* Black Poplar	19.0	1	60	N E S W 8.0 4.0 8.0 8.0	4.0	7.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	162.9	7.2	40+	B	1
T1639	1	*Quercus robur* English Oak	10.0	1	76	N E S W 3.0 3.0 3.0 3.0	3.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	261.3	9.1	20-40	B	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1640	1	*Quercus robur* English Oak	18.0	1	82	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	304.2	9.8	40+	A	1
T1641	1	*Acer campestre* Field Maple	10.0	1	35	N E S W 5.0 5.0 5.0 5.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	55.4	4.2	20-40	C	1 3
T1642	1	*Acer campestre* Field Maple	11.0	1	35	N E S W 5.0 5.0 5.0 5.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	55.4	4.2	20-40	C	1 3
H1643	50 40 15 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ulmus procera* English Elm	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. Managed hedge with sporadic outgrown trees.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1644	50 40 15 4	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ulmus procera* English Elm	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. Managed hedge with sporadic outgrown trees.	11.6	1.9	40+	C	2
G1645	2 1	*Quercus robur* English Oak *Acer pseudoplatanus* Sycamore	18.0	1	75	N E S W 8.0 8.0 8.0 8.0	3.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	254.5	9.0	40+	A	2 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1646	150	*Picea sitchensis* Sitka Spruce	20.0	1	40	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fungal fruiting body - structural decay suspected. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Ivy or climbing plant.	72.4	4.8	40+	A	2 3
	120	*Quercus cerris* Turkey Oak														
	120	*Cerasus avium* Wild Cherry														
	120	*Castanea sativa* Sweet Chestnut														
	60	*Prunus spinosa* Blackthorn/Sloe														
	50	*Sambucus nigra* Elder														
	40	*Fraxinus excelsior* Ash														
	40	*Crataegus monogyna* Common Hawthorn/Quick/May														
	30	*Quercus robur* English Oak														
	30	*Acer pseudoplatanus* Sycamore														
	25	*Acer campestre* Field Maple														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1647	1	*Fraxinus excelsior* Ash	7.0	1	40	N 3.0 E 3.0 S 3.0 W 3.0	0.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect - Base. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Ivy or climbing plant.	72.4	4.8	10-20	C	1 3
T1648	1	*Fraxinus excelsior* Ash	10.0	3	34	N 5.0 E 5.0 S 5.0 W 5.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	54.3	4.2	20-40	C	1 3
T1649	1	*Quercus robur* English Oak	15.0	1	60	N 4.0 E 4.0 S 4.0 W 4.0	4.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole.	162.9	7.2	40+	B	1
T1650	1	*Quercus robur* English Oak	15.0	1	65	N 6.0 E 6.0 S 6.0 W 6.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole.	191.1	7.8	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1651	1	*Quercus robur* English Oak	20.0	1	82	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	304.2	9.8	40+	A	1
T1652	1	*Quercus robur* English Oak	17.0	1	60	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	162.9	7.2	40+	A	1
T1653	1	*Quercus robur* English Oak	18.0	1	85	N E S W 8.0 8.0 8.0 8.0	4.0	6.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	326.9	10.2	40+	A	1
T1654	1	*Quercus robur* English Oak	17.0	1	62	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	173.9	7.4	40+	B	1
T1655	1	*Acer campestre* Field Maple	8.0	3	51	N E S W 3.0 3.0 3.0 3.0	1.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	122.1	6.2	20-40	C	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1656	1	*Fraxinus excelsior* Ash	19.0	1	75	N 9.0 E 9.0 S 9.0 W 9.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	254.5	9.0	20-40	B	1 3
T1657	1	*Fraxinus excelsior* Ash	17.0	1	60	N 6.0 E 6.0 S 6.0 W 6.0	3.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	162.9	7.2	20-40	B	1 3
T1658	1	*Fraxinus excelsior* Ash	17.0	1	60	N 6.0 E 6.0 S 6.0 W 6.0	3.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	162.9	7.2	20-40	B	1 3
T1659	1	*Fraxinus excelsior* Ash	17.0	1	60	N 6.0 E 6.0 S 6.0 W 6.0	3.0	3.0	Early Mature	Poor	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Affected by hymenoscyphus fraxineus (ash dieback).	162.9	7.2	10-20	C	1 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1660	1	*Fraxinus excelsior* Ash	17.0	1	55	N 4.0 E 4.0 S 4.0 W 4.0	6.0	3.0	Early Mature	Poor	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Affected by hymenoscyphus fraxineus (ash dieback).	136.8	6.6	10-20	C	1 3
T1661	1	*Fraxinus excelsior* Ash	19.0	1	60	N 6.0 E 6.0 S 6.0 W 6.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Affected by hymenoscyphus fraxineus (ash dieback).	162.9	7.2	20-40	B	1 3
T1662	1	*Fraxinus excelsior* Ash	18.0	1	75	N 8.0 E 8.0 S 8.0 W 8.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Affected by hymenoscyphus fraxineus (ash dieback).	254.5	9.0	20-40	B	1 3
T1663	1	*Acer campestre* Field Maple	8.0	3	51	N 3.0 E 3.0 S 3.0 W 3.0	1.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	122.1	6.2	20-40	C	1 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1664	1	*Fraxinus excelsior* Ash	19.0	1	64	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Affected by hymenoscyphus fraxineus (ash dieback).	185.3	7.7	20-40	B	1 3
T1665	1	*Fraxinus excelsior* Ash	19.0	1	64	N E S W 8.0 8.0 8.0 8.0	4.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Physiological / cambial damage - Fungal. Affected by hymenoscyphus fraxineus (ash dieback).	185.3	7.7	20-40	B	1 3
T1666	1	*Fraxinus excelsior* Ash	15.0	1	60	N E S W 7.0 7.0 7.0 7.0	4.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems.	162.9	7.2	20-40	B	1 3
H1667	300 200 30 20 20	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ulmus procera* English Elm *Sambucus nigra* Elder	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1668	150 30 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	3.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2
T1669	1	*Acer campestre* Field Maple	8.0	3	51	N 3.0 E 3.0 S 3.0 W 3.0	1.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	122.1	6.2	20-40	C	1 3
T1670	1	*Quercus robur* English Oak	19.0	1	85	N 8.0 E 11.0 S 8.0 W 8.0	2.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	326.9	10.2	40+	A	1
T1671	1	*Acer campestre* Field Maple	8.0	3	51	N 3.0 E 3.0 S 3.0 W 3.0	1.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	122.1	6.2	20-40	C	1 3
T1672	1	*Fraxinus excelsior* Ash	17.0	1	50	N 6.0 E 6.0 S 6.0 W 6.0	3.0	3.0	Early Mature	Poor	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Affected by hymenoscyphus fraxineus (ash dieback).	113.1	6.0	10-20	C	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1673	1	*Acer campestre* Field Maple	8.0	3	51	N E S W 4.0 4.0 4.0 4.0	1.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Ivy or climbing plant.	122.1	6.2	20-40	C	1 3
T1674	1	*Fraxinus excelsior* Ash	14.0	1	45	N E S W 5.0 5.0 5.0 5.0	3.0	3.0	Early Mature	Poor	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Affected by hymenoscyphus fraxineus (ash dieback).	91.6	5.4	10-20	C	1 3
G1675	2	*Quercus robur* English Oak	18.0	2	42	N E S W 8.0 8.0 8.0 8.0	1.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems.	81.4	5.1	40+	B	2
G1676	2	*Fraxinus excelsior* Ash	18.0	2	56	N E S W 9.0 9.0 9.0 9.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Epicormic growth - Base / bole / principal stems.	144.8	6.8	20-40	B	2
T1677	1	*Quercus robur* English Oak	11.0	1	60	N E S W 3.0 3.0 3.0 3.0	3.0	3.0	Early Mature	Dead	Dead tree / trees. Tree/stem to be retained as monolith for habitat.			0-10	U	

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1678	1	*Quercus robur* English Oak	14.0	1	65	N E S W 4.0 4.0 4.0 4.0	5.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems. Ivy or climbing plant. Affected by hymenoscyphus fraxineus (ash dieback).	191.1	7.8	20-40	C	1 3
T1679	1	*Quercus robur* English Oak	17.0	1	55	N E S W 8.0 8.0 8.0 8.0	3.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	136.8	6.6	40+	B	1
T1680	1	*Quercus robur* English Oak	8.0	1	32	N E S W 4.0 4.0 4.0 4.0	1.0	2.0	Early Mature	Good	Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems.	46.3	3.8	40+	C	1
T1681	1	*Quercus robur* English Oak	17.0	1	62	N E S W 7.0 10.0 7.0 7.0	1.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	173.9	7.4	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1682	300 300 60 50 50	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder *Ulmus procera* English Elm *Acer campestre* Field Maple	3.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2
T1683	1	*Quercus robur* English Oak	10.0	1	32	N 3.0 E 3.0 S 3.0 W 3.0	4.0	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	46.3	3.8	40+	C	1
T1684	1	*Quercus robur* English Oak	12.0	2	45	N 5.0 E 5.0 S 5.0 W 5.0	4.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	92.6	5.4	40+	B	1
H1685	300 40	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	3.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1686	15 10 5	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder	4.0	1	16	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Good	Natural regeneration.	11.6	1.9	40+	C	2
T1687	1	*Quercus robur* English Oak	15.0	1	55	N 8.0 E 8.0 S 8.0 W 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	136.8	6.6	40+	B	1
T1688	1	*Quercus robur* English Oak	17.0	1	60	N 8.0 E 8.0 S 8.0 W 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	162.9	7.2	40+	B	1
T1689	1	*Quercus robur* English Oak	17.0	1	65	N 8.0 E 8.0 S 8.0 W 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	191.1	7.8	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1690	1	*Quercus robur* English Oak	17.0	1	65	N E S W 7.0 8.0 6.0 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems.	191.1	7.8	40+	B	1
T1691	1	*Quercus robur* English Oak	17.0	1	65	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	191.1	7.8	40+	B	1
T1692	1	*Acer campestre* Field Maple	10.0	2	28	N E S W 4.0 4.0 4.0 4.0	3.0	1.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	36.2	3.4	40+	C	1
H1693	300 40 15	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Sambucus nigra* Elder	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1694	200 40 15	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Sambucus nigra* Elder	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2
T1695	1	*Quercus robur* English Oak	17.0	1	65	N E S W 7.0 7.0 7.0 7.0	4.0	6.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems.	191.1	7.8	40+	B	1
H1696	150 10 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Sambucus nigra* Elder	3.0	1	16	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1697	1	*Populus nigra* Black Poplar	20.0	1	130	N E S W 9.0 9.0 9.0 9.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems.	706.9	15.0	40+	B	1
T1698	1	*Quercus robur* English Oak	15.0	1	65	N E S W 7.0 7.0 7.0 7.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems.	191.1	7.8	40+	B	1
T1699	1	*Quercus robur* English Oak	10.0	1	65	N E S W 4.0 4.0 4.0 4.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	191.1	7.8	40+	C	1
T1700	1	*Populus nigra* Black Poplar	20.0	1	110	N E S W 9.0 9.0 9.0 9.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	547.4	13.2	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1701	1	*Populus nigra* Black Poplar	22.0	1	110	N 11.0 E 11.0 S 11.0 W 11.0	4.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	547.4	13.2	40+	B	1
T1702	1	*Populus nigra* Black Poplar	22.0	1	110	N 9.0 E 9.0 S 9.0 W 9.0	4.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	547.4	13.2	40+	B	1
T1703	1	*Populus nigra* Black Poplar	19.0	1	95	N 9.0 E 9.0 S 9.0 W 9.0	4.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	408.3	11.4	40+	B	1
T1704	1	*Populus nigra* Black Poplar	20.0	1	96	N 9.0 E 9.0 S 9.0 W 9.0	4.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Bark wound - Mechanical. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	416.9	11.5	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1705	120 20 4 4	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm *Acer campestre* Field Maple	3.0	1	16	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained. Managed hedge with sporadic outgrown trees.	11.6	1.9	40+	C	2
H1706	1500 200 200 50 50	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Alnus glutinosa* Common Alder *Fagus sylvatica* Common Beech *Ilex aquifolium* Holly	2.0	1	10	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	10-20	C	2
T1707	1	*Quercus robur* English Oak	7.0	1	33	N 4.0 E 3.0 S 3.0 W 3.0	1.5	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Ivy or climbing plant.	49.3	4.0	40+	A	1
T1708	1	*Quercus robur* English Oak	17.0	1	120	N 8.0 E 7.0 S 10.0 W 7.0	3.0	2.5	Late Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant.	651.4	14.4	40+	A	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1709	30	*Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	10	N 0.8 E 0.8 S 0.8 W 0.8	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	10-20	C	2
T1710	1	*Quercus robur* English Oak	12.0	1	130	N 3.0 E 6.0 S 4.0 W 5.0	2.5	2.0	Late Mature	Fair	Access to inspect base - Restricted / obscured. Crack - Longitudinal / shear crack. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Hollow trunk - Open cavity. Pollard - Regrown.	706.9	15.0	20-40	B	1
T1711	1	*Quercus robur* English Oak	17.0	1	120	N 11.0 E 8.0 S 8.0 W 8.0	2.0	2.5	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor.	651.4	14.4	40+	A	1
T1712	1	*Quercus robur* English Oak	17.0	1	100	N 10.0 E 7.0 S 7.0 W 6.0	2.5	2.5	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant.	452.4	12.0	40+	A	1
T1713	1	*Acer campestre* Field Maple	3.0	1	45	N 0.0 E 3.0 S 7.0 W 3.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Fallen tree / trees - Whole tree. Ivy or climbing plant.			0-10	U	

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1714	150 60 25 20 15 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Sambucus nigra* Elder *Acer campestre* Field Maple *Quercus robur* English Oak *Fraxinus excelsior* Ash	7.0	1	15	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	10.2	1.8	20-40	B	2
T1715	1	*Fraxinus excelsior* Ash	17.0	4	101	N 8.0 E 9.0 S 8.0 W 5.0	3.0	1.0	Mature	Good	Coppice stool - Coppice origin / Mature stems. Multi-stemmed.	468.2	12.2	20-40	B	1
G1716	4 3 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Fraxinus excelsior* Ash	13.0	1	60	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Tree on bank.	162.9	7.2	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1717	20 20 8	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak	13.0	1	75	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	254.5	9.0	40+	B	2
G1718	500 300 100 75 50 50 10 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak *Fraxinus excelsior* Ash *Sambucus nigra* Elder *Acer campestre* Field Maple *Acer pseudoplatanus* Sycamore *Betula sp.* Birch *Prunus sp.* Cherry sp.	13.0	1	50	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	113.1	6.0	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1719	4	*Quercus robur* English Oak	15.0	1	100	N E S W 6.0 6.0 6.0 6.0	2.0	1.5	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Shedding limb / limbs - Major. Shedding limb / limbs - Recent. Tree on bank.	452.4	12.0	40+	A	2
T1720	1	*Quercus robur* English Oak	18.0	1	117	N E S W 7.0 4.0 8.0 7.0	1.0	2.5	Post Mature	Good	Deadwood - Major. Form - Low canopy. Shedding limb / limbs - Historic. Shedding limb / limbs - Major.	619.3	14.0	40+	B	1
G1721	3	*Quercus robur* English Oak	15.0	1	75	N E S W 4.0 4.0 4.0 4.0	1.5	2.0	Mature	Fair	Deadwood - Minor. Tree on bank.	254.5	9.0	40+	B	2
G1722	10	*Prunus spinosa* Blackthorn/Sloe	4.0	1	10	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Fair	Deadwood - Minor. Multi-stemmed. Tree on bank.	4.5	1.2	10-20	C	2
T1723	1	*Quercus robur* English Oak	18.0	1	110	N E S W 10.0 8.0 8.0 8.0	2.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Hollow trunk - Open cavity. Ivy or climbing plant.	547.4	13.2	40+	A	1
T1724	1	*Quercus robur* English Oak	18.0	1	14	N E S W 11.0 8.0 8.0 4.0	2.0	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Extensive. Decay / structural defect - Principal stems. Ivy or climbing plant.	8.9	1.7	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1725	750 10 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Ilex aquifolium* Holly	2.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	10-20	C	2
T1726	1	*Fraxinus excelsior* Ash	11.0	1	45	N E S W 7.0 5.0 5.0 8.0	2.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	91.6	5.4	40+	B	1
T1727	1	*Fraxinus excelsior* Ash	10.0	1	40	N E S W 7.0 7.0 5.0 7.0	2.5	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	72.4	4.8	40+	B	1
T1728	1	*Quercus robur* English Oak	16.0	1	160	N E S W 7.0 5.0 7.0 7.0	2.0	2.5	Late Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	706.9	15.0	40+	A	1
T1729	1	*Fraxinus excelsior* Ash	19.0	1	130	N E S W 4.0 2.0 4.0 4.0	1.0	2.5	Late Mature	Poor	Deadwood - Major. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Principal stems. Fungal fruiting body - structural decay suspected. Shedding limb / limbs - Historic. I. hispidus on main stem			0-10	U	
T1730	1	*Quercus robur* English Oak	18.0	1	122	N E S W 5.0 9.0 9.0 3.0	2.0	2.5	Late Mature	Good	Deadwood - Minor. Unbalanced crown - Major.	673.3	14.6	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1731	50 20 20 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder *Corylus avellana* Common Hazel *Ilex aquifolium* Holly	2.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	10-20	C	2
T1732	1	*Quercus robur* English Oak	15.0	1	167	N E S W 13.0 8.0 3.0 8.0	2.0	2.5	Ancient or Veteran	Good	Deadwood - Major. Deadwood - Minor. Habitat - High value. Shedding limb / limbs - Historic. Unbalanced crown - Major. Woodpecker holes.	706.9	15.0	40+	A	1 3
W1733	800 800 800 300 300	*Quercus robur* English Oak *Pinus sp.* Pine sp. *Acer pseudoplatanus* Sycamore *Fraxinus excelsior* Ash *Acer campestre* Field Maple	15.0	1	40	N E S W 3.0 3.0 3.0 3.0	1.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Dead tree / trees.	72.4	4.8	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1734	1	*Quercus robur* English Oak	10.0	1	75	N E S W 1.0 5.0 5.0 5.0	4.0	2.5	Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Decline - Evident / observed. Deadwood - Major.			0-10	U	
T1735	1	*Fraxinus excelsior* Ash	16.0	10	123	N E S W 6.0 8.0 8.0 8.0	2.5	2.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Multi-stemmed.	688.1	14.8	40+	B	1
T1736	1	*Acer campestre* Field Maple	8.0	4	58	N E S W 4.0 5.0 4.0 5.0	2.5	0.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed.	152.7	7.0	20-40	B	1
T1737	1	*Acer campestre* Field Maple	8.0	1	30	N E S W 3.0 3.5 3.0 3.5	3.0	0.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	40.7	3.6	20-40	B	1
T1738	1	*Acer campestre* Field Maple	8.0	1	35	N E S W 3.0 3.0 3.0 3.0	3.0	2.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	55.4	4.2	20-40	B	1
T1739	1	*Acer campestre* Field Maple	9.0	1	35	N E S W 3.0 4.0 4.0 4.0	3.0	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	55.4	4.2	20-40	B	1
T1740	1	*Quercus robur* English Oak	16.0	1	130	N E S W 6.0 10.0 9.0 8.0	3.0	2.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Hollow trunk - Open cavity.	706.9	15.0	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1741	1	*Quercus robur* English Oak	18.0	1	120	N E S W 5.0 8.0 8.0 5.0	2.5	2.5	Late Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Hollow trunk - Open cavity.	651.4	14.4	20-40	B	1
H1742	200 50 50	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer campestre* Field Maple	3.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown.	4.5	1.2	10-20	C	2
T1743	1	*Quercus robur* English Oak	18.0	1	160	N E S W 8.0 8.0 8.0 8.0	2.0	2.0	Late Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Branch - Broken. Branch - Suspended. Deadwood - Major. Stems - Co-dominant.	706.9	15.0	40+	A	1
T1744	1	*Quercus robur* English Oak	17.0	1	120	N E S W 11.0 8.0 10.0 6.0	3.0	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Decay / structural defect - Base.	651.4	14.4	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1745	1	*Quercus robur* English Oak	18.0	1	120	N E S W 5.0 9.0 9.0 4.0	3.0	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Decay / structural defect - Base. Decay / structural defect - Extensive. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Principal stems. Decay / structural defect - Bole. Leaning trunk - Minor.	651.4	14.4	10-20	C	1
H1746	700	*Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	B	2
G1747	5 4 3	*Sambucus nigra* Elder *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel	3.0	1	15	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	10.2	1.8	10-20	C	2
T1748	1	*Quercus robur* English Oak	10.0	1	70	N E S W 4.0 4.0 4.0 7.0	1.5	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Shedding limb / limbs - Historic. Tree on bank.	221.7	8.4	10-20	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1749	200 200 100 100	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Ulmus procera* English Elm *Corylus avellana* Common Hazel	5.0	1	15	N 1.5 E 1.5 S 1.5 W 1.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown. Multi-stemmed.	10.2	1.8	10-20	C	2
T1750	1	*Quercus robur* English Oak	18.0	1	70	N 7.0 E 7.0 S 8.0 W 5.0	2.0	2.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Ivy or climbing plant. Poor past pruning. Tree on bank.	221.7	8.4	40+	A	1
T1751	1	*Quercus robur* English Oak	14.0	5	100	N 8.0 E 7.0 S 6.0 W 5.0	1.0	1.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Recent. Multi-stemmed. Poor past pruning. Tree on bank.	454.7	12.0	40+	B	1
T1752	1	*Fraxinus excelsior* Ash	9.0	2	53	N 3.0 E 3.0 S 3.0 W 3.0	2.0	1.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Tree on bank.	127.8	6.4	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1753	1	*Quercus robur* English Oak	11.0	1	55	N E S W 7.0 4.0 4.0 4.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	136.8	6.6	40+	A	1
T1754	1	*Quercus robur* English Oak	11.0	1	70	N E S W 8.0 5.0 5.0 5.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Tree on bank.	221.7	8.4	40+	A	1
T1755	1	*Quercus robur* English Oak	7.0	1	35	N E S W 5.0 4.0 4.0 4.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Tree on bank.	55.4	4.2	40+	B	1
H1756	60 30 20	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel	5.0	1	15	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown. Multi-stemmed.	10.2	1.8	10-20	C	2
T1757	1	*Fraxinus excelsior* Ash	16.0	5	76	N E S W 6.0 6.0 6.0 2.0	2.5	1.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Tree on bank.	264.6	9.2	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1758	1	*Fraxinus excelsior* Ash	15.0	4	82	N 6.0 E 2.0 S 6.0 W 5.0	2.5	1.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Tree on bank.	308.8	9.9	20-40	B	1
T1759	1	*Fraxinus excelsior* Ash	14.0	7	103	N 5.0 E 5.0 S 5.0 W 3.0	2.0	1.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Major. Decay / structural defect - Base. Decay / structural defect - Open cavity / cavities. Tree on bank.	481.7	12.4	10-20	C	1
T1760	1	*Fraxinus excelsior* Ash	8.0	4	49	N 2.0 E 2.0 S 2.0 W 2.0	5.0	1.5	Semi Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Major. Tree on bank.			0-10	U	
T1761	1	*Quercus robur* English Oak	12.0	1	85	N 7.0 E 9.0 S 8.0 W 5.0	3.0	2.5	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Tree on bank.	326.9	10.2	40+	A	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1762	1	*Fraxinus excelsior* Ash	13.0	2	55	N E S W 3.0 3.0 3.0 7.0	3.0	2.5	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Tree on bank.	141.4	6.7	20-40	B	1
G1763	10 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	5.0	1	15	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed.	10.2	1.8	10-20	C	2
T1764	1	*Fraxinus excelsior* Ash	16.0	3	75	N E S W 3.0 5.0 5.0 5.0	1.0	3.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Multi-stemmed. Tree on bank.	260.1	9.1	20-40	B	1
T1765	1	*Fraxinus excelsior* Ash	14.0	2	57	N E S W 5.0 5.0 2.0 5.0	1.0	3.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Multi-stemmed. Tree on bank.	147.0	6.8	20-40	B	1
T1766	1	*Fraxinus excelsior* Ash	14.0	3	55	N E S W 4.0 4.0 4.0 4.0	1.0	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Multi-stemmed. Tree on bank.	138.0	6.6	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1767	1	*Fraxinus excelsior* Ash	8.0	2	42	N E S W 4.0 4.0 4.0 4.0	2.5	2.0	Early Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Mid crown. Deadwood - Minor. Tree on bank.	81.4	5.1	10-20	C	1
T1768	1	*Fraxinus excelsior* Ash	9.0	1	35	N E S W 3.0 3.0 3.0 3.0	2.0	2.5	Semi Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	55.4	4.2	20-40	B	1
H1769	300 100 50 25 25	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm *Corylus avellana* Common Hazel *Acer campestre* Field Maple	2.5	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Neglected / overgrown.	4.5	1.2	10-20	C	2
G1770	7 2	*Ulmus procera* English Elm *Crataegus monogyna* Common Hawthorn/Quick/May	9.0	1	14	N E S W 2.0 2.0 2.0 2.0	1.0	1.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Dutch elm disease. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Natural regeneration.	8.9	1.7	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1771	50	*Crataegus monogyna* Common Hawthorn/Quick/May	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
T1772	1	*Quercus robur* English Oak	18.0	1	82	N E S W 9.0 9.0 9.0 9.0	2.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	304.2	9.8	40+	A	1
G1773	3 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder	5.0	1	14	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown.	8.9	1.7	40+	C	2
G1774	10 7 2 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Sambucus nigra* Elder	14.0	1	30	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	40.7	3.6	40+	B	2
T1775	1	*Fraxinus excelsior* Ash	11.0	2	42	N E S W 4.0 4.0 4.0 4.0	1.0	0.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	81.4	5.1	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1776	7 1	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May	10.0	1	35	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	55.4	4.2	40+	B	2
T1777	1	*Fraxinus excelsior* Ash	11.0	2	42	N E S W 5.0 5.0 5.0 5.0	1.0	0.0	Early Mature	Good	Arboricultural work - Historic. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	81.4	5.1	20-40	B	1
G1778	4	*Corylus avellana* Common Hazel	9.0	1	30	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Base / bole / principal stems.	40.7	3.6	40+	C	2
G1779	5 1	*Ulmus procera* English Elm *Crataegus monogyna* Common Hawthorn/Quick/May	9.0	1	14	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Dutch elm disease. Epicormic growth - Base / bole / principal stems.	8.9	1.7	20-40	C	2
G1780	1 1	*Ulmus procera* English Elm *Sambucus nigra* Elder	9.0	1	14	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Dutch elm disease. Epicormic growth - Base / bole / principal stems.	8.9	1.7	20-40	C	2
G1781	10	*Populus nigra* Black Poplar	24.0	1	50	N E S W 9.0 9.0 9.0 9.0	3.0	5.0	Early Mature	Good	Access to inspect base - Not possible. Deadwood - Minor.	113.1	6.0	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1782	1	*Fraxinus excelsior* Ash	13.0	5	44	N E S W 5.0 5.0 5.0 5.0	3.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	90.5	5.4	20-40	B	1
G1783	120 30 30 20 15	*Populus x canadensis* Hybrid Black Poplars *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Ulmus procera* English Elm	19.0	1	36	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Not possible. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree.	58.6	4.3	40+	B	2
T1784	1	*Quercus robur* English Oak	18.0	1	105	N E S W 9.0 9.0 9.0 9.0	2.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Localised. Decay / structural defect - Open cavity / cavities. Epicormic growth - Bole / principal stems.	498.8	12.6	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1785	140 10 10 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Quercus robur* English Oak	5.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown.	2.9	1.0	40+	C	2
T1786	1	*Quercus robur* English Oak	17.0	1	68	N E S W 7.0 7.0 9.0 7.0	3.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems.	209.2	8.2	40+	B	1
T1787	1	*Quercus robur* English Oak	19.0	1	85	N E S W 8.0 8.0 8.0 8.0	3.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems.	326.9	10.2	40+	A	1
T1788	1	*Quercus robur* English Oak	18.0	1	85	N E S W 9.0 9.0 9.0 9.0	1.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	326.9	10.2	40+	A	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1789	1	*Quercus robur* English Oak	18.0	1	68	N E S W 9.0 9.0 9.0 9.0	1.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	209.2	8.2	40+	A	1
T1790	1	*Quercus robur* English Oak	19.0	1	86	N E S W 11.0 11.0 11.0 11.0	2.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	334.6	10.3	40+	A	1
T1791	1	*Quercus robur* English Oak	17.0	1	62	N E S W 7.0 7.0 7.0 7.0	2.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	173.9	7.4	40+	B	1
T1792	1	*Quercus robur* English Oak	15.0	1	58	N E S W 7.0 7.0 8.0 8.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	152.2	7.0	40+	B	1
G1793	3	*Fraxinus excelsior* Ash	19.0	1	70	N E S W 9.0 9.0 9.0 9.0	2.0	2.0	Early Mature	Good	Access to inspect base - Not possible. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	221.7	8.4	20-40	B	2 3

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1794	60 35 30 30 20 3	*Fraxinus excelsior* Ash *Ulmus procera* English Elm *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Corylus avellana* Common Hazel *Acer pseudoplatanus* Sycamore	15.0	1	30	N 5.0 E 5.0 S 5.0 W 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Natural regeneration.	40.7	3.6	40+	B	2
G1795	3	*Fraxinus excelsior* Ash	15.0	3	43	N 5.0 E 5.0 S 5.0 W 5.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	84.8	5.2	20-40	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1796	140 10 10 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fraxinus excelsior* Ash *Quercus robur* English Oak	5.0	1	8	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown.	2.9	1.0	40+	C	2
G1797	2	*Fraxinus excelsior* Ash	15.0	3	43	N 5.0 E 5.0 S 5.0 W 5.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	84.8	5.2	20-40	B	2
G1798	1 1	*Quercus robur* English Oak *Fraxinus excelsior* Ash	15.0	1	40	N 5.0 E 5.0 S 5.0 W 5.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	72.4	4.8	20-40	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1799	2	*Fraxinus excelsior* Ash	15.0	2	28	N E S W 4.0 4.0 4.0 4.0	2.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	36.2	3.4	20-40	B	2
T1800	1	*Quercus robur* English Oak	19.0	1	60	N E S W 5.0 8.0 8.0 8.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	162.9	7.2	40+	B	1
G1801	8 2	*Fraxinus excelsior* Ash *Quercus robur* English Oak	15.0	1	40	N E S W 5.0 5.0 5.0 5.0	3.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	72.4	4.8	20-40	B	2
T1802	1	*Fraxinus excelsior* Ash	18.0	1	60	N E S W 8.0 8.0 8.0 6.0	4.0	6.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Decay / structural defect in crown limb / limbs - Extensive. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Bole / principal stems.	162.9	7.2	40+	B	1 3

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1803	50 30 25 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Fraxinus excelsior* Ash *Quercus robur* English Oak *Acer campestre* Field Maple	10.0	1	20	N 4.0 E 4.0 S 4.0 W 4.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant. Physiological / cambial damage - Fungal. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	18.1	2.4	20-40	C	2
T1804	1	*Quercus robur* English Oak	9.0	1	28	N 4.0 E 4.0 S 4.0 W 4.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems.	35.5	3.4	40+	C	1
T1805	1	*Quercus robur* English Oak	9.0	1	28	N 4.0 E 4.0 S 4.0 W 4.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems.	35.5	3.4	40+	C	1
H1806	50	*Crataegus monogyna* Common Hawthorn/Quick/May	3.0	1	8	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1807	50 10 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe	3.0	1	8	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
T1808	1	*Quercus robur* English Oak	12.0	1	60	N 7.0 E 7.0 S 7.0 W 7.0	0.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	162.9	7.2	40+	B	1
T1809	1	*Quercus robur* English Oak	18.0	1	75	N 9.0 E 9.0 S 9.0 W 9.0	1.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	254.5	9.0	40+	B	1
T1810	1	*Salix caprea* Goat Willow/Great Sallow	9.0	2	25	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems.	29.3	3.1	40+	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1811	50 30 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
T1812	1	*Fraxinus excelsior* Ash	12.0	2	35	N E S W 4.0 4.0 4.0 4.0	2.0	3.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems.	56.5	4.2	40+	C	1
T1813	1	*Quercus robur* English Oak	18.0	1	80	N E S W 9.0 9.0 9.0 9.0	1.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	289.5	9.6	40+	A	1
T1814	1	*Quercus robur* English Oak	16.0	1	56	N E S W 8.0 8.0 8.0 8.0	1.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	141.9	6.7	40+	B	1
T1815	1	*Quercus robur* English Oak	15.0	1	46	N E S W 7.0 7.0 7.0 7.0	1.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	95.7	5.5	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1816	1	*Quercus robur* English Oak	14.0	1	55	N 6.0 E 6.0 S 6.0 W 6.0	1.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	136.8	6.6	40+	B	1
T1817	1	*Quercus robur* English Oak	13.0	1	46	N 7.0 E 7.0 S 7.0 W 7.0	1.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	95.7	5.5	40+	B	1
T1818	1	*Quercus robur* English Oak	17.0	1	80	N 9.0 E 9.0 S 9.0 W 9.0	1.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	289.5	9.6	40+	A	1
T1819	1	*Quercus robur* English Oak	18.0	1	95	N 7.0 E 7.0 S 8.0 W 9.0	1.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Branch - Broken. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	408.3	11.4	40+	B	1
T1820	1	*Quercus robur* English Oak	15.0	1	78	N 7.0 E 7.0 S 8.0 W 7.0	1.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	275.2	9.4	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1821	1	*Quercus robur* English Oak	8.0	1	20	N E S W 2.0 2.0 2.0 2.0	3.0	3.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	18.1	2.4	40+	C	1
T1822	1	*Acer pseudoplatanus* Sycamore	9.0	5	22	N E S W 3.0 3.0 3.0 3.0	3.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	22.6	2.7	40+	C	1
T1823	1	*Quercus robur* English Oak	15.0	1	72	N E S W 5.0 7.0 7.0 7.0	3.0	2.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	234.5	8.6	40+	B	1
T1824	1	*Quercus robur* English Oak	15.0	2	70	N E S W 5.0 7.0 7.0 7.0	3.0	0.0	Early Mature	Poor	Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Decline - Evident / observed. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Decay / structural defect - Major. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Fallen tree / trees - Partial collapse. Ivy or climbing plant.	226.2	8.5	10-20	C	1 3
T1825	1	*Quercus robur* English Oak	19.0	1	85	N E S W 9.0 9.0 9.0 12.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	326.9	10.2	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1826	200 50	*Crataegus monogyna* Common Hawthorn/Quick/May *Swida sanguinea* Common Dogwood	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
H1827	150 50	*Crataegus monogyna* Common Hawthorn/Quick/May *Swida sanguinea* Common Dogwood	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
T1828	1	*Quercus robur* English Oak	18.0	1	68	N E S W 7.0 8.0 8.0 8.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	209.2	8.2	40+	A	1
T1829	1	*Quercus robur* English Oak	18.0	1	58	N E S W 5.0 7.0 7.0 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	152.2	7.0	40+	B	1
T1830	1	*Quercus robur* English Oak	18.0	1	72	N E S W 7.0 7.0 7.0 7.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Epicormic growth - Crown. Ivy or climbing plant.	234.5	8.6	40+	B	1
T1831	1	*Quercus robur* English Oak	17.0	1	72	N E S W 8.0 8.0 8.0 8.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	234.5	8.6	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1832	1	*Quercus robur* English Oak	17.0	1	80	N E S W 8.0 8.0 9.0 8.0	1.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	289.5	9.6	40+	B	1
T1833	1	*Quercus robur* English Oak	19.0	1	95	N E S W 9.0 9.0 9.0 9.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	408.3	11.4	40+	A	1
H1834	300 200 100	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Swida sanguinea* Common Dogwood	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
T1835	1	*Quercus robur* English Oak	18.0	1	74	N E S W 9.0 9.0 9.0 9.0	1.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	247.7	8.9	40+	A	1
T1836	1	*Fraxinus excelsior* Ash	18.0	1	68	N E S W 6.0 9.0 9.0 9.0	1.0	9.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Localised. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	209.2	8.2	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1837	1	*Quercus robur* English Oak	18.0	1	68	N E S W 7.0 7.0 7.0 7.0	1.0	4.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Ivy or climbing plant.	209.2	8.2	40+	B	1
T1838	1	*Quercus robur* English Oak	18.0	1	72	N E S W 9.0 9.0 9.0 10.0	3.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Minor. Ivy or climbing plant.	234.5	8.6	40+	A	1
T1839	1	*Quercus robur* English Oak	11.0	1	42	N E S W 5.0 5.0 5.0 5.0	3.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	79.8	5.0	20-40	C	1
T1840	1	*Ulmus procera* English Elm	9.0	6	29	N E S W 4.0 4.0 4.0 4.0	3.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Minor. Excavation within root zone - Historic. Ivy or climbing plant. Root damage - Mechanical.	39.1	3.5	20-40	C	1
T1841	1	*Ilex aquifolium* Holly	9.0	6	19	N E S W 2.0 1.0 2.0 1.0	3.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Minor. Excavation within root zone - Historic. Ivy or climbing plant. Root damage - Mechanical.	17.4	2.4	40+	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1842	1	*Ilex aquifolium* Holly	9.0	6	19	N E S W 2.0 1.0 2.0 1.0	3.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Altered ground level - Historic. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Minor. Excavation within root zone - Historic. Ivy or climbing plant. Root damage - Mechanical.	17.4	2.4	40+	C	1
H1843	50 30	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
H1844	200 30 25 20 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Swida sanguinea* Common Dogwood *Ulmus procera* English Elm *Acer campestre* Field Maple	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
T1845	1	*Quercus robur* English Oak	8.0	1	20	N E S W 4.0 4.0 4.0 4.0	2.0	2.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems.	18.1	2.4	40+	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1846	200 30 25 20 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Swida sanguinea* Common Dogwood *Ulmus procera* English Elm *Acer campestre* Field Maple	6.0	1	10	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained. Maintained hedge with sporadic outgrown sections.	4.5	1.2	40+	C	2
T1847	1	*Quercus robur* English Oak	14.0	2	35	N 7.0 E 7.0 S 7.0 W 7.0	3.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	56.5	4.2	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1848	200 30 25 20 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Swida sanguinea* Common Dogwood *Ulmus procera* English Elm *Acer campestre* Field Maple	3.0	1	8	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
H1849	25 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	3.0	1	8	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Early Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
H1850	10 10 3 2	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Swida sanguinea* Common Dogwood	3.0	1	8	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1851	3 2	*Acer campestre* Field Maple *Crataegus monogyna* Common Hawthorn/Quick/May	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
T1852	1	*Fraxinus excelsior* Ash	11.0	1	25	N E S W 2.0 2.0 2.0 2.0	5.0	4.0	Semi Mature	Poor	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decline - Evident / observed. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	28.3	3.0	40+	C	1
H1853	20 20	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May	6.0	1	8	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown. Natural regeneration.	2.9	1.0	40+	C	2
H1854	10 5 1	*Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Sorbus aria* Whitebeam	9.0	1	8	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown. Natural regeneration.	2.9	1.0	40+	C	2
H1855	20	*Prunus spinosa* Blackthorn/Sloe	6.0	1	8	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown. Natural regeneration.	2.9	1.0	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1856	200 5	*Prunus spinosa* Blackthorn/Sloe *Salix caprea* Goat Willow/Great Sallow	6.0	1	8	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown. Natural regeneration.	2.9	1.0	40+	C	2
H1857	2	*Acer campestre* Field Maple	13.0	2	42	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown. Natural regeneration.	81.4	5.1	40+	B	2
H1858	50 15	*Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	9.0	1	20	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown. Natural regeneration.	18.1	2.4	40+	B	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1859	300 150 150 150 100 50 40 35 30	*Fraxinus excelsior* Ash *Ulmus procera* English Elm *Prunus spinosa* Blackthorn/Sloe *Quercus robur* English Oak *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Corylus avellana* Common Hazel *Fagus sylvatica* Common Beech *Pinus sylvestris* Scots Pine	20.0	1	50	N 7.0 E 7.0 S 7.0 W 7.0	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Decline - Evident / observed. Decline - Suspected. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Base. Ivy or climbing plant. Natural regeneration.	113.1	6.0	40+	A	2 3
T1860	1	*Quercus robur* English Oak	18.0	1	75	N 8.0 E 8.0 S 6.0 W 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	254.5	9.0	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1861	1	*Quercus robur* English Oak	18.0	1	82	N 6.0 E 8.0 S 8.0 W 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	304.2	9.8	40+	A	1
T1862	1	*Quercus robur* English Oak	18.0	1	75	N 8.0 E 8.0 S 8.0 W 8.0	4.0	5.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	254.5	9.0	40+	B	1
T1863	1	*Quercus robur* English Oak	18.0	1	68	N 6.0 E 8.0 S 8.0 W 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	209.2	8.2	40+	A	1
T1864	1	*Quercus robur* English Oak	18.0	1	80	N 8.0 E 8.0 S 6.0 W 8.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	289.5	9.6	40+	A	1
T1865	1	*Quercus robur* English Oak	17.0	1	65	N 7.0 E 7.0 S 7.0 W 7.0	2.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	191.1	7.8	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1866	1	*Fraxinus excelsior* Ash	10.0	1	25	N 4.0 E 4.0 S 4.0 W 4.0	2.0	3.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	28.3	3.0	20-40	C	1
T1867	1	*Fraxinus excelsior* Ash	18.0	4	60	N 6.0 E 6.0 S 6.0 W 6.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	162.9	7.2	20-40	B	1
T1868	1	*Fraxinus excelsior* Ash	16.0	3	34	N 4.0 E 4.0 S 4.0 W 4.0	4.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	54.3	4.2	20-40	B	1
G1869	5	*Fraxinus excelsior* Ash	15.0	1	30	N 4.0 E 4.0 S 4.0 W 4.0	3.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Physiological / cambial damage - Fungal. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	40.7	3.6	20-40	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1870	19	*Fraxinus excelsior* Ash	17.0	2	35	N E S W 4.0 4.0 4.0 4.0	3.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Physiological / cambial damage - Fungal. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	56.5	4.2	20-40	C	2
G1871	8 5	*Corylus avellana* Common Hazel *Acer campestre* Field Maple	14.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	40.7	3.6	20-40	C	2
G1872	5 4	*Acer campestre* Field Maple *Corylus avellana* Common Hazel	14.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	40.7	3.6	20-40	C	2
G1873	2	*Fraxinus excelsior* Ash	17.0	3	51	N E S W 6.0 6.0 6.0 6.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Throughout crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Physiological / cambial damage - Fungal. Tree(s) infected with hymenoscyphus fraxineus (ash dieback).	122.1	6.2	20-40	C	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1874	6	*Acer campestre* Field Maple	14.0	1	30	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown.	40.7	3.6	20-40	C	2
G1875	2 1	*Acer pseudoplatanus* Sycamore *Quercus robur* English Oak	21.0	1	70	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Extensive. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Woodpecker holes.	221.7	8.4	40+	A	2 3
G1876	2	*Acer pseudoplatanus* Sycamore	21.0	1	65	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Major. Deadwood - Minor. Decay / structural defect - Minor. Decay / structural defect - Open cavity / cavities. Decay / structural defect - Bole. Epicormic growth - Base / bole / principal stems. Woodpecker holes.	191.1	7.8	40+	A	2 3
G1877	4	*Acer pseudoplatanus* Sycamore	10.0	1	16	N E S W 2.5 2.5 2.5 2.5	1.0	1.0	Mature	Good	Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems. Natural regeneration. Woodpecker holes.	11.6	1.9	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1878	1	*Quercus robur* English Oak	18.0	1	82	N E S W 7.0 7.0 7.0 7.0	1.0	3.0	Mature	Fair	Arboricultural work - Historic. Die-back - Upper crown. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	304.2	9.8	40+	B	1
H1879	400 200 60 50 40 30 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Swida sanguinea* Common Dogwood *Ulmus procera* English Elm *Salix caprea* Goat Willow/Great Sallow	7.0	1	12	N E S W 2.5 2.5 2.5 2.5	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown. Natural regeneration.	6.5	1.4	40+	C	2
T1880	1	*Fraxinus excelsior* Ash	14.0	4	40	N E S W 4.0 4.0 4.0 4.0	4.0	4.0	Early Mature	Fair	Arboricultural work - Historic. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Bole / principal stems. Physiological / cambial damage - Fungal. Affected by hymenoscyphus fraxineus (ash dieback).	72.4	4.8	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1881	1	*Fraxinus excelsior* Ash	9.0	3	24	N 4.0 E 4.0 S 4.0 W 4.0	4.0	4.0	Early Mature	Fair	Arboricultural work - Historic. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Bole / principal stems. Physiological / cambial damage - Fungal. Affected by hymenoscyphus fraxineus (ash dieback).	26.6	2.9	20-40	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1882	400	*Crataegus monogyna* Common Hawthorn/Quick/May	19.0	1	40	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Felled. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree.	72.4	4.8	40+	B	2 3
	150	*Alnus glutinosa* Common Alder														
	150	*Fraxinus excelsior* Ash														
	150	*Cerasus avium* Wild Cherry														
	100	*Acer campestre* Field Maple														
	100	*Quercus robur* English Oak														
	100	*Prunus spinosa* Blackthorn/Sloe														
	70	*Picea abies* Norway Spruce														
	50	*Fagus sylvatica* Common Beech														
	40	*Betula pendula* Silver Birch														
	40	*Pinus nigra* Black Pine														
	40	*Carpinus betulus* Hornbeam														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1883	1	*Quercus robur* English Oak	18.0	1	80	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	289.5	9.6	40+	A	1
T1884	1	*Quercus robur* English Oak	18.0	1	75	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Die-back - Upper crown. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	254.5	9.0	40+	A	1
H1885	50 50 15 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Corylus avellana* Common Hazel	12.0	1	16	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Hedgerow - Neglected / overgrown. Natural regeneration.	11.6	1.9	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1886	350	*Crataegus monogyna* Common Hawthorn/Quick/May	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
	30	*Prunus spinosa* Blackthorn/Sloe														
	25	*Swida sanguinea* Common Dogwood														
	20	*Ulmus procera* English Elm														
	10	*Acer campestre* Field Maple														
H1887	500	*Crataegus monogyna* Common Hawthorn/Quick/May	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
	100	*Acer campestre* Field Maple														
	100	*Prunus spinosa* Blackthorn/Sloe														
	60	*Swida sanguinea* Common Dogwood														
	40	*Ulmus procera* English Elm														

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1888	200 50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	5.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown.	2.9	1.0	40+	C	2
H1889	200 50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
T1890	1	*Quercus robur* English Oak	9.0	2	19	N E S W 4.0 4.0 4.0 4.0	1.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems.	17.7	2.4	40+	C	1
T1891	1	*Acer campestre* Field Maple	9.0	4	20	N E S W 4.0 4.0 4.0 4.0	1.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Epicormic growth - Bole / principal stems.	18.1	2.4	40+	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1892	200 50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2
H1893	200 50 20 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Quercus robur* English Oak	3.0	1	8	N E S W 1.0 1.0 1.0 1.0	0.0	0.0	Semi Mature	Good	Hedgerow - Maintained.	2.9	1.0	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1894	100	*Pinus sylvestris* Scots Pine	14.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	28.3	3.0	40+	B	2
	50	*Quercus robur* English Oak														
	40	*Chamaecyparis lawsoniana* Lawson Cypress														
	10	*Abies grandis* Giant Fir														
	6	*Fagus sylvatica* Common Beech														
	6	*Aesculus hippocastanum* Horse Chestnut														
	5	*Cerasus avium* Wild Cherry														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1895	80	*Pinus sylvestris* Scots Pine	14.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	28.3	3.0	40+	B	2
	50	*Quercus robur* English Oak														
	30	*Chamaecyparis lawsoniana* Lawson Cypress														
	10	*Abies grandis* Giant Fir														
	6	*Fagus sylvatica* Common Beech														
	6	*Aesculus hippocastanum* Horse Chestnut														
	5	*Cerasus avium* Wild Cherry														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1896	150	*Pinus sylvestris* Scots Pine	14.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	28.3	3.0	40+	B	2
	100	*Quercus robur* English Oak														
	50	*Chamaecyparis lawsoniana* Lawson Cypress														
	40	*Abies grandis* Giant Fir														
	30	*Acer campestre* Field Maple														
	30	*Cerasus avium* Wild Cherry														
	20	*Ilex aquifolium* Holly														
	20	*Aesculus hippocastanum* Horse Chestnut														
	20	*Fagus sylvatica* Common Beech														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1897	100	*Quercus robur* English Oak	14.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	28.3	3.0	40+	B	2
	100	*Pinus sylvestris* Scots Pine														
	30	*Acer campestre* Field Maple														
	30	*Chamaecyparis lawsoniana* Lawson Cypress														
	30	*Abies grandis* Giant Fir														
	20	*Fagus sylvatica* Common Beech														
	20	*Cerasus avium* Wild Cherry														
	20	*Ilex aquifolium* Holly														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1898	100	*Quercus robur* English Oak	14.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	28.3	3.0	40+	B	2
	100	*Pinus sylvestris* Scots Pine														
	30	*Acer campestre* Field Maple														
	30	*Chamaecyparis lawsoniana* Lawson Cypress														
	30	*Abies grandis* Giant Fir														
	20	*Fagus sylvatica* Common Beech														
	20	*Cerasus avium* Wild Cherry														
	20	*Ilex aquifolium* Holly														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1899	80	*Quercus robur* English Oak	14.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	28.3	3.0	40+	B	2
	80	*Pinus sylvestris* Scots Pine														
	20	*Chamaecyparis lawsoniana* Lawson Cypress														
	20	*Abies grandis* Giant Fir														
	15	*Fagus sylvatica* Common Beech														
	15	*Cerasus avium* Wild Cherry														
	15	*Acer campestre* Field Maple														
	5	*Ilex aquifolium* Holly														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1900	80	*Pinus sylvestris* Scots Pine	14.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	28.3	3.0	40+	B	2
	80	*Quercus robur* English Oak														
	20	*Abies grandis* Giant Fir														
	20	*Chamaecyparis lawsoniana* Lawson Cypress														
	15	*Acer campestre* Field Maple														
	15	*Cerasus avium* Wild Cherry														
	15	*Fagus sylvatica* Common Beech														
	5	*Ilex aquifolium* Holly														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1901	80	*Quercus robur* English Oak	14.0	1	25	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	28.3	3.0	40+	B	2
	80	*Pinus sylvestris* Scots Pine														
	20	*Chamaecyparis lawsoniana* Lawson Cypress														
	20	*Abies grandis* Giant Fir														
	15	*Fagus sylvatica* Common Beech														
	15	*Cerasus avium* Wild Cherry														
	15	*Acer campestre* Field Maple														
	5	*Ilex aquifolium* Holly														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1902	80 80 20 20 15 15 15 5	*Quercus robur* English Oak *Pinus sylvestris* Scots Pine *Chamaecyparis lawsoniana* Lawson Cypress *Abies grandis* Giant Fir *Fagus sylvatica* Common Beech *Cerasus avium* Wild Cherry *Acer campestre* Field Maple *Ilex aquifolium* Holly	14.0	1	25	N 3.0 E 3.0 S 3.0 W 3.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	28.3	3.0	40+	B	2
W1903	40	*Crataegus monogyna* Common Hawthorn/Quick/May	7.0	1	14	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	8.9	1.7	40+	C	2
W1904	40	*Crataegus monogyna* Common Hawthorn/Quick/May	7.0	1	14	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1905	40	*Crataegus monogyna* Common Hawthorn/Quick/May	7.0	1	14	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Semi Mature	Good	Access to inspect base - Restricted / obscured. Base / stems obscured - Vegetation. Staked tree / trees - Ingrown / Restricting growth.	8.9	1.7	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1906	400	*Crataegus monogyna* Common Hawthorn/Quick/May	19.0	1	40	N E S W 4.0 4.0 4.0 4.0	0.0	0.0	Early Mature	Good	Arboricultural work - Historic. Base / stems obscured - Vegetation. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Felled. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree.	72.4	4.8	40+	B	2 3
	150	*Fraxinus excelsior* Ash														
	150	*Alnus glutinosa* Common Alder														
	150	*Cerasus avium* Wild Cherry														
	100	*Prunus spinosa* Blackthorn/Sloe														
	100	*Quercus robur* English Oak														
	100	*Acer campestre* Field Maple														
	70	*Picea abies* Norway Spruce														
	50	*Fagus sylvatica* Common Beech														
	40	*Carpinus betulus* Hornbeam														
	40	*Betula pendula* Silver Birch														
	40	*Pinus nigra* Black Pine														

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1907	1	*Quercus robur* English Oak	18.0	1	68	N 8.0 E 8.0 S 8.0 W 8.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	209.2	8.2	40+	A	1
T1908	1	*Quercus robur* English Oak	13.0	1	60	N 6.0 E 6.0 S 6.0 W 6.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	162.9	7.2	40+	B	1
T1909	1	*Quercus robur* English Oak	15.0	1	60	N 6.0 E 6.0 S 6.0 W 6.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	162.9	7.2	40+	B	1
T1910	1	*Quercus robur* English Oak	15.0	1	60	N 6.0 E 6.0 S 6.0 W 6.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	162.9	7.2	40+	B	1
T1911	1	*Quercus robur* English Oak	18.0	1	76	N 9.0 E 9.0 S 9.0 W 9.0	4.0	6.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	261.3	9.1	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1912	1	*Quercus robur* English Oak	18.0	1	74	N 8.0 E 8.0 S 8.0 W 8.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	247.7	8.9	40+	A	1
T1913	1	*Quercus robur* English Oak	16.0	1	66	N 8.0 E 8.0 S 8.0 W 8.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	197.1	7.9	40+	B	1
T1914	1	*Quercus robur* English Oak	18.0	1	82	N 6.0 E 9.0 S 9.0 W 9.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	304.2	9.8	40+	A	1
T1915	1	*Quercus robur* English Oak	16.0	1	76	N 8.0 E 6.0 S 6.0 W 6.0	4.0	5.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	261.3	9.1	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1916	100 30 10 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Quercus robur* English Oak	3.0	1	14	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Mature	Good	Hedgerow - Maintained.	8.9	1.7	40+	B	2
T1917	1	*Quercus robur* English Oak	15.0	1	65	N 7.0 E 7.0 S 7.0 W 7.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	191.1	7.8	40+	B	1
T1918	1	*Quercus robur* English Oak	15.0	1	65	N 7.0 E 7.0 S 7.0 W 7.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	191.1	7.8	40+	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1919	1	*Quercus robur* English Oak	17.0	1	70	N E S W 8.0 8.0 8.0 8.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant.	221.7	8.4	40+	A	1
T1920	1	*Quercus robur* English Oak	16.0	1	68	N E S W 9.0 9.0 9.0 9.0	4.0	4.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Decay / structural defect in crown limb / limbs - Minor. Decay / structural defect in crown limb / limbs - Open cavity / cavities. Deadwood - Minor. Epicormic growth - Base / bole / principal stems.	209.2	8.2	40+	B	1
H1921	450 200 60 30 25 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Fraxinus excelsior* Ash *Quercus robur* English Oak *Acer pseudoplatanus* Sycamore	2.0	1	14	N E S W 2.0 2.0 2.0 2.0	0.0	0.0	Mature	Good	Hedgerow - Maintained.	8.9	1.7	40+	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1922	1	*Quercus robur* English Oak	13.0	1	36	N E S W 5.0 5.0 5.0 5.0	1.0	1.0	Early Mature	Good	Arboricultural work - Historic.	58.6	4.3	40+	B	1
T1923	1	*Acer campestre* Field Maple	13.0	4	60	N E S W 6.0 6.0 4.0 6.0	0.0	0.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Coppice stool - Coppice origin / Mature stems. Epicormic growth - Base / bole / principal stems.	162.9	7.2	40+	B	1
T1924	1	*Fraxinus excelsior* Ash	18.0	4	60	N E S W 6.0 6.0 4.0 6.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Coppice stool - Coppice origin / Mature stems. Die-back - Throughout crown. Epicormic growth - Crown. Epicormic growth - Base / bole / principal stems. Ivy or climbing plant. Physiological / cambial damage - Fungal.	162.9	7.2	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1925	40 25 20 15 10 10	*Fraxinus excelsior* Ash *Quercus robur* English Oak *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May	19.0	1	50	N 6.0 E 6.0 S 6.0 W 6.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Decline - Evident / observed. Dead tree / trees. Deadwood - Major. Deadwood - Minor. Epicormic growth - Base / bole / principal stems. Fallen tree / trees - Partial collapse. Fallen tree / trees - Whole tree. Physiological / cambial damage - Fungal. Ash tree(s) infected with hymenoscyphus fraxineus (ash dieback).	113.1	6.0	40+	B	2 3
T1926	1	*Quercus robur* English Oak	19.0	1	75	N 9.0 E 9.0 S 9.0 W 9.0	1.0	3.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Deadwood - Major. Deadwood - Minor.	254.5	9.0	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1927	60 10 10 6 6 4 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Cerasus avium* Wild Cherry *Fagus sylvatica* Common Beech *Corylus avellana* Common Hazel *Acer campestre* Field Maple *Pinus sylvestris* Scots Pine	7.0	1	10	N 1.5 E 1.5 S 1.5 W 1.5	0.0	0.0	Semi Mature	Good	Epicormic growth - Base / bole / principal stems. Staked tree / trees - Ingrown / Restricting growth.	4.5	1.2	40+	C	2
G1928	10 5 4 2	*Corylus avellana* Common Hazel *Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple *Quercus robur* English Oak	14.0	1	40	N 5.0 E 5.0 S 4.0 W 5.0	0.0	0.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Epicormic growth - Base / bole / principal stems. Hedgerow - Neglected / overgrown. Ivy or climbing plant.	72.4	4.8	40+	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1929	1	*Quercus robur* English Oak	15.0	1	105	N E S W 7.0 7.0 4.0 7.0	4.0	4.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Epicormic growth - Bole / principal stems. Ivy or climbing plant.	498.8	12.6	40+	B	1
T1930	1	*Quercus robur* English Oak	19.0	1	150	N E S W 3.0 7.0 7.0 8.0	5.0	7.0	Late Mature	Good	Access to inspect base - Restricted / obscured. Ivy or climbing plant.	706.9	15.0	40+	A	1
T1931	1	*Fraxinus excelsior* Ash	15.0	1	80	N E S W 5.0 5.0 4.0 5.0	2.5	5.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	289.5	9.6	20-40	B	1
T1932	1	*Quercus robur* English Oak	15.0	1	100	N E S W 7.0 5.0 5.0 4.0	5.0	2.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Upper crown. Deadwood - Major.	452.4	12.0	20-40	B	1
T1933	1	*Quercus robur* English Oak	16.0	1	100	N E S W 7.0 5.0 7.0 7.0	2.5	3.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant.	452.4	12.0	40+	A	1
T1934	1	*Quercus robur* English Oak	16.0	1	130	N E S W 9.0 7.0 7.0 8.0	2.5	3.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Die-back - Upper crown. Deadwood - Major. Ivy or climbing plant. Stag-headed crown.	706.9	15.0	20-40	B	1
T1935	1	*Fraxinus excelsior* Ash	12.0	1	90	N E S W 5.0 3.0 6.0 5.0	2.0	2.5	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant. Tree on bank.	366.4	10.8	20-40	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1936	1	*Fraxinus excelsior* Ash	15.0	3	61	N E S W 5.0 3.0 5.0 3.0	1.0	2.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Coppice stool - Coppice origin / Mature stems. Ivy or climbing plant. Tree on bank.	173.0	7.4	20-40	B	1
T1937	1	*Fraxinus excelsior* Ash	14.0	1	80	N E S W 4.0 4.0 4.0 2.0	2.0	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant. Tree on bank.	289.5	9.6	20-40	B	1
G1938	65	*Populus sp.* Poplar sp.	18.0	1	50	N E S W 3.0 3.0 3.0 3.0	1.0	1.0	Early Mature	Good	Branch - Broken. Deadwood - Minor. Shedding limb / limbs - Historic. Tree on bank.	113.1	6.0	20-40	B	2
H1939	1250 200 50	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Ulmus procera* English Elm	2.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	20-40	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1940	75 50 30 30	*Pinus sp.* Pine sp. *Fraxinus excelsior* Ash *Fagus sylvatica* Common Beech *Quercus robur* English Oak	15.0	1	40	N E S W 3.0 3.0 3.0 3.0	1.5	1.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	72.4	4.8	40+	A	2
H1941	160 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Acer campestre* Field Maple	8.0	1	16	N E S W 3.0 3.0 3.0 3.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown. Unmanaged hedge with sporadic outgrown trees.	11.6	1.9	40+	C	2
G1942	3	*Pinus sylvestris* Scots Pine	18.0	1	50	N E S W 6.0 6.0 6.0 6.0	8.0	9.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	113.1	6.0	40+	B	2
G1943	3	*Pinus sylvestris* Scots Pine	18.0	1	70	N E S W 6.0 6.0 6.0 6.0	8.0	9.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	221.7	8.4	40+	B	2
T1944	1	*Pinus sylvestris* Scots Pine	19.0	2	84	N E S W 9.0 9.0 9.0 9.0	3.0	1.0	Mature	Good	Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Base / stems obscured - Vegetation. Deadwood - Major. Deadwood - Minor. Ivy or climbing plant.	325.7	10.2	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
H1945	200 30 20 10	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Acer campestre* Field Maple *Malus sylvestris* Wild Crab	6.0	1	16	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Semi Mature	Good	Hedgerow - Neglected / overgrown.	11.6	1.9	40+	C	2
H1946	2000 500	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	2.0	1	5	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	1.1	0.6	10-20	C	2
W1947	100 100 100 100	*Quercus robur* English Oak *Fraxinus excelsior* Ash *Fagus sylvatica* Common Beech *Acer pseudoplatanus* Sycamore	15.0	1	50	N 3.0 E 3.0 S 3.0 W 3.0	2.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Ivy or climbing plant. Frontline trees within offsite woodland strip	113.1	6.0	40+	B	2
T1948	1	*Quercus robur* English Oak	17.0	1	102	N 6.0 E 6.0 S 9.0 W 6.0	3.0	1.5	Early Mature	Good	Deadwood - Minor.	470.7	12.2	40+	A	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1949	1	*Quercus robur* English Oak	16.0	1	89	N 5.0 E 5.0 S 7.0 W 6.0	3.0	2.0	Early Mature	Good	Deadwood - Minor.	358.3	10.7	40+	A	1
T1950	1	*Quercus robur* English Oak	14.0	1	77	N 5.0 E 6.0 S 7.0 W 5.0	3.0	2.0	Early Mature	Good	Deadwood - Major.	268.2	9.2	20-40	B	1
T1951	1	*Quercus robur* English Oak	16.0	1	111	N 6.0 E 6.0 S 6.0 W 7.0	3.0	2.0	Mature	Good	Deadwood - Minor.	557.4	13.3	40+	A	1
H1952	75	*Crataegus monogyna* Common Hawthorn/Quick/May	1.0	1	10	N 0.3 E 0.3 S 0.3 W 0.3	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	10-20	C	2
G1953	500 300	*Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak	7.0	1	20	N 2.0 E 2.0 S 2.0 W 2.0	0.0	0.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	18.1	2.4	20-40	B	2
G1954	400	*other* Other	1.0	1	1	N 0.1 E 0.1 S 0.1 W 0.1	0.0	0.0	Young	Fair	Staked tree / trees. Young planted tree / trees. Recent planting (unestablished). Species mix unidentified.	0.0	0.1	40+	C	2
T1955	1	*Quercus robur* English Oak	11.0	1	41	N 5.0 E 3.0 S 5.0 W 5.0	2.0	2.0	Semi Mature	Good	Deadwood - Minor.	76.0	4.9	40+	B	1
T1956	1	*Quercus robur* English Oak	7.0	2	28	N 4.0 E 3.0 S 4.0 W 4.0	1.0	0.5	Semi Mature	Good	Deadwood - Minor.	35.9	3.4	40+	B	1
T1957	1	*Quercus robur* English Oak	7.0	7	58	N 4.0 E 4.0 S 4.0 W 5.0	1.0	0.5	Semi Mature	Good	Multi-stemmed.	153.3	7.0	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1958	1	*Quercus robur* English Oak	16.0	1	85	N 7.0 E 6.0 S 6.0 W 5.0	3.0	3.0	Early Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant.	326.9	10.2	40+	A	1
T1959	1	*Quercus robur* English Oak	9.0	1	51	N 5.0 E 4.0 S 5.0 W 5.0	1.0	0.5	Semi Mature	Fair	Deadwood - Minor.	117.7	6.1	20-40	B	1
T1960	1	*Quercus robur* English Oak	12.0	2	72	N 7.0 E 5.0 S 7.0 W 7.0	0.5	0.5	Early Mature	Good	Deadwood - Minor.	238.2	8.7	40+	A	1
T1961	1	*Quercus robur* English Oak	10.0	4	59	N 4.0 E 3.0 S 4.0 W 4.0	1.0	0.5	Early Mature	Good	Deadwood - Minor.	159.9	7.1	40+	B	1
T1962	1	*Quercus robur* English Oak	8.0	9	54	N 3.0 E 3.0 S 3.0 W 3.0	1.0	0.5	Early Mature	Good	Multi-stemmed.	131.9	6.5	40+	B	1
T1963	1	*Quercus robur* English Oak	11.0	1	62	N 6.0 E 4.0 S 6.0 W 6.0	0.5	1.0	Early Mature	Fair	Deadwood - Major. Form - Low canopy.	173.9	7.4	40+	B	1
T1964	1	*Quercus robur* English Oak	14.0	1	78	N 7.0 E 6.0 S 7.0 W 7.0	1.0	0.5	Mature	Good	Deadwood - Minor.	275.2	9.4	40+	A	1
T1965	1	*Quercus robur* English Oak	11.0	1	67	N 3.0 E 5.0 S 3.0 W 5.0	1.0	1.0	Early Mature	Good	Deadwood - Minor.	203.1	8.0	40+	B	1
T1966	1	*Quercus robur* English Oak	15.0	1	72	N 4.0 E 7.0 S 3.0 W 6.0	1.0	1.0	Early Mature	Fair	Deadwood - Major. Shedding limb / limbs - Historic. Stems - Co-dominant.	234.5	8.6	20-40	B	1
T1967	1	*Quercus robur* English Oak	16.0	1	93	N 8.0 E 8.0 S 6.0 W 6.0	1.0	2.0	Mature	Good	Deadwood - Major.	391.3	11.2	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1968	1	*Quercus robur* English Oak	8.0	3	49	N 3.0 E 3.0 S 3.0 W 3.0	1.0	0.5	Semi Mature	Fair	Multi-stemmed.	109.2	5.9	20-40	B	1
T1969	1	*Quercus robur* English Oak	8.0	1	31	N 3.0 E 3.0 S 4.0 W 3.0	0.5	1.0	Semi Mature	Fair	Deadwood - Minor.	43.5	3.7	40+	B	1
T1970	1	*Quercus robur* English Oak	14.0	1	100	N 7.0 E 6.0 S 5.0 W 6.0	3.0	2.5	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant.	452.4	12.0	40+	A	1
T1971	1	*Quercus robur* English Oak	16.0	1	65	N 9.0 E 6.0 S 6.0 W 7.0	2.5	1.5	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant.	191.1	7.8	40+	A	1
T1972	1	*Quercus robur* English Oak	17.0	1	70	N 8.0 E 7.0 S 8.0 W 7.0	2.5	2.0	Mature	Good	Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant.	221.7	8.4	40+	A	1
T1973	1	*Quercus robur* English Oak	9.0	4	48	N 3.5 E 3.5 S 4.0 W 3.5	1.0	1.0	Semi Mature	Good	Multi-stemmed.	105.0	5.8	40+	B	1
G1974	20 15	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	4.0	1	10	N 1.0 E 1.0 S 1.0 W 1.0	0.0	0.0	Semi Mature	Fair	Access to inspect base - Restricted / obscured.	4.5	1.2	10-20	C	2
G1975	10	*Crataegus monogyna* Common Hawthorn/Quick/May	3.0	1	15	N 1.5 E 1.5 S 1.5 W 1.5	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Die-back - Throughout crown. Deadwood - Minor.	10.2	1.8	10-20	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G1976	50 20	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	3.0	1	15	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured. Die-back - Throughout crown. Deadwood - Minor.	10.2	1.8	10-20	C	2
T1977	1	*Quercus robur* English Oak	12.0	1	50	N E S W 4.0 2.0 3.0 5.0	2.0	3.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	113.1	6.0	20-40	B	1
T1978	1	*Quercus robur* English Oak	8.0	1	50	N E S W 3.0 3.0 3.0 3.0	3.0	3.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	113.1	6.0	20-40	C	1
T1979	1	*Quercus robur* English Oak	12.0	1	90	N E S W 5.0 5.0 5.0 5.0	2.0	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	366.4	10.8	20-40	A	1
H1980	700 300 200	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe *Sambucus nigra* Elder	2.0	1	10	N E S W 0.3 0.3 0.3 0.3	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	10-20	C	2
T1981	1	*Quercus robur* English Oak	10.0	1	50	N E S W 5.0 4.0 4.0 4.0	3.0	2.0	Semi Mature	Poor	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Arboricultural work - Historic. Weak live growth.	113.1	6.0	10-20	C	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T1982	1	*Quercus robur* English Oak	9.0	1	50	N 4.0 E 4.0 S 4.0 W 4.0	2.0	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	113.1	6.0	20-40	B	1
H1983	350	*Crataegus monogyna* Common Hawthorn/Quick/May	1.5	1	10	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	10-20	C	2
T1984	1	*Quercus robur* English Oak	10.0	4	57	N 4.0 E 4.0 S 4.0 W 4.0	1.0	2.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed.	147.0	6.8	40+	B	1
T1985	1	*Quercus robur* English Oak	12.0	1	45	N 4.0 E 4.0 S 4.0 W 3.0	3.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	91.6	5.4	40+	B	1
T1986	1	*Quercus robur* English Oak	10.0	1	45	N 5.0 E 4.0 S 4.0 W 4.0	3.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	91.6	5.4	40+	B	1
T1987	1	*Quercus robur* English Oak	8.0	1	40	N 4.0 E 5.0 S 4.0 W 4.0	2.0	2.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	72.4	4.8	40+	B	1
T1988	1	*Quercus robur* English Oak	4.0	1	31	N 1.5 E 2.5 S 2.5 W 2.5	2.0	1.5	Semi Mature	Poor	Die-back - Upper crown. Deadwood - Major.	43.5	3.7	10-20	C	1
T1989	1	*Quercus robur* English Oak	5.0	1	23	N 2.0 E 2.5 S 1.5 W 2.5	2.0	1.5	Semi Mature	Fair	No significant faults observed.	23.9	2.8	10-20	B	1
T1990	1	*Quercus robur* English Oak	12.0	1	45	N 4.0 E 4.0 S 4.0 W 4.0	2.5	0.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	91.6	5.4	40+	B	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1991	600 100 100	*Pinus sp.* Pine sp. *Quercus robur* English Oak *Fagus sylvatica* Common Beech	15.0	1	35	N E S W 3.0 3.0 3.0 3.0	2.0	1.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	55.4	4.2	40+	B	2
T1992	1	*Quercus robur* English Oak	11.0	2	54	N E S W 5.0 5.0 5.0 5.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	132.3	6.5	40+	B	1
T1993	1	*Quercus robur* English Oak	10.0	2	49	N E S W 4.0 5.0 4.0 5.0	2.0	1.5	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	110.8	5.9	40+	B	1
T1994	1	*Quercus robur* English Oak	8.0	2	47	N E S W 4.0 4.0 4.0 4.0	2.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	100.7	5.7	40+	B	1
W1995	300 50 25	*Pinus sp.* Pine sp. *Fagus sylvatica* Common Beech *Quercus robur* English Oak	12.0	1	35	N E S W 3.0 3.0 3.0 3.0	2.0	1.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	55.4	4.2	40+	B	2
H1996	200 100	*Crataegus monogyna* Common Hawthorn/Quick/May *Prunus spinosa* Blackthorn/Sloe	2.0	1	10	N E S W 0.5 0.5 0.5 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	10-20	C	2

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W1997	175 25	*Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder	3.0	1	15	N E S W 1.5 1.5 1.5 1.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	10.2	1.8	10-20	C	2
T1998	1	*Quercus robur* English Oak	10.0	1	106	N E S W 7.0 5.0 9.0 7.0	2.0	1.0	Mature	Fair	Deadwood - Major.	508.3	12.7	20-40	B	1
T1999	1	*Quercus robur* English Oak	7.0	1	39	N E S W 2.0 4.0 4.0 4.0	1.0	1.5	Semi Mature	Good	Deadwood - Minor.	68.8	4.7	40+	A	1
T2000	1	*Quercus robur* English Oak	9.0	1	47	N E S W 5.0 4.0 2.0 4.0	1.0	1.0	Semi Mature	Good	Deadwood - Minor.	99.9	5.6	40+	A	1
T2001	1	*Quercus robur* English Oak	14.0	1	84	N E S W 10.0 8.0 8.0 8.0	2.5	3.0	Mature	Good	Deadwood - Major.	319.2	10.1	40+	A	1
T2002	1	*Quercus robur* English Oak	15.0	1	77	N E S W 9.0 6.0 10.0 9.0	2.5	3.0	Mature	Good	Branch - Broken. Branch - Suspended. Deadwood - Major.	268.2	9.2	40+	A	1
T2003	1	*Quercus robur* English Oak	12.0	1	53	N E S W 3.0 5.0 8.0 6.0	1.0	1.5	Semi Mature	Good	Deadwood - Minor.	127.1	6.4	40+	A	1
T2004	1	*Quercus robur* English Oak	14.0	1	36	N E S W 5.0 5.0 2.0 5.0	3.0	3.0	Semi Mature	Good	Deadwood - Minor.	58.6	4.3	40+	A	1
G2005	600 50	*Pinus sp.* Pine sp. *Fagus sylvatica* Common Beech	14.0	1	40	N E S W 2.5 2.5 2.5 2.5	1.0	1.0	Early Mature	Good	Deadwood - Minor.	72.4	4.8	40+	A	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
G2006	30	*Prunus spinosa* Blackthorn/Sloe	2.5	1	10	N E S W 1.0 1.0 1.0 1.0	0.0	1.0	Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Located within pig farm	4.5	1.2	10-20	C	2
T2007	1	*Quercus robur* English Oak	3.0	1	15	N E S W 2.0 2.0 2.0 2.0	0.5	1.5	Young	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	10.2	1.8	40+	C	1
G2008	4 1 1	*Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Quercus robur* English Oak	4.0	1	20	N E S W 2.5 2.5 2.5 2.5	0.0	1.0	Mature	Good	Deadwood - Minor.	18.1	2.4	10-20	C	2
T2009	1	*Quercus robur* English Oak	8.0	1	35	N E S W 3.0 3.0 3.0 5.0	3.0	2.0	Semi Mature	Fair	Access to inspect base - Not possible. Deadwood - Minor.	55.4	4.2	40+	B	1
T2010	1	*Quercus robur* English Oak	11.0	1	45	N E S W 5.0 4.0 5.0 6.0	2.5	2.5	Semi Mature	Fair	Access to inspect base - Not possible. Deadwood - Minor.	91.6	5.4	40+	B	1
T2011	1	*Quercus robur* English Oak	15.0	1	85	N E S W 7.0 5.0 5.0 7.0	2.0	2.0	Mature	Good	Deadwood - Minor. Stems - Co-dominant.	326.9	10.2	40+	A	1
T2012	1	*Quercus robur* English Oak	13.0	2	76	N E S W 7.0 5.0 5.0 9.0	3.0	2.0	Early Mature	Good	Twin-stemmed.	263.5	9.2	40+	B	1
T2013	1	*Quercus robur* English Oak	13.0	2	68	N E S W 8.0 6.0 7.0 8.0	2.0	2.0	Early Mature	Good	Deadwood - Major. Twin-stemmed.	209.2	8.2	40+	A	1

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T2014	1	*Quercus robur* English Oak	11.0	2	54	N 6.0 E 5.0 S 5.0 W 6.0	2.0	2.5	Early Mature	Good	Deadwood - Major. Twin-stemmed.	132.3	6.5	40+	B	1
T2015	1	*Quercus robur* English Oak	12.0	1	51	N 7.0 E 5.0 S 5.0 W 5.0	2.0	2.0	Early Mature	Good	Deadwood - Minor.	117.7	6.1	40+	B	1
G2016	3	*Quercus robur* English Oak	12.0	1	45	N 5.0 E 5.0 S 5.0 W 5.0	2.0	1.0	Early Mature	Fair	Deadwood - Minor.	91.6	5.4	40+	B	2
G2017	2	*Quercus robur* English Oak	9.0	1	40	N 4.0 E 4.0 S 4.0 W 4.0	2.0	1.0	Semi Mature	Fair	Deadwood - Minor.	72.4	4.8	40+	B	2
T2018	1	*Quercus robur* English Oak	5.0	1	20	N 2.0 E 1.0 S 2.0 W 3.0	3.0	3.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major.	18.1	2.4	40+	B	1
G2019	26	*Quercus robur* English Oak	12.0	1	45	N 5.0 E 5.0 S 5.0 W 5.0	2.0	1.0	Early Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Minor. Multi-stemmed. Twin-stemmed.	91.6	5.4	20-40	B	2
T2020	1	*Pinus sylvestris* Scots Pine	12.0	1	65	N 5.0 E 5.0 S 5.0 W 4.0	0.5	2.0	Late Mature	Fair	Access to inspect base - Restricted / obscured. Form - Low canopy. Ivy or climbing plant. Leaning trunk - Minor. Weak live growth.	191.1	7.8	10-20	C	1
T2021	1	*Pinus sylvestris* Scots Pine	9.0	1	46	N 3.0 E 4.0 S 3.0 W 3.0	3.0	7.0	Mature	Good	No significant faults observed.	95.7	5.5	20-40	B	1
T2022	1	*Fraxinus excelsior* Ash	9.0	1	39	N 4.0 E 4.0 S 3.0 W 4.0	3.0	1.5	Semi Mature	Poor	Die-back - Mid crown. Deadwood - Major. Ivy or climbing plant.	68.8	4.7	10-20	C	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T2023	1	*Quercus robur* English Oak	16.0	1	95	N E S W 8.0 7.0 7.0 8.0	2.5	2.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Deadwood - Major. Ivy or climbing plant.	408.3	11.4	20-40	B	1
G2024	13 10 5	*Pinus sylvestris* Scots Pine *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May	8.0	1	30	N E S W 3.0 3.0 3.0 3.0	2.0	2.0	Early Mature	Fair	Access to inspect base - Restricted / obscured. Deadwood - Minor. Ivy or climbing plant.	40.7	3.6	20-40	B	2
T2025	1	*Fraxinus excelsior* Ash	9.0	1	40	N E S W 5.0 4.0 4.0 4.0	3.0	3.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured.	72.4	4.8	20-40	B	1
T2026	1	*Fraxinus excelsior* Ash	8.0	3	37	N E S W 3.0 3.0 3.0 2.0	2.5	1.0	Semi Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Multi-stemmed.	64.5	4.5	20-40	B	1
W2027	30 20 15	*Prunus spinosa* Blackthorn/Sloe *Pinus sp.* Pine sp. *Crataegus monogyna* Common Hawthorn/Quick/May	10.0	1	35	N E S W 2.5 2.5 2.5 2.5	0.0	1.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Offsite woodland edge	55.4	4.2	20-40	B	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T2028	1	*Quercus robur* English Oak	11.0	1	64	N E S W 5.0 4.0 1.0 4.0	3.0	2.5	Early Mature	Good	Fork - Suspected structurally sound. Fork - Weak with included bark. Stems - Co-dominant. Unbalanced crown - Major.	185.3	7.7	40+	B	1
W2029	15 10 5 3 1	*Pinus sp.* Pine sp. *Prunus spinosa* Blackthorn/Sloe *Crataegus monogyna* Common Hawthorn/Quick/May *Fraxinus excelsior* Ash *Quercus robur* English Oak	13.0	1	35	N E S W 2.5 2.5 2.5 2.5	0.0	1.0	Early Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Offsite woodland edge	55.4	4.2	20-40	B	2
T2030	1	*Pinus sylvestris* Scots Pine	10.0	1	42	N E S W 5.0 2.0 3.0 3.0	4.0	4.0	Early Mature	Good	Deadwood - Major.	79.8	5.0	20-40	B	1

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
W2031	300 150 150 15 5 5	*Crataegus monogyna* Common Hawthorn/Quick/May *Quercus robur* English Oak *Pinus sp.* Pine sp. *Fagus sylvatica* Common Beech *Fraxinus excelsior* Ash *Acer pseudoplatanus* Sycamore	14.0	1	50	N 3.0 E 3.0 S 3.0 W 3.0	1.0	1.0	Early Mature	Good	Deadwood - Minor.	113.1	6.0	40+	A	2
H2032	1300	*Crataegus monogyna* Common Hawthorn/Quick/May	2.0	1	10	N 0.5 E 0.5 S 0.5 W 0.5	0.0	0.0	Mature	Fair	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Hedgerow - Maintained.	4.5	1.2	10-20	C	2
T2033	1	*Crataegus monogyna* Common Hawthorn/Quick/May	4.0	1	35	N 2.0 E 1.0 S 2.0 W 2.0	0.0	0.5	Mature	Fair	Deadwood - Minor.	55.4	4.2	10-20	C	1
G2034	5 2	*Crataegus monogyna* Common Hawthorn/Quick/May *Sambucus nigra* Elder	4.0	1	15	N 1.5 E 1.5 S 1.5 W 1.5	0.0	0.0	Mature	Fair	Access to inspect base - Restricted / obscured.	10.2	1.8	10-20	C	2

Generated By MyTREES tree management software

High Grove Solar Farm, Norfolk
Tree Survey BS5837-2012

Treework Environmental Practice

Tree/Group Reference	Tree Count	Species	Height (m)	Stem Count	Stem Diameter (cm)	Crown Radius (m)	Crown Clearance Height (m)	Lowest Branch Height (m)	Life Stage	Physiological Condition	Observations and Recommendations	RPA (m^2)	RPR (m)	Remaining Contribution (Years)	Retention Category	Retention Sub-category
T2035	1	*Crataegus monogyna* Common Hawthorn/Quick/May	4.0	3	36	N 2.5 E 1.0 S 2.5 W 1.0	0.0	0.5	Mature	Fair	Access to inspect base - Restricted / obscured. Multi-stemmed.	61.9	4.4	10-20	C	1
G2036	70	*Pinus sp.* Pine sp.	10.0	1	30	N 2.5 E 2.5 S 2.5 W 2.5	1.5	1.0	Semi Mature	Good	Access to inspect base - Not possible. Access to inspect base - Restricted / obscured. Offsite linear group	40.7	3.6	40+	A	2

Tree Schedule Key

Treework Environmental Practice

Tree/Group Reference	Reference number for individual trees or groups of trees, prefixed by T (Tree), G (Group), W (Woodland), H (Hedge) or S (Shrub) to indicate the type of feature.
Tree Count	Number of trees of a particular species recorded within a group feature, with the default value of 1 for single trees.
Species	Scientific name followed by common name (where available).
Height (m)	Tree height to the nearest metre, either measured with a device or estimated. Tree height for group records refers to the estimated average height of trees within the group (unrepresentative trees may be excluded from this estimate).
Stem Count	Number of stems. Stem count indicates whether the tree is single-stemmed or multi-stemmed and informs the RPA calculation.
Stem Diameter (cm)	Stem diameter, measured at 1.5m above ground level in accordance with Annex C of BS5837:2012. Diameters of multi-stemmed trees are presented as a combined stem diameter calculated in accordance with the formulae in Section 4.6.1 of BS5837:2012. Stem diameter for group records refers to the estimated average stem diameter of trees within the group (unrepresentative trees may be excluded from this estimate).
Crown Radius (m)	Distance from stem position to crown periphery in either the four cardinal or four ordinal directions, estimated to the nearest half metre. Crown spreads for group records refer to the estimated average spreads of trees within the group (unrepresentative trees may be excluded from this estimate).
Crown Clearance Height (m)	Distance between the ground and the lowest point of the crown periphery, estimated to the nearest half metre.
Lowest Branch Height (m)	Height of the lowest branch, the removal of which is considered likely to have a significant negative effect on the tree in terms of physiology or in terms of the size of wound created.
Life Stage	Young, Semi-mature, Early Mature, Mature, Late Mature, Ancient or Veteran.
Physiological Condition	Good, Fair, Poor, Dead.
Observations	General description of the tree or tree group, including basic features and morphology, structural and physiological condition, growing conditions and surroundings.
Recommendations	Management recommendations for tree works to address immediate unacceptable risks, or to facilitate development proposals.
RPA (m^2)	Minimum area around a tree deemed to contain sufficient roots and rooting soil volume to maintain the tree's viability, in which the protection of roots and soil structure is treated as a priority. Calculated from the stem diameter according to the formulae in BS5837:2012. RPA for group records is based on the estimated average stem diameter of trees within the group (unrepresentative trees may be excluded from this estimate).
RPR (m)	Radius of the RPA, in metres, when this is plotted as a circle around the tree stem.
Remaining Contribution (years)	Estimated number of years for which the tree will continue to make a positive contribution to the site, banded as < 10, 10-20, 20-40, 40 +.
Retention Category	Quality and value category (**A**, **B**, **C** or **U**) as defined in Table 1 of BS5837: 2012 (reproduced below), where **A** = high quality and value; **B** = moderate quality and value; **C** = low quality and value and **U** = tree identified for removal due to poor condition regardless of development proposals.
Retention Sub-category	One or more sub-categories (1-3) as defined in Table 1 of BS5837: 2012 (reproduced below), assigned for Categories **A**, **B** or **C** where 1 = arboricultural qualities, 2 = landscape qualities and 3 = conservation and cultural value.

Appendix E

Tree Survey Method and Limitations

Treework Environmental Practice

Tree Survey Method and Limitations

Tree Survey Method

1. The tree survey was conducted from ground level aided by the Visual Tree Assessment method (Mattheck and Breloer, 1994) and in accordance with BS5837: 2012.

2. All trees on the site with a stem diameter of over 75 mm (measured at 1.5 m above ground) were included in the survey.

3. Offsite trees within influencing distance of the site (typically those located within a distance of up to 12 times their stem diameter away from the site) were included in the survey.

4. Data collected included:

   - a designated tree number
   - type of feature (trees, group, woodland, hedge)
   - number of trees in group
   - tree species
   - height (metres)
   - number of stems
   - stem diameter (in centimetres, as measured at 1.5 m above ground)
   - crown clearance (height of periphery of crown spread above ground level in metres)
   - height of lowest branch (metres),
   - branch spread (to N, S, E and W)
   - age class
   - physiological condition
   - useful life expectancy
   - structural condition
   - BS5837 retention category (A, B, C or U)
   - site notes (where this has a bearing on the present or future health or structural condition of the tree)
   - preliminary management recommendations.

5. All measurements were made in metric using measuring devices where applicable. Estimated stem diameters (e.g., due to lack of access or dense undergrowth) were recorded as such and are shown in the Tree Schedule in bold (see the key at the end of the Tree Schedule table at Appendix A for an explanation of the measurements and codes presented therein).

6. While the appraisals of the surveyed trees are not tree risk assessments, they nonetheless take into account observed structural defects in drawing conclusions about the trees' retentive worth.

Survey Limitations

1. The survey was a preliminary assessment from ground level and observations were made solely from visual inspection for the purposes of an assessment relevant to planning and development. Only binoculars, trowel, mallet and fine manual metal probe were used to aid tree assessment, where necessary. No invasive or other detailed internal decay detection devices were used in assessing trunk condition.

2. The conclusions relate to conditions found at the time of survey. Any significant alteration to the site that may affect the trees that are present or have a bearing on the planning implications (including level changes, hydrological changes, extreme climatic events or other site works) will require a re-assessment of the trees and the site.

3. This survey is not a tree safety inspection. It is carried out in order to inform the planning process. Where clear and obvious hazards have been observed, these have been addressed in the recommendations (see Appendix A - Tree Schedule). A full assessment of the levels of risk posed by trees would need to consider site use together with tree hazards.

RWE Renewables UK Solar and Storage Limited

Windmill Hill Business Park
Whitehill Way
Swindon SN5 6PB
United Kingdom